CERTERRA
WESTERN TECHNOLOGIES

Materially Better™

HUD Environmental Review Record

Client Name:	JTED Bridges II, LLC 20 East Congress Street, Suite 300 Tucson, Arizona 85701
Project Name:	JTED at the Bridges Phase III 3300 South Park Avenue Tucson, Arizona 85713
Project Number:	29-824105-0_REV_I
Report Issuance:	March 12, 2026

U.S Department of Housing and Urban Development
451 Seventh Street SW
Washington, DC 20410
www.hud.gov

Environmental Assessment
Determinations and Compliance Findings for HUD-assisted Projects
24 CFR Part 58

Project Information

Project Name: Urban Workforce Development via Career and Technical Education

Responsible Entity: City of Tucson, PO Box 27210, Tucson, AZ 85726

Preparer: Western Technologies Inc. dba Certerra Western Technologies ("Certerra")

Certifying Officer Name and Title: Ann Chanecka, Director, City of Tucson, Housing & Community Development

Consultant: Western Technologies Inc. dba Certerra Western Technologies ("Certerra")

Direct Comments to: Emilie Fisher, City of Tucson Housing & Community Development Department, PO Box 27210, Tucson, Arizona 85726, emilie@fisher@tucsonaz.gov

Project Location: 751 East Marketplace Boulevard, Tucson, Pima County Arizona, 85713
Pima County Assessor Parcel Number 132-13-104A

ERR A – Figures
ERR B – Photographic Log
ERR C – Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report dated February 2025

Description of the Proposed Project [24 CFR 50.12 & 58.32; 40 CFR 1508.25]**:** The Urban Workforce Development via Career and Technical Education Project will increase access to Career and Technical Education (CTE) programs in inner-city Tucson and throughout Southern Arizona by purchasing 4.5 acres of land adjacent to an existing campus currently operating at capacity. The property will become the future site of Building 3 of Bridges at JTED. Hundreds of secondary students each year in programs like Construction Technology or Heavy Equipment Operator will benefit from an immediate availability of outdoor work-based learning activities. In the decades following, thousands more students will benefit from this foundational workforce development investment.

Statement of Purpose and Need for the Proposal [40 CFR 1508.9(b)]: There are two primary benefits of the Urban Workforce Development via Career and Technical Education Project. The first benefit is the immediate programmatic improvements offered by an increase in outdoor learning spaces. The second benefit is on the future possibilities that the project will make possible for the students of Urban Workforce Development via Career and Technical Education. Additionally, the program will make a substantial contribution to the much-needed pipeline of ready-trained people to accept work positions in the various trades promoted by the organization. The project is a priority because without financial support, the District could lose its chance to purchase a plot of land directly adjacent to its existing facilities and that is amenable for current program demand and future innovation.

Many career and technical education programs require students to practice their trades in an outdoor area. For example, Pima JTED offers a Heavy Equipment Operator program where students learn to use heavy construction equipment (i.e. tractors, dozers, etc.). Currently, there is no available soil at the campus that is owned by the district for students to practice on their machines. Furthermore, the Construction Technology students would be able to use the land to practice trade skills like masonry, electrical, plumbing and framing. Other programs like Engineering and Robotics can capitalize on this space by partnering with a proposed bioscience and sustainability program to design build active and passive sustainability systems at the site.

As an inner-city school, Pima JTED's Innovation Tech High School does not have much opportunity to capture land for these types of practicums. The proposed location for this project is adjacent to our existing campus and will allow programs to quickly pivot to its utilization. However, the long-term utilization of this space will be dependent on the economic and workforce needs of the time. It is critical to capture this logistically critical space to allow Pima JTED opportunities to develop relevant job training programs in the future.

Existing Conditions and Trends [24 CFR 58.40(a)]: The project site is currently undeveloped vacant land within a densely developed area of southern Tucson. It is adjoined by the Pima JTED Innovation Tech High School, commercially zoned vacant land, a metal salvage operation, and residential neighborhoods.

Funding Information

Grant Number	HUD Program	Funding Amount
B-24-CP-AZ-0060	Economic Development Initiative Community Project Funding	$2,700,000.00

Estimated Total HUD Funded Amount: $2,700,000.00

Estimated Total Project Cost (HUD and non-HUD funds) [24 CFR 58.32(d)]**:** $3,400,000.00

Compliance with 24 CFR 50.4, 58.5, and 58.6 Laws and Authorities

Record below the compliance or conformance determinations for each statute, executive order, or regulation. Provide credible, traceable, and supportive source documentation for each authority. Where applicable, complete the necessary reviews or consultations and obtain or note applicable permits of approvals. Clearly note citations, dates/names/titles of contacts, and page references. Attach additional documentation as appropriate.

Compliance Factors: Statutes, Executive Orders, and Regulations listed at 24 CFR §58.5 and §58.6	Are formal compliance steps or mitigation required?	Compliance determinations
STATUTES, EXECUTIVE ORDERS, AND REGULATIONS LISTED AT 24 CFR 50.4 and 58.6		
Airport Hazards 24 CFR Part 51 Subpart D	Yes ☐ No ☒	The project site is over 15,000 feet from the boundaries of the nearest airport, Davis Monthan Air Force Base. **Source:** ERR D – Arizona Department of Transportation (ADOT), Airports of Arizona Interactive Map
Coastal Barrier Resources Coastal Barrier Resources Act, as amended by the Coastal Barrier Improvement Act of 1990 [16 USC 3501]	Yes ☐ No ☒	The project is in Arizona and does not contain Coastal Barrier Resources System (CBRS) units. The project site is in compliance with Coastal Barrier Resources regulations **Source:** ERR E – US Fish and Wildlife Service (USFWS) Coastal Barrier Resources System Map
Flood Insurance Flood Disaster Protection Act of 1973 and National Flood Insurance Reform Act of 1994 [42 USC 4001-4128 and 42 USC 5154a]	Yes ☐ No ☒	The project does not involve the acquisition, management, construction, or improvements of land within a 100-year floodplain as identified by FEMA maps, and does not involve a critical action within a 500-year floodplain. The project is located within flood zone X, which is defined by FEMA to be "the area determined to be outside the 500-year flood and protected by levee from 100- year flood." The project is in compliance with Flood Insurance requirements. **Source:** ERR F - FEMA FIRMette, Map Panel 04019C2279L effective June 16, 2011
STATUTES, EXECUTIVE ORDERS, AND REGULATIONS LISTED AT 24 CFR 50.4 & 58.5		
Clean Air Clean Air Act, as amended, particularly section 176(c) & (d); 40 CFR Parts 6, 51, 93	Yes ☐ No ☒	The project is located within an attainment area. The closest non-attainment zone is the Rillito Nonattainment Zone, approximately 11.9 miles to the northwest.

		The proposed action intends to increase available outdoor space for JTED Construction Technology students to be able to use the land to practice trade skills like masonry, electrical, plumbing and framing. Other JTED programs like Engineering and Robotics can utilize this space by partnering with a proposed bioscience and sustainability program to design and build active and passive sustainability systems at the site. The project is in compliance with the Clean Air Act and mitigation measures are not warranted. **Sources:** ERR G1 – Arizona Department of Environmental Quality (ADEQ) Air Quality in My Community Map ERR G2 – ADEQ, Air Quality, Nonattainment Areas, https://azdeq.gov/air-quality-nonattainment-areas
Coastal Zone Management Coastal Zone Management Act, sections 307(c) & (d)	Yes ☐ No ☒	The Project Site is in Tucson, Arizona and does not participate in the Coastal Zone Management Programs. This project is in compliance with the Coastal Zone Management Act. **Sources:** ERR E1 – USFWS Coastal Barrier Resources System Map ERR E2 - Office of Coastal Management, National Oceanic and Atmospheric Administration, Coastal Zone Management Programs https://coast.noaa.gov/czm/mystate/
Contamination and Toxic Substances 24 CFR Part 50.3(i) & 58.5(i)(2)	Yes ☐ No ☒	At the time of the site visit, Certerra did not observe fueling facilities, municipal or private solid waste landfills or uncontrolled dump sites, mining activities, evaporation ponds, waste treatment units, or other locations that contain, or may have contained hazardous waste in proximity to the Project Site. An adjacent site identified as Tucson Iron and Metal appeared to operate a metal salvage business. Tucson Iron and Metal was reported as a “non-generator” under the Resource Conservation Recovery Act (RCRA), which means this facility does not generate, treat, store, or dispose of regulated hazardous waste. Base on visual observations, Certerra did not identify indications the migration of hazardous materials, chemicals, gases, contamination, and radioactive materials onto the Subject Site from Tucson Iron and Metal or other sites in the surrounding area.

		Certerra queried the USEPA NEPAssist database to assess contamination and toxic substances on the Project Site and surrounding area. Within 3,000 feet of the Project Site, the following sites were identified: 12 Resource Conservation and Recovery Act (RCRA) sites and several US Brownfields sites. Certerra reviewed and obtained a commercial database report from EDR that compiles information from regulatory databases and lists kept by the USEPA and ADEQ. The findings included 10 Leaking Underground Storage Tanks (LUST) sites, 2 RCRA Non-generator sites and 13 US Brownfields sites. The RCRA Sites are as follows: Old Spanish Trail, Lake Shore Inc, Chevron #9-0965, Payless Cashways Inc 136, Tucson Iron and Metal, Busy D Pumping Inc, Walmart Supercenter #5626, Advanced Ceramics Research, ATL Tucson Facility, ARCO No. 5904, Merry x Ray, White Cap Construction Sully #HDWC0705, Interchecks Inc, and Beaudry Rv Service and Del RV3. Old Spanish Trail and Lake Shore Inc are listed as verified non-generators. Walmart Supercenter #5626 and ATL Tucson Facility are both listed as active RCRA sites, however there are no reported violations. The remaining RCRA sites are inactive and have no reported violations The Brownfields sites are as follows: Spanish Trails East, Spanish Trail Task 2, Greyhound Site, Primavera Homeless Shelter, Spanish Trails West, Spanish Trails North, Centro Carismatico, Hedlund 310, Orion Leasing, Realty, and Investment, Orion Leasing Realty & Investment, Former Chile Rellenos Restaurant, Primavera Property, and Kunz South Property. Most of the listed sites are designated as “No Cleanup Required” or “Ready for Anticipated Use”. Contaminants consisted of asbestos and lead for many of the sites. These contaminants do not represent a risk for the Project Site since they are specific to structural components at the reported locations away from the Project Site. The Kunz South Property site is listed as in the assessment stage and the clean up requirement is unknown. Given the physical distance of the site from the Project Site, approximately 0.63 miles northwest, this site does not warrant concern. According to the Arizona EPA Map of Radon Zones acquired from the USEPA website, the Project Site is in Zone 2, an area of moderate potential with average radon levels ranging between 2 and 4 picocuries per liter (pCi/L).

		According to data published by the Arizona Radiation Regulatory Agency (ARRA) from 1987/1988 and 1988/1989, Radon concentrations as measured with charcoal canister and Alpha Track Detectors Tucson, Arizona ranged from 0.50 to 2.70 pCi/L with an average of 1.04 pCi/L. Of the 24 measurements collected for zip code 85713, none were above the 4.0 pCi/L guidance level established by USEPA. Based on these measurements, there is a low potential for radon accumulations in the zip code encompassing the Project Site. Since the Project Site is not proposed for long-term residential occupancy, the reported localized levels of radon do not present a risk to the Project Site. The Project is in compliance with contamination and toxic substances requirements. **Sources:** Site Visit on May 15, 2025 ERR B – Photographic Log ERR H1 - NEPAssist Map with 3,000ft Buffer ERR H2 – NEPAssist Report ERR H3 – EDR Radius Map Report, Inquire No. 7970166.2s dated April 25, 2025 ERR H4 – ECHO Reports for RCRA Sites ERR H5 – Cleanups In My Community (CIMC) Reports for US Brownfield Sites ERR H6 – ARRA Radon Survey Data for Tucson, Arizona 1987/1988 and 1988/1989 ERR H7 – USPA Radon Map of Arizona
Endangered Species Endangered Species Act of 1973, particularly section 7; 50 CFR Part 402	Yes ☐ No ☒	The proposed project is not likely to adversely affect any federal protected Threatened or Endangered Species, nor adversely modify designated critical habitats, based on a review of critical habitat, a site visit, and online consultation with Arizona Game and Fish. Given the nature of the Project's proposed action, if active nests are identified during project activities, work should cease and the AZGF Wildlife Program be notified to make appropriate arrangements. Based on site observations, minimally suitable habitat for wildlife is present at the Project Site. The Project Site has been cleared and graded in connection with prior site development activities. The proposed project will not involve activities that have the potential to affect species or habitats. Based on the specifics of both the

		project and any federally listed species in the action area, the project will have no effect on listed species or critical habitat. This Project is in compliance with the Endangered Species Act. **Sources:** ERR I_IPaC Resource List Site Visit on May 15, 2025
Explosive and Flammable Hazards 24 CFR Part 51 Subpart C	Yes ☐ No ☒	Certerra did not observe sources of explosive or flammable operations on the site or project vicinity. The Project Site does not include a hazardous facility. Two water towers were observed approximately 0.25 miles south of the Project Site. Given the contents of water, these ASTs do not warrant concern to the Project Site. The Project is in compliance with Explosives and Flammable Hazards **Sources:** ERR A – Figures Site Visit on May 15, 2025
Farmlands Protection Farmland Protection Policy Act of 1981, particularly sections 1504(b) and 1541; 7 CFR Part 658	Yes ☐ No ☒	The Project Site is characterized as planned area development (PAD) -15 consisting of approximately 4 acres of undeveloped land. The Project Site does not include prime or unique farmland, or other farmland of statewide or local importance as identified by the U.S. Department of Agriculture, Natural Resources Conservation Service NRCS. Historical aerial photographs depicted the Project Site as native desert land in 1936 (earliest photograph reviewed). Major changes were not depicted until 2019 when the southern portion appeared to be graded vacant land. The purpose of the Farmland Protection Policy Act is to minimize the effect of federal programs on the unnecessary and irreversible conversion of farmland to non-agricultural uses. A review of historical aerials indicates the Project Site was not used for agricultural purposes in the past. The proposed project does not involve conversion of farmland to non-agricultural use. The project is in compliance with the Farmland Protection Policy Act. **Sources:** ERR B – Photographic Log ERR J - NRCS Farmland Classification ERR K - EDR Aerial Photo Decade Package

		ERR L –City of Tucson Planning and Development Zoning Map Site Visit on May 15, 2025
Floodplain Management Executive Order 11988, particularly section 2(a); 24 CFR Part 55	Yes ☐ No ☒	The project is located within flood zone X, which is defined by FEMA to be "the area determined to be outside the 500-year flood and protected by levee from 100- year flood." The project is in compliance with Floodplain Management. **Sources:** ERR C - FEMA FIRMette, Map Panel 04019C2279L effective June 16, 2011
Historic Preservation National Historic Preservation Act of 1966, particularly sections 106 and 110; 36 CFR Part 800	Yes ☐ No ☒	Tribal Section 106 consultation letters were sent through email on May 16, 2025. The following tribes were contacted: Fort Sill Apache Tribe of Oklahoma, Hopi Tribe of Arizona, Pascua Yaqui Tribe of Arizona, San Carlos Apache Tribe, Tohono O'odham Nation of Arizona, and the White Mountain Apache Tribe. On May 16, 2025 Peter L. Steere, Tribal Historical Preservation Officer (THPO) of the Tohono O'odham Nation replied stating the Tribe concur that "no historic properties" will be affected by the Project. Mr. Steere informed Certerra should buried cultural deposits, including burials, are encountered during construction, the THPO of the Tohono O'odham Nation will need to contacted along with the Arizona State Museum. On May 21, 2025 Mark Altaha, THPO of the White Mountain Apache Tribe replied with "No Adverse Effect" with the proposed project. On May 23, 2025, Karl Hoerig, THPO of the Pascua Yaqui Tribe replied stating "The PYT [Pascua Yaqui Tribe] THPO has no information that would suggest this project will have any effect on heritage resources of importance to the Tribe. On April 30, 2025 Certerra notified the Arizona State Historic Preservation Officer (SHPO) Kathryn Leonard. On May 28, 2025 Erin Davis, Archeological Compliance Specialist, recommended a finding of No Adverse Effect is appropriate for the Project and no additional archaeological work is recommended. On April 30, 2025 Certerra notified the City of Tucson Historic Preservation Office requesting consultation regarding the Project. Certerra followed-up regarding the request on August 6, 2025. On September 2, 2025, Jonathan

		Knighton-Wisor, Cultural Resource Compliance Project Manager, informed Certerra there are no applicable City of Tucson cultural resources compliance regulations. Since the Project is on private land and is not a City Capital Improvement Project, the City of Tucson will not be the lead agency for Section 106 consultation. Lastly, while the Project Site is on private land, A.R.S. § 41-865 (treatment of human/funerary remains on private land) will still be applicable. In February of 2025, a cultural resources Class I Survey was conducted by Harris Environmental Group Inc. The report was titled *Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report* dated February 2025. The report concluded there is little potential for the inadvertent discovery of significant archaeological remains within the project area. The Project Site and surrounding areas within the Area of Potential Effects (APE) are not listed in or eligible for listing in the National Register of Historic Places. Responses from Fort Sill Apache, Hopi Tribe, and San Carlos Apache Tribe were not received. The project is in compliance with Historic Preservation requirements. **Sources:** ERR A – Figures ERR M1 – Tribal Consultation Letters: Fort Sill Apache Tribe of Oklahoma, Hopi Tribe, Pascua Yaqui Tribe, San Carlos Apache, Tohono O'odham Nation, and White Mountain Apache Tribe ERR M2 – Tribal Responses: White Mountain Apache Tribe dated May 21, 2025, Pascua Yaqui Tribe dated May 23, 2025, Tohono O'odham Nation dated May 16, 2025 ERR M3 – SHPO Consultation Letter ERR M4 – SHPO Response dated May 28, 2025 ERR M5 – Tucson Historic Preservation Office Consultation Letter ERR C – *Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report* dated February 2025 submitted by Harris Environmental
Noise Abatement and Control Noise Control Act of 1972, as amended by the Quiet	Yes ☐ No ☒	The Project Site is within 1,000 feet of a major roadway or railroad. The Davis Monthan Air Force Base airport is approximately 2.97 miles (15,682 feet) from the Project Site.

Communities Act of 1978; 24 CFR Part 51 Subpart B		The Project Site is along East Tucson Marketplace Boulevard which is classified as a minor roadway. The closest major roadway is South Park Avenue located approximately 1,125 feet east of the Project Site and Interstate 10 located approximately 637 feet south of the Project Site. The Union Pacific (West) Railroad is located approximately 232 feet west of the Project Site. Certerra queried the HUD Day/Night Noise Level calculator regarding nearby roadway and railway traffic. According to the calculator, the combined DNL for all road and rail sources is 72 decibels (dB). Certerra queried the HUD Barrier Performance Module (BPM) calculator to measure the nearby barrier's effectiveness on noise reduction. According to the BPM calculator, the combined roadway and railroad DNL with barrier reduction is 65.5068 dB. 65.5068 dB is slightly above the threshold of the HUD recommended level of 65 dB. The slight exceedance of the 65 dB recommended level is not considered significant since the Project Site is not proposed for residential use; therefore, overnight occupancy will not be present. The Project Site will supplement instructional facilities and resources for the existing operations, which currently function unimpeded by the existing noise sources in the Project Area. No mitigation measures are warranted. The project is anticipated to be in compliance with Noise and Abatement Control. **Sources:** ERR N1 - DNL Calculator ERR N2 - UP Tucson train analysis ERR N3 - 2022 I-10 survey ERR N4 - I-10 Distance Map ERR N5 - Train Distance Map ERR N6 - BPM Calculator
Sole Source Aquifers Safe Drinking Water Act of 1974, as amended, particularly section 1424(e); 40 CFR Part 149	Yes ☐ No ☒	The project site is located within a Sole Source Aquifer. However, the project is not anticipated to impact the aquifer. The property is on the municipal water system, and the anticipated use does not include water using facilities. **Sources:** ERR O - USEPA Sole Source Aquifer Map

Wetlands Protection Executive Order 11990, particularly sections 2 and 5	Yes ☐ No ☒	No potential Waters of the US, channels, wetlands, ponds, or impoundments are present on the Project Site. The closes body of water is a lake approximately 1.39 miles southeast of the Project Site located within the Sam Lena Disc Golf Course at 2805 East Ajo Way in Tucson Arizona. The project is in compliance with Executive Order 11990 **Sources:** ERR P – USFWS National Wetlands Inventory Map
Wild and Scenic Rivers Wild and Scenic Rivers Act of 1968, particularly section 7(b) and (c)	Yes ☐ No ☒	The project site is not located within one mile of a wild, scenic, recreational, or study river as designated on the National Rivers Inventory online database. **Sources:** ERR Q1 - Wild and Scenic River Map ERR Q2 - Study Rivers Map ERR Q3 - National River Map
ENVIRONMENTAL JUSTICE		
Environmental Justice Executive Order 12898	Yes ☐ No ☒	According to the US Census Bureau, Tucson has a population of 542,629 (2020 Decennial Census). The median age of a resident is 35 and the median household income is $55,708 (2023 American Community Survey 1-Year Estimates), whereas Arizona's median household income is $77,315. 65.1% of the employed population are an employee of a private company and 17.4% are local, state, and federal workers. Tucson primarily consist of people reported as White with a population of 295,986 followed by Hispanic or Latino with a population of 228,878. No adverse environmental impacts were identified in the project's environmental review. The project is intended to provide additional space to continue educational instruction at JTED. The proposed action will benefit Tucson's residents who seek advanced and technical education. The project is in compliance with Executive Order 12898. **Sources:** ERR R – US Census Bureau, Tucson, Pima County, Arizona profile, https://data.census.gov/profile/Tucson_city,_Arizona?g=160XX00US0477000

Environmental Assessment Factors [24 CFR 58.40; Ref. 40 CFR 1508.8 &1508.27] Recorded below is the qualitative and quantitative significance of the effects of the proposal on the character, features and resources of the project area. Each factor has been evaluated and documented, as appropriate and in proportion to its relevance to the proposed action. Verifiable source documentation has been provided and described in support of each determination, as appropriate. Credible, traceable and supportive source documentation for each authority has been provided. Where applicable, the necessary reviews or consultations have been completed and applicable permits of approvals have been obtained or noted. Citations, dates/names/titles of contacts, and page references are clear. Additional documentation is attached, as appropriate. **All conditions, attenuation or mitigation measures have been clearly identified.**

Impact Codes: Use an impact code from the following list to make the determination of impact for each factor.
(1) Minor beneficial impact
(2) No impact anticipated
(3) Minor Adverse Impact – May require mitigation
(4) Significant or potentially significant impact requiring avoidance or modification which may require an Environmental Impact Statement

Environmental Assessment Factor	Impact Code	Impact Evaluation
LAND DEVELOPMENT		
Conformance with Plans / Compatible Land Use and Zoning / Scale and Urban Design	**2**	The project site is within an area of the City of Tucson zoned PAD-Planned Area of Development. **Sources:** ERR L - City of Tucson Planning and Development Zoning Map https://codelibrary.amlegal.com/codes/tucson/latest/tucson_az_udc/0-0-0-640
Soil Suitability/ Slope/ Erosion/ Drainage/ Storm Water Runoff	**2**	The project site has suitable soil with no evidence of stabilization methods being required on site. Further, the intended use of the project site precludes changing the structure and stability of the soils on site. **Sources:** ERR J - NRCS Farmland Classification
Hazards and Nuisances including Site Safety and Noise	**2**	The project site does not have hazards or nuisances, and the anticipated project is not anticipated to generate hazards and nuisances. **Sources:** Site Visit on May 15, 2025

Environmental Assessment Factor	Impact Code	Impact Evaluation
SOCIOECONOMIC		
Employment and Income Patterns	**1**	The goal of Pima JTED #11's projects are to increase the skillsets, competency, confidence, and overall knowledge of the youth of Tucson. The long-term goal of this project is to increase the income patterns of the population in the surrounding area and boost Tucson employment rates. **Sources:** ERR R - Pima JTED Market Study dated October 26, 2023
Demographic Character Changes, Displacement	**1**	The project is anticipated to positively impact the demographics in the surrounding area by providing services to the youth in the area that they otherwise would not have access to.

		Sources: ERR R - Pima JTED Market Study dated October 26, 2023
Environmental Justice	**1**	The proposed site is suitable for its proposed use and will not adversely impact low income or minority populations. The project is anticipated to benefit the surrounding area, which largely consists of low-income and minority families. **Sources:** ERR R - Pima JTED Market Study dated October 26, 2023

Environmental Assessment Factor	Impact Code	Impact Evaluation
COMMUNITY FACILITIES AND SERVICES		
Educational and Cultural Facilities	**1**	The project is anticipated to positively impact educational facilities through the use of the land to allow students of the adjoining Innovation Tech High School to have hands-on experience of technical skills.
Commercial Facilities	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding commercial facilities.
Health Care and Social Services	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding health care and social services.
Solid Waste Disposal / Recycling	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding solid waste disposal/recycling services.
Waste Water / Sanitary Sewers	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding waste water/sanitary services.
Water Supply	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding water supply.
Public Safety - Police, Fire and Emergency Medical	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding public safety services.
Parks, Open Space and Recreation	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding parks, open space, and recreational spaces.
Transportation and Accessibility	**2**	The project is not anticipated to increase the number of people in the surrounding area, so it is not anticipated to put undue stress on surrounding transportation and accessibility. The proposed action is acquisition of land, so there is also no anticipated temporary traffic increase since development is not anticipated within the scope of this action.

Environmental Assessment Factor	Impact Code	Impact Evaluation
NATURAL FEATURES		

Unique Natural Features, Water Resources	**2**	The proposed action is not anticipated to impact unique natural features or water resources in the area. The depth to groundwater in the surrounding area is between 145 and 175 feet below ground surface. The anticipated action does not include water use. **Sources:** Arizona Department of Water Resources, Well Registry https://azwatermaps.azwater.gov/wellreg/
Vegetation, Wildlife	**2**	The proposed action is not anticipated to impact the vegetation and wildlife in the area. The project site is within a densely populated and urbanely developed portion of southern Tucson and is currently vacant, undeveloped land with sparse to no vegetation present. **Sources:** Site Visit on May 15, 2025
Other Factors		N/A

Environmental Assessment Factor	Impact Code	Impact Evaluation
CLIMATE AND ENERGY		
Climate Change Impacts	**2**	The proposed action does not include changing the current use of the land.
Energy Efficiency	**2**	The project is not anticipated to impact the energy efficiency of the area as the proposed action does not include changing the energy consumption of the current land.

Additional Studies Performed: Traffic Impact Study
Field Inspection: May 15, 2025 completed by Kage Anderson, Project Manager, Certerra

List of Sources, Agencies and Persons Consulted [40 CFR 1508.9(b)]**:**

Jason Lilienthal y Trujillo, City of Tucson, Planning & Development Services Department, Lead Historic Preservation Planner
Jonathan Knighton-Wisor, City of Tucson, Planning & Development Services Department, Historic Preservation Office, Cultural Resource Compliance Project Manager
Kathryn Leonard, Arizona State Park State Historic Preservation Office, AZSHPO@stateparks.com
Karl Hoerig, Tribal Historic Preservation Officer, Pasca Yaqui Tribe, 520-883-5116, karl.hoerig@pascuayaqui-nsn.gov
Mark Altaha, Tribal Historic Preservation Officer, White Mountain Apache Tribe, 928-338-3033, markaltaha@wmat.us
Matt Dickey, Bourn Companies, 520-429-6018, mdickey@bourncompanies.com
Megan Magee, Bourn Companies, mmagee@bourncompanies.com
Peter L. Steere, Tribal Historic Preservation Officer, Tohono O'odham Nation, 520-383-3622, peter.steere@tonation-nsn.gov
Tina Norton, Pima County JTED, Special Projects, 520-419-3744, tnorton@pimajted.org

ERR A: Figures
ERR B: Photographic Log

ERR C: *Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report* dated February 2025 submitted by Harris Environmental
ERR D: Arizona Department of Transportation (ADOT), Airports of Arizona Interactive Map, http://www.azdot.gov/maps
ERR E1: US Fish and Wildlife Service (USFWS) Coastal Barrier Resources System Map, https://fwsprimary.wim.usgs.gov/CBRSMapper-v2/
ERR E2: Office of Coastal Management, National Oceanic and Atmospheric Administration, Coastal Zone Management Programs https://coast.noaa.gov/czm/mystate/
ERR F: FEMA FIRMette, Map Panel 04019C2279L effective June 16, 2011
ERR G1: Arizona Department of Environmental Quality (ADEQ) Air Quality in My Community Map
ERR G2: ADEQ, Air Quality, Nonattainment Areas, https://azdeq.gov/air-quality-nonattainment-areas
ERR H1: NEPAssist Map with 3,000ft Buffer
ERR H2: NEPAssist Report
ERR H3: EDR Radius Map Report, Inquire No. 7970166.2s dated April 25, 2025
ERR H4: ECHO Reports for RCRA Sites
ERR H5: Cleanups In My Community (CIMC) Reports for US Brownfield Sites
ERR H6: ARRA Radon Survey Data for Tucson, Arizona 1987/1988 and 1988/1989
ERR H7: USPA Radon Map of Arizona
ERR I: USFWS, IPaC Resource List
ERR J: USDA Natural Resources Conservation Service (NRCS) Custom Soil Report, Farmland Classification
ERR K: EDR, The EDR Aerial Photo Decade Package, Inquiry No. 7970166.8, dated April 25, 2025
ERR L: City of Tucson, Department of Planning and Development Services, Interactive Zoning Map, https://www.tucsonaz.gov/Departments/Planning-Development-Services
ERR M1: Section 106 Tribal Consultation Letters dated – Fort Sill Apache Tribe, Hopi Tribe, Pascua Yaqui Tribe, San Carlos Tribe, Tohono O'odham Nation, White Mountain Apache Tribe
ERR M2: Section 106: Tribal Response – Pascua Yaqui Tribe dated May 23, 2025, White Mountain Apache Tribe dated May 21, 2025 and Tohono O'odham Nation dated May 16, 2025
ERR M3: Section 106: Arizona SHPO Consultation Letter dated April 30, 2025
ERR M4: Section 106: Arizona SHPO Consultation Response dated May 28, 2025
ERR N1: DNL Calculator: https://www.hudexchange.info/programs/environmental-review/dnl-calculator/
ERR N2: UP Tucson train analysis: https://www.trainorders.com/discussion/read.php?1,5338606
ERR N3: 2022 I-10 survey: chrome-extension://efaidnbmnnnibpcajpcglclefindmkaj/https://azdot.gov/sites/default/files/2023-08/2022-AADT-PUBLICATION_StateRoutes.pdf
ERR N4: I-10 Distance Map: Google Earth Pro, 2025
ERR N5: Train Distance Map: Google Earth Pro, 2025
ERR N6: BPM Calculator: https://www.hudexchange.info/programs/environmental-review/bpm-calculator/
ERR O: USEPA Sole Source Aquifer Map https://epa.maps.arcgis.com/apps/webappviewer/index.html?id=9ebb047ba3ec41ada1877155fe31356b
ERR P: USFWS National Wetlands Inventory Map https://www.fws.gov/program/national-wetlands-inventory/wetlands-mapper
ERR Q1: Wild and Scenic River Map - https://www.rivers.gov/carp/map
ERR Q2: Study Rivers Map - https://www.rivers.gov/carp/map
ERR Q3: National River Map - https://www.rivers.gov/carp/map
ERR R: City of Tucson Census Data - https://data.census.gov/profile/Tucson_city,_Arizona?g=160XX00US0477000
ERR S: Market Study: Mel and Enid Zuckerman Center for Health and Medical Careers, Market Study

List of Permits Obtained: N/A

Public Outreach [24 CFR 50.23 & 58.43]**:**

Web publication of combined Notice of Intent to Request Release of Funds/Finding of No Significant Impact (RROF/FONSI) and the Environmental Review Record (ERR) on the City of Tucson's Housing & Community Development Environmental Review webpage at www.tucsonaz.gov/Departments/HousingandCommunityDevelopment/Documents/Environmental-Review. The combined RROF/FONSI and the ERR were available in-person at 310 North Commerce Park Loop, Tucson, Arizona 85745. Interested parties were contacted by e-mail.

Cumulative Impact Analysis [24 CFR 58.32]**:**

This project will have no significant impact on the human environment, therefore an Environmental Impact Statement under NEPA is not required. Cumulative impacts to the environment are expected to be minimal. Any impacts from temporary construction activities including noise and dust will be mitigated through construction management activities. Temporary impacts from soil erosion, sediment, and runoff will be mitigated with erosion and sedimentation controls during construction management activities.

Alternatives [24 CFR 58.40(e); 40 CFR 1508.9]

No other alternatives other than the no action alternative was considered

No Action Alternative [24 CFR 58.40(e)]:

The No Active Alternative would jeopardize the loss of funding for the project. Without the procurement and utilization of the property, the adjoining JTED facility would continue operating at capacity and would thus limit the ability for students to refine their technical skills without the ability to use an outdoor space.

Summary of Findings and Conclusions:

Of the compliance factors observed for this project site, the project followed all 16 compliance factors. For the Noise Control Act of 1972, The Project Site was slightly above the 65 dB threshold that is recommended by HUD, but was not considered significant since the Project Site is not proposed for residential use (and occupancy will not be present overnight).

Mitigation Measures and Conditions [40 CFR 1505.2(c)]

Summarize below all mitigation measures adopted by the Responsible Entity to reduce, avoid, or eliminate adverse environmental impacts and to avoid non-compliance or non-conformance with the above-listed authorities and factors. These measures/conditions must be incorporated into project contracts, development agreements, and other relevant documents. The staff responsible for implementing and monitoring mitigation measures should be clearly identified in the mitigation plan.

Law, Authority, or Factor	Mitigation Measure
Noise Abatement and Control	65.5068 dB is slightly above the threshold of the HUD recommended level of 65 dB. The slight exceedance of the 65 dB recommended level is not considered significant since the Project Site is not proposed for residential use; therefore, overnight occupancy will not be present. The Project Site will supplement instructional facilities and resources for the existing operations, which currently function unimpeded by the existing noise sources in the Project Area. No mitigation measures are warranted.

Urban Workforce Development via Career and Technical Education Grant No. B-24-CP-AZ-0060
Tucson, Arizona

Determination:

☒ **Finding of No Significant Impact** [24 CFR 58.40(g)(1); 40 CFR 1508.27]
The project will not result in a significant impact on the quality of the human environment.

☐ **Finding of Significant Impact** [24 CFR 58.40(g)(2); 40 CFR 1508.27]
The project may significantly affect the quality of the human environment.

Preparer Signature: _____ Date: March 12, 2026

Name/Title/Organization: Kage Anderson/ Senior Environmental Scientist/ Certerra

Certifying Officer Signature: Ann Chanecka Date: 3/13/2026

Name/Title: Ann Chanecka, Director, City of Tucson, Housing & Community Development

This original, signed document and related supporting material must be retained on file by the Responsible Entity in an Environmental Review Record (ERR) for the activity/project (ref: 24 CFR Part 58.38) and in accordance with recordkeeping requirements for the HUD program(s).

ERR A

LEGEND

APPROXIMATE AREA OF POTENTIAL EFFECTS (APE)

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	1
WT Job No. 29-824105-0	
Area of Potential Effects (APE) Map	

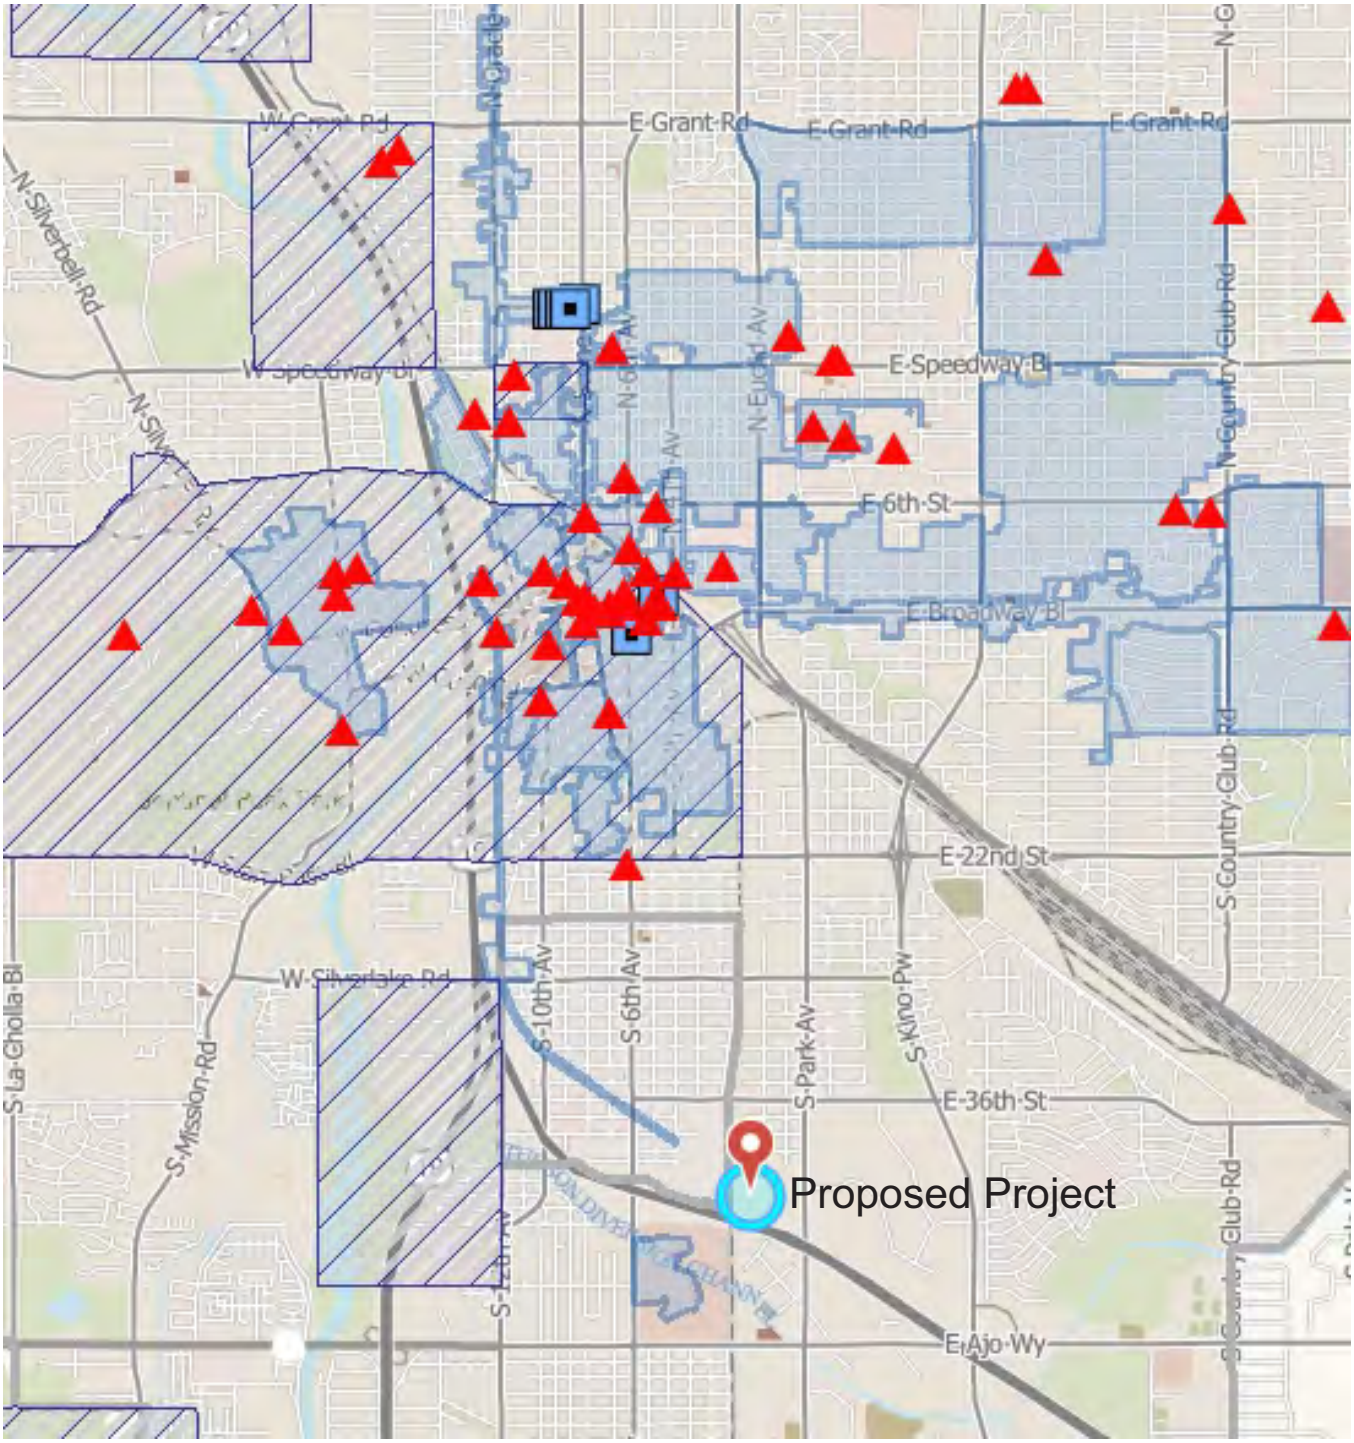

LEGEND

Historic District Boundaries

NRHP Listed Historic Property

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	2
WT Job No. 29-824105-0	
NRHPMap	

1: Northeast corner of Project Site, facing west.

2: Northwest corner of Project Site, facing east.

3: South margin of Project Site, facing north.

4: Current JTED facility, south adjoining to Project Site.

5: Asphalt remnants in north margin of Project Site.

6: Soil stockpiles in north margin of Project Site.

7: Additional soil stockpiles.

8: Metal reclaimer located immediately north of Project Site.

9: North margin of Project Site, facing south. Note two water towers southwest of Project Site.

10: North boundary of Project Site.

Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

Prepared for:
Pima County Joint Technical Education District #11
2855 West Master Pieces Drive
Tucson, AZ 85741

Prepared by:
Sarah Wolfram and Drew Sangerman

Submitted by:
Harris Environmental Group, Inc.
650 N 6th Ave, Tucson, AZ 85705

February 2025

1. REPORT TITLE

1a. Report Title: Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

1b. Report Author(s): Sarah Wolfram and Drew Sangerman

1c. Date: February 2025

2. PROJECT REGISTRATION/PERMITS

2a. AAA Permit Number: 2025-034bl

3. ORGANIZATION/CONSULTING FIRM

3a. Name: Harris Environmental Group, Inc.

3b. Internal Project Number: 25-003

3c. Internal Project Name: Tucson Marketplace Class I

3d. Contact Name: Sarah Wolfram

3e. Contact Address: 650 North 6th Ave, Tucson, AZ 85705

3f. Contact Phone: 520-628-7648

3g. Contact Email: swolfram@heg-inc.com

4. SPONSOR/LEAD AGENCY

4a. Sponsor: Pima County Joint Technical Education District #11

4b. Lead Agency: Pima County Joint Technical Education District #11

4c. Funding Source(s): Private

4d. Other Involved Agencies: Western Technologies

4e. **Applicable Regulations:** Arizona Antiquities Act (AAA), Arizona Revised Statutes (ARS; Title 41 § 841-844), the Arizona State Historic Preservation Act (SHPA; ARS Title 41 § 861-865), and Section 106 of the National Historic Preservation Act. A Class III pedestrian survey was necessary to identify, document, and evaluate cultural resources that could be affected by the proposed project. This process requires consultation with the SHPO and ASM to review the findings of this study regarding the undertaking's potential effects on cultural resources. This report was prepared per guidelines specified by the SHPO (2009, 2016).

5. DESCRIPTION OF PROJECT OR UNDERTAKING: Class I Cultural Resources Survey, associated with a 4.09-acre parcel located in Tucson, Arizona.

6. PROJECT AREA/AREA OF POTENTIAL EFFECTS: The area of potential effects (APE) is 4.09 acres located in Tucson, Arizona. The surrounding environment is built with modern buildings and roads in use. The southern end of the parcel has standing structures that are in use.

7. PROJECT LOCATION

7a. Address: 751 East Tucson Marketplace Boulevard

7b. Nearest City/Town: Tucson

7c. County: Pima

7d. Project Locator UTM: 503756 Easting, 3561169 Northing

7e. NAD 83

7f. Zone: 12N

7g. Baseline & Meridian: Gila & Salt River

7h. USGS Quadrangle(s): Tucson

7i. Legal Description(s): Township 14 S, Range 14 E, Section 30

8. SURVEY AREA

8a. Total Acres: 4.09

8b. Survey Area.

1. Land Jurisdiction	2. Total Acres Surveyed	3. Total Acres Not Surveyed	4. Justification for Areas Not Surveyed
Private	4.09	0	N/A

9. ENVIRONMENTAL CONTEXTS

9a. Landform: The project area is on a southeast facing gradual slope.

9b. Elevation: 2,462 ft amsl

9c. Surrounding Topographic Features: Characterized by broad sweeping alluvial plains. Sentinel Peak is located 2.43 miles to the northwest.

9d. Nearest Drainage: The Santa Cruz River is 1.68 miles to the west.

9e. Local Geology: The geology of this region consists of Quaternary Surficial deposits. Quaternary Surficial deposits are associated with strongly consolidated alluvial and eolian deposits. The geologic make up consists of course poorly sorted alluvial fan and terrace deposits

on middle to upper piedmonts and along large drainages. Sand, silt, and clay are present on alluvial plains, with wind-blown sand deposits (Arizona Geologic Survey, 2025).

9f. Vegetation: Common vegetation of this region is dominated by creosote (*Larrea tridentata*), ocotillo (*Fouquieria*), saguaro cactus (*Carnegiea gigantea*), ironwood (*Olneya tesota*), and mesquite (*Prosopis glandulosa*) (Griffith et al, 2014).

9g. Soils/Deposition: Soils across the project area are primarily composed of cave soils and urban land. This soil is typical of the surrounding fan terraces. A typical profile consists of zero to seven inches of gravelly fine sandy loam, seven to twenty inches of cemented material, and twenty to sixty inches of gravelly loamy sand (NRCS, 2024).

9h. Buried Deposits: Buried cultural deposits are not likely within the project area.

9i. Justification: The known cultural sites in the immediate vicinity of the project area are all historic affiliation, with very little potential for subsurface artifacts.

I0. BUILT ENVIRONMENT: The project area is located just north of the Pima JTED Innovative Learning Center in Tucson, Arizona. The surrounding area is built as an urban setting across all cardinal directions. No historical standing architecture is present in the project area.

11. INVENTORY CLASS COMPLETED

11a. Class I Inventory: ☒

11b. Researcher(s): Jonathan Damp Ph.D. and Sarah Wolfram

11c. Class II Survey: ☐

11d Sampling Strategy:

11e. Class III Inventory: ☐

12. BACKGROUND RESEARCH SOURCES

12a. AZSITE: ☒

12b. ASM Archaeological Records Office: ☒

12c. SHPO Inventories and/or SHPO Library: ☐

12d. NRHP Database: ☐

12e. ADOT Portal: ☐

12f. GLO Maps: #204095, 1872; #204097, 1872; #210345, 1876; #210347, 1876

12g. Land- Managing Agency Files: N/A

12h. Tribal Cultural Resources Files: N/A

12i. Local Government Websites: N/A

12j. Other: USGS Topographic Maps: Tucson, AZ 1:125,000 1904; Tucson, AZ 1:125,000 1905; Tucson, AZ 1:62,500 1948; Tucson, AZ 1:250,000 1956; Tucson, AZ 1:24,000 1957; Tucson, AZ

1:250,000 1958; Tucson, AZ 1:250,000 1959; Tucson, AZ 1:250,000 1962; Tucson, AZ 1:250,000 1964

13. BACKGROUND RESEARCH RESULTS

Harris Environmental personnel conducted a site file search on AZSITE to identify previous projects and sites within one half-mile of the project area. AZSITE records noted 31 previous projects within the project area and or buffer. An ASM Archaeological Records Office (ARO) search was also conducted as part of that project, which do not provide a differing information that what was shown on AZSITE. Nine previously recorded site are located within one half-mile of the project area, with three of these previously recorded cultural resources identified within the project area.

The sites located within the project area are: AZ BB:13:738(ASM), AZ BB:13:744(ASM), and AZ BB:13:798(ASM).

AZ BB:13:738(ASM) is a concrete foundation of the Fiesta Drive-In Theatre, that was located at 3230 South Park Avenue. The business first opened in 1953 and was torn down in 1966. The remaining foundation consists of a cluster of seven concrete pads, each measuring approximately 6 ft long and 1 ft high. The concession building was bulldozed into a rubble pile, which remains on site (ASM, 2012).

AZ BB:13:744(ASM) is the Tucson-Bisbee Highway, which once ran through the area but now remains as an arbitrary line. The section through the project area, noted as "Section 1, Number 18" ran parallel alongside the EP&SW train track, from South 6th Avenue. This highway was built between 1909 and 1914, and abandoned in 1928, but was re-established as a county road in 1931, renamed as "Old Vail Road." Today, no portions of the original road survive (ASM, 2021).

AZ BB:13:798(ASM) is a historic house foundation that consists of four "wing walls" extending out from a square center. The foundation measures 106 ft by 84 ft, standing 10 ft tall. These walls are sloping downward, outside from the center. There is a small concrete pad to the west of the foundation. The property is present in 1954 aerial photographs of the area, but not in the 1946 aerial images. The purpose of the structure is unknown (ASM, 2012).

13a. Previous Projects Within Study Area and Half-Mile Buffer.

1. Project Reference Number	2. Project Name	3. Author(s)	4. Year
1980-155	Santa Cruz SW Interceptor Project	Brew	1980
1983-134	SE Interceptor Route	Brew	1983
1993-213	Julian/Rodeo Wash Survey	Slawson	1993
1996-286	Water Main Alignments in the Vicinity of Park Avenue and 33rd Street, Tucson	Sliva	1996
1997-28	Kino Community Center Reclaimed Water Main Project	Eppley	1997
1997-33	Kino Silverlake Main Replacement Project Survey	Eppley	1997

1998-43	6th Ave. I-10 to Ajo Way Survey	Castalia	1998
1998-44	S. Park (19th to 36th) Survey	Castalia	1998
1998-266	6th Ave- 18th St. to I-10 Survey	Diehl	1998
2000-116	Jct. I-19 - Craycroft Rd.	Montero	2000
2000-166	Pipeline Anomaly Digs	Rogge	2000
2000-284	Moratorium Streets Survey	Diehl	2000
2000-882	N/A	N/A	N/A
2001-399	South Park Survey	Diehl	2001
2001-769	B-10 Survey	Wright	2001
2002-316	South Park Back to Basics Survey	Diehl	2002
2003-505	Hope VI South Park 35th Street Survey	Diehl	2003
2003-1217	Hope VI 35th Street Purchase Survey	Diehl	2003
2003-1218	Habitat - 36th and Mountain Survey	Diehl	2003
2003-1514	N/A	N/A	N/A
2004-541	I-10/6th Avenue Bridge, Artistic Fencing and Sidewalk Improvements	Touchin	2004
2004-1748	902 East 35th Street Survey	Diehl	2004
2005-877	MUSD Transportation Facility	DeJongh & Dart	2005
2007-681	Sinclair Data Recovery	Jones et al.	2009
2012-73	Proposed Fiber Optic Corridor-Cultural Resource Survey	Knoblock	2001
2012-76	Cultural Resources Inventory of a Portion of The Loop	Smith, Wygant, & McKee	2012
2012-146	Sinclair Survey	Doak	2007
2012-147	Sinclair Survey -- Fiesta Drive-In	Doak	2006
2015-6	Southeast Interceptor Class III	King & Prasciunas	2015
2016-397	Old Nogales Interceptor	Stone	2017
SHPO-2001-548	Request for Evaluation - Telecommunication Facilities - UTILITY INTERNATIONAL Solomon Industrial P	SHPO	2001

13b. Previously Recorded Cultural Resources Within Study Area and Half-Mile Buffer.

1. Site Number/Name	2. Affiliation	3. Site Type	4. Eligibility Status	5. Associated Reference(s)
AZ BB:13:679(ASM)	Euro-American	Railroad	Eligible	Tucker, 2000 Ruble, 2001 Smith & Wheeler, 2001 Estes et al, 2005 Twilling, 2006

				Twilling, Luchetta, & Shaw 2007 Luchetta & Shaw, 2007 Goldstein, 2008 Hesse, 2010 Howell, 2011 Lindeman, Diel, & Gilma 2012 Peters, 2013 Heilman, 2013 Hesse & Hesse, 2014 Rawson, 2015 King & Prasciunas, 2015
AZ BB:13:738(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2006 Doak, 2007
AZ BB:13:739(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2007
AZ BB:13:744(ASM)	Euro-American	Road-trail	Unevaluated	Doak, 2006 Doak, 2007 Copperstone, 2014
AZ BB:13:748(ASM)	Euro-American	Historic structure and artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:763(ASM)	Euro-American	Historic artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:798(ASM)	Euro-American	House Foundation	Eligible	Doak, 2007
AZ EE:1:300(ASM)	Euro-American	Railroad	Eligible	Wright, 2000 Luchetta & Shaw, 2007 Hesse, Levstik, & Barr, 2009 Tucker, 2009 Hess & Barr, 2009 Lindeman, Diel, & Gilman, 2012 Smith, Wygant, & McKee, 2012 Heilman, 2013 Hesse & Hesse, 2014 Jerla & King, 2014
AZ FF:9:17(ASM)	Euro-American	Road-trail	Eligible	Champe, 1936 Davis, 2001 Knoblock, 2001

				Davis & Ogren, 2002 Davis, 2002 Touchin & Brodbeck, 2002 Rogge, 2002 Chapin-Pyritz & Hill, 2002 McDermott, 2002 Touchin, Palmer, & Brodbeck, 2002 Shepard & Turner, 2002 Moses & Doak, 2003 Doak, 2003 Klune & Moses, 2003 Touchin & Brodbeck, 2003 Lindly, 2004 Moses & Montgomery, 2004 Jones, 2004 Stephen, 2004 Moses, 2004 Jolly & Fangmeier, 2004 Twilling, Fahrni, & DeJongh, 2004 Terhune, 2004 Compton-Gore & Rogge, 2005 Klune & Doak, 2005 Petersen, 2005 Webb, 2005 Schroeder, 2005 Hesse, 2005 Allan, Price, Arrigoni, & Kearney, 2005 Strohmayer, McDermott, & Ramsey, 2005 Estes, 2005 Fahrni, 2005 Vanderpot, 2005

				Rossi & Garcia, 2005 Courtright, 2005 Ekstrom, 2006 Goldstein & Bassett, 2006 Barr, 2006 Stahman, 2006 Brodbeck, Touchin, Belvin, & Silverman, 2006 Davis, Davis, Lincoln-Babb, Montero, & Turner, 2006 Davis, Turner, & Davis, 2006 Gordon, 2006 Shilling & Fangmeier, 2006 Rawson, Rieder, & Boley, 2006 Cook, 2006 Rieder, Rawson, & Epperson, 2006 Jones, Gegory, Bockhorst, & Stokes, 2006 Petersen, 2006 Florie & Luhnow, 2007 West & Ezzo, 2007 Compton-Gore, Cox, & Rogge, 2007 Goldstein, 2007 Newsome, 2007 Huebechen, Garcia, & Bruden, 2008 Davis, 2008 Vance, 2008 Caldwell, 2008 Goldstein, 2008 Davis, 2008 Williams, 2008 Wright, 2008 Lascaux & Klucas, 2008

				Hesse & Barr, 2009 Tucker, 2009 Jones & Fangmeier, 2009 Langan & Rehar, 2009 Tucker, 2010 Rodgers, 2010 Barr 2010 Jones & Vargas 2010, Alexandra & Vaughn, 2010 Schilz, 2011 Rayle, 2011 Jones, 2011 Watkins, Davis, & Courtright, 2011 Leonard, Greata, Ryden D., & Ryden E., 2011 Rawson, 2011 Howard, Moore, & Jacoby, 2011 Watkins, 2011 Peterson & Hesse, 2011 Hesse & West, 2011 Bowler, 2012 Steely, 2012 Rodgers, 2012 Langan & Solliday, 2012 Lindeman, Diehl, & Gilman, 2012 Hesse J., Ferland, &Hesse I., 2012 Hart & Barnes, 2012 Rawson, 2012 Melanie, Jones, & Stokes, 2012 Punzmann, 2012 Fahrni & Foster, 2012 Tinseth, 2013 Tucker & Hesse, 2013

				Tactikos, Jones, & Gregory, 2013 Graces, Natoli, & Huber, 2013 Lundin, Solliday, & Langan, 2013 Tactikos, 2013 Jones, 2014 Stevens, 2014 Rawson, 2014 Jessica, 2014 Bastin, 2014 Tactikos & Jones, 2014 Rucker, 2015 Hart, 2015 Lonardo & Vorsanger, 2015 Brodbeck, 2015 King & Prasciunas, 2015 Rucker, 2016 Klebacha, 2016 Stone, 2017 Schilling, 2018 Schilling, 2018 Chamorro, 2019 Brodbeck, Faer, Garnett, Mueller, & Thomas, 2021

13c. Historic Buildings/Districts/Neighborhoods.

1. Property Name or Address	2. Year	3. Eligibility Status
N/A		

14. CULTURAL CONTEXTS

14a. Prehistoric Culture: Hohokam

14b. Protohistoric Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14c. Indigenous Historic Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14d. Euro-American Culture: 1540s to present.

15. PERSONNEL

15a. Principal Investigator: Jonathan Damp Ph. D.

15b. Supervisor: Sarah Wolfram

15C. Date(s): February 4, 2025

16. COMMENTS:

Harris Environmental performed a literature review Class I cultural resource survey of the project area. Four previously recorded cultural resource sites were observed during the survey within the project area.

Background research revealed 31 previous surveys for cultural resources, and 9 previously recorded cultural sites within the project area and half-mile buffer, with 3 of these sites being in the project area.

Ground visibility within the APE ranges from 0-100% depending on disturbance. The landform has been altered substantially due to the construction of the surrounding urban area.

There is little potential for the inadvertent discovery of significant archaeological remains within the project area. If previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency. If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

SECTION 19. ATTACHMENTS
19a. Project Location Map: ☒
19b. Land Jurisdiction Map: ☒
19c. Background Research Map(s): ☒
19d. GLO Map(s): ☐
19e. References: ☒

SECTION 20. CONSULTANT CERTIFICATION

I certify the information provided herein has been reviewed for content and accuracy and all work meets applicable agency standards.

_____
Signature

President

_____
Title

SECTION 21. DISCOVERY CLAUSE

In the event that previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency.

If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

Appendix A: Project Area Maps

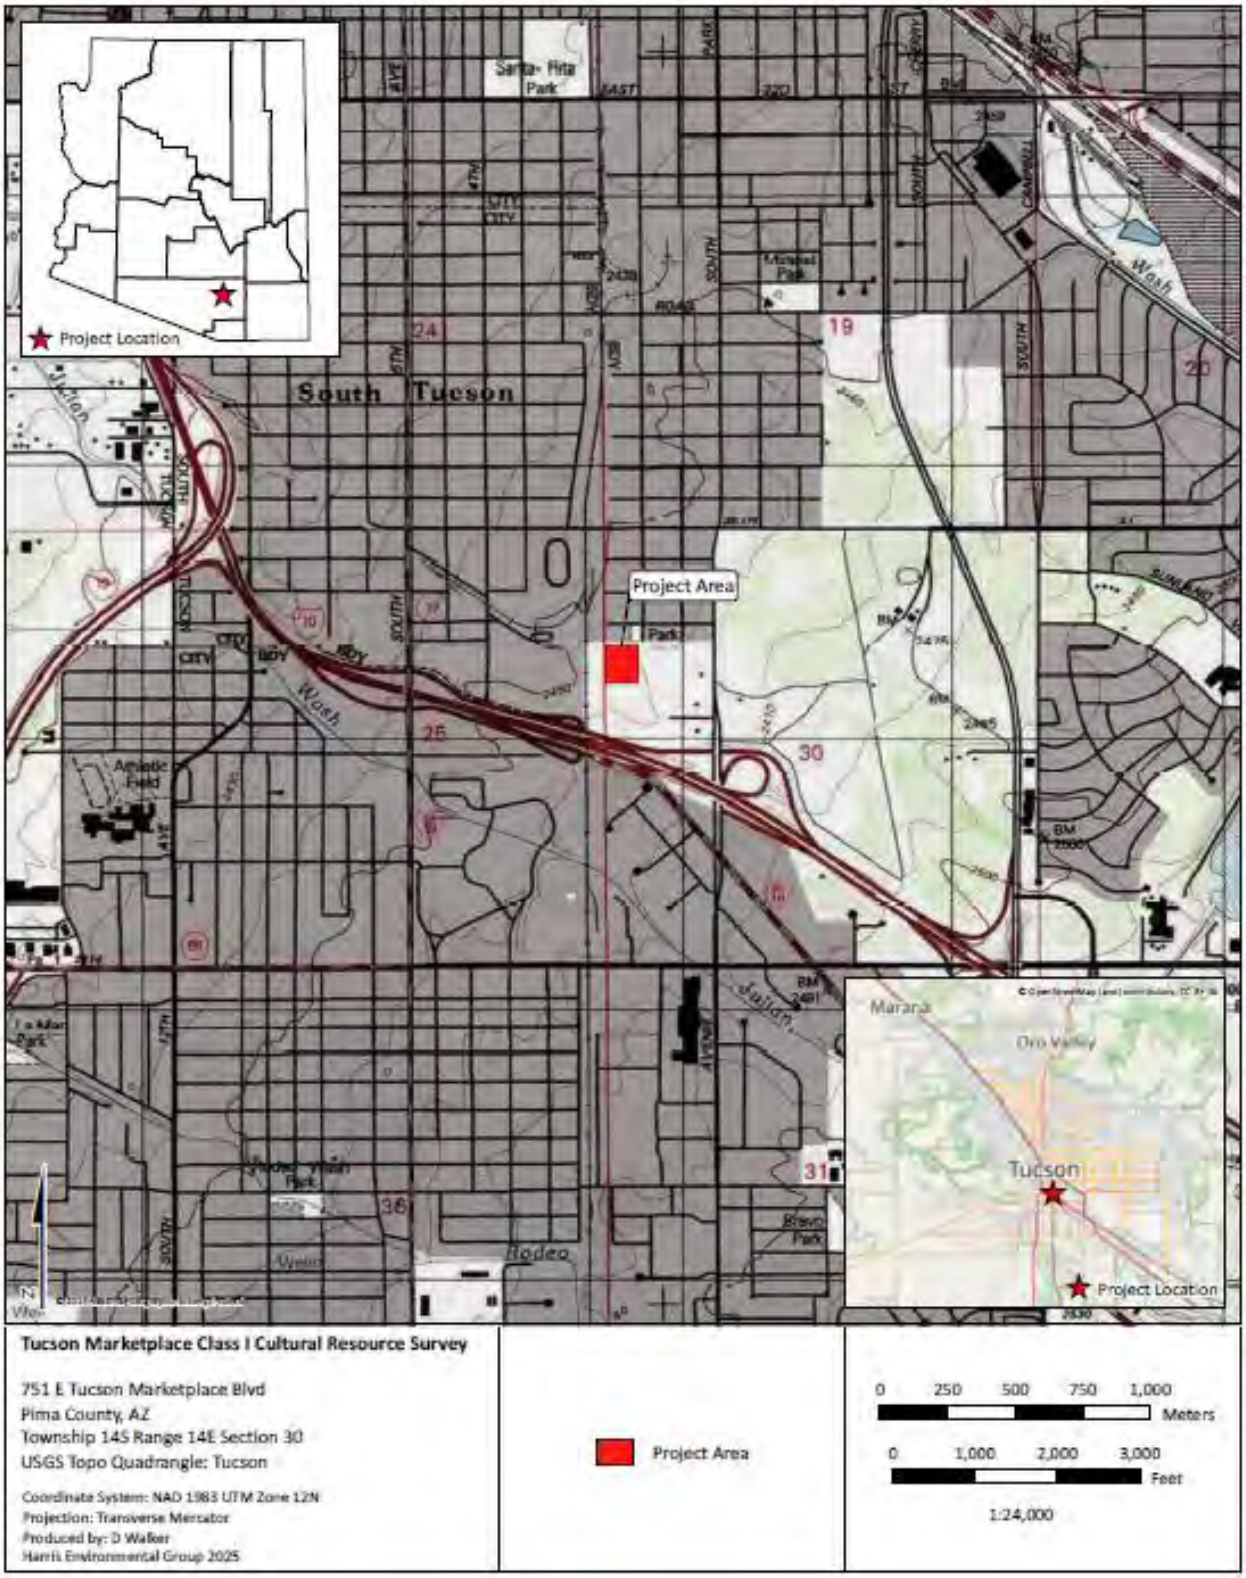

Figure 1. Project area map, topographic.

Figure 2. Project area map, aerial.

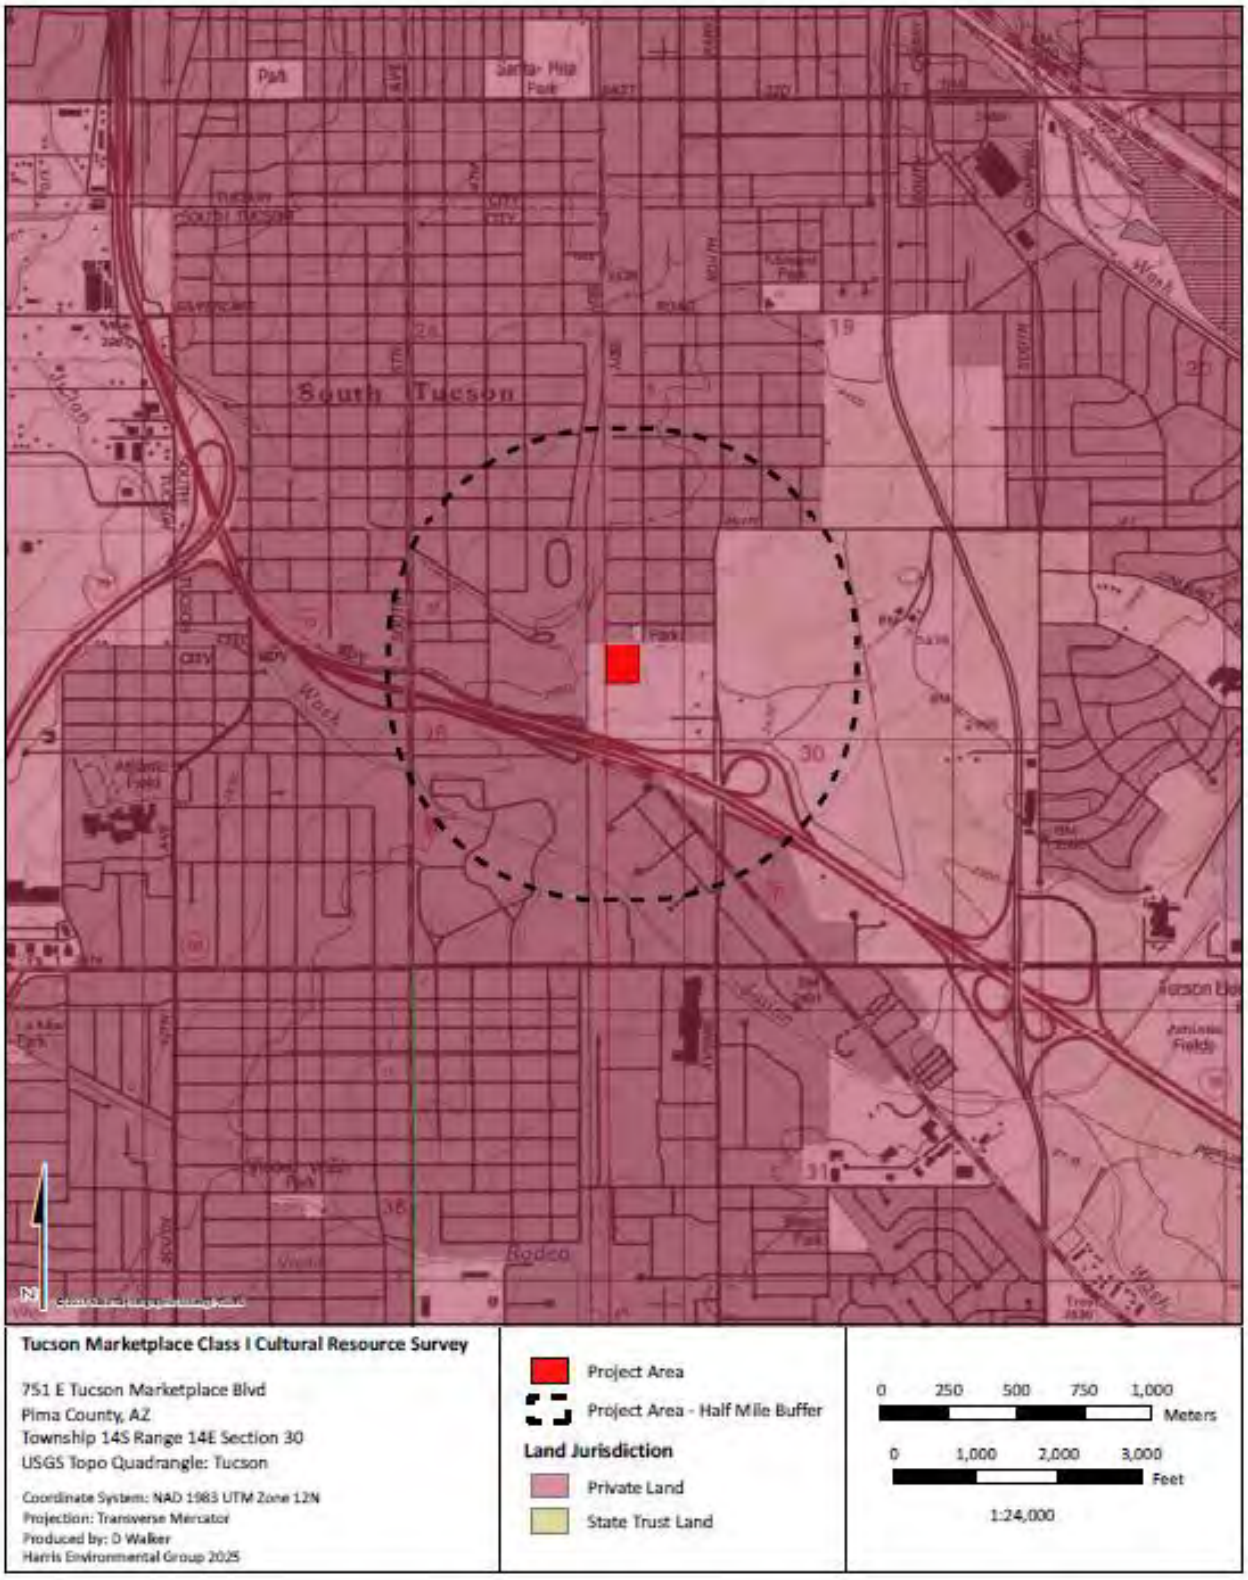

Figure 3. Project area map, land jurisdiction.

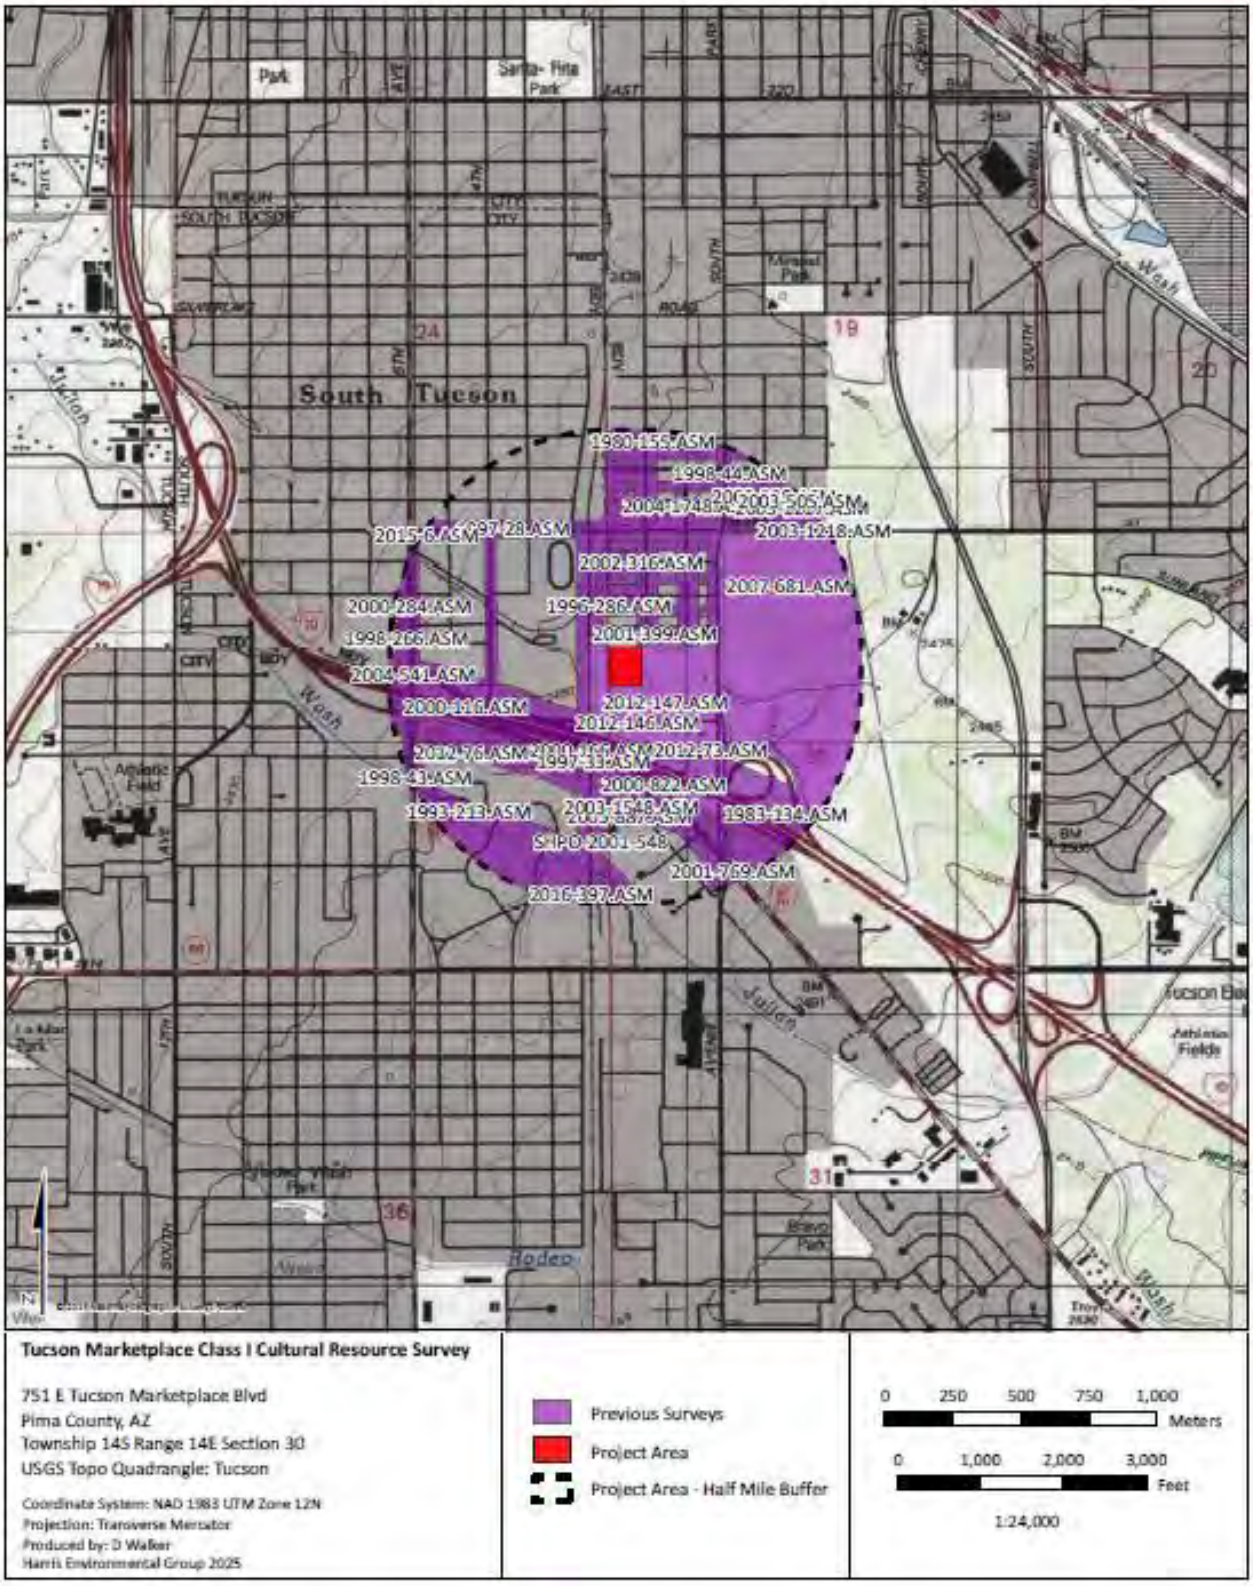

Figure 4. Project area map, previous cultural resource surveys.

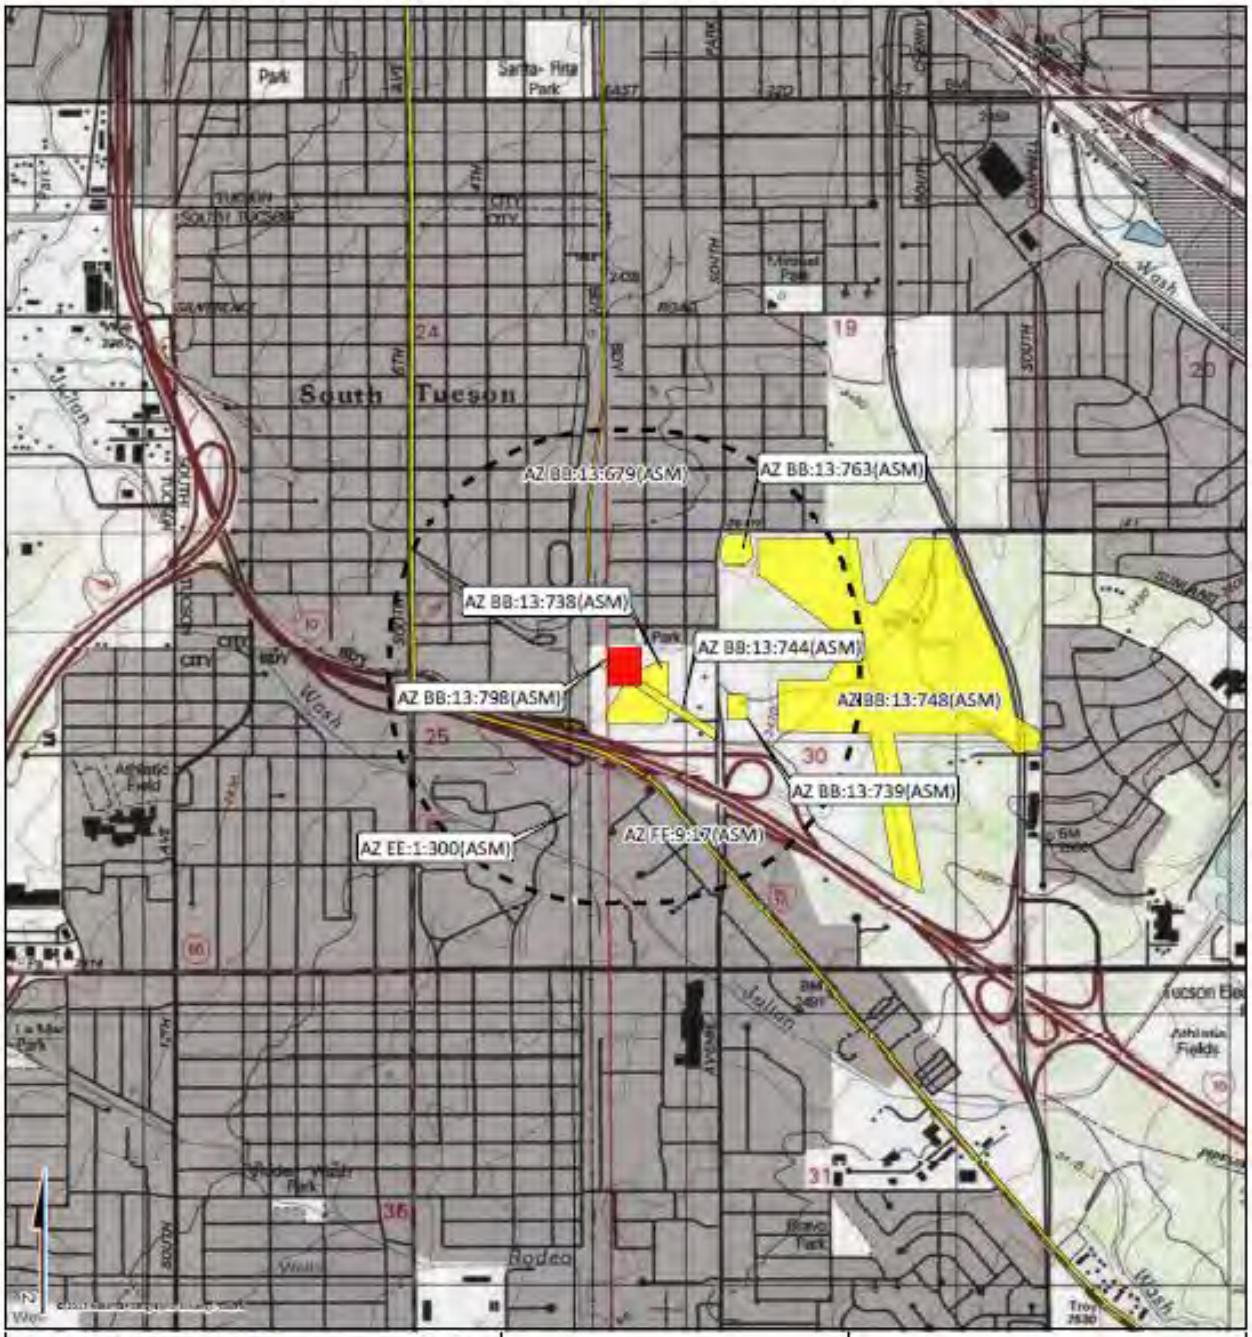

Figure 5. Project area map, previously recorded cultural resource sites.

References:

Allan, James M. et al.
2005 Cultural Resource Survey Report KMEP Line Section 53/54 SCC Digs Project Maricopa and Pinal Counties, Arizona. William Self Associates, Inc. Orinda, California.

Arizona State Historic Preservation Office (SHPO)
2016 Arizona Reporting Standards for Cultural Resources. Developed by the AZSHPO, the ASM, and the ASLD. Adopted by the Arizona State Parks Board in 2002, with minor edits, revisions, and updates in 2009; 2016.

Arizona State Historic Preservation Office (SHPO) and Salt River Pima-Maricopa Indian Community (SRP-MIC)
2024 *Government to Government Consultation Toolkit*. https://sites.google.com/view/az-consultation-toolkit/home.

Arizona State Museum (ASM)
1993 *Archaeological Site Recording Manual*. Arizona State Museum, University of

Arizona, Tucson.
1995 *Revised Site Definition Policy*. Arizona State Museum, University of Arizona, Tucson.

Arizona Geological Survey
2025 *Geologic Map of Arizona*. https://geomapaz.azgs.arizona.edu/. Accessed online January 30, 2025.

Barr, David M. R.
2006 A Cultural Resources Survey of a 3.5-mile-long Corridor as Part of the Bachmann Springs Electrical Routing Project, Cochise County, Arizona. Cultural Resources Report No. 06-39. SWCA Environmental Consultants, Tucson.

2010 Cultural resources inventory for 7210 north Oracle Road (parcel 225-51-2350), Pima County, Arizona. Report 2 of 2. Cultural Resource Report no. 10-347. SWCA Environmental Consultants, Tucson, Arizona.

Bastin, Kerri A.
2014 A class I literature review addendum report for the MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Buckles, Avi et al.

2012 A Cultural Resources Inventory of the Magma Arizona Railroad Right-of-way, Pinal County, Arizona. Westland Project No. 807.44 C 500. WestLand Resources, Inc, Tucson, Arizona.

Bowler, Maggie R.
2012 Cultural Resources Survey of 38.42 Acres Outside ADOT Right-of-way along State Route 77 between milepost 81.91 and 88.12, Oro Valley and Catalina, Pima and Pinal Counties, Arizona. Report no. AZG0907-030. AZTEC Engineering, Phoenix, Arizona.

Brodbeck, Mark.
2015 A Final Class III Survey of the W59 and E1 Alignments for the South Mountain Freeway, Maricopa County, Arizona. Cultural Resources Report 15-2. HDR, Inc., Phoenix, Arizona.

Brodbeck, Mark et al.
2006 A Class III Cultural Resources Survey of Proposed Corridors for the State Route (SR) 801 Freeway, SR 303L to SR 202L, Maricopa County, Arizona. Report 07-08. HDR Engineering, Inc., Phoenix, Arizona.

2021 Archaeological Monitoring and Data Recovery Excavations for the Tempe Streetcar Project, Tempe Maricopa County, Arizona. Report No. 21-13. HDR Engineering, Inc., Phoenix, Arizona.

Brown, David E. (editor)
1994 *Biotic Communities: Southwestern United States and Northwestern Mexico*. University of Utah Press, Salt Lake City.

Caldwell, Bryana.
2008 Determination of No Adverse Effect: Cactus Forest/State Route 79 Rehabilitation. SCIP Project No. R-048-050. Bureau of Indian Affairs: San Carlos Irrigation Project, Coolidge, Arizona.

Chamorro, Sebastian.
2019 Cultural Resources Inventory of 9.5 Linear Miles for a Portion of the Irvington to Sonoran to Vail Reconductor Project in Pima County, Arizona. Report 2019-34. WestLand Resources, Inc., Tucson, Arizona.

Champe, John L.
1936 The Sweetwater Culture Complex. Chapters in Nebraska Archaeology 1(3): 249-299. Lincoln: University of Nebraska.

Chapin-Pyritz, Regina L., and Matthew E. Hill
2002 A Cultural Resources Survey of the Proposed Hassayampa to Jojoba 500kV Transmission Line, Maricopa County, Arizona. Environmental Planning Group. Cultural Resource Services Technical Paper No.10. Tucson, Arizona.

Code of Federal Regulation
2010 National Archive and Records Administration. http://www.gpoaccess.gov/cfr/.

Compton-Gore et al.
2005 Cultural Resource Survey for the Mission View Wash Drainage Improvements Project in Tucson, Pima County, Arizona. URS Cultural Resource Report 2005-24(AZ). URS Corporation, Phoenix, Arizona.

2007 Cultural Resource Survey of Turner Road (Maricopa County Route 85 Extension to Hazen Road) and 24 intersections along Maricopa County Route 85 (75th Avenue to State Route 85), Maricopa County, Arizona. URS Cultural Resource Report 2007-46(AZ). URS Corporation, Phoenix, Arizona

Cook, Michael D.
2006 A Class III Cultural Resources Survey of 10.65 Acres Within ADOT Right-of-Way along State Route 79 for the Willow Springs Development. Cultural Resources Report 2005-67. Westland Resources, Inc., Tucson, Arizona.

Copperstone, Chance
2014 A class III cultural resources survey for the proposed installation of a telecommunications line along East Valencia Road for Cox Communications in Pima County, Arizona. Tierra Right of Way Services, Tucson, Arizona.

Courtright, J. Scott
2005 A cultural resources survey for 611.7 acres of proposed new right-of-way for the SR 85 and I-8 Interchange and the evaluation of eight previously recorded sites between SR 85 mileposts 120.24 and 123.00 and I-8 mileposts 117.40 and 119.25, Gila Bend, Maricopa County, Arizona. Logan Simpson Design, Inc. Technical Report No. 035051. Tempe, Arizona.

Dart, Allen
1989 *Prehistoric Irrigation in Arizona: A Component of the Arizona Historic Preservation Plan*. Center for Desert Archeology. Arizona State Historic Preservation Office.

Davis, Erin
2001 A Cultural Resource Survey of 18.60 Miles (605 Acres) along Interstate 10 between Mileposts 296.20 and 301.10, and between Mileposts 302.20 and 316.00, near the City of Benson, Safford Maintenance District, Cochise County, Arizona. Entranco Project Report 2001-012. Phoenix, Arizona.

2002 A Cultural Resource Survey of 22.06 Miles (660.08 Acres) along Interstate 8 between Mileposts 65.94 and 88.00, near the Towns of Dateland and Sentinel, Yuma Maintenance District, Yuma and Maricopa Counties, Arizona. Entranco Project Report No. 2001-046. Phoenix, Arizona.

Davis, Erin, and Kari Ogren
2002 A Cultural Resource Survey of 23.47 Miles (1,270.82 Acres) along Both Sides of Interstate 8 between Mileposts 3.00 and 19.00 and the Westbound Right-of-Way between Mileposts 19.00 and 20.40 in the Vicinity of Yuma, and Both Sides of Interstate 8 between Mileposts 29.00 and 34.80, near the Town of Wellton, ADOT Yuma Maintenance District, Yuma County, Arizona. Entranco Project Report 2001-045. Phoenix, Arizona.

Davis, Erin et al.
2002 A Cultural Resource Survey of 20.48 Moles (595.72 Acres) Along Interstate 8 Between Mileposts 106.07 and 119.40, and Mileposts 121.00 and 125.00, and Along Business Route 8 Between Mileposts 117.15 and 120.30 in the Vicinity of Gila Bend, Yuma Maintenance District, Maricopa County, Arizona. Entranco Project Report 2001-047. Phoenix, Arizona.

2008 A class III cultural resources survey of approximately 4,451 acres of Arizona State Trust Land for the proposed Lost Duchman Hights Project, Apache Junction, Pinal County, Arizona. Report No. 2007-018. Carter & Burgess, Inc., Phoenix.

Davis, Linda.
2008 Archaeological Monitoring for the 15th Avenue Sewer Main Replacement, Phoenix, Maricopa County, Arizona. Project Report No. 2006-030. Carter Burgess, Phoenix, Arizona.

Davis, Linda et al.
2006 A Class III Cultural Resources Survey of Approximately 8,875 Acres of Private Land Within the Proposed Paloma Ranch Development West of Gila Bend, Maricopa County, Arizona. Report No. 2006-011, Carter & Burgess, Inc., Phoenix.

2006 A cultural resources survey of 15 traffic interchanges totaling approximately 97.3 acres along Interstate 10, between mileposts 268 and 350, between Tucson and Willcox, Pima and Cochise Counties, Arizona. Report No. Project Report (Carter & Burgess); no. 2006-021. Carter & Burgess: Phoenix, Arizona.

DeJongh, Jennifer and Allen Dart.

2005 Cultural Resources Survey of 15.0 acres for Proposed School District Transportation Facility Southeast of the Intersection of Avra Valley Road and Interstate 10 in Marana, Arizona. Letter Report No. 20042005.023. Old Pueblo Archaeology Center. Tucson, Arizona.

Diehl, Allison Cohen.
2002 Cultural Resources Survey for the Proposed South Park Back to Basics Project, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 02-160. Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

2016 Cultural Resources Survey on Oracle Road (State Route 77) near Los Lomitas Road, Pima County, Arizona. DAI Project Report 16-104. Desert Archaeology, Inc., Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

Doak, David P.

2003 A Cultural Resource Survey of a 7.5-Mile-Long Stretch of Deep Well Ranch Road, South of Florence, Pinal County, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2002-100A. Tucson, Arizona.

2006 The Sinclair Property Survey: A Class III Cultural Resource Survey of a 32-acre Parcel in Tucson, Arizona, the Former Site of the Fiesta Drive-In Theater. Report no. 2004-93. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2007 A Class III Cultural Resources Survey of Two Parcels Constituting Part of the Sinclair Property, Tucson, Arizona. Report no. 2007-1. Tierra Right of Way Services, Tucson, Arizona.

2007 A class III cultural resource survey of a 2.10-acre parcel at the junction of Ajo Way and Interstate 10, in Tucson, Pima County, Arizona. Tierra Archaeological Report No. 2007-131. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2008 A class III cultural resource survey/assessment of a 6-mile-long communications line corridor running along Arizona Highway 80, near Tombstone, Cochise County, Arizona. Report No. 2008-58. Tierra Right of Way Services, Tucson, Arizona.

2010 A Class III Cultural Resource Survey of a 6.25-Mile-Long Corridor in the Eastern Tucson Basin: the TEP Cienega Power Line Maintenance Corridor Survey. Archaeological Report No. 2009-76. Tierra Right of Way Services, Ltd.: A Land Services Company, Tucson, Arizona.

Ekstrom, Saskia M.
2006 A cultural resource survey of 26 temporary construction easement parcels along Interstate 8 between mileposts 29.18 to 36.86, near the town of Wellton, Yuma County, Arizona. Carter & Burgess: Phoenix, Arizona.

Estes, Allen et al.
2005 Final data recovery and monitoring report, KMEP Tucson pipeline replacement project, phases III and IV, Pima County, Arizona. William Self Associates, Orinda, California.

Fahrni, Grant
2005 A class III cultural resources survey of approximately five acres near the intersection of East Hardy Road and North Oracle Road, Oro Valley, Pima County, Arizona. Harris Environmental Group, Tucson, Arizona.

Fahrni, Grant and Foster Michael S.
2012 A cultural resources survey of two alternatives for the extension of SR 195 from I-8 to US 95: the South Avenue 3E and Araby Road Alignments, Yuma County, Arizona. Logan Simpson Design, Tempe, Arizona.

Florie, Paige and Glennda Luhnow.
2007 Cultural Resources Survey of State Route 80 between Mileposts 295.00 and 295.50 for the United Civil Group Turn Lanes Project, Benson, Cochise County, Arizona. ACS Internal Report No. 07-206-02. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Florie, Paige B. et al.
2009 A Cultural Resource Survey and Inventory for the Gila to Wellton-Mohawk 161-kV Transmission Line, Yuma County, Arizona: Background, Fieldwork Results, and Eligibility and Management Recommendations. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Goldstein, Beau J.
2007 Class III Cultural Resources Survey Report Vail Area 138kV System Project, Pima County, Arizona. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 1 of 2. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 2 of 2. Transcon Environmental, Inc., Mesa, Arizona.

Goldstein, Beau J., and Everett Bassett.
2006 Cultural III resources survey report, Ajo to Gila Bend Telecommunications Project, Pima and Maricopa Counties, Arizona. Transcon Environmental, Mesa, Arizona.

Gordon, Carl J.
2006 Cultural resources survey of Arizona Public Service Company right-of-way on Mule Mountain near Bisbee, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Graves, William M. et al.
2013 A Class I Overview and Class III Cultural Resource Inventory of the Proposed San Luis Rio Colorado Project Transmission Line Corridor, Yuma County, Arizona. Report no. 07-11. Statistical Research, Inc., Tucson, Arizona.

Griffith, G.E., Omernik, J.M., Johnson, C.B., and Turner, D.S.,
2014 Ecoregions of Arizona (poster): U.S. Geological Survey Open-File Report 2014-1141, with map, scale 1:1,325,000, http://dx.doi.org/10.3133/ofr20141141.

Hart, David R.

2015 Addendum Report: cultural resources survey of proposed integrated fixed towers and remote video surveillance systems on Arizona State Trust Land in support of right of way application no 14-116685, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Hart, David R., and Dean A. Barnes.
2012 Revised Final: cultural resources survey in support of integrated fixed towers in Douglas Station's area of responsibility, US Border Patrol, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Heilman, Jill.
2013 Cultural Resource Survey in Support of Improvements along Old Vail Connection Road and Nogales Highway within Unincorporated Pima County, Arizona. Report no. 13-442. EcoPlan Associates, Inc., Tucson, Arizona.

Hesse, India S.
2005 RE: TRICO Willow Springs Oracle Substation to Proposed Saddlebrook Ranch Substation Reroute Survey: An Addendum to a Cultural Resources Survey of the Proposed 69kV Transmission Line Between the Oracle Substation and the Proposed Willow Springs Substation, Pinal County, Arizona (TRICO W.O. No. 33808). SWCA Environmental Consultants, Tucson.

Hesse, S. Jerome.
2010 Cultural resources survey for the Palo Parado Road- Road, Bridge, Rail Improvements Project, Santa Cruz, Arizona. Resources Report No. 10-102. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and David M. R. Barr.
2009 Historic Properties Inventory for the EPNG Line No. 1007 MAOP Uprate project, Tucson Metropolitan Area, Pima County, Arizona. Cultural Resources Report No. 08-497. SWCA Environmental Consultants, Tucson, Arizona

Hesse, S. Jerome, and Heather West.
2011 Valencia Road improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona. Report 1 of 2. Report No. 10-404. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and India S. Hesse.

2014 Archaeological survey of a 7.0-mile-long water pipeline corridor for the proposed Sahuarita supply line slip liner project in Pima County, Arizona (City of Tucson Project 14-09). SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome et al.
2009 Historic Properties Inventory for the EPNG line 1007 Make-Piggable Project Between EPNG Mileposts 89 and 99 in Metropolitan Tucson, Pima County, Arizona. Cultural Resources Report No. 08-547. SWCA Environmental Consultants, Tucson, Arizona.

2012. Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona: supplemental survey of road crossings. SWCA Cultural Resources Report No. 12-140. SWCA Environmental Consultants, Tucson, Arizona.

Historic Aerials
2025 https://www.historicaerials.com/viewer

Howard, Alexandra, and Catherine S. Vaughn.
2010 Class III Cultural Resources Survey Oracle Junction Substation to Catalina to Oracle 12.5kV Power Lines Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howard, Alexandra et al.
2011 Customer service project and trouble reports Pima and Pinal Counties, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howell, Joseph.
2011 A class III cultural resource survey of a proposed high-pressure natural gas line reinforcement route in Green Valley, Pima County, Arizona. Report No. 2011-174. Tierra Right of Way Services, Tucson, Arizona.

Huebchen, Karl R. et al.
2008 A Cultural Resource Overview and Survey for the SR 303 Loop, SR 801/MC 85 to I-10, Maricopa County, Arizona. Environmental Planning Group Report Number STP-303-A(ASO). EcoPlan Associates, Inc.

Inter-Tribal Council of Arizona.
2011 Salt River Pima-Maricopa Indian Community. https://itcaonline.com/member-tribes/salt-river-pima-maricopa-indian-community/ Accessed electronically March 8, 2024.

Jerla, Christine A. and Anna King.
2014 A cultural resources inventory of 783.3 acres for the SWTC Bicknell to Vail transmission line upgrade, Pima County, Arizona. WestLand Resources, Tucson, Arizona.

Jolly, Donald W. and Kristin L. Fangmeier
2004 Cultural Resources Survey of Red Mountain Freeway Right-of-Way Between University Drive and Southern Avenue, Mesa, Maricopa County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-029-02. Tempe, Arizona.

Jones, Jeffrey T.
2010 A Class III Cultural Resource Survey of 5.83 Km (3.62 Miles) of 20-M-Wide (66-Foot-Wide) Areas of Potential Effect Proposed for the Construction of Two Segments of the Arizona Trail within and Near Cienega Creek Natural Preserve in Pima County, Arizona. Tierra Archaeological Report Number 2010-166, Tierra Right of Way Services, Ltd., Tucson, Arizona.

2012 A class III cultural resource survey of a portion of The Loop, a pedestrian and non-motorized vehicle trail, in Tucson and Pima County, Arizona. EcoPlan Associates, Inc., Mesa, Arizona.

Jones, Jeffrey T. et al.
2009 Archaeological data recovery investigations at AZ BB:13:742(ASM), AZ BB:13:748(ASM), and AZ BB:13:763(ASM) in Tucson, Arizona. Report No. 2007-146. Tierra Right of Way Services, Tucson, Arizona.

Jones, Thomas E.
2004 Cultural Resources Survey for Arizona Public Service Company's McVay 69kV Transmission Line Right-of-Way Renewal, La Paz County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-056-02. Tempe, Arizona.

2008 Cultural Resource Survey of a 350-Acres Parcel for the Proposed Painted Rock Grain Handling Facility West of Gila Bend, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2011 Documentation of Old US 80 and Associated Features at Gillespie Dam Bridge, South of Arlington, Maricopa County, Arizona for documentation of its Information Potential Associated with the Historic State Highway System. Report no. 11-120-csur. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2014 A class III cultural resource survey of State Route 79 between mileposts 144.4 and 145.1 for the Silver Bar Mine regional landfill access road project, North of Florence, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas, and Kristin L. Fangmeier.

2009 A class I cultural resource literature review and class III pedestrian survey for a Crown Castle International Wireless telecommunications facility (Site #1123-3285) near State Route 79 and Deep Well Ranch Road southeast of Florence, Pinal County, Arizona. Archaeological Consulting Services, Ltd., Tempe.

Jones, Thomas E., and Victoria D. Vargas.
2010 Archaeological monitoring at Old US Highway 80 (AZ FF:9:17[ASM]) for Maricopa County Department of Transportation (MCDOT) Maricopa Highway 85 and Baseline Road Intersection Improvements Project, Buckeye, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas E. et al.
2006 CULTURAL RESOURCES SURVEY AND HISTORICAL CONTEXT OF THE GILLESPIE DAM BRIDGE POTENTIAL IMPACT AREA, MARICOPA COUNTY DEPARTMENT OF TRANSPORTATION, MARICOPA COUNTY, ARIZONA. Manuscript on file, Archaeological Consulting Services, Tempe.

King, Anna Martin, and Mary M Prasciunas.
2015 A Cultural Resources Inventory Of 22.4 Acres for The Southeast Interceptor Sewer Augmentation Project in The Cities of Tucson and South Tucson, Pima County, Arizona. Cultural Resources Report 2015-10. Westland Resources, Tucson, Arizona.

Klebacha, Caroline.
2016 Cultural Resource Survey, Glance Creek Bridge, ADOT Structure #237, Cochise County, Arizona. Technical Report No. 13-467016. EcoPlan Associates, Inc., Mesa, Arizona.

Klune, Ingrid and David P. Doak
2005 A class III cultural resources survey of 2.5 linear miles of Arizona Department of Transportation Right of-Way alongside portions of Interstate 10 and State Highways 80 and 90 near Benson, Cochise County, Arizona. Tierra Archaeological Report No. 2005-28. Tierra Right of Way Services, Tucson, Arizona.

Klune, Ingrid and James Moses
2003 A Cultural Resources Assessment Survey of Approximately 2530 Linear Feet along State Highway 77 and Edwin Road, Pima and Pinal Counties, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2003-54. Tucson, Arizona.

Knoblock, Keith
2001 A Cultural Resource Survey for a Proposed Fiber Optic Corridor Spanning Southeastern Arizona in Pima, Santa Cruz, and Cochise Counties. Lone Mountain Report No. 421/423. Lone Mountain Archaeological Services, Inc., Tucson, Arizona.

Langan, John S. and Courtney C. Rehar.
2009 Cultural Resources Survey of 1.0 Mile of ADOT Right-of-way along State Route 77, Between Mileposts 88.0 and 89.0, near Catalina, Pinal County, Arizona. Report No. AZG0907-008, AZTEC Engineering, Phoenix, Arizona.

Langan, John S. and Scott Solliday.
2012 Cultural Resource Survey for Widening and Improvement of Maricopa County Route 85 in Avondale, Phoenix, and Tollston, Maricopa County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Larsen, David N.
2009 A Cultural Resources Survey Report of Four Pavement Preservation Projects, Town of Buckeye, Maricopa County, Arizona. AMEC Internal Report No. 04009005, AMEC Earth & Environmental, Inc., Tempe, Arizona.

Lascaux, Annick and Eric Klucas.
2008 A cultural resources inventory of the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #1 plant substation 34.5-KV and Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #3 pumping plant substation 34.5-KV transmission lines, and the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk pumping plant #2 4.16-KV distribution line rebuild project, Yuma County, Arizona. Tierra Archaeological Report 2007-16. Tierra Right of Way Services, Ltd., Tucson, Arizona.

Leonard, Kathryn et al.
2011 Historic streetscape assessment report for a roadway transportation enhancement project on SR 80, Fremont Street in the Schieffelin Historic District, Tombstone, Cochise County, Arizona. Logan Simpson Design, Tempe, Arizona.

Lindeman, Michael W. et al. 2012 A Plan for Monitoring, Discovery, and Limited Data Recovery within City of Tucson right-of-way in Eleven Archaeological Sensitivity Zones in the City of Tucson. Report No. 2011-06. Desert Archaeology, Inc., Tucson, Arizona.

Lindly, John M.
2004 An Archaeological Survey of the Proposed Loop 303 Expressway (Cotton Lane) South of Interstate 10 to the Gila River in Southwest Maricopa County, Arizona. SWCA Environmental Consultants. SWCA Cultural Resources Report No. 04-248. Phoenix, Arizona.

Lonardo, Cara, and Andrew Vorsanger.
2015 A Class III Cultural Resources Survey for the Western Area Power Administration Levee-Salinity Power Systems Project, Yuma County, Arizona. EPG Cultural Resource Services Technical Paper No. 2015-22. Environmental Planning Group, LLC, Phoenix, Arizona.

Luchetta, Sarah, and Chester Shaw.
2007 A class III cultural resources survey of approximately 2.3 miles along Sahuarita Road between La Villita Road and County Club Road in Sahuarita and Unincorporated Pima County, Arizona. HEG project 06-190. Harris Environmental Group, Inc., Tucson, Arizona.

Lundin, Deil R. et al.
2013 A cultural resources survey for the Chino Road extension project in Douglas, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

McDermott, Matt
2002 A Cultural Resource Survey of 15.5-Miles of ADOT Right-of-Way Along State Route 80, Between Silver Creek and Bernardino, Northeast of Douglas, Cochise County, Arizona. EcoPlan Associates, Inc. EcoPlan Associates, Inc. Report #00-469:44. Mesa, Arizona.

Morgan, Rieder et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-08. Williams Self Associates, Inc., Tucson, Arizona.

Moses, James J.
2004 A Class III Cultural Resources Survey of Approximately 480 Acres West of State Route 79 south of Bogard Wash, 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Report no. 2003-48. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and David P. Doak
2003 A Class III Cultural Resources Survey of a Proposed Temporary Access Road for a Materials Source Pit West of State Route 79 and 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Arizona State Land Department Right of Entry Permit Reference No. 29.109254. Report no. 2003-56. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and Barbara Montgomery
2004 A Cultural Resources Assessment of a Cellular Tower Site located at 7900 East Main Street in Mesa, Maricopa County, Arizona. Tierra Archaeological Report No. 2004-72. Tierra Right of Way Services, Tucson, Arizona.

Newsome, Daniel K.
2007 Cultural resources inventory of 4.57 miles for a 69/12kV transmission line rebuild across Arizona State Trust Land near Arlington, Maricopa County, Arizona. Report (EnviroSystems Management (Flagstaff, Ariz.)); no. 1259-06. EnviroSystems Management: Flagstaff, Arizona.

National Resources and Conservation Service (NRCS)

2024 Web Soil Survey. Natural Resources and Conservation Service, US Department of Agriculture. Electronic document, http://websoilsurvey.nrcs.usda.gov/app/WebSoilSurvey.aspx.

Petersen, Eric S.
2004 A cultural resources survey for a proposed 69-kV Transmission line between the Oracle Substation and the proposed Willow Springs Substation near Oracle Junction, Pinal County, Arizona. Project Report No. 8886-067. SWCA Environmental Consultants. Tucson, Arizona.

Petersen, Eric S., and S. Jerome Hesse.
2011 Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona. SWCA Cultural Resource Report No. 11-369. SWCA Environmental Consultants, Tucson, Arizona.

Peters, Matthew D.
2013 Class III cultural resources survey report: ‡b Vail to Valencia 115kV to 138kV transmission line upgrade project, private lands, and previously authorized right-of-way south of Kantor substation, Santa Cruz County, Arizona. Transcon Environmental, Mesa, Arizona.

Punzmann, Walter R.
2012 A Class III Cultural Resource Survey of Four Proposed Bus Pullouts Along State Route 77/Oracle Road, Tucson, Pima County, Arizona. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2006 Trico Willow Springs 69-kV line reroute survey: an addendum to a cultural resources survey of the proposed 69-kV transmission line between the Oracle Substation and the proposed Willow Springs Substation, Pinal County, Arizona. SWCA Environmental Consultants: Tucson, Arizona

Rawson, Paul M.
2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2015 Cultural resources survey for the Elephant Head Road Bridge Superstructure Replacement Project, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rawson, Paul M. et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion: Addendum, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-12. William Self Associates, Inc., Tucson, Arizona.

Rayle, Greta J.
2011 A class III cultural resources survey and a reconnaissance-level architectural survey along State Route 80, Patton Street between Miller Lane and milepost 300.64, St. David, Cochise County, Arizona. Report No. 095451. Logan Simpson Design, Inc., Tempe, Arizona.

Rawson, Paul M.
2011 A cultural resource survey of the Ina and Oracle Road intersection improvements project, Pima County, Arizona. Report 1 of 2. Cultural Resources Report no. 11-407. SWCA Environmental Consultants, Tucson, Arizona.

2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2014 Archaeological records search and pedestrian survey for the City of Tucson 14-03 ADA sidewalk improvements project, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rodgers, James B.
2010 An archaeological inventory of the Loop 303 Outfall Project Area in Goodyear and West-Central Maricopa County, Arizona. Contract Archaeology Series 10-1, Scientific Archeological Services, Phoenix, Arizona.

Rogge et al.
2002 Cultural Resource Survey for the Phase 3 PM-10 Roads Project Number 16214, Maricopa County, Arizona. URS Cultural Resource Report 2002-36(AZ). URS Corporation, Phoenix, Arizona.

Rossi, Erica, and Daniel Garcia
2005 A Cultural Resource Survey of State Route 280 (Ave 3E) from Interstate 8 to Business 8, Yuma, Yuma County, Arizona. EcoPlan Cultural Resource Survey Report No. 04-712:09. Mesa, Arizona.

Ruble, Ellen C.
2004 Cultural resources monitoring results for the Kinder Morgan gasoline pipeline within the Arizona Department of Transportation right-of-way, Pima County, Arizona. Project report no. 03-193. Desert Archaeology, Inc., Tucson, Arizona.

Rucker, Daniel.
2015 Class III cultural resources survey: Cross Hill Quarry, Pima County, Arizona. Transcon Environmental, Mesa, Arizona.

2016 Class III Cultural Resources Survey: Cross Hill Quarry Access Road, Pima County, Arizona. Transcon Report No. M06-22. Transcon Environmental, Inc., Mesa, Arizona.

Ryan, E. Melanie et al.
2012 Final Report of Class III Cultural Resource Survey for the SCIDD-Florence Canal, Phase I: Station 45+00 to 1224+00, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Schilz, Allan J.
2011 Tracks Through Time: Urban Archaeology Along the METRO Light Rail Corridor. Report no. 147. Archaeological Consulting Services, Tempe, Arizona.

Schroeder, K.J.
2005 A class III (intensive field inventory) cultural resources survey of approximately five miles of waterline right-of-way on state trust land along Baseline Road, Apache Junction, Pinal County, Arizona. Archaeological Research Services, Inc.

Shepard, Kristopher S., and Korri Dee Turner
2002 A Cultural Resource Survey of 27.63 Miles (226.96 Acres) along Five Segments of State Route 80 between Mileposts 295.62 and 383.00, and along a 1.90-Mile-Long Segment (2.30 Acres) of Business State Route 80 between Mileposts 366.20 and 368.10, within Cochise County, Arizona. Entranco Project Report 2001-026. Phoenix, Arizona.

Schilling, Linda M.
2013 Class III cultural resource survey of 35.8 acres for the I-8 South Frontage Road, Avenue 8.5E to Fortuna Road project, Yuma County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2018 A Class III Cultural Resources Survey for Drainage Improvements at Rainbow Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-002. Jacobs Engineering Group, Inc., Phoenix, Arizona.

2018 A Class III Cultural Resource Survey for Drainage Improvements at Butterfield Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-003. Jacobs Engineering Group, Inc., Phoenix, Arizona.

Shilling, Linda M., and Kristin L. Fangmeier.
2006 Cultural Resources Survey for the AZTech SMART Corridors Phase 3 Project, Maricopa County, Arizona. ACS Project No. 05-110-02. Archaeological Consulting Services, Ltd. Tempe, Arizona.

SHPO A Cultural Resources Inventory for a Proposed Telecommunications Site (PH30822C) at Solomon Industrial Park Lot 3 in Tucson, Arizona

Slawson, Laurie V.

1993 A Class III Archaeological Survey for the Julian and Rodeo Wash Linear Parks in Tucson, Arizona. Tucson, Arizona: Cultural & Environmental Systems, Inc.

Smith, Alexa M. et al.
2012 A Cultural Resources Inventory for a Portion of The Loop Between South Park and South 6th Avenues, Tucson, Arizona. Report no. 2012-06. William Self Associates, Inc., Tucson, Arizona.

Smith, Matthew B., and Charles W. Wheeler.
2001 An Archaeological Survey of the Proposed South of Tucson Reroute Addendum 5 to An Archaeological Survey of the Arizona Portion of Link Two of the AT&T NexGen/Core Project. Western Cultural Resource Management, Inc Report No. WCRM(F)228. Farmington, New Mexico.

Stahman, Andrea R.
2006 Cultural Resources Survey of 26 Linear Miles Along County Road 85/Buckeye Road between 75th Avenue and Turner Road, Maricopa County, Arizona. Report no. 06-12. Northland Research, Tempe, Arizona.

Steely, James Wright et al.
2012 Cultural Resources Evaluation of the Tucson Downtown Links Project, Tucson, Arizona. Report no. 12-232. SWCA Environmental Consultants, Tucson, Arizona.

Stephen, David V.M.
2004 Cultural resources survey of the Landin Park Access Project near Tombstone, Cochise County, Arizona. P.A.S.T. Cultural Resources Report No. 041620. Professional Archaeological Services of Tucson, Tucson, Arizona

Stevens, Michelle.
2014 Prehistoric and historic land use in Cienega Valley, southeastern Arizona: results of the Cienega Valley Survey Project. Project Report No. 2013-104. Desert Archaeology, Inc., Tucson, Arizona.

Stone, Bradford W.
2017 A Cultural Resources Inventory for the old Nogales Interceptor/Aerospace Corridor/Park Avenue Sewer Project, Pima County, Arizona. Cultural Resources Report 2016-50. Westland Resources, Tucson, Arizona.

2017 A Cultural Resources Inventory for the Proposed Benson Highway at Drexel Road Intersection Improvements Project. Cultural Resources Report 2017-0240. Westland Resources Inc., Tucson, Arizona.

Strohmayer, Jodi et al
2005 A Cultural Resource Survey and the Final Results of a Feasibility Study for the Relocation of the Marsh Station Traffic Interchange along I-10, Pima County, Arizona. EcoPlan Cultural Resource Report No. 00-469:115. EcoPlan Associates, Inc., Mesa, Arizona.

Tactikos, Joanne C.
2013 A class III cultural resource survey for a proposed improvements to the Avondale Boulevard and MC 85 intersection in Avondale, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Tactikos, Joanne C. and Thomas Jones.
2014 A class III cultural resource survey for the proposed improvements to MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Tactikos, Joanne C. et al.
2013 Addendum report to the class III survey along reaches 1 and 2 of the San Carlos Irrigation Project rehabilitation. ACS Project No. 13-107. Archaeology Consulting Services, Tempe, Arizona.

Terhune, Claire E.
2004 A Cultural Resources Survey for a Pavement Preservation and Culvert Extension Project on State Route 80, St. David, Cochise County, Arizona. EcoPlan Associates, Inc. Cultural Resources Report 02-599, Task 5. Mesa, Arizona.

Tinseth, George.
2013 A cultural resources inventory of approximately 5.6 acres for a Tucson Electronic Power Company distribution line installation along Oracle Road, Pima County, Arizona. Report no. 2013-39. Westland Resources, Inc., Tucson, Arizona.

Touchin, Jewel.

2004 A Cultural Resources Survey of a Proposed New Right-of-Way and Temporary Construction Easement at the Sixth Avenue and Westbound Frontage Road Intersection in South Tucson, Pima County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-29. Phoenix, Arizona.

Touchin, Jewel et al.

2002 A cultural resources survey of State Route 79, from milepost 135.00 to milepost 150.28, Florence to Florence Junction, Pinal County, Arizona. HDR Engineering, Inc. Cultural Resources Report 02-14. Phoenix, Arizona.

Touchin, Jewel and Mark Brodbeck
2002 A Cultural Resources Survey of State Route 80, from Milepost 302.0 to Milepost 309.0, South of St. David, Cochise County, Arizona. Cultural Resource Report 01-12. HDR Engineering, Inc., Phoenix, Arizona.

2003 A Cultural Resources Survey of State Route 80, between Mileposts 356.3 and 357.0, Between Bisbee and Douglas, Cochise County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-14. Phoenix, Arizona.

Tucker, David B.
2000 Report 3 of 4 The El Paso to Los Angeles Fiber Optic Cable Project: A Cultural Resources Survey of the Arizona Segment of a Linear Right-of-Way Across Cochise, Pima, Pinal, Maricopa, and La Paz Counties, Arizona. SWCA, Inc., Tucson, AZ.

2009 Archaeological Records Search and Survey for Amphi Neighborhood Light Project, Phase 2, Navajo Road, Oracle Road to Stone Avenue, Tucson, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

2009 An archaeological survey for the TRICO circuit 76 rebuild project, Pima County, Arizona: TRICO work order No. 40543. Cultural Resources Report No. 08-483. SWCA Environmental Consultants, Tucson, Arizona.

2010 Archaeological Records Search and Survey for Grant Road and Oracle Road Intersection Improvements, Tucson, Arizona, and Building Assessments for 225 and 201 West Grant Road. SWCA, Environmental Consultants, Tucson, Arizona.

Tucker, David B., and India S. Hesse.
2013 A cultural resources survey for the five points combined transportation enhancement and pedestrian improvements, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Twilling, Shannon D.
2006 A class III cultural resources survey of 2.75 acres along Nogales Highway at Franco Wash in Pima County, Arizona. Harris Environmental Group: Tucson, Arizona.

2007 A Class III Cultural Resources Investigation of 704 Acres at the Tucson International Airport in Support of Proposed Runway 11R/29L Relocation. Project no. 05-052. Harris Environmental Group, Inc., Tucson, Arizona.

Twilling, Shannon et al.
2004 A Cultural Resources Survey and Treatment Plan in Support of a Proposed Perimeter Fence Line Installation Around the Florence Military Reservation Perimeter, Pinal County, Arizona. Harris Environmental Group. Harris Project No. 04-106. Tucson, Arizona.

Vance, Meghann M.
2008 Class III Cultural Resources Survey: Oracle to Oracle Junction Transmission Line, Pinal County, Arizona.

Vanderpot, Rein et al.
2005 Archaeological Investigations for the Transfer of Title to Facilities, Works, and Lands of Gila Project, Wellton-Mohawk Division, to the Wellton-Mohawk Irrigation and Drainage District, Yuma County, Arizona. Report 04-64. Statistical Research, Inc., Tucson, Arizona.

Vaughn, Catherine S.
2009 Distribution line along State Route 79 milepost 106 to Iron Valley, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

2009 Distribution line from Oracle Junction to milepost 103.5 along State Route 79, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Watkins, Christopher N.
2011 A cultural resources survey on State and Federal lands of 8.20 miles (49.69 acres) of the SE-12 (Mural-Fairview) 69-kV and 2.04 miles (12.36 acres) of the SE-13 (McNeal-San Pedro) 69kV-transmission lines in Cochise County, Arizona. Logan Simpson Design, Temple, Arizona.

Watkins, Christopher N. et al.
2011 A cultural resources survey on Federal and State land of 58.06 miles (351.87 acres) of the Arizona Public Service M-108 (Bunyan-Aztec) 69-kV transmission line, 2.92 miles (17.69 acres) of the M-110 (Gila Bend-Bunyan) 69-kV transmission line, and 20.76 miles (125.81 acres) of the M-111 (Gillespie-Gila Bend) 69-kV transmission line in Maricopa and Yuma Counties, Arizona. Logan Simpson Design, Tempe, Arizona.

Webb, David
2005 Cultural resources survey of new right-of-way and drainage easement parcels located between State Route 80 mileposts 294.96 and 296.45, Benson, Cochise County, Arizona. Project Number AZ02103, Task 43, AZTEC Engineering, Phoenix, Arizona.

West, Heather M., and Joseph A. Ezzo
2007 Cultural Resources Survey of 159 Washes Along the Union Pacific Railroad form Estrella to Stockham-Milepost No. 876 in Maricopa County to Milepost No. 980 in Tucson, Pima County, Arizona. SWCA Cultural Resources Report 07-205, SWCA Environmental Consultants, Tucson.

Williams, CaraMia
2008 A class III cultural resources survey of 4.39 linear miles within the Arizona Department of Transportation (ADOT) right-of-way on both sides of State Route 80, beginning at milepost 298.94 and ending at 2nd Avenue (milepost 303.3), and within utility easements along Dragoon Vista Road and Lee Street, in the town of St. David, Cochise County, Arizona. Report No. 2007-67. Tierra Right of Way Services, Tucson, Arizona.

Wright, Thomas E.
2000 A Cultural Resources Survey along Business Interstate 19 (Mileposts 44.20-57.42 and 62.48-63.48), between Interstate 19 and Interstate 10, Pima County, Arizona. Project Report No. 99:35. Archaeological Research Services, Inc., Tempe, Arizona.

2001 A Cultural Resources Survey of 5.2 Miles of Business Interstate 10 Right-of-Way, Mileposts 248.0 - 253.2, Tucson, Pima County, Arizona. Archaeological Research Services, Inc. Report No. 2001:085. Tempe, Arizona.

2008 An archaeological survey of a proposed water line right-of-way on Arizona State Trust Land near Florence Junction, Pinal County, Arizona. Cultural Resources Report No. 08-258. SWCA Environmental Consultants, Phoenix, Arizona.

Young, Jessica.
2014 Class III cultural resources surveys and monitoring. Customer service projects and trouble reports, Gila and Pinal counties, Arizona: 2014 second quarter report. San Carlos Irrigation Project, Coolidge, Arizona.

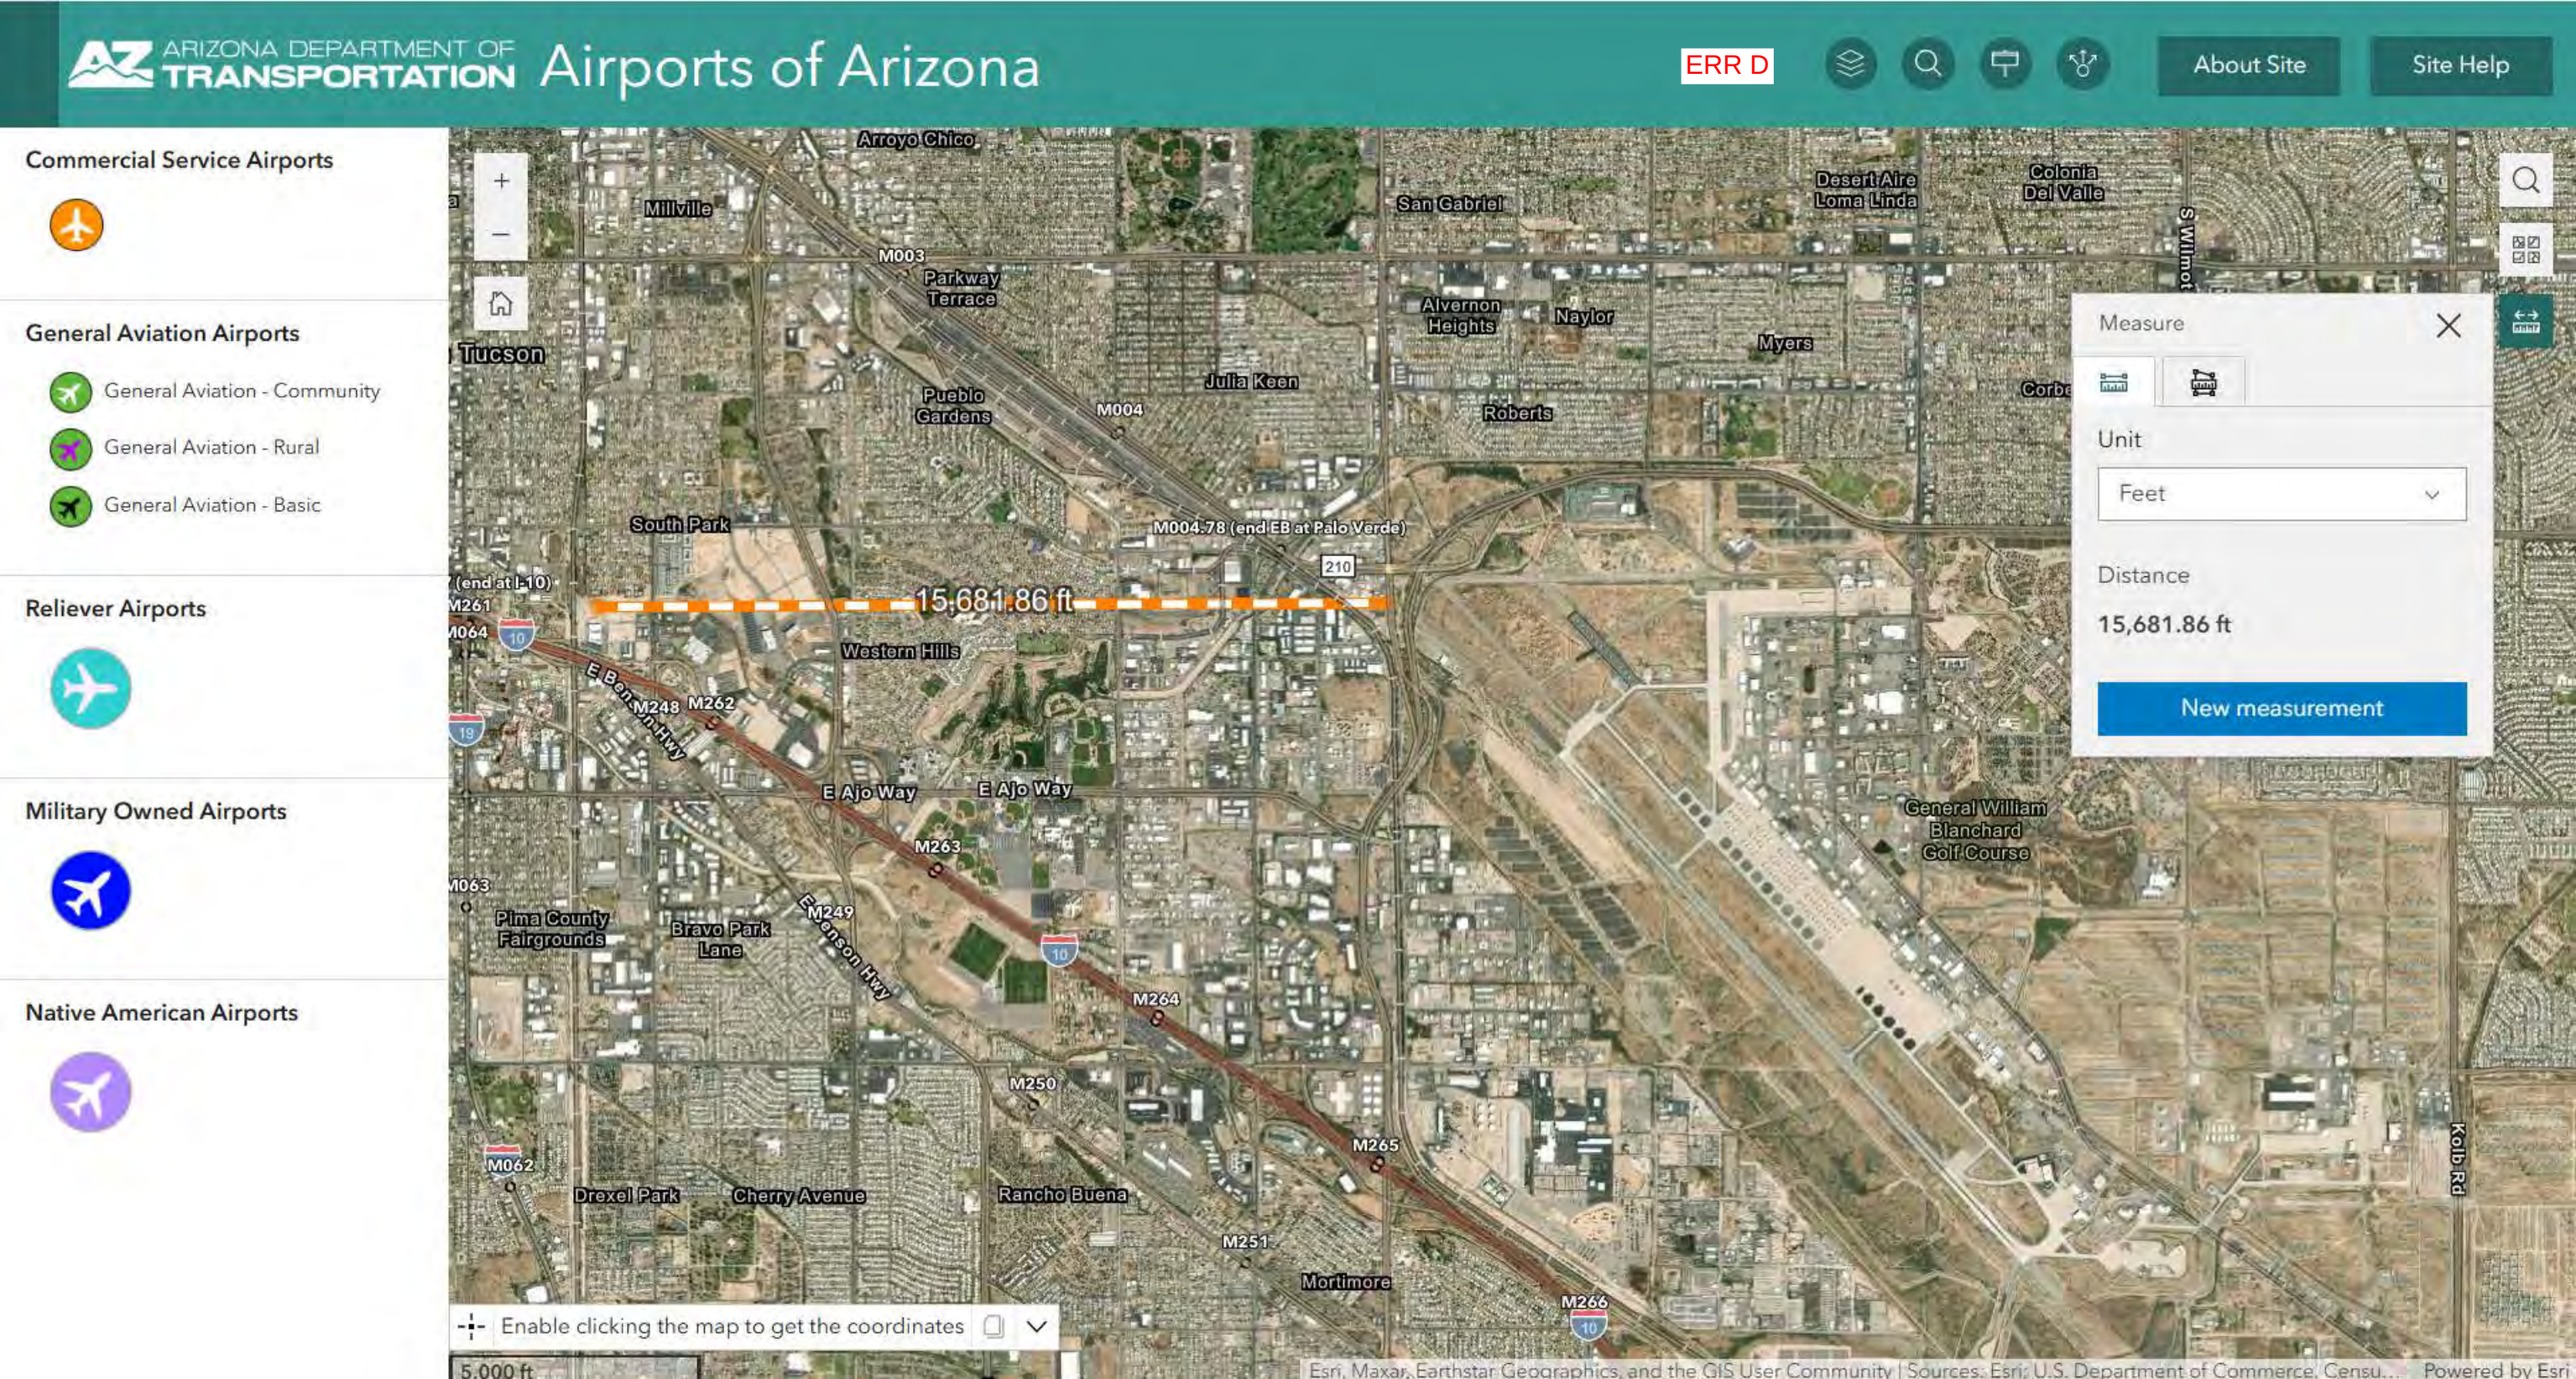
ARIZONA DEPARTMENT OF TRANSPORTATION
Airports of Arizona
ERR D
About Site
Site Help
Commercial Service Airports
General Aviation Airports
General Aviation - Community
General Aviation - Rural
General Aviation - Basic
Reliever Airports
Military Owned Airports
Native American Airports
Arroyo Chico
Millville
M003
Parkway Terrace
San Gabriel
Desert Aire
Loma Linda
Colonia Del Valle
S Wilmot
Tucson
Alvernon Heights
Naylor
Myers
Julia Keen
Pueblo Gardens
M004
Roberts
South Park
M004.78 (end EB at Palo Verde)
210
15,681.86 ft
Western Hills
E Benson Hwy
M248
M262
E Ajo Way
M263
General William Blanchard Golf Course
M063
Pima County Fairgrounds
Bravo Park Lane
M249
M264
M250
M265
M062
Drexel Park
Cherry Avenue
Rancho Buena
M251
Mortimore
M266
Kolb Rd
Measure
Unit
Feet
Distance
15,681.86 ft
New measurement
Enable clicking the map to get the coordinates
5,000 ft
Esri, Maxar, Earthstar Geographics, and the GIS User Community | Sources: Esri, U.S. Department of Commerce, Censu...
Powered by Esri

U.S. Fish and Wildlife Service
Coastal Barrier Resources System

JTED: Urban Workforce Develop.

June 20, 2025

Generalized Units

This map is for general reference only. The Coastal Barrier Resources System (CBRS) boundaries depicted on this map are representations of the controlling CBRS boundaries, which are shown on the official maps, accessible at https://www.fws.gov/library/collections/official-coastal-barrier-resources-system-maps. All CBRS related data should be used in accordance with the layer metadata found on the CBRS Mapper website.

The CBRS Buffer Zone represents the area immediately adjacent to the CBRS boundary where users are advised to contact the Service for an official determination (https://www.fws.gov/service/coastal-barrier-resources-system-property-documentation) as to whether the property or project site is located "in" or "out" of the CBRS.

CBRS Units normally extend seaward out to the 20- or 30-foot bathymetric contour (depending on the location of the unit). The true seaward

Coastal Zone Management Programs

Alabama [#alabama]
Alaska (*) [#alaska]
American Samoa [#samoa]
California [#california]
Connecticut [#connecticut]
Delaware [#delaware]
Florida [#florida]
Georgia [#georgia]
Guam [#guam]
Hawaii [#hawaii]
Illinois [#illinois]
Indiana [#indiana]
Louisiana [#louisiana]
Maine [#maine]
Maryland [#maryland]
Massachusetts [#massachusetts]
Michigan [#michigan]
Minnesota [#minnesota]
Mississippi [#mississippi]
New Hampshire [#newhampshire]
New Jersey [#newjersey]
New York [#newyork]
North Carolina [#northcarolina]
Northern Mariana Islands [#mariana]
Ohio [#ohio]
Oregon [#oregon]
Pennsylvania [#pennsylvania]
Puerto Rico [#puertorico]
Rhode Island [#rhodeisland]
South Carolina [#southcarolina]
Texas [#texas]
Virgin Islands [#virginislands]
Virginia [#virginia]
Washington [#washington]
Wisconsin [#wisconsin]

** All 35 coastal and Great Lakes states and territories (with the exception of Alaska) participate in the National Coastal Zone Management Program.*

ALABAMA
The Alabama Coastal Area Management Program [http://adem.alabama.gov/programs/coastal/default.cnt] , approved by NOAA in 1979, is administered by two state agencies:

- The Alabama Department of Conservation and Natural Resources [https://www.outdooralabama.com/coastal-programs/alabama-coastal-area-management-program] is responsible for planning, fiscal management, public education, and research management; and the
- Alabama Department of Environmental Management [http://adem.alabama.gov/programs/coastal/default.cnt] carries out permitting, regulatory, and enforcement functions.

The primary authority for the coastal management program is the Alabama Coastal Area Act of 1976 (Act 534). The Alabama coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] extends inland to the continuous 10-foot contour in Mobile and Baldwin Counties.

ALASKA
Alaska withdrew from the voluntary National Coastal Zone Management Program [/czm/about/] on July 1, 2011. Contact NOAA's Office for Coastal Management for additional information.

AMERICAN SAMOA
The American Samoa Coastal Management Program [https://www.doc.as.gov/our-divisions] , approved by NOAA in 1980, is led by the American Samoa Department of Commerce. The coastal program has developed a unique approach that incorporates both western and traditional systems of management. The American Samoa Coastal Management Act provides the primary authority for the program. American Samoa's coastal zone boundary [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] consists of seven islands, totaling roughly 77 square miles, with a coastline of 126 miles.

CALIFORNIA
The California Coastal Management Program, approved by NOAA in 1978, is administered by three state agencies:

- The California Coastal Commission [https://www.coastal.ca.gov/] manages development along the California coast except San Francisco Bay, where the
- San Francisco Bay Conservation and Development Commission [https://www.bcdc.ca.gov/] oversees development.
- The California Coastal Conservancy [https://scc.ca.gov/] purchases, protects, restores, and enhances coastal resources, and provides access to the shore.

The primary authorities for the California Coastal Management Program are the California Coastal Act, McAteer-Petris Act, and Suisan Marsh Preservation Act. The California coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] generally extends 1,000 yards inland from the mean high tide line. The coastal zone for the San Francisco Bay Conservation and Development Commission includes the open water, marshes, and mudflats of greater San Francisco Bay, and areas 100 feet inland from the line of highest tidal action.

CONNECTICUT
The Connecticut Coastal Management Program [https://portal.ct.gov/DEEP] , approved in 1980, is administered by the Office of Long Island Sound Programs within the Department of Energy and Environmental Protection. The primary authority for the coastal management program is the Connecticut Coastal Management Act of 1980. Connecticut has a two-tiered coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] . The first tier, the "coastal boundary," generally extends inland 1,000 feet from the shore. The second tier, the "coastal area," includes all of the state's 36 coastal municipalities.

DELAWARE
The Delaware Coastal Management Program [https://dnrec.alpha.delaware.gov/coastal-programs/coastal-management/] was approved by NOAA in 1979. The coastal management program's lead agency is the Division of Climate, Coastal, and Energy, Department of Natural Resources and Environmental Control. The program coordinates across nearly every state agency to ensure the effective implementation of policies, state laws, regulations and executive orders that affect coastal resources. Because the goals of the coastal management program are to balance the use, preservation, and development of coastal resources, these policies cover a surprising range of coastal issues.

The whole state of Delaware is designated as a coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] due to its small size and is divided into two tiers: the "coastal strip" and the rest of the state. The coastal strip, averaging four miles in width, receives special zoning protection from industrial development, while the second tier only falls under general program provisions.

FLORIDA
The Florida Coastal Management Program [https://floridadep.gov/fcmp] was approved by NOAA in 1981, with the Florida Department of Environmental Protection serving as the lead agency. A network of nine state agencies and five water management districts together enforce 23 separate statutes. The Florida coastal zone

[https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] is the entire state but is divided into two tiers. Only coastal cities and counties that include or are contiguous to state water bodies are eligible to receive coastal management funds.

GEORGIA
The Georgia Coastal Management Program [https://coastalgadnr.org/CoastalManagement] was approved by NOAA in 1998, with Georgia's Department of Natural Resources, Coastal Resources Division, serving as the lead agency. The Georgia Coastal Management Act authorized the creation of the Georgia Coastal Management Program. The Georgia coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the state's six coastal counties and five "inland tier" counties, which include Chatham, Effingham, Bryan, Liberty, McIntosh, Long, Glynn, Wayne, Brantley, Camden, and Charlton counties.

GUAM
The Guam Coastal Management Program [http://bsp.guam.gov/guam-coastal-management-program/] was approved in 1979, and is overseen by the Bureau of Statistics and Plans. The coastal management program guides the use, protection, and development of land and ocean resources within Guam's coastal zone.

Guam's comprehensive planning enabling legislation, Seashore Protection Act, and several executive orders are among the key legislation for the coastal management program. Because Guam is a small island, the entire land area is included within its coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] .

HAWAII
The Hawaii Coastal Management Program [http://planning.hawaii.gov/czm/] , approved by NOAA in 1978, is led by the Hawaii Office of Planning. The coastal management program is a network of authorities and partnerships collectively implementing the objectives and policies of Hawaii's Coastal Zone Management Statutes (Chapter 205A, HRS). The entire state of Hawaii falls within Hawaii's coastal zone boundary [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] .

ILLINOIS
The Illinois Coastal Management Program [https://dnr.illinois.gov/cmp.html] is the newest state partner in the National Coastal Zone Management Program, gaining approval in 2012. Illinois' program, under the direction of the Illinois Department of Natural Resources, Office of Coastal Management, focuses on several priority issues in the Illinois coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] , a 63-mile stretch along Lake Michigan. The program manages impacts to its Lake Michigan shoreline through the Rivers, Lakes, and Streams Act, Lake Michigan Shore Line Act, and a network of other authorities.

INDIANA
The Indiana Coastal Management Program [https://www.in.gov/dnr/lake-michigan-coastal-program/] , approved by NOAA in 2002, is led by the Indiana Department of Natural Resources. The coastal management program is a networked program built upon a framework of state laws and authorities addressing key coastal priorities. The Coastal Advisory Board, which represents various stakeholder groups, determines the priorities for each grant funding cycle and provides a forum for public input on regional issues affecting Lake Michigan coastal resources. The Indiana coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] is based on watershed boundaries and varies from a little less than two miles to 17 miles from the shore.

LOUISIANA
The Louisiana Coastal Management Program [http://www.dnr.louisiana.gov/index.cfm?md=pagebuilder&tmp=home&pid=85&ngid=5] , approved by NOAA in 1980, is administered by the Department of Natural Resources through the Office of Coastal Management. The primary authority for the coastal management program is the State and Local Coastal Resources Management Act of 1978. The Louisiana coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] , which varies from 16 to 32 miles inland from the Gulf coast, is a 10 million-acre area that includes 40 percent of the nation's coastal wetlands.

MAINE
The Maine Coastal Management Program [https://www.maine.gov/dmr/mcp/index.htm] , approved in 1978, is led by the Maine Department of Agriculture, Conservation, and Forestry. The coastal management program consists of a network of 19 state laws with four state agencies working in cooperation with local governments, nonprofit organizations, private businesses, and the public to improve management of coastal resources. Maine's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] extends to the inland boundary of all towns bordering tidal waters and includes all coastal islands.

MARYLAND

The Maryland Coastal Management Program [https://dnr.maryland.gov/ccs/Pages/funding/czma.aspx] was approved by NOAA in 1978, with the Department of Natural Resources acting as the lead agency. The coastal management program is a networked program composed of several state planning and regulatory programs implementing a suite of enforceable policies to protect coastal resources and manage coastal uses, including the Chesapeake Bays Critical Areas Protection Program. Maryland's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] follows the inland boundary of the counties (and Baltimore City) bordering the Atlantic Ocean, Chesapeake Bay, and the Potomac River (as far as the municipal limits of Washington, D.C.).

MASSACHUSETTS
The Massachusetts Coastal Management Program [https://www.mass.gov/orgs/massachusetts-office-of-coastal-zone-management] , approved by NOAA in 1978, is administered by the Office of Coastal Zone Management within the Executive Office of Environmental Affairs and serves as the lead for coastal policy and technical assistance in the state.

The Executive Office of Environmental Affairs enforces 20 program policies and nine management principles governing activities within the coastal zone. The Massachusetts coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] roughly includes all land within a half-mile of coastal waters and salt marshes, as well as all islands.

MICHIGAN
The Michigan Coastal Management Program [https://www.michigan.gov/egle/about/organization/water-resources/coastal-management] was approved by NOAA in 1978, and is administered by the Department of Environmental Quality. Key management authorities of the coastal management program include several parts of the Natural Resources and Environmental Protection Act pertaining to Shorelands Protection and Management (Part 323), Great Lakes Submerged Lands (Part 325), and Sand Dunes Protection and Management (Part 353).

Boasting the world's largest freshwater coastline, Michigan's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] generally extends a minimum of 1,000 feet inland from the ordinary high water mark, with the boundary extending further inland in some locations to encompass important coastal features.

MINNESOTA
The Minnesota Coastal Management Program [http://www.dnr.state.mn.us/waters/lakesuperior/index.html] was approved by NOAA in 1999 and consists of a network of agencies and programs led by the Department of Natural Resources.

Key legislation includes the Shoreland Management Act and the North Shore Management Plan. Minnesota's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the area approximately six miles inland from Lake Superior, following the nearest township boundaries along the shore.

MISSISSIPPI
The Mississippi Coastal Management Program [https://dmr.ms.gov/coastal-resources-management-2/] , approved by NOAA in 1980, consists of a network of agencies with authority in the coastal zone. The Department of Marine Resources, through the Office of Coastal Ecology, serves as the lead agency.

The primary authority guiding the coastal management program is the Coastal Wetlands Protection Act. The Mississippi coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the three coastal counties, as well as all adjacent coastal waters and the barrier islands of the coast.

NEW HAMPSHIRE
The New Hampshire Department of Environmental Services leads the implementation of the state's coastal program. The New Hampshire Coastal Management Program [https://www.des.nh.gov/water/coastal-waters] , approved by NOAA in 1982, is a networked program where several state agencies help enforce the coastal management program's 16 coastal policies. The New Hampshire coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] covers areas next to the Atlantic Ocean and the lower Piscataqua River, along with areas bordering the Great Bay and tidal rivers, and all 17 municipalities along tidal waters.

NEW JERSEY
The New Jersey Coastal Management Program [https://www.state.nj.us/dep/cmp/] was approved by NOAA in 1978 and is directly administered by its lead agency, the New Jersey Department of Environmental Protection, in partnership with the New Jersey Meadowlands Commission, as the lead planning agency for the Hackensack Meadowlands District.

The coastal management program is based on three major laws: the Coastal Area Facility Review Act, the Wetlands Act of 1970, and the Waterfront Development Law. New Jersey's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] encompasses approximately 1,800 miles of tidal coastline and ranges in width from 100 feet to 24 miles inland.

NEW YORK
The New York Coastal Management Program [https://dos.ny.gov/state-coastal-management-program] was approved by NOAA in 1982, with the New York Department of State serving as the lead agency. The Executive Law Article 42, Waterfront Revitalization of Coastal Areas and Inland Waterways, provides the state with the authority to establish a coastal program, develop coastal policies, define the coastal boundaries, and establish state consistency requirements.

The inland New York coastal zone boundary [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] is variable but generally is 1,000 feet from the shoreline in non-urbanized areas. In urbanized areas and other developed locations along the coastline, the inland boundary is usually 500 feet or less from the shoreline, with the boundary possibly extending inland up to 10,000 feet to encompass significant coastal resources.

NORTH CAROLINA
The North Carolina Coastal Management Program [https://deq.nc.gov/about/divisions/coastal-management] , approved by NOAA in 1978, is administered by the Division of Coastal Management within the Department of Environment and Natural Resources. The primary authority for the coastal management program is the Coastal Area Management Act.

North Carolina's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes 20 coastal counties that in whole or in part are adjacent to, adjoining, intersected, or bounded by the Atlantic Ocean or any coastal sound.

NORTHERN MARIANA ISLANDS
The Commonwealth of the Northern Mariana Islands is made up of 14 islands that span 440 miles of the western Pacific Ocean, with the Division of Coastal Resources Management [https://dcrm.gov.mp/] serving as the lead agency for the Northern Mariana Islands Coastal Management Program. NOAA approved the commonwealth's coastal management program in 1980. Since the islands are small, the entire land and water area of the commonwealth is included within the coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] .

OHIO
The Ohio Coastal Management Program [https://ohiodnr.gov/wps/portal/gov/odnr/discover-and-learn/safety-conservation/about-odnr/coastal-management] was approved by NOAA in 1997, with the Ohio Department of Natural Resources serving as the lead agency for the networked program. The coastal management program incorporates state laws, regulations, and programs within 41 management policies that are organized around nine issue areas [https://ohiodnr.gov/wps/portal/gov/odnr/discover-and-learn/safety-conservation/about-odnr/coastal-managementocmp] . Ohio's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] is quite varied and runs through the nine counties bordering Lake Erie and its tributaries. The boundary width ranges from about one-eighth of a mile to 15 miles depending on features, such as coastal wetlands and bluffs.

OREGON
The Oregon Coastal Management Program [https://www.oregon.gov/LCD/OCMP/pages/index.aspx] , approved by NOAA in 1977, consists of a network of agencies with authority in the coastal zone. The Oregon Department of Land Conservation and Development serves as the lead agency. The primary authority for the coastal management program is the Oregon Land Use Planning Act and the 19 statewide planning goals. The Oregon coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the state's coastal watersheds and extends inland to the crest of the coast range, with a few minor exceptions.

PENNSYLVANIA
The Pennsylvania Coastal Management Program [https://www.dep.pa.gov/Business/Water/Compacts%20and%20Commissions/Coastal%20Resources%20Management%20Program/Pages/default.aspx] , approved in 1980, is administered by the Department of Environmental Protection. The coastal management program comprises two widely separated coastal areas: the 63-mile Lake Erie shoreline and the 57-mile stretch of coastline along the Delaware Estuary.

The program relies on a network of state authorities. The Pennsylvania coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] along Lake Erie varies from 900 feet in urban areas to over three miles in rural areas, and the Delaware River Estuary boundary extends inland from 660 feet in urbanized areas to 3.5 miles in rural areas.

PUERTO RICO
Puerto Rico's Coastal Management Program [https://www.drna.pr.gov/tag/zona-costanera/] was approved by NOAA in 1978 and comprises a network of state agencies led by the Department of Natural and Environmental Resources. The program encompasses 40 statutes.

Puerto Rico's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] generally extends 1,000 meters (one kilometer) inland, but extends further inland in places to include important coastal resources.

RHODE ISLAND
The Rhode Island Coastal Management Program [http://www.crmc.ri.gov/] , approved by NOAA in 1978, is administered by the Rhode Island Coastal Resources Management Council. The primary authority for the coastal management program is the Coastal Resources Management Act of 1971. Rhode Island's coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] encompasses the entire state, although the inland extent of the coastal management program's regulatory authority is generally 200 feet inland from any coastal feature.

SOUTH CAROLINA
The South Carolina Coastal Management Program [https://scdhec.gov/environment/your-water-coast/ocean-coastal-resource-management/coastal-zone-management/south] was approved by NOAA in 1979, and the lead agency is the Department of Health and Environmental Control. The primary authority for the coastal management program is the 1977 Coastal Tidelands and Wetlands Act. The South Carolina coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes all lands and waters in the counties of the state that contain any one or more "critical areas," which are defined as coastal waters, tidelands, beaches, and beach/dune system.

TEXAS
The Texas Coastal Management Program [https://www.glo.texas.gov/coast/grant-projects/cmp/index.html] , approved by NOAA in 1996, is administered by the Texas General Land Office in conjunction with the Coastal Coordination Advisory Committee. The Coastal Coordination Act is the primary authority for the Texas Coastal Management Program. The Texas coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] is generally the area seaward of the Texas coastal facility designation line, up to three marine leagues into the Gulf of Mexico.

VIRGIN ISLANDS
The U.S. Virgin Islands Coastal Management Program was approved by NOAA in 1979. The lead agency is the Department of Planning and Natural Resources. The primary authority for the coastal management program is the U.S. Virgin Islands Coastal Zone Management Act, and the coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the entire territory.

VIRGINIA
The Virginia Coastal Management Program [https://www.deq.virginia.gov/our-programs/coastal-zone-management] was approved by NOAA in 1986, and the Department of Environmental Quality serves as the lead agency. Authorized by a commonwealth executive order, the coastal management program is structured as a network of agencies that have authority for implementing nine core policies and a set of advisory policies covering wetlands, fisheries, water quality, dunes and beaches, subaqueous lands, and other coastal resources in the Virginia coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] . The coastal zone includes the state's 29 coastal counties, 17 cities, and 42 incorporated towns.

WASHINGTON
The Washington Coastal Management Program [https://ecology.wa.gov/Water-Shorelines/Shoreline-coastal-management/Coastal-zone-management] , approved by NOAA in 1976, was the first approved program in the nation. The Department of Ecology serves as the lead coastal management agency. The primary authority for the coastal management program is the Shoreline Management Act of 1971. The Washington coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] includes the state's 15 coastal counties that front saltwater.

WISCONSIN
The Wisconsin Coastal Management Program [https://doa.wi.gov/Pages/LocalGovtsGrants/CoastalManagement.aspx] , approved by NOAA in 1978, is administered by the Department of Administration, Bureau of Intergovernmental Relations. The coastal management program is a networked program implemented in partnership with the Wisconsin Coastal Management Council, with representatives from local governments, state agencies, Native American tribes, and interest groups. The council sets the policy direction for the program. The Wisconsin coastal zone [https://coast.noaa.gov/data/czm/media/StateCZBoundaries.pdf] comprises the 15 counties fronting Lake Superior, Lake Michigan, and Green Bay.

For more information, contact us [https://coast.noaa.gov/contactform/] .

About the National Program [/czm/about/]

Bipartisan Infrastructure Law [https://coast.noaa.gov/funding/infrastructure.html]

Coastal Management Fellowship [https://coast.noaa.gov/fellowship/coastalmanagement.html]

Coastal Zone Management Act [/czm/act/]

Evaluations [/czm/evaluations/]

National Program Funding Summary [https://coast.noaa.gov/data/czm/media/funding-summary.pdf]

National Program Publications [/czm/publications/]

Performance Measures [/czm/performance/]

Program Change Website [https://coast.noaa.gov/czmprogramchange/]

Program Guidance [/czm/guidance/]

Regulations [https://www.ecfr.gov/cgi-bin/text-idx?SID=73fa77136a5eecb25a52b3ef02368ecb&tpl=/ecfrbrowse/Title15/15cfr923_main_02.tpl]

States and Territories [/czm/mystate/]

ERR F

National Flood Hazard Layer FIRMette

FEMA

110°57'55"W 32°11'32"N

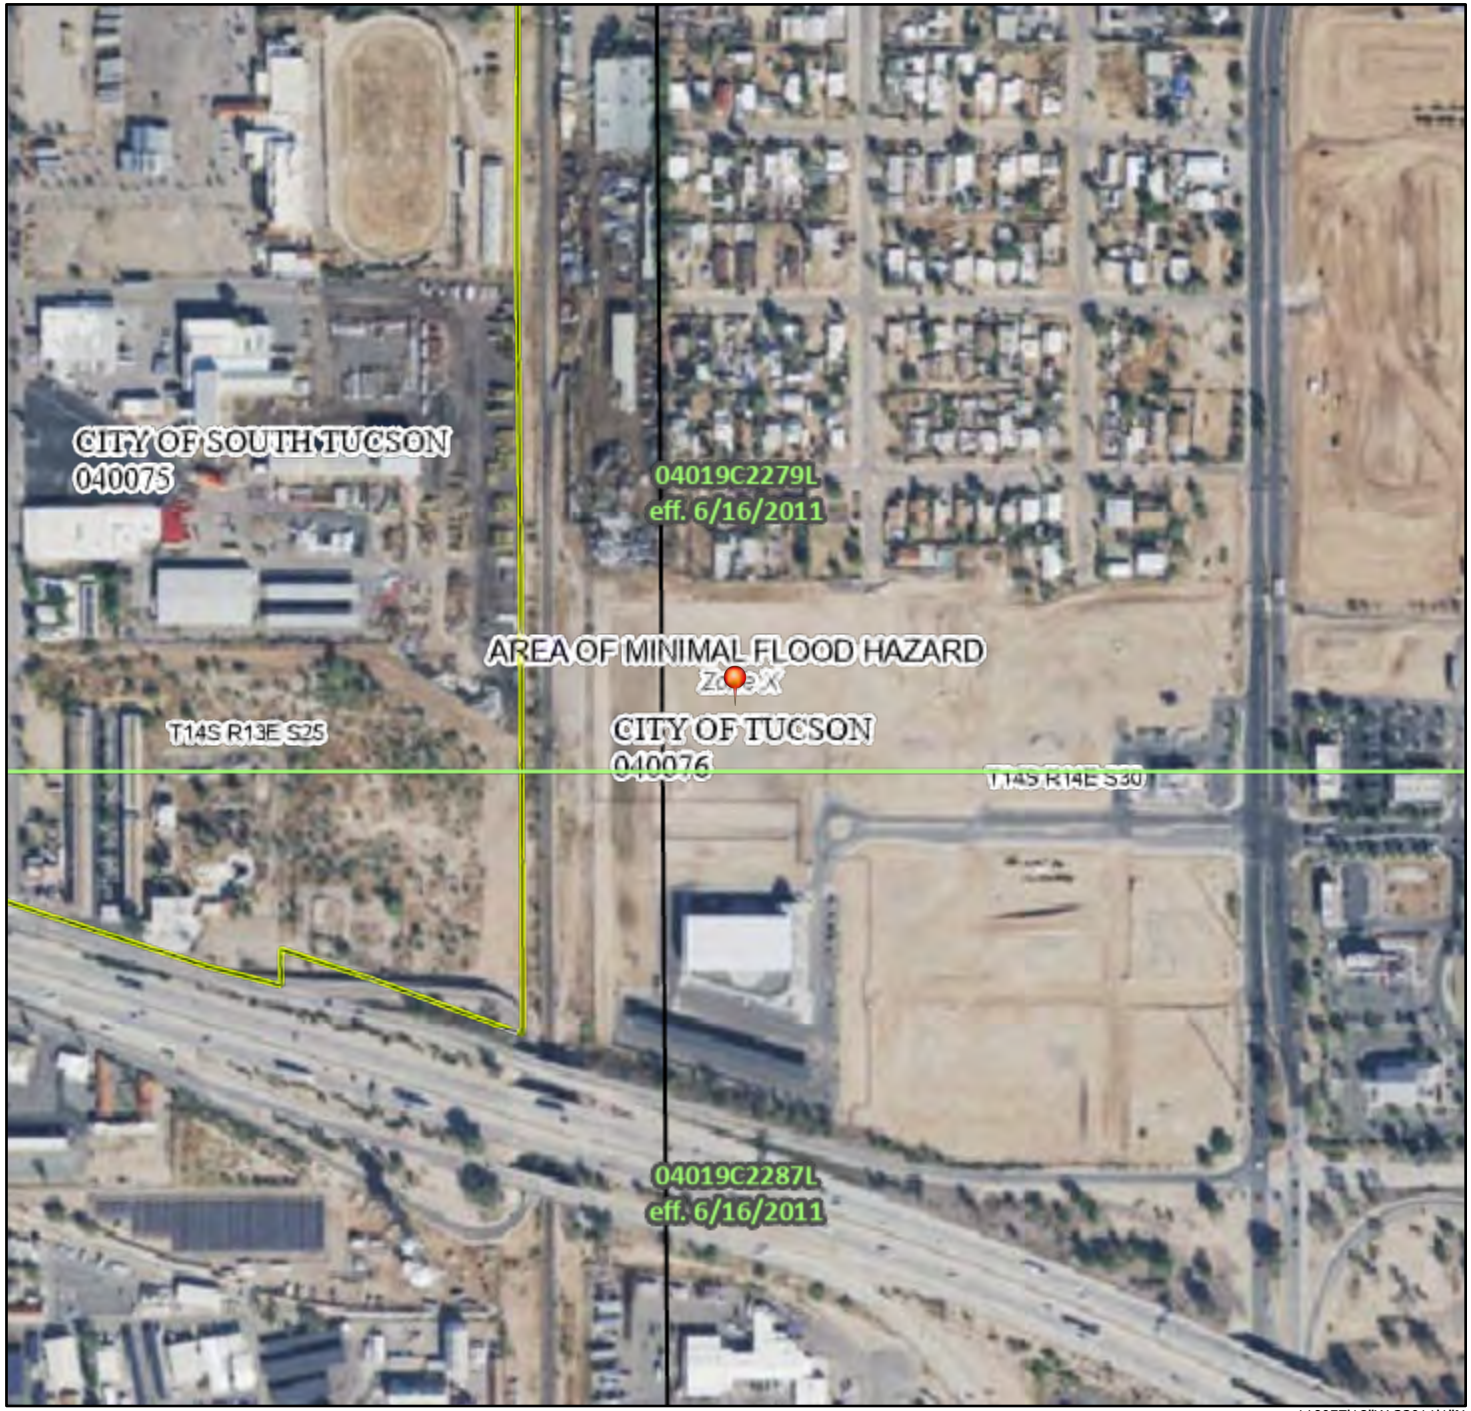

110°57'18"W 32°11'1"N

0 250 500 1,000 1,500 2,000 Feet

1:6,000

Basemap Imagery Source: USGS National Map 2023

Legend

SEE FIS REPORT FOR DETAILED LEGEND AND INDEX MAP FOR FIRM PANEL LAYOUT

SPECIAL FLOOD HAZARD AREAS
- Without Base Flood Elevation (BFE) *Zone A, V, A99*
- With BFE or Depth *Zone AE, AO, AH, VE, AR*
- Regulatory Floodway

OTHER AREAS OF FLOOD HAZARD
- 0.2% Annual Chance Flood Hazard, Areas of 1% annual chance flood with average depth less than one foot or with drainage areas of less than one square mile *Zone X*
- Future Conditions 1% Annual Chance Flood Hazard *Zone X*
- Area with Reduced Flood Risk due to Levee. See Notes. *Zone X*
- Area with Flood Risk due to Levee *Zone D*

OTHER AREAS
- NO SCREEN Area of Minimal Flood Hazard *Zone X*
- Effective LOMRs
- Area of Undetermined Flood Hazard *Zone D*

GENERAL STRUCTURES
- Channel, Culvert, or Storm Sewer
- Levee, Dike, or Floodwall

OTHER FEATURES
- 20.2 Cross Sections with 1% Annual Chance
- 17.5 Water Surface Elevation
- Coastal Transect
- Base Flood Elevation Line (BFE)
- Limit of Study
- Jurisdiction Boundary
- Coastal Transect Baseline
- Profile Baseline
- Hydrographic Feature

MAP PANELS
- Digital Data Available
- No Digital Data Available
- Unmapped

N

The pin displayed on the map is an approximate point selected by the user and does not represent an authoritative property location.

This map complies with FEMA's standards for the use of digital flood maps if it is not void as described below. The basemap shown complies with FEMA's basemap accuracy standards

The flood hazard information is derived directly from the authoritative NFHL web services provided by FEMA. This map was exported on 1/16/2025 at 5:30 PM and does not reflect changes or amendments subsequent to this date and time. The NFHL and effective information may change or become superseded by new data over time.

This map image is void if the one or more of the following map elements do not appear: basemap imagery, flood zone labels, legend, scale bar, map creation date, community identifiers, FIRM panel number, and FIRM effective date. Map images for unmapped and unmodernized areas cannot be used for regulatory purposes.

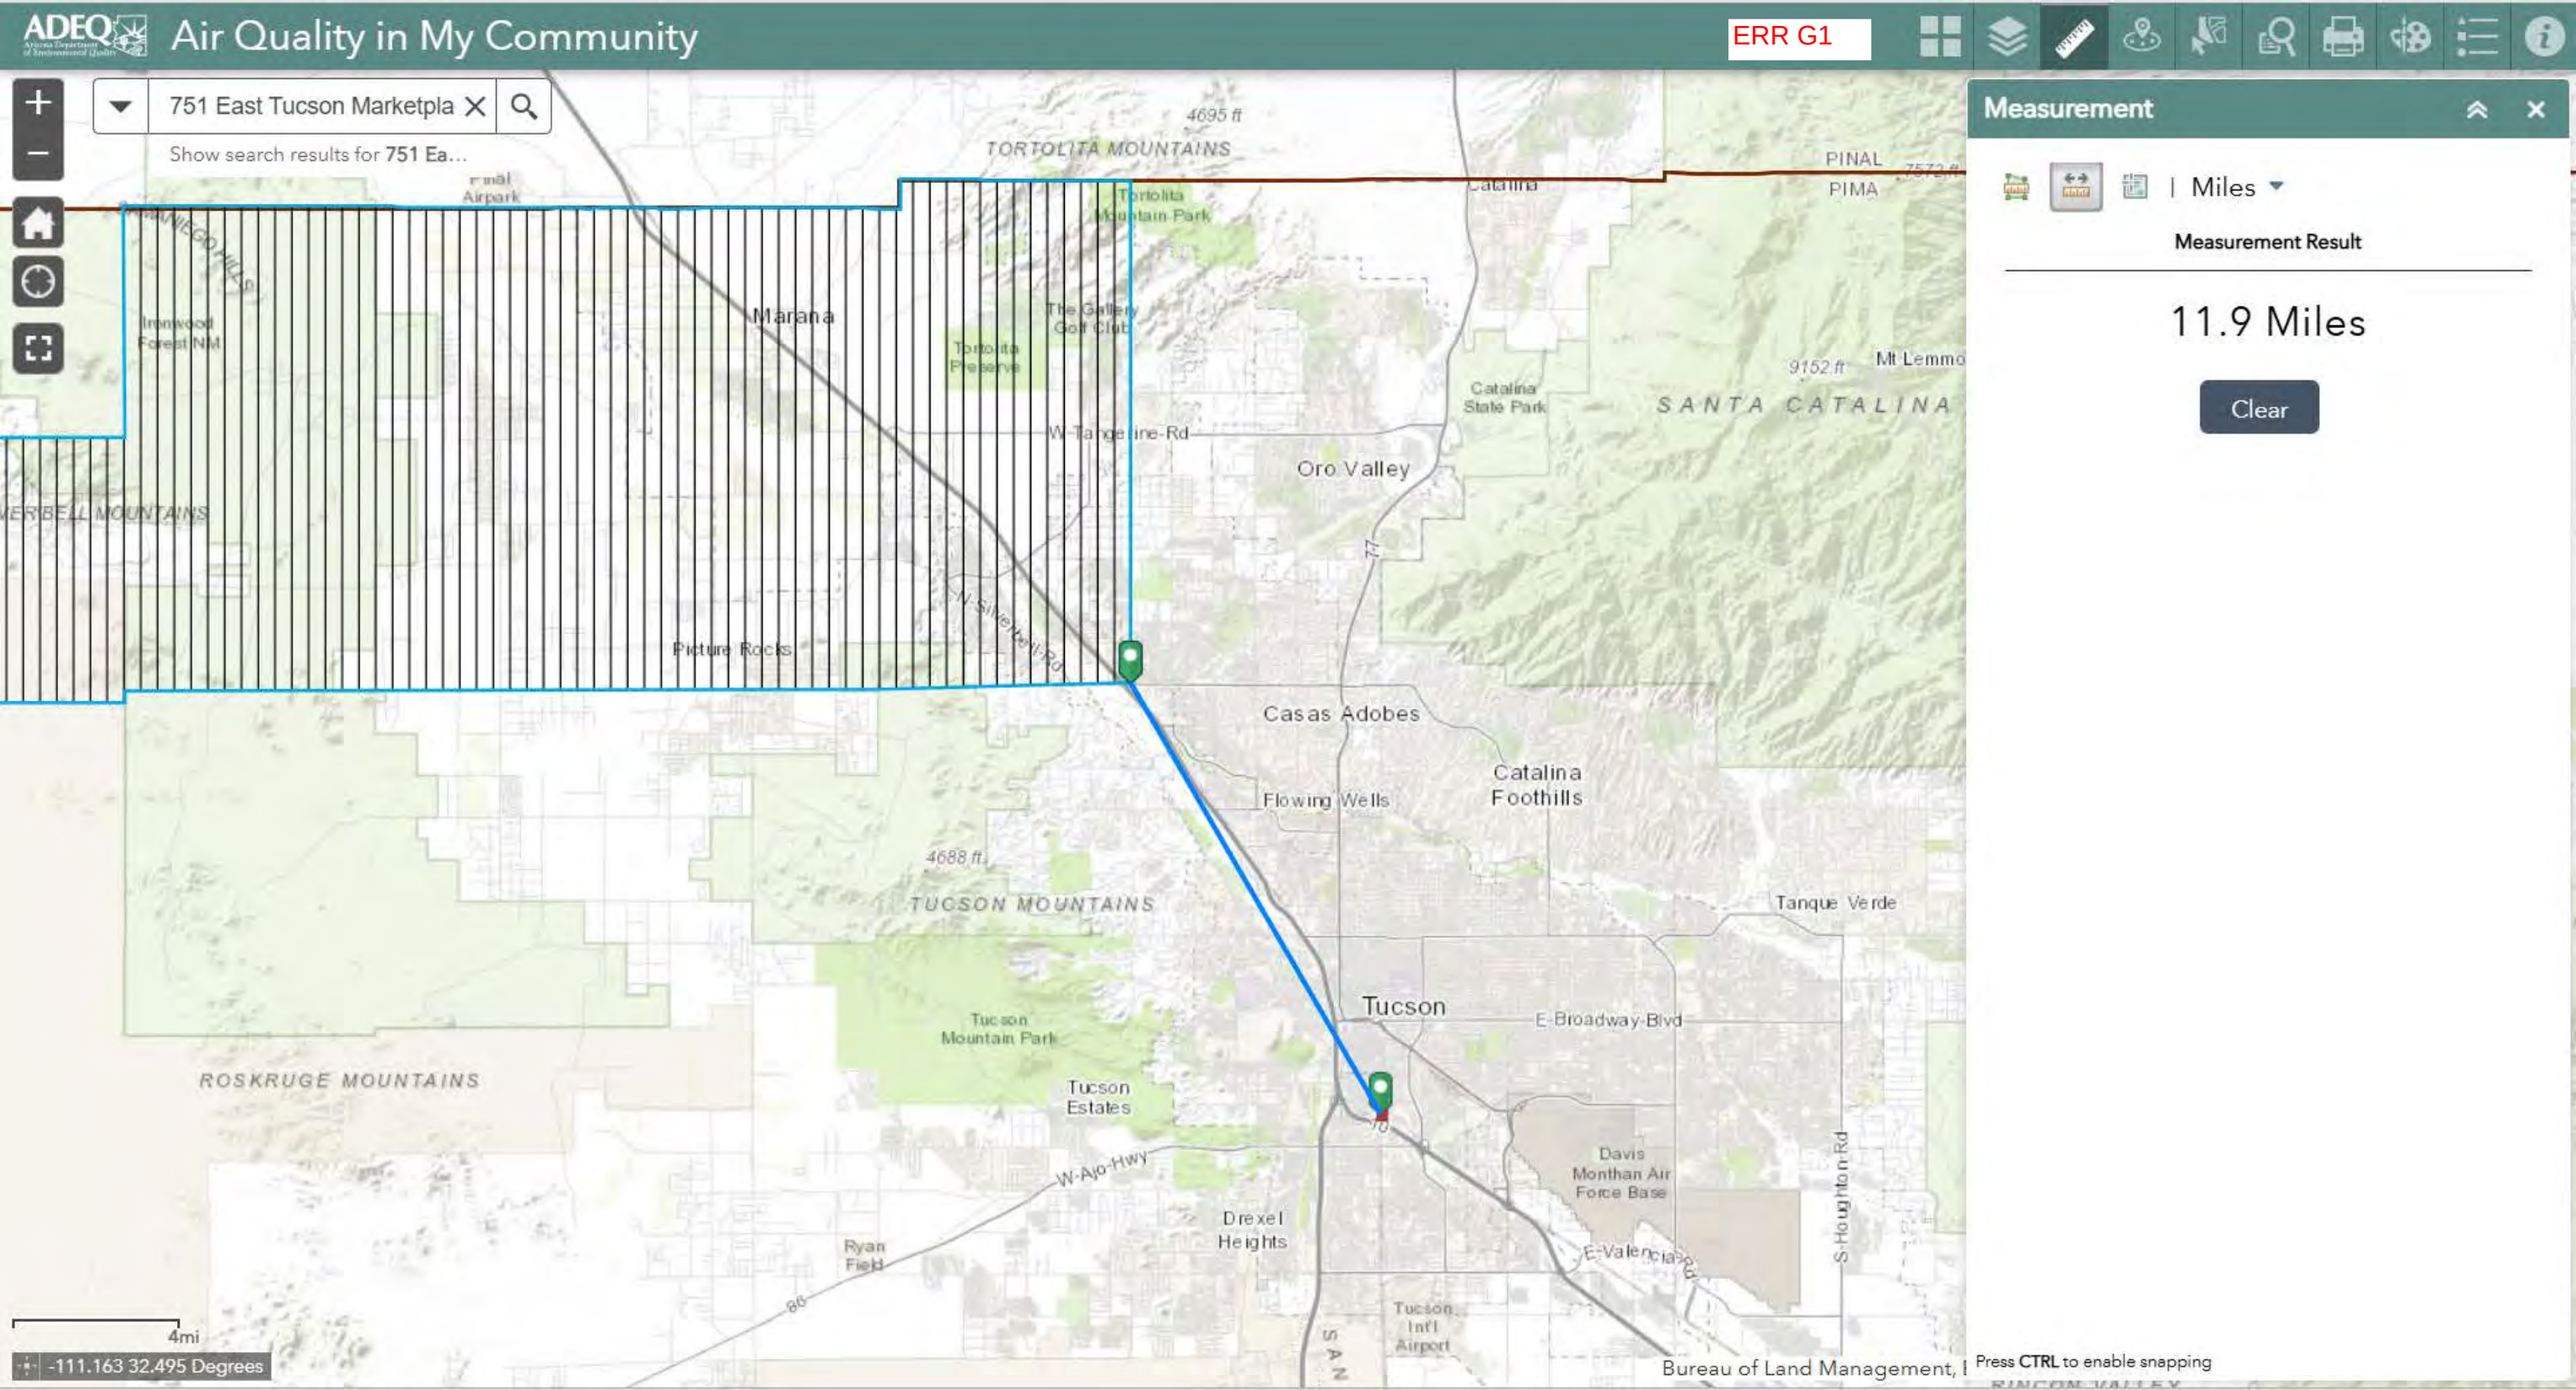
ADEQ
Air Quality in My Community
ERR G1
751 East Tucson Marketpla
Show search results for 751 Ea...
Measurement
Miles
Measurement Result
11.9 Miles
Clear
4695 ft
TORTOLITA MOUNTAINS
Tortolita Mountain Park
PINAL
PIMA
Catalina
Marana
Ironwood Forest NM
The Gallery Golf Club
Tortolita Preserve
W Tangerine Rd
Oro Valley
Catalina State Park
9152 ft
Mt Lemmo
SANTA CATALINA
77
Picture Rocks
N Silverbell Rd
Casas Adobes
Catalina Foothills
Flowing Wells
4688 ft
TUCSON MOUNTAINS
Tanque Verde
Tucson
E Broadway Blvd
Tucson Mountain Park
ROSKRUGE MOUNTAINS
Tucson Estates
10
W Ajo Hwy
Davis Monthan Air Force Base
S Houghton Rd
Drexel Heights
Ryan Field
E Valencia Rd
86
Tucson Intl Airport
4mi
-111.163 32.495 Degrees
Bureau of Land Management,
Press CTRL to enable snapping

Air Quality | Nonattainment Areas

< RETURN TO MY COMMUNITY

Nonattainment areas are classified by the Environmental Protection Agency (EPA) to have air quality monitoring data for criteria pollutants above the National Ambient Air Quality Standards (NAAQS), which are outlined in the Clean Air Act. These areas are designated conservatively and are not necessarily exceeding the NAAQS every day | See Today's Air Quality Forecast >

The following is a list of the nonattainment areas listed by county:

Cochise County

- PM_{10} — Paul Spur/Douglas | Learn More >

Gila County

- PM_{10} — Miami | Learn More >
- SO_2 — Miami | Learn More >
- SO_2 — Hayden | Learn More >
- Lead — Hayden | Learn More >

Maricopa County

- PM_{10} — Phoenix | Learn More >
- Ozone — Phoenix | Learn More >

Pinal County

- PM_{10} — Hayden | Learn More >
- SO_2 — Hayden | Learn More >
- Lead — Hayden | Learn More >
- PM_{10} — West Pinal | Learn More >
- PM_{10} — Miami | Learn More >

Pima County

- PM_{10} — Rillito | Learn More >

Santa Cruz County

- PM_{10} — Nogales | Learn More >
- $PM_{2.5}$ — Nogales | Learn More >

Yuma County

- Ozone — Yuma | Learn More >
- PM_{10} — Yuma | Learn More >

Counties with no nonattainment areas at this time:

- Apache County
- Coconino County
- Graham County
- Greenlee County
- La Paz County
- Mohave County
- Navajo County
- Yavapai County

National Ambient Air Quality Standards

EPA Nonattainment Areas for Criteria Pollutants | Learn More >

Unfamiliar with some of the acronyms or technical terms used on this page?

Visit our glossary | View Glossary >

NEPAssist Map - 3,000ft Buffer

ERR H

June 10, 2025

1:18,056

0 0.13 0.25 0.5 mi

0 0.2 0.4 0.8 km

- Brownfields (ACRES)
- Brownfields (ACRES)
- Air Pollution (ICIS-AIR)
- Hazardous Waste (RCRAInfo)
- Hazardous Waste (RCRAInfo)
- Project Buffer
- JTED Environmental Assessment

Sources: Esri, TomTom, Garmin, FAO, NOAA, USGS, (c) OpenStreetMap contributors, and the GIS User Community, Maxar

NEPAssist Report

JTED Environmental Assessment

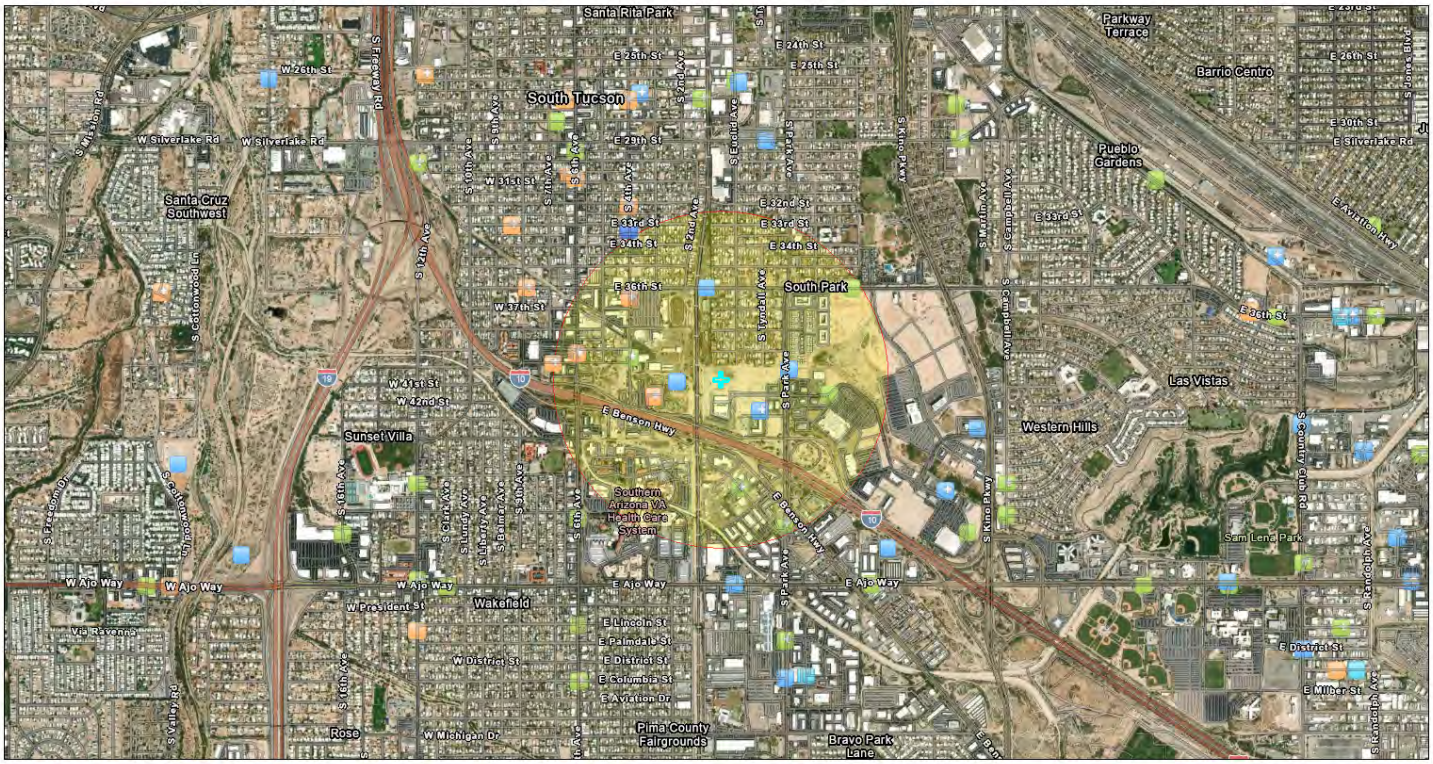

Project Location	32.187915,-110.960021
Within 3000 feet of an Ozone 1-hr (1979 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of an Ozone 8-hr (1997 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of an Ozone 8-hr (2008 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of an Ozone 8-hr (2015 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a Lead (2008 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a SO2 1-hr (2010 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a PM2.5 24hr (2006 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a PM2.5 Annual (1997 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a PM2.5 Annual (2012 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a PM10 (1987 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a CO Annual (1971 standard) Non-Attainment/Maintenance Area?	yes
Within 3000 feet of a NO2 Annual (1971 standard) Non-Attainment/Maintenance Area?	no
Within 3000 feet of a Federal Land?	no
Within 3000 feet of an impaired stream?	no
Within 3000 feet of an impaired waterbody?	no
Within 3000 feet of a waterbody?	no
Within 3000 feet of a stream?	yes
Within 3000 feet of an NWI wetland?	Available Online
Within 3000 feet of a Brownfields site?	yes
Within 3000 feet of a Superfund site?	no

Within 3000 feet of a Toxic Release Inventory (TRI) site?	no
Within 3000 feet of a water discharger (NPDES)?	yes
Within 3000 feet of a hazardous waste (RCRA) facility?	yes
Within 3000 feet of an air emission facility?	no
Within 3000 feet of a school?	yes
Within 3000 feet of an airport?	no
Within 3000 feet of a hospital?	yes
Within 3000 feet of a designated sole source aquifer?	yes
Within 3000 feet of a historic property on the National Register of Historic Places?	no
Within 3000 feet of a Chemical Data Reporting (CDR) site?	no
Within 3000 feet of a Land Cession Boundary?	yes
Within 3000 feet of a tribal area (lower 48 states)?	no
Within 3000 feet of the service area of a mitigation or conservation bank?	yes
Within 3000 feet of the service area of an In-Lieu-Fee Program?	yes
Within 3000 feet of a Public Property Boundary of the Formerly Used Defense Sites?	no
Within 3000 feet of a Munitions Response Site?	no
Within 3000 feet of an Essential Fish Habitat (EFH)?	no
Within 3000 feet of a Habitat Area of Particular Concern (HAPC)?	no
Within 3000 feet of an EFH Area Protected from Fishing (EFHA)?	no
Within 3000 feet of a Bureau of Land Management Area of Critical Environmental Concern?	no
Within 3000 feet of an ESA-designated Critical Habitat Area per U.S. Fish & Wildlife Service?	no
Within 3000 feet of an ESA-designated Critical Habitat river, stream or water feature per U.S. Fish & Wildlife Service?	no

Created on: 6/9/2025 6:00:37 PM

ERR H3

JTED
751 East Marketplace Boulevard
Tucson, AZ 85713

Inquiry Number: 7970166.2s
April 25, 2025

The EDR Radius Map™ Report with GeoCheck®

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	212
Government Records Searched/Data Currency Tracking	GR-1

GEOCHECK ADDENDUM

Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-6
Physical Setting Source Map	A-16
Physical Setting Source Map Findings	A-18
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA) INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527 - 21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E2247 - 16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E1528 - 22) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

751 EAST MARKETPLACE BOULEVARD
TUCSON, AZ 85713

COORDINATES

Latitude (North):	32.1879400 - 32° 11' 16.58''
Longitude (West):	110.9599970 - 110° 57' 35.98''
Universal Tranverse Mercator:	Zone 12
UTM X (Meters):	503770.8
UTM Y (Meters):	3561080.2
Elevation:	2461 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	50001019 TUCSON, AZ
Version Date:	2021

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20190616
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
751 EAST MARKETPLACE BOULEVARD
TUCSON, AZ 85713

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
1	JTED 2 AT BRIDGES OU		EMAP	Lower	1 ft.
2	SPANISH TRAILS EAST	425 EAST BENSON HIGH	US BROWNFIELDS, FINDS	Lower	558, 0.106, WSW
3	SINCLAIR RETAIL #020	3231 S PARK AVE	UST	Higher	978, 0.185, East
4	SINCLAIR OIL CORP	2808 S PARK AVE	UST	Higher	1005, 0.190, NE
5	ADOT/E-Z FILL	3345 S PARK AVE	UST	Higher	1057, 0.200, ESE
A6	OLD SPANISH TRAIL	305 S BENSON HWY	RCRA NonGen / NLR	Lower	1141, 0.216, WSW
A7	SPANISH TRAIL TASK 2	305 EAST BENSON HIGH	US BROWNFIELDS, FINDS	Lower	1141, 0.216, WSW
8	UNKNOWN		MINES MRDS	Lower	1153, 0.218, SSW
B9	LAKE SHORE INC	400 E 38TH ST	RCRA NonGen / NLR, FINDS, ECHO	Lower	1172, 0.222, NW
B10	LAKE SHORE INC	400 E 38TH ST	UST, AST	Lower	1172, 0.222, NW
11	GREYHOUND SITE	2601 SOUTH 3RD AVENU	US BROWNFIELDS, FINDS	Lower	1220, 0.231, NNW
B12	HOLSUM BAKERY INC	2801 S 4TH AVE	UST	Lower	1308, 0.248, WNW
C13	PRIMAVERA HOMELESS S	3001 SOUTH 4TH AVENU	US BROWNFIELDS, FINDS	Lower	1357, 0.257, West
C14	PAYLESS CASHWAYS	2901 S 4TH AVE	LUST, UST, AZURITE, EMAP	Lower	1385, 0.262, WNW
C15	PAYLESS CASHWAYS	2901 S 4TH AVE	UST FINDER, UST FINDER RELEASE	Lower	1385, 0.262, WNW
D16	SPANISH TRAILS WEST	3255 SOUTH 4TH AVENU	US BROWNFIELDS, FINDS	Lower	1402, 0.266, WSW
D17	SOUTH TUCSON HOSPITA	3255 S 4TH AVE	UST FINDER, UST FINDER RELEASE	Lower	1402, 0.266, WSW
D18	SOUTH TUCSON HOSPITA	3255 S 4TH AVE	LUST, UST, EMAP	Lower	1402, 0.266, WSW
D19	SPANISH TRAILS NORTH	NE OF 4TH AVENUE AND	US BROWNFIELDS, FINDS	Lower	1475, 0.279, WSW
20	CENTRO CARISMATICO C	NWC 4TH AVENUE AND B	US BROWNFIELDS	Lower	1629, 0.309, West
E21	TUCSON TRUCK ACCESSO	750 E EVANS BLVD	UST FINDER, UST FINDER RELEASE	Higher	1778, 0.337, South
E22	TUCSON TRUCK ACCESSO	750 E EVANS BLVD	LUST, UST, AZURITE, EMAP	Higher	1778, 0.337, South
F23	CUTTING EDGE COLLISI	2626 S 4TH AVE	LUST, UST, AZURITE, EMAP	Lower	1913, 0.362, NW
F24	CUTTING EDGE COLLISI	2626 S 4TH AVE	UST FINDER, UST FINDER RELEASE	Lower	1913, 0.362, NW
G25	UNOCAL #3888	821 E BENSON HWY	UST FINDER, UST FINDER RELEASE	Higher	1935, 0.366, SSE
G26	UNOCAL #3888	821 E BENSON HWY	LUST, UST, AZURITE, EMAP	Higher	1935, 0.366, SSE
H27	HEDLUND 310	310 EAST 35TH STREET	US BROWNFIELDS	Lower	2137, 0.405, NW
I28	ORION LEASING, REALT	SEC 39TH STREET AND	US BROWNFIELDS, FINDS	Lower	2238, 0.424, West
I29	ORION LEASING REALTY	101 E. 40TH STREET	US BROWNFIELDS, FINDS	Lower	2270, 0.430, West
H30	FORMER CHILE RELLENO	2433 S. 4TH AVE.	US BROWNFIELDS, FINDS	Lower	2278, 0.431, NW
J31	PARK AVE SHELL	880 E BENSON HWY	LUST, UST, EMAP, Enforcement	Higher	2279, 0.432, SSE
J32	PARK AVE SHELL	880 E BENSON HWY	UST FINDER, UST FINDER RELEASE	Higher	2279, 0.432, SSE
I33	PRIMAVERA PROPERTY	2901 S. SIXTH AVENUE	US BROWNFIELDS, FINDS	Lower	2325, 0.440, West
K34	GIANT 6619	1001 E BENSON HWY	UST FINDER, UST FINDER RELEASE	Higher	2374, 0.450, SSE
K35	GIANT 6619	1001 E BENSON HWY	LUST, UST, AZURITE, EMAP, Enforcement	Higher	2374, 0.450, SSE
36	KUNZ SOUTH PROPERTY	2413 S. 4TH AVENUE	US BROWNFIELDS	Lower	2477, 0.469, NW
L37	CHEVRON #9-0965	3002 S 6TH AVE	UST FINDER, UST FINDER RELEASE	Lower	2499, 0.473, West
L38	CHEVRON #9-0965	3002 S 6TH AVE	LUST, UST, EMAP, Enforcement	Lower	2499, 0.473, West
M39	TOOT-N-MOO	2802 S 6TH AVE	LUST, UST, EMAP	Lower	2512, 0.476, WNW

MAPPED SITES SUMMARY

Target Property Address:
751 EAST MARKETPLACE BOULEVARD
TUCSON, AZ 85713

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
M40	TOOT-N-MOO	2802 S 6TH AVE	UST FINDER, UST FINDER RELEASE	Lower	2512, 0.476, WNW
N41	SALVATION ARMY - ADU	2717 S 6TH AVE	UST FINDER, UST FINDER RELEASE	Lower	2559, 0.485, WNW
N42	SALVATION ARMY - ADU	2717 S 6TH AVE	LUST, UST, AZURITE, EMAP	Lower	2559, 0.485, WNW
43	OPTICAL ELECTRONICS	3939 S. PARK AVE/180	SHWS	Higher	4075, 0.772, SSE
44	VEGA BIOCHEMICAL INC	420 E COLUMBIA ST	SHWS, EMAP	Higher	5227, 0.990, South

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL ---------- National Priority List
Proposed NPL ---------- Proposed National Priority List Sites
NPL LIENS ---------- Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL ---------- National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY ---------- Federal Facility Site Information listing
SEMS ---------- Superfund Enterprise Management System

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE ---------- Superfund Enterprise Management System Archive

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS ---------- Corrective Action Report

Lists of Federal RCRA TSD facilities

RCRA-TSDF ---------- RCRA - Treatment, Storage and Disposal

Lists of Federal RCRA generators

RCRA-LQG ---------- RCRA - Large Quantity Generators
RCRA-SQG ---------- RCRA - Small Quantity Generators
RCRA-VSQG ---------- RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

Federal institutional controls / engineering controls registries

LUCIS ---------- Land Use Control Information System

US ENG CONTROLS ..... Engineering Controls Sites List
US INST CONTROLS ..... Institutional Controls Sites List

Federal ERNS list

ERNS ..... Emergency Response Notification System

Lists of state- and tribal (Superfund) equivalent sites

AZ NPL ..... NPL Detail Listing
AZ WQARF ..... Water Quality Assurance Revolving Fund Sites

Lists of state- and tribal hazardous waste facilities

SPL ..... Superfund Program List

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF ..... Directory of Solid Waste Facilities

Lists of state and tribal leaking storage tanks

INDIAN LUST ..... Leaking Underground Storage Tanks on Indian Land

Lists of state and tribal registered storage tanks

FEMA UST ..... Underground Storage Tank Listing
INDIAN UST ..... Underground Storage Tanks on Indian Land

State and tribal institutional control / engineering control registries

AUL ..... DEUR Database

Lists of state and tribal voluntary cleanup sites

INDIAN VCP ..... Voluntary Cleanup Priority Listing
VCP ..... Voluntary Remediation Program Sites

Lists of state and tribal brownfield sites

BROWNFIELDS ..... Brownfields Tracking System

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

SWTIRE ..... Solid Waste Tire Facilities
INDIAN ODI ..... Report on the Status of Open Dumps on Indian Lands
ODI ..... Open Dump Inventory
DEBRIS REGION 9 ..... Torres Martinez Reservation Illegal Dump Site Locations
IHS OPEN DUMPS ..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL ..... Delisted National Clandestine Laboratory Register

CDL	Clandestine Drug Labs
US CDL	National Clandestine Laboratory Register

Local Land Records

LIENS 2	CERCLA Lien Information

Records of Emergency Release Reports

HMIRS	Hazardous Materials Information Reporting System
SPILLS	Hazardous Material Logbook
SPILLS 90	SPILLS 90 data from FirstSearch

Other Ascertainable Records

FUDS	Formerly Used Defense Sites
DOD	Department of Defense Sites
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR	Financial Assurance Information
EPA WATCH LIST	EPA WATCH LIST
2020 COR ACTION	2020 Corrective Action Program List
TSCA	Toxic Substances Control Act
TRIS	Toxic Chemical Release Inventory System
SSTS	Section 7 Tracking Systems
ROD	Records Of Decision
RMP	Risk Management Plans
RAATS	RCRA Administrative Action Tracking System
PRP	Potentially Responsible Parties
PADS	PCB Activity Database System
ICIS	Integrated Compliance Information System
FTTS	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS	Material Licensing Tracking System
COAL ASH DOE	Steam-Electric Plant Operation Data
COAL ASH EPA	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER	PCB Transformer Registration Database
RADINFO	Radiation Information Database
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS	Incident and Accident Data
CONSENT	Superfund (CERCLA) Consent Decrees
INDIAN RESERV	Indian Reservations
FUSRAP	Formerly Utilized Sites Remedial Action Program
UMTRA	Uranium Mill Tailings Sites
LEAD SMELTERS	Lead Smelter Sites
US AIRS	Aerometric Information Retrieval System Facility Subsystem
US MINES	Mines Master Index File
ABANDONED MINES	Abandoned Mines
FINDS	Facility Index System/Facility Registry System
UXO	Unexploded Ordnance Sites
DOCKET HWC	Hazardous Waste Compliance Docket Listing
ECHO	Enforcement & Compliance History Information
FUELS PROGRAM	EPA Fuels Program Registered Listing
PFAS NPL	Superfund Sites with PFAS Detections Information
PFAS FEDERAL SITES	Federal Sites PFAS Information
PFAS TRIS	List of PFAS Added to the TRI

PFAS TSCA ---- PFAS Manufacture and Imports Information
PFAS RCRA MANIFEST ---- PFAS Transfers Identified In the RCRA Database Listing
PFAS ATSDR ---- PFAS Contamination Site Location Listing
PFAS WQP ---- Ambient Environmental Sampling for PFAS
PFAS NPDES ---- Clean Water Act Discharge Monitoring Information
PFAS PROJECT ---- NORTHEASTERN UNIVERSITY PFAS PROJECT
PFAS ECHO ---- Facilities in Industries that May Be Handling PFAS Listing
PFAS ECHO FIRE TRAIN ---- Facilities in Industries that May Be Handling PFAS Listing
PFAS PT 139 AIRPORT ---- All Certified Part 139 Airports PFAS Information Listing
AQUEOUS FOAM NRC ---- Aqueous Foam Related Incidents Listing
BIOSOLIDS ---- ICIS-NPDES Biosolids Facility Data
UST FINDER ---- UST Finder Database
E MANIFEST ---- Hazardous Waste Electronic Manifest System
PFAS ---- PFAS Contamination Site Listing
AQUEOUS FOAM ---- Aqueous Film Forming Foam Listing
AIRS ---- Arizona Airs Database
Aquifer ---- Aquifer Protection Permits List
AZ DOD ---- Department of Defense Sites
Dry Wells ---- Drywell Registration
DRYCLEANERS ---- Drycleaner Facility Listing
Enforcement ---- Enforcement and Violation Listing
Financial Assurance ---- Financial Assurance Information Listing
MANIFEST ---- Facility and Manifest Data
SPDES ---- NPDES
VAPOR ---- Vapor Intrusion
UIC ---- Underground Injection Control Wells
WWFAC ---- Waste Water Treatment Facilities
DRYWELLS HIST ---- Historical Drywells Listing

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP ---- EDR Proprietary Manufactured Gas Plants
EDR Hist Auto ---- EDR Exclusive Historical Auto Stations
EDR Hist Cleaner ---- EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS ---- Recovered Government Archive State Hazardous Waste Facilities List
RGA LF ---- Recovered Government Archive Solid Waste Facilities List
RGA LUST ---- Recovered Government Archive Leaking Underground Storage Tank

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.
Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

EXECUTIVE SUMMARY

STANDARD ENVIRONMENTAL RECORDS

Lists of state- and tribal hazardous waste facilities

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Quality's ZipAcids database.

A review of the SHWS list, as provided by EDR, and dated 01/03/2000 has revealed that there are 2 SHWS sites within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
OPTICAL ELECTRONICS Facility Id: 1050	3939 S. PARK AVE/180	SSE 1/2 - 1 (0.772 mi.)	43	210
VEGA BIOCHEMICAL INC Facility Id: 298	***420 E COLUMBIA ST***	***S 1/2 - 1 (0.990 mi.)***	***44***	***210***

Lists of state and tribal leaking storage tanks

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environmental Quality's LUST File Listing by Zip Code.

A review of the LUST list, as provided by EDR, and dated 12/11/2024 has revealed that there are 10 LUST sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TUCSON TRUCK ACCESSO Date Closed: 07/25/94 Facility Id: 0-005004 Facility Status: CLOSED	***750 E EVANS BLVD***	***S 1/4 - 1/2 (0.337 mi.)***	***E22***	***102***
UNOCAL #3888 Date Closed: 09/30/02 Facility Id: 0-005278 Facility Status: CLOSED	***821 E BENSON HWY***	***SSE 1/4 - 1/2 (0.366 mi.)***	***G26***	***115***
PARK AVE SHELL Date Closed: 07/28/20 Date Closed: 12/19/18 Date Closed: 09/17/13 Date Closed: 05/31/22 Facility Id: 0-004960 Facility Status: CLOSED	***880 E BENSON HWY***	***SSE 1/4 - 1/2 (0.432 mi.)***	***J31***	***163***
GIANT 6619 Date Closed: 07/06/18 Date Closed: 07/22/96 Facility Id: 0-001052 Facility Status: CLOSED	***1001 E BENSON HWY***	***SSE 1/4 - 1/2 (0.450 mi.)***	***K35***	***189***

Lower Elevation	Address	Direction / Distance	Map ID	Page
PAYLESS CASHWAYS	***2901 S 4TH AVE***	***WNW 1/4 - 1/2 (0.262 mi.)***	***C14***	***64***

Date Closed: 12/07/98
Facility Id: 0-007077
Facility Status: CLOSED

SOUTH TUCSON HOSPITA	***3255 S 4TH AVE***	***WSW 1/4 - 1/2 (0.266 mi.)***	***D18***	***89***
Date Closed: 05/04/05 Facility Id: 0-004587 Facility Status: CLOSED				
CUTTING EDGE COLLISI	***2626 S 4TH AVE***	***NW 1/4 - 1/2 (0.362 mi.)***	***F23***	***104***
Date Closed: 11/18/98 Facility Id: 0-002721 Facility Status: CLOSED				
CHEVRON #9-0965	***3002 S 6TH AVE***	***W 1/4 - 1/2 (0.473 mi.)***	***L38***	***199***
Date Closed: 10/22/01 Date Closed: 09/18/17 Facility Id: 0-005748 Facility Status: CLOSED				
TOOT-N-MOO	***2802 S 6TH AVE***	***WNW 1/4 - 1/2 (0.476 mi.)***	***M39***	***202***
Date Closed: 11/14/08 Facility Id: 0-009043 Facility Status: CLOSED				
SALVATION ARMY - ADU	***2717 S 6TH AVE***	***WNW 1/4 - 1/2 (0.485 mi.)***	***N42***	***208***
Date Closed: 04/13/95 Facility Id: 0-004319 Facility Status: CLOSED				

Lists of state and tribal registered storage tanks

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Quality's Arizona UST-DMS Facility and Tank Data Listing by City database.

A review of the UST list, as provided by EDR, and dated 12/11/2024 has revealed that there are 5 UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SINCLAIR RETAIL #020 Closure Type: Removal Facility Id: 0-004534 Date Closed: 12/28/1990	3231 S PARK AVE	E 1/8 - 1/4 (0.185 mi.)	3	17
SINCLAIR OIL CORP Closure Type: Removal Facility Id: 0-010029 Date Closed: 10/27/2004	2808 S PARK AVE	NE 1/8 - 1/4 (0.190 mi.)	4	18
ADOT/E-Z FILL Closure Type: Removal Facility Id: 0-004532 Date Closed: 12/28/1990	3345 S PARK AVE	ESE 1/8 - 1/4 (0.200 mi.)	5	19

Lower Elevation	Address	Direction / Distance	Map ID	Page
LAKE SHORE INC	***400 E 38TH ST***	***NW 1/8 - 1/4 (0.222 mi.)***	***B10***	***32***

Closure Type: Removal
Facility Id: 0-006690
Date Closed: 01/31/1990

HOLSUM BAKERY INC	2801 S 4TH AVE	WNW 1/8 - 1/4 (0.248 mi.)	B12	59

Closure Type: Removal
Facility Id: 0-002509
Date Closed: 12/21/1989

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Quality's Arizona UST-DMS Facility and Tank Data Listing by City database.

A review of the AST list, as provided by EDR, has revealed that there is 1 AST site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
LAKE SHORE INC	***400 E 38TH ST***	***NW 1/8 - 1/4 (0.222 mi.)***	***B10***	***32***

Database: AST 2, Date of Government Version: 11/12/2024
Cert Status: Closed

State and tribal institutional control / engineering control registries

AZURITE: ADEQ maintains a repository listing sites remediated under programs administered by the department.

A review of the AZURITE list, as provided by EDR, and dated 03/12/2024 has revealed that there are 6 AZURITE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TUCSON TRUCK ACCESSO	***750 E EVANS BLVD***	***S 1/4 - 1/2 (0.337 mi.)***	***E22***	***102***
UNOCAL #3888	***821 E BENSON HWY***	***SSE 1/4 - 1/2 (0.366 mi.)***	***G26***	***115***
GIANT 6619	***1001 E BENSON HWY***	***SSE 1/4 - 1/2 (0.450 mi.)***	***K35***	***189***

Lower Elevation	Address	Direction / Distance	Map ID	Page
PAYLESS CASHWAYS	***2901 S 4TH AVE***	***WNW 1/4 - 1/2 (0.262 mi.)***	***C14***	***64***
CUTTING EDGE COLLISI	***2626 S 4TH AVE***	***NW 1/4 - 1/2 (0.362 mi.)***	***F23***	***104***
SALVATION ARMY - ADU	***2717 S 6TH AVE***	***WNW 1/4 - 1/2 (0.485 mi.)***	***N42***	***208***

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 09/09/2024 has revealed that there

are 13 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SPANISH TRAILS EAST	***425 EAST BENSON HIGH***	***WSW 0 - 1/8 (0.106 mi.)***	***2***	***8***
SPANISH TRAIL TASK 2	***305 EAST BENSON HIGH***	***WSW 1/8 - 1/4 (0.216 mi.)***	***A7***	***23***
GREYHOUND SITE	***2601 SOUTH 3RD AVENU***	***NNW 1/8 - 1/4 (0.231 mi.)***	***11***	***35***
PRIMAVERA HOMELESS S	***3001 SOUTH 4TH AVENU***	***W 1/4 - 1/2 (0.257 mi.)***	***C13***	***60***
SPANISH TRAILS WEST	***3255 SOUTH 4TH AVENU***	***WSW 1/4 - 1/2 (0.266 mi.)***	***D16***	***70***
SPANISH TRAILS NORTH	***NE OF 4TH AVENUE AND***	***WSW 1/4 - 1/2 (0.279 mi.)***	***D19***	***91***
CENTRO CARISMATICO C	NWC 4TH AVENUE AND B	W 1/4 - 1/2 (0.309 mi.)	20	96
HEDLUND 310	310 EAST 35TH STREET	NW 1/4 - 1/2 (0.405 mi.)	H27	119
ORION LEASING, REALT	***SEC 39TH STREET AND***	***W 1/4 - 1/2 (0.424 mi.)***	***I28***	***140***
ORION LEASING REALTY	***101 E. 40TH STREET***	***W 1/4 - 1/2 (0.430 mi.)***	***I29***	***145***
FORMER CHILE RELLENO	***2433 S. 4TH AVE.***	***NW 1/4 - 1/2 (0.431 mi.)***	***H30***	***158***
PRIMAVERA PROPERTY	***2901 S. SIXTH AVENUE***	***W 1/4 - 1/2 (0.440 mi.)***	***I33***	***172***
KUNZ SOUTH PROPERTY	2413 S. 4TH AVENUE	NW 1/4 - 1/2 (0.469 mi.)	36	194

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 02/17/2025 has revealed that there are 2 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
OLD SPANISH TRAIL EPA ID:: AZS000043497	305 S BENSON HWY	WSW 1/8 - 1/4 (0.216 mi.)	A6	20
LAKE SHORE INC EPA ID:: AZD982484560	***400 E 38TH ST***	***NW 1/8 - 1/4 (0.222 mi.)***	***B9***	***29***

MINES MRDS: Mineral Resources Data System

A review of the MINES MRDS list, as provided by EDR, and dated 06/04/2024 has revealed that there is 1 MINES MRDS site within approximately 0.25 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
UNKNOWN		SSW 1/8 - 1/4 (0.218 mi.)	8	28

UST FINDER RELEASE: US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

A review of the UST FINDER RELEASE list, as provided by EDR, and dated 06/08/2023 has revealed that

there are 10 UST FINDER RELEASE sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TUCSON TRUCK ACCESSO	*750 E EVANS BLVD*	*S 1/4 - 1/2 (0.337 mi.)*	*E21*	*100*
UNOCAL #3888	*821 E BENSON HWY*	*SSE 1/4 - 1/2 (0.366 mi.)*	*G25*	*111*
PARK AVE SHELL	*880 E BENSON HWY*	*SSE 1/4 - 1/2 (0.432 mi.)*	*J32*	*167*
GIANT 6619	*1001 E BENSON HWY*	*SSE 1/4 - 1/2 (0.450 mi.)*	*K34*	*185*

Lower Elevation	Address	Direction / Distance	Map ID	Page
PAYLESS CASHWAYS	*2901 S 4TH AVE*	*WNW 1/4 - 1/2 (0.262 mi.)*	*C15*	*67*
SOUTH TUCSON HOSPITA	*3255 S 4TH AVE*	*WSW 1/4 - 1/2 (0.266 mi.)*	*D17*	*87*
CUTTING EDGE COLLISI	*2626 S 4TH AVE*	*NW 1/4 - 1/2 (0.362 mi.)*	*F24*	*108*
CHEVRON #9-0965	*3002 S 6TH AVE*	*W 1/4 - 1/2 (0.473 mi.)*	*L37*	*196*
TOOT-N-MOO	*2802 S 6TH AVE*	*WNW 1/4 - 1/2 (0.476 mi.)*	*M40*	*204*
SALVATION ARMY - ADU	*2717 S 6TH AVE*	*WNW 1/4 - 1/2 (0.485 mi.)*	*N41*	*206*

EMAP: A listing of all places of interest to the Department of Environmental Quality, including air, waste and water sites.

A review of the EMAP list, as provided by EDR, and dated 11/22/2024 has revealed that there is 1 EMAP site within approximately 0.001 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
JTED 2 AT BRIDGES OU Facility Status: ACTIVE ID Number: 231515		0 - 1/8 (0.000 mi.)	1	8

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 3 records.

Site Name	Database(s)
VARSITY CLEANERS	DRYCLEANERS
CAMPUS CLEANERS	DRYCLEANERS
SUPER CLEANERS TUCSON	DRYCLEANERS

OVERVIEW MAP - 7970166.2S

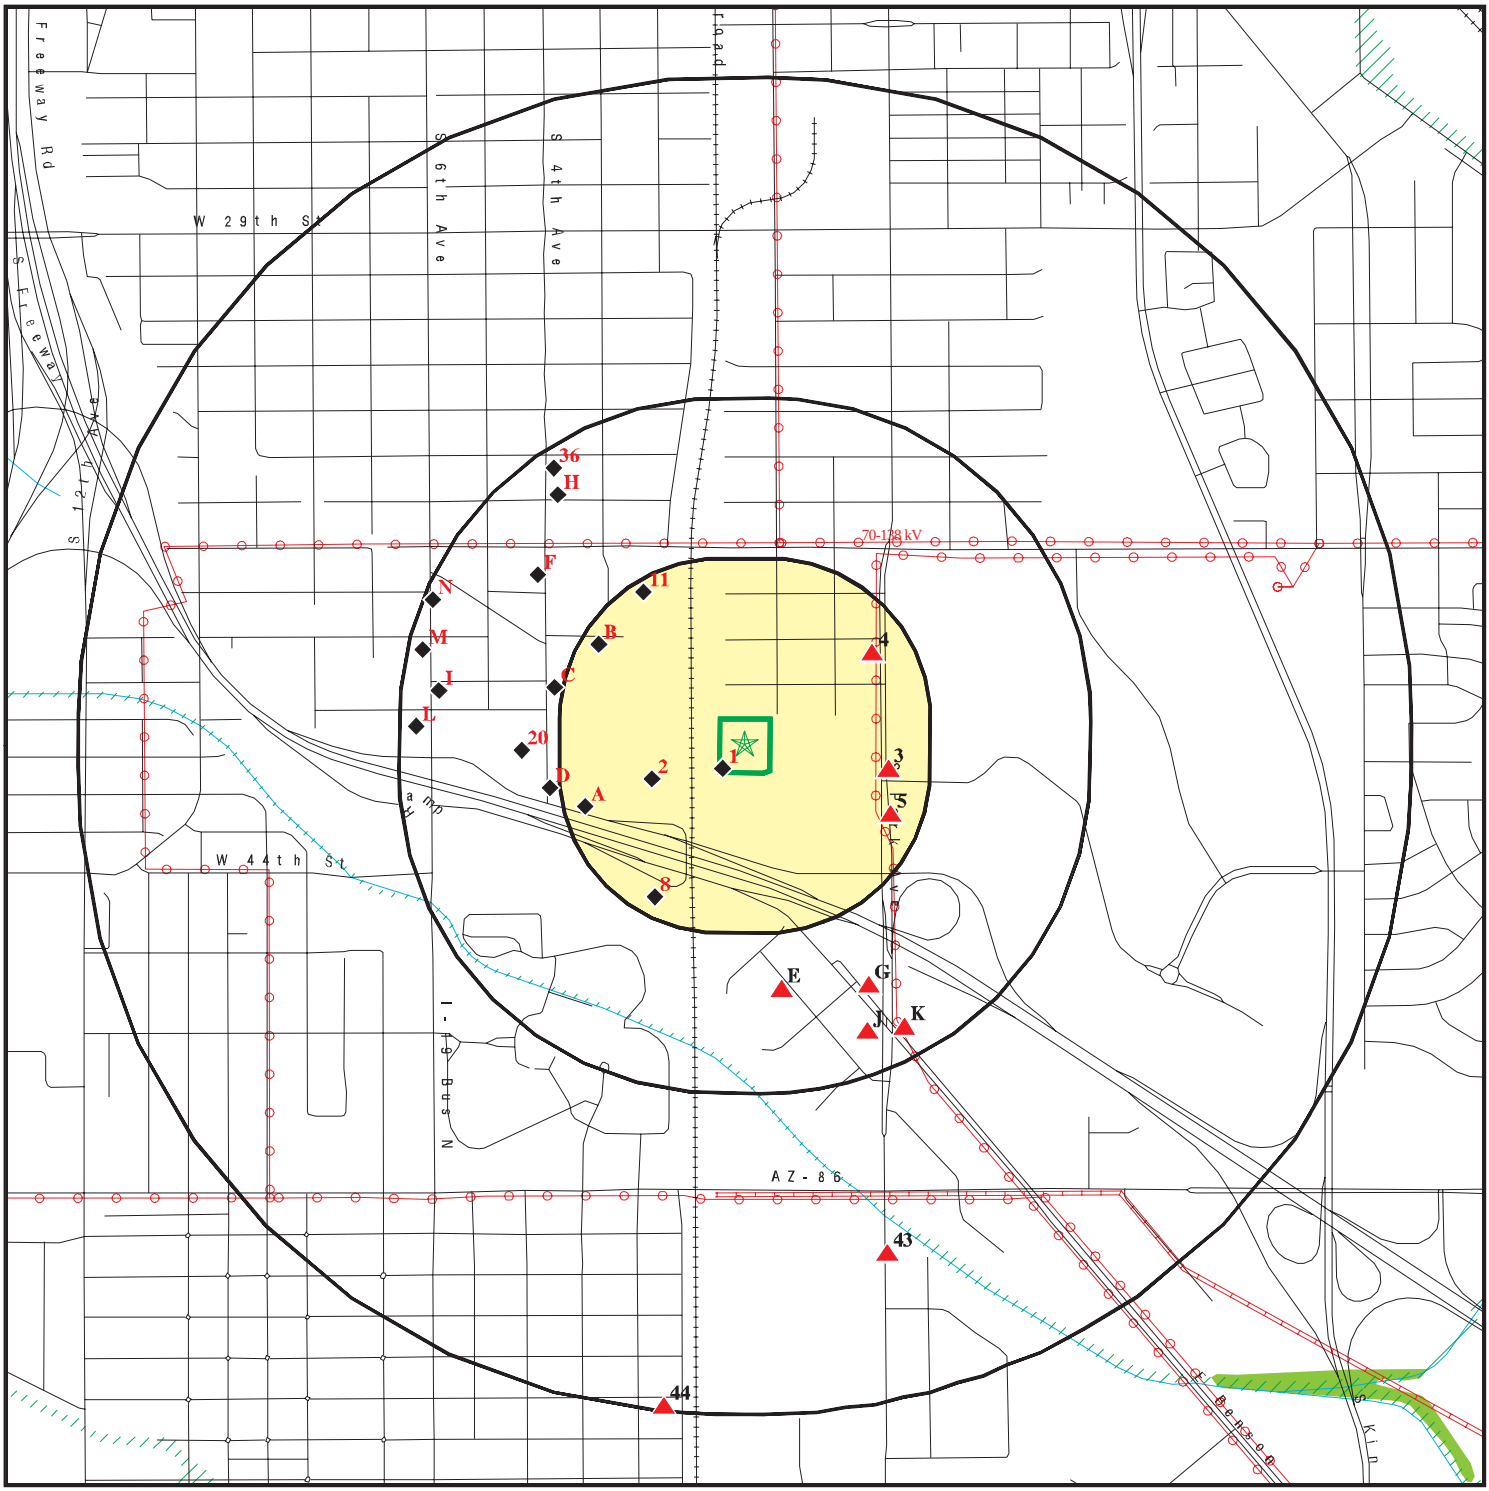

0 1/4 1/2 1 Miles

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Pipelines
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands
- DOD Sites: AZ DEQ
- Water Quality Assurance Revolving Fund Areas
- AZ NPL

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: JTED	CLIENT: Western Technologies, Inc.
ADDRESS: 751 East Marketplace Boulevard Tucson AZ 85713	CONTACT: Kenna Karjala
LAT/LONG: 32.18794 / 110.959997	INQUIRY #: 7970166.2s DATE: April 25, 2025 4:00 pm

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

DETAIL MAP - 7970166.2S

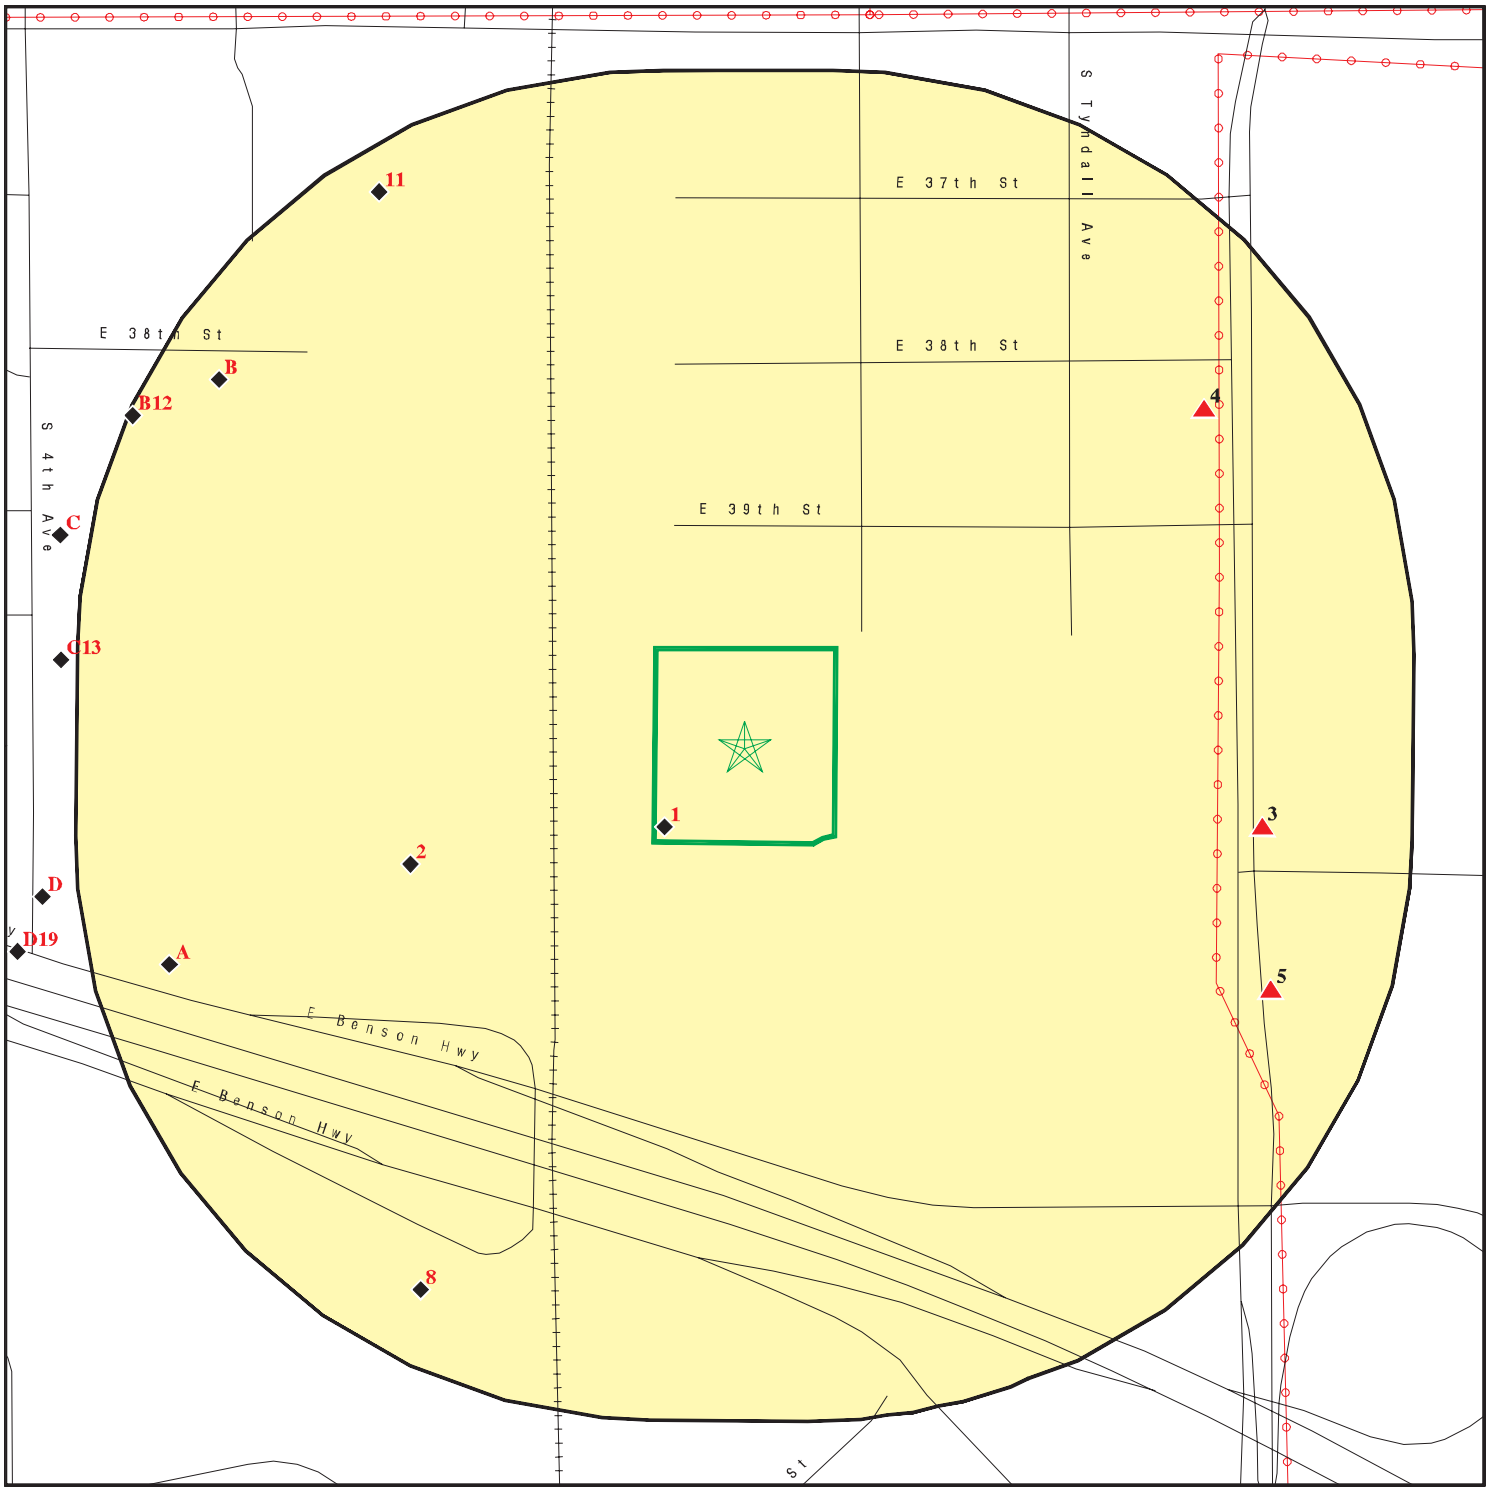

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- Power transmission lines
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- DOD Sites: AZ DEQ
- Water Quality Assurance Revolving Fund Areas
- AZ NPL

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME:	JTED	CLIENT:	Western Technologies, Inc.
ADDRESS:	751 East Marketplace Boulevard Tucson AZ 85713	CONTACT:	Kenna Karjala
LAT/LONG:	32.18794 / 110.959997	INQUIRY #:	7970166.2s
		DATE:	April 25, 2025 4:02 pm

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
Lists of Federal NPL (Superfund) sites								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
Lists of Federal Delisted NPL sites								
Delisted NPL	1.000		0	0	0	0	NR	0
Lists of Federal sites subject to CERCLA removals and CERCLA orders								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
Lists of Federal CERCLA sites with NFRAP								
SEMS-ARCHIVE	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA facilities undergoing Corrective Action								
CORRACTS	1.000		0	0	0	0	NR	0
Lists of Federal RCRA TSD facilities								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
Lists of Federal RCRA generators								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-VSQG	0.250		0	0	NR	NR	NR	0
Federal institutional controls / engineering controls registries								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
Federal ERNS list								
ERNS	0.001		0	NR	NR	NR	NR	0
Lists of state- and tribal (Superfund) equivalent sites								
AZ NPL	1.000		0	0	0	0	NR	0
AZ WQARF	1.000		0	0	0	0	NR	0
Lists of state- and tribal hazardous waste facilities								
SPL	1.000		0	0	0	0	NR	0
SHWS	1.000		0	0	0	2	NR	2
Lists of state and tribal landfills and solid waste disposal facilities								
SWF/LF	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Lists of state and tribal leaking storage tanks								
LUST	0.500		0	0	10	NR	NR	10
INDIAN LUST	0.500		0	0	0	NR	NR	0
Lists of state and tribal registered storage tanks								
FEMA UST	0.250		0	0	NR	NR	NR	0
UST	0.250		0	5	NR	NR	NR	5
AST	0.250		0	1	NR	NR	NR	1
INDIAN UST	0.250		0	0	NR	NR	NR	0
State and tribal institutional control / engineering control registries								
AZURITE	0.500		0	0	6	NR	NR	6
AUL	0.500		0	0	0	NR	NR	0
Lists of state and tribal voluntary cleanup sites								
INDIAN VCP	0.500		0	0	0	NR	NR	0
VCP	0.500		0	0	0	NR	NR	0
Lists of state and tribal brownfield sites								
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		1	2	10	NR	NR	13
Local Lists of Landfill / Solid Waste Disposal Sites								
SWTIRE	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
CDL	0.001		0	NR	NR	NR	NR	0
US CDL	0.001		0	NR	NR	NR	NR	0
Local Land Records								
LIENS 2	0.001		0	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
SPILLS	0.001		0	NR	NR	NR	NR	0
SPILLS 90	0.001		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		0	2	NR	NR	NR	2

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001		0	NR	NR	NR	NR	0
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
MINES MRDS	0.250		0	1	NR	NR	NR	1
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	0.001		0	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
DOCKET HWC	0.001		0	NR	NR	NR	NR	0
ECHO	0.001		0	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
PFAS NPL	0.250		0	0	NR	NR	NR	0
PFAS FEDERAL SITES	0.250		0	0	NR	NR	NR	0
PFAS TRIS	0.250		0	0	NR	NR	NR	0
PFAS TSCA	0.250		0	0	NR	NR	NR	0
PFAS RCRA MANIFEST	0.250		0	0	NR	NR	NR	0
PFAS ATSDR	0.250		0	0	NR	NR	NR	0
PFAS WQP	0.250		0	0	NR	NR	NR	0
PFAS NPDES	0.250		0	0	NR	NR	NR	0
PFAS PROJECT	0.250		0	0	NR	NR	NR	0
PFAS ECHO	0.250		0	0	NR	NR	NR	0
PFAS ECHO FIRE TRAIN	0.250		0	0	NR	NR	NR	0
PFAS PT 139 AIRPORT	0.250		0	0	NR	NR	NR	0
AQUEOUS FOAM NRC	0.250		0	0	NR	NR	NR	0
BIOSOLIDS	0.001		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
UST FINDER	0.250		0	0	NR	NR	NR	0
UST FINDER RELEASE	0.500		0	0	10	NR	NR	10
E MANIFEST	0.250		0	0	NR	NR	NR	0
PFAS	0.250		0	0	NR	NR	NR	0
AQUEOUS FOAM	0.250		0	0	NR	NR	NR	0
AIRS	0.001		0	NR	NR	NR	NR	0
Aquifer	0.001		0	NR	NR	NR	NR	0
AZ DOD	0.500		0	0	0	NR	NR	0
Dry Wells	0.001		0	NR	NR	NR	NR	0
DRYCLEANERS	0.250		0	0	NR	NR	NR	0
EMAP	0.001		1	NR	NR	NR	NR	1
Enforcement	0.001		0	NR	NR	NR	NR	0
Financial Assurance	0.001		0	NR	NR	NR	NR	0
MANIFEST	0.250		0	0	NR	NR	NR	0
SPDES	0.001		0	NR	NR	NR	NR	0
VAPOR	0.500		0	0	0	NR	NR	0
UIC	0.001		0	NR	NR	NR	NR	0
WWFAC	0.500		0	0	0	NR	NR	0
DRYWELLS HIST	0.001		0	NR	NR	NR	NR	0
EDR HIGH RISK HISTORICAL RECORDS								
EDR Exclusive Records								
EDR MGP	1.000		0	0	0	0	NR	0
EDR Hist Auto	0.125		0	NR	NR	NR	NR	0
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0
EDR RECOVERED GOVERNMENT ARCHIVES								
Exclusive Recovered Govt. Archives								
RGA HWS	0.001		0	NR	NR	NR	NR	0
RGA LF	0.001		0	NR	NR	NR	NR	0
RGA LUST	0.001		0	NR	NR	NR	NR	0
- Totals --		0	2	11	36	2	0	51

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

1 **JTED 2 AT BRIDGES OUTFALL 4** **EMAP** **S131735816**
N/A

< 1/8 **, AZ**
1 ft.

Relative: **Lower**

Actual: **2458 ft.**

EMAP:

Name:	JTED 2 AT BRIDGES OUTFALL 4
Address:	Not reported
City,State,Zip:	AZ
ID Number:	231515
Township:	Not reported
Range:	Not reported
Section:	Not reported
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.18743000
Longitude:	-110.96059
Collection Method:	PROVIDED BY OWNER/OPERATOR
Place Type:	STORMWATER DISCHARGE POINT
Place Type Code:	RO
Place C Code:	REGULATED OBJECTS
Facility Status:	ACTIVE
End Date:	Not reported
Verified:	Y

---

2 **SPANISH TRAILS EAST** **US BROWNFIELDS** **1024241774**
WSW **425 EAST BENSON HIGHWAY** **FINDS** **N/A**
< 1/8 **TUCSON, AZ 85713**
0.106 mi.
558 ft.

Relative: **Lower**

Actual: **2452 ft.**

US BROWNFIELDS:

Name:	Spanish Trails East
Address:	425 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238600
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-038B
Parcel Size:	7.81
Latitude:	32.187193
Longitude:	-110.962466
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-06-28 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-09-24 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	180
Below Poverty Percent:	25.21
Meidan Income:	315
Meidan Income Number:	482
Meidan Income Percent:	67.51
Vacant Housing Number:	49
Vacant Housing Percent:	16.19
Unemployed Number:	52
Unemployed Percent:	7.28

Name:	Spanish Trails East
Address:	425 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238600
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-038B
Parcel Size:	7.81
Latitude:	32.187193
Longitude:	-110.962466
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	180
Below Poverty Percent:	25.21
Meidan Income:	315
Meidan Income Number:	482
Meidan Income Percent:	67.51
Vacant Housing Number:	49
Vacant Housing Percent:	16.19
Unemployed Number:	52
Unemployed Percent:	7.28

Name:	Spanish Trail Task 3
Address:	425 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228295
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-038B
Parcel Size:	8.6

SPANISH TRAILS EAST (Continued) **1024241774**

Latitude:	32.187193
Longitude:	-110.962466
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2015-03-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2015-05-03 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	8.6
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	180
Below Poverty Percent:	25.21
Meidan Income:	315
Meidan Income Number:	482
Meidan Income Percent:	67.51
Vacant Housing Number:	49
Vacant Housing Percent:	16.19
Unemployed Number:	52
Unemployed Percent:	7.28

SPANISH TRAILS EAST (Continued) **1024241774**

Name:	Spanish Trail Task 3
Address:	425 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228295
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-038B
Parcel Size:	8.6
Latitude:	32.187193
Longitude:	-110.962466
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported

SPANISH TRAILS EAST (Continued) **1024241774**

Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	8.6
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	180

SPANISH TRAILS EAST (Continued) **1024241774**

Below Poverty Percent:	25.21
Meidan Income:	315
Meidan Income Number:	482
Meidan Income Percent:	67.51
Vacant Housing Number:	49
Vacant Housing Percent:	16.19
Unemployed Number:	52
Unemployed Percent:	7.28

FINDS:
Registry ID: 110070247586

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

---

3 **SINCLAIR RETAIL #02002 ADOT POS** **UST** **U001627038**
East **3231 S PARK AVE** **N/A**
1/8-1/4 **TUCSON, AZ 85713**
0.185 mi.
978 ft.

Relative:
Higher

Actual:
2468 ft.

UST:

Name:	SINCLAIR RETAIL #02002 ADOT POS
Address:	3231 S PARK AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004534
Owner:	ARIZONA DEPARTMENT OF TRANSPORTATION
Latitude:	32.186478
Longitude:	110.956648
Tank ID:	1
Date Closed:	12/28/1990
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**04/21/1966**
Capacity:	**8000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Pressure**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**
Tank ID:	2
Date Closed:	12/28/1990
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**04/21/1966**
Capacity:	**8000**

SINCLAIR RETAIL #02002 ADOT POS (Continued) **U001627038**

Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Unknown**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 3
Date Closed: 12/28/1990
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **04/21/1966**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Unknown**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

4
NE
1/8-1/4
0.190 mi.
1005 ft.

SINCLAIR OIL CORP **UST** **U004120143**
2808 S PARK AVE **N/A**
TUCSON, AZ 85713

Relative:
Higher

Actual:
2463 ft.

UST:
Name: SINCLAIR OIL CORP
Address: 2808 S PARK AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-010029
Owner: None
Latitude: 32.190309
Longitude: 110.955898

Tank ID: 1
Date Closed: 10/27/2004
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1960**
Capacity: **2000**
Substance: **Unidentified**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 10/27/2004
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1960**
Capacity: **6000**
Substance: **Unidentified**

SINCLAIR OIL CORP (Continued) **U004120143**

Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

---

5 **ADOT/E-Z FILL** **UST** **U001627037**
ESE **3345 S PARK AVE** **N/A**
1/8-1/4 **TUCSON, AZ 85713**
0.200 mi.
1057 ft.

Relative:
Higher

Actual:
2469 ft.

UST:
Name: ADOT/E-Z FILL
Address: 3345 S PARK AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-004532
Owner: ARIZONA DEPARTMENT OF TRANSPORTATION
Latitude: 32.18235
Longitude: 110.956511

Tank ID: 1
Date Closed: 12/28/1990
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **04/21/1966**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 12/28/1990
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **04/21/1966**
Capacity: **8000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 3
Date Closed: 12/28/1990
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **04/21/1966**
Capacity: **6000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**

ADOT/E-Z FILL (Continued) **U001627037**

Tank Const Type: **Double Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

A6 **OLD SPANISH TRAIL** **RCRA NonGen / NLR** **1025826595**
WSW **305 S BENSON HWY** **AZS000043497**
1/8-1/4 **TUCSON, AZ 85713**
0.216 mi.
1141 ft. **Site 1 of 2 in cluster A**

Relative: **Lower**
Actual: **2457 ft.**

RCRA Listings:

Date Form Received by Agency:		20040831
Handler Name:		Old Spanish Trail
Handler Address:		305 S Benson Hwy
Handler City,State,Zip:		TUCSON, AZ 85713
EPA ID:		AZS000043497
Contact Name:		UNKNOWN UNKNOWN
Contact Address:		305 S BENSON HWY
Contact City,State,Zip:		TUCSON, AZ 85713
Contact Telephone:		602-207-2222
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		09
Land Type:		Private
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		305 S BENSON HWY
Mailing City,State,Zip:		TUCSON, AZ 85713
Owner Name:	Old Spanish Trail	
Owner Type:		Private
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline

OLD SPANISH TRAIL (Continued) **1025826595**

2018 GPRA Renewals Baseline:	Not on the Baseline
202 GPRA Corrective Action Baseline:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20040831
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name: OLD SPANISH TRAIL	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	305 S BENSON HWY
Owner/Operator City,State,Zip:	TUCSON, AZ 85713
Owner/Operator Telephone:	602-207-2222
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: OLD SPANISH TRAIL	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	305 S BENSON HWY
Owner/Operator City,State,Zip:	TUCSON, AZ 85713
Owner/Operator Telephone:	602-207-2222
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20040831
Handler Name: OLD SPANISH TRAIL	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No

OLD SPANISH TRAIL (Continued) **1025826595**

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020517
Handler Name: OLD SPANISH TRAIL
Federal Waste Generator Description: Very Small Quantity Generator (formerly Conditionally-Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Has the Facility Received Notices of Violations:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported

OLD SPANISH TRAIL (Continued) **1025826595**

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Evaluation Action Summary:

Evaluation Date:	20020226
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R9STA
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

A7 **SPANISH TRAIL TASK 2** **US BROWNFIELDS** **1024241773**
WSW **305 EAST BENSON HIGHWAY** **FINDS** **N/A**
1/8-1/4 **TUCSON, AZ 85713**
0.216 mi.
1141 ft. **Site 2 of 2 in cluster A**

Relative: **Lower**

Actual: **2457 ft.**

US BROWNFIELDS:

Name:	Spanish Trail Task 2
Address:	305 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228292
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-020C and 119-01-037D
Parcel Size:	7.07
Latitude:	32.1870918
Longitude:	-110.9638996
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported

SPANISH TRAIL TASK 2 (Continued) **1024241773**

Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported

SPANISH TRAIL TASK 2 (Continued) **1024241773**

RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	7.07
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	320
Below Poverty Percent:	32.49
Meidan Income:	1810
Meidan Income Number:	675
Meidan Income Percent:	68.53
Vacant Housing Number:	59
Vacant Housing Percent:	14.44
Unemployed Number:	67
Unemployed Percent:	6.8

Name:	Spanish Trail Task 2
Address:	305 East Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228292
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-020C and 119-01-037D
Parcel Size:	7.07
Latitude:	32.1870918
Longitude:	-110.9638996
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported

SPANISH TRAIL TASK 2 (Continued) **1024241773**

Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2015-03-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2015-04-22 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported

SPANISH TRAIL TASK 2 (Continued) **1024241773**

Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	7.07
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	320
Below Poverty Percent:	32.49
Meidan Income:	1810
Meidan Income Number:	675
Meidan Income Percent:	68.53
Vacant Housing Number:	59
Vacant Housing Percent:	14.44
Unemployed Number:	67
Unemployed Percent:	6.8

FINDS:
Registry ID: 110070247585

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA)

SPANISH TRAIL TASK 2 (Continued) **1024241773**

performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

---

8 **UNKNOWN** **MINES MRDS** **1025730264**
SSW **N/A**
1/8-1/4 **PIMA (County), AZ**
0.218 mi.
1153 ft.

Relative:
Lower

Actual:
2459 ft.

MINES MRDS:

Name:	UNKNOWN
Address:	Not reported
Deposit identification Number:	10255712
City,State,Zip:	ARIZONA
URL:	
MRDS Identification Number:	Not reported
MAS/MILS Identification Number:	40190836
Region:	NA
Country:	United States
Primary Commodities:	Geothermal
Secondary Commodities:	Not reported
Tertiary Commodities:	Not reported
Operation Type:	Well
Deposit Type:	Not reported
Production Size:	Not reported
Development Status:	Occurrence
Ore Minerals or Materials:	Not reported
Gangue Minerals or Materials:	Not reported
Other Minerals or Materials:	Not reported
Ore Body Form:	Not reported
Workings Type:	Not reported
Mineral Deposit Model:	Not reported
Alteration Processes:	Not reported
Concentration Processes:	Not reported
Previous Names:	Not reported
Ore Controls:	Not reported
Reporter:	Not reported
Host Rock Unit Name:	Not reported
Host Rock Type:	Not reported
Associated Rock Unit Name:	Not reported
Associated Rock Type Code:	Not reported
Structural Characteristics:	Not reported
Tectonic Setting:	Not reported
References:	Not reported
First Production Year:	Not reported
Began Before/After FPY:	Not reported
Last Production Year:	Not reported
Ended Before/After LPY:	Not reported
Year Discovered:	Not reported
Found Before/After YD:	Not reported
Production History:	Not reported
Discovery Information:	Not reported
Latitude:	32.18452
Longitude:	-110.96239
Object ID:	249313
Score:	Not reported

B9 **LAKE SHORE INC** **RCRA NonGen / NLR** **1000198584**
NW **400 E 38TH ST** **FINDS** **AZD982484560**
1/8-1/4 **TUCSON, AZ 85713** **ECHO**
0.222 mi.
1172 ft. **Site 1 of 3 in cluster B**

Relative: **Lower**
Actual: **2449 ft.**

RCRA Listings:

Date Form Received by Agency:		20211104
Handler Name:		Lake Shore Equipment Inc
Handler Address:		400 E 38th St
Handler City,State,Zip:		TUCSON, AZ 85713
EPA ID:		AZD982484560
Contact Name:		Not reported
Contact Address:		Not reported
Contact City,State,Zip:		Not reported
Contact Telephone:		Not reported
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		09
Land Type:		Other
Federal Waste Generator Description:		Not a generator, verified
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Not reported
State District Owner:		Not reported
State District:		Not reported
Mailing Address:		Not reported
Mailing City,State,Zip:		Not reported
Owner Name:	Not reported	
Owner Type:		Not reported
Operator Name:	Not reported	
Operator Type:		Not reported
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		N
Sub-Part K Indicator:		Not reported
2018 GPRA Permit Baseline:		Not on the Baseline
2018 GPRA Renewals Baseline:		Not on the Baseline
202 GPRA Corrective Action Baseline:		No
Subject to Corrective Action Universe:		No
Non-TSDFs Where RCRA CA has Been Imposed Universe:		No
Corrective Action Priority Ranking:		No NCAPS ranking
Environmental Control Indicator:		No
Institutional Control Indicator:		No

LAKE SHORE INC (Continued) **1000198584**

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20211104
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name: NOT REQUIRED	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, ME 99999
Owner/Operator Telephone:	415-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name: LAKE SHORE INC	
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, ME 99999
Owner/Operator Telephone:	415-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20211104
Handler Name: LAKE SHORE EQUIPMENT INC	
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

LAKE SHORE INC (Continued) **1000198584**

Receive Date: 19900322
Handler Name: LAKE SHORE EQUIPMENT INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110002584454

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Resource Conservation and Recovery Act Information System (RCRAInfo) is EPA's comprehensive information system in support of the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. It tracks many types of information about generators, transporters, treaters, storers, and disposers of hazardous waste.
The Arizona Unified Repository for Informational Tracking of the Environment (AZURITE) is a database used by the Arizona Department of Environmental Quality (ADEQ) for environmental enforcement and compliance reporting to the Permit and Compliance System (PCS) and to the Air Facility System Universal Interface (AFS-UI).

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000198584
Registry ID: 110002584454

DFR URL:
Name: LAKE SHORE INC
Address: 400 E 38TH ST
City,State,Zip: TUCSON, AZ 85713

B10 **LAKE SHORE INC** **UST** **U001628135**
NW **400 E 38TH ST** **AST** **N/A**
1/8-1/4 **TUCSON, AZ 85713**
0.222 mi.
1172 ft. **Site 2 of 3 in cluster B**

Relative:
Lower

Actual:
2449 ft.

UST:

Name:	LAKE SHORE INC
Address:	400 E 38TH ST
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-006690
Owner:	LAKE SHORE INC
Latitude:	32.190048
Longitude:	110.963837
Tank ID:	1
Date Closed:	01/31/1990
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**01/01/1979**
Capacity:	**1500**
Substance:	**Used Oil/Waste Oil**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Unknown**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**
Tank ID:	2
Date Closed:	01/31/1990
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**10000**
Substance:	**Diesel**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Unknown**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**
Tank ID:	3
Date Closed:	01/31/1990
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**10000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Unknown**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

AST 2:

Name:	LAKE SHORE INC

LAKE SHORE INC (Continued) **U001628135**

Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	8
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2540
Installed Date:	02/14/2002
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC
Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	9
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2250
Installed Date:	03/28/2003
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC
Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	7
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2450
Installed Date:	05/03/2000
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC

LAKE SHORE INC (Continued) **U001628135**

Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	6
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2000
Installed Date:	05/16/2000
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC
Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	5
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2450
Installed Date:	11/08/1993
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC
Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	4
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2000
Installed Date:	11/08/1993
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

Name:	LAKE SHORE INC

LAKE SHORE INC (Continued) **U001628135**

Address:	400 E 38TH ST
City:	TUCSON
Exemption Num:	1000589-11
Old Exemption Num:	10-1000024
Owner Id:	256
Owner Name:	Borderland Construction Co
Applicant Mailing Address:	400 E 38th St
Applicant City, State, Zip:	Tucson, AZ 85713-4871
Cert Status:	Closed
Cert Effective Date:	10/16/1990
Tank Number:	10
Product Code:	Compartment Tank
Tank Type:	Above
Capacity:	2500
Installed Date:	09/05/2005
Cancellation Date:	12/13/2022
Cert Validation Date:	04/01/2011

11
NNW
1/8-1/4
0.231 mi.
1220 ft.

GREYHOUND SITE **US BROWNFIELDS** **1031217199**
2601 SOUTH 3RD AVENUE **FINDS** **N/A**
TUCSON, AZ 85713

Relative:
Lower

Actual:
2448 ft.

US BROWNFIELDS:

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	ESA
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious

GREYHOUND SITE (Continued) **1031217199**

Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported

GREYHOUND SITE (Continued) **1031217199**

RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	ESA
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	ESA
Assessment Funding:	Not reported
Assessment Funding Source:	Private/Other Funding
Redevelopment Funding:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2022-05-05 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-05-26 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported

GREYHOUND SITE (Continued) **1031217199**

RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported

GREYHOUND SITE (Continued) **1031217199**

RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson

GREYHOUND SITE (Continued) **1031217199**

Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Sampling and Analysis Plan
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	ESA
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2024-03-13 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2024-04-12 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77

GREYHOUND SITE (Continued) **1031217199**

Unemployed Number:	236
Unemployed Percent:	8.7
Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported

GREYHOUND SITE (Continued) **1031217199**

IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	ESA
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Private/Other Funding
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2022-05-05 00:00:00
Ownership Entity:	Private

GREYHOUND SITE (Continued) **1031217199**

Additional Institutional Controls Information:	Not reported
Completion Date:	2022-05-26 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	ESA
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2023-06-19 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2024-01-08 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported

GREYHOUND SITE (Continued) **1031217199**

RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2023-03-10 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2023-09-08 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported

GREYHOUND SITE (Continued) **1031217199**

RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7

GREYHOUND SITE (Continued) **1031217199**

Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Sampling and Analysis Plan
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Sampling and Analysis Plan
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2024-03-13 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2024-04-12 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported

GREYHOUND SITE (Continued) **1031217199**

ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

GREYHOUND SITE (Continued) **1031217199**

Click this hyperlink while viewing on your computer to access
8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

Name:	Greyhound Site
Address:	2601 South 3rd Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	255537
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	Not reported
Parcel Size:	16.7
Latitude:	32.191705812
Longitude:	-110.96272255
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Sampling and Analysis Plan
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	VOCs, Lead, Other Metals, SVOCs,
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Evaluate Reuse options that are climate conscious
Cooperative Agreement Number:	98T07001
Start Date:	2024-03-13 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2024-04-12 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	Not reported
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported

GREYHOUND SITE (Continued) **1031217199**

Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1095
Below Poverty Percent:	40.38
Meidan Income:	3455
Meidan Income Number:	2013
Meidan Income Percent:	74.23
Vacant Housing Number:	192
Vacant Housing Percent:	16.77
Unemployed Number:	236
Unemployed Percent:	8.7

Click this hyperlink while viewing on your computer to access
8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

FINDS:
Registry ID: 110071715991

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

B12 **HOLSUM BAKERY INC** **UST** **U000017206**
WNW **2801 S 4TH AVE** **N/A**
1/8-1/4 **TUCSON, AZ 85713**
0.248 mi.
1308 ft. **Site 3 of 3 in cluster B**

Relative:
Lower

Actual:
2448 ft.

UST:

Name:	HOLSUM BAKERY INC
Address:	2801 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-002509
Owner:	HOLSUM BAKERY INC
Latitude:	32.190103
Longitude:	110.964909
Tank ID:	1
Date Closed:	12/21/1989
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**03/10/1961**
Capacity:	**10000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Single Walled**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

C13
West
1/4-1/2
0.257 mi.
1357 ft.

PRIMAVERA HOMELESS SHELTER
3001 SOUTH 4TH AVENUE
TUCSON, AZ 85713

Site 1 of 3 in cluster C

US BROWNFIELDS FINDS | **1024241858** / **N/A**

Relative:
Lower

Actual:
2449 ft.

US BROWNFIELDS:

Name:	Primavera Homeless Shelter
Address:	3001 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	235761
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-021A
Parcel Size:	0.84
Latitude:	32.188513
Longitude:	-110.9648
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I, LAS, LBP
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I, LAS, LBP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Asbestos Lead
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2017-08-16 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2017-10-10 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

PRIMAVERA HOMELESS SHELTER (Continued) **1024241858**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.84
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	0.84
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

PRIMAVERA HOMELESS SHELTER (Continued) **1024241858**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	802
Below Poverty Percent:	45.21
Meidan Income:	3238
Meidan Income Number:	1308
Meidan Income Percent:	73.73
Vacant Housing Number:	100
Vacant Housing Percent:	13.45
Unemployed Number:	143
Unemployed Percent:	8.06

Name:	Primavera Homeless Shelter
Address:	3001 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	235761
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-021A
Parcel Size:	0.84
Latitude:	32.188513
Longitude:	-110.9648
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I, LAS, LBP
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Asbestos Lead
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	Y
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported

PRIMAVERA HOMELESS SHELTER (Continued) **1024241858**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.84
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

PRIMAVERA HOMELESS SHELTER (Continued) **1024241858**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	0.84
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	802
Below Poverty Percent:	45.21
Meidan Income:	3238
Meidan Income Number:	1308
Meidan Income Percent:	73.73
Vacant Housing Number:	100
Vacant Housing Percent:	13.45
Unemployed Number:	143
Unemployed Percent:	8.06

FINDS:
Registry ID: 110070247674

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

C14 **PAYLESS CASHWAYS** **LUST** **U004119796**
WNW **2901 S 4TH AVE** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **AZURITE**
0.262 mi. **EMAP**
1385 ft. **Site 2 of 3 in cluster C**

Relative:
Lower

Actual:
2447 ft.

LUST:

Name:	PAYLESS CASHWAYS
Address:	2901 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-007077
Lust Number:	0702.01
Facility Status:	CLOSED
Leak Priority:	5G1
Priority Description:	Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification:	04/21/89
Date Closed:	12/07/98

Name:	PAYLESS CASHWAYS
Address:	2901 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713

PAYLESS CASHWAYS (Continued) **U004119796**

Facility ID: 0-007077
Lust Number: 0702.02
Facility Status: CLOSED
Leak Priority: 5G1
Priority Description: Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification: 04/21/89
Date Closed: 12/07/98

Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-007077
Lust Number: 0702.03
Facility Status: CLOSED
Leak Priority: 5G1
Priority Description: Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification: 04/21/89
Date Closed: 12/07/98

UST:
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-007077
Owner: WOOD BROTHERS LUMBER CO
Latitude: 32.189232
Longitude: 110.964416

Tank ID: 1
Date Closed: 05/29/1991
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: Not reported
Capacity: 1000
Substance: Unleaded Gasoline
Compartment: COMPARTMENT A
Tank Const Type: Not reported
Tank Mtrl Type: Asphalt coated or Bare Steel
Pipe Type: Not reported
Pipe Mtrl Type: Not reported
Pipe const Type: Not reported

AZURITE:
Remediation Level Achieved: HBGL Residential
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 795
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0702.01
Type: OTHER
Remediation Start Date: 08/10/1989
Remediation End Date: 12/07/1998
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported

PAYLESS CASHWAYS (Continued) **U004119796**

DEUR Release Date: Not reported

AZURITE:
Remediation Id: 795
Standard Types: Health Based Guidance Level
Contaminants: TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentraction Mg/Kg: 530
Depth Feet: 41

Remediation Level Achieved: HBGL Residential
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 796
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0702.02
Type: OTHER
Remediation Start Date: 08/10/1989
Remediation End Date: 12/07/1998
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

Remediation Level Achieved: HBGL Residential
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 2247
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0702.03
Type: OTHER
Remediation Start Date: 08/10/1989
Remediation End Date: 12/07/1998
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

EMAP:
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
ID Number: 4054
Township: 14
Range: 13
Section: 25
Quarter 1: Not reported
Quarter 2: Not reported
Quarter 3: Not reported
Latitude: 32.18923239
Longitude: -110.96441679
Collection Method: GPS WITH CORRECTION < 3 METER ERROR
Place Type: RETAIL STORE
Place Type Code: PP
Place C Code: PHYSICAL PROPERTIES

PAYLESS CASHWAYS (Continued) **U004119796**

Facility Status: ACTIVE
End Date: Not reported
Verified: Y

C15 **PAYLESS CASHWAYS** **UST FINDER** **1028177023**
WNW **2901 S 4TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.262 mi.
1385 ft. **Site 3 of 3 in cluster C**

Relative:
Lower

Actual:
2447 ft.

UST FINDER:
Object ID: 25138
Facility ID: AZ0-007077
Name: PAYLESS CASHWAYS
Address: 2901 S 4TH AVE
City,State,Zip: TUCSON, AZ
Address Match Type: Not reported
Open USTs: 0
Closed USTs: 1
TOS USTs: 0
Population 1500ft: 506
Private Wells 1500ft: 1
Within 100yr Floodplain: No
Land Use: Developed, High Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Facility Status: Closed UST(s)
Date of Last Inspection: Not reported
EPA Region: 9
Tribe: Not reported
Coordinate Source: State
X Coord: -110.964416793
Y Coord: 32.1892323860001
Latitude: 32.189232386
Longitude: -110.964416793

UST FINDER:
Object ID: 69835
Facility ID: AZ0-007077
Tank ID: AZ0-007077_1
Tank Status: Closed
Installation Date: Not reported
Removal Date: 1991/05/29 15:59:59+00
Tank Capacity: 1000
Substances: Gasoline
Tank Wall Type: Not reported

UST FINDER RELEASE:
Object ID: 462641

PAYLESS CASHWAYS (Continued) **1028177023**

Facility ID:	AZ0-007077
Lust ID:	AZ0-007077-702.03
Name:	PAYLESS CASHWAYS
Address:	2901 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	StreetAddress
Reported Date:	1989/04/21 16:00:00+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	467
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.965230423
Y Coord:	32.189343493
Latitude:	32.1893434929711
Longitude:	-110.965230423331

Object ID:	462642
Facility ID:	AZ0-007077
Lust ID:	AZ0-007077-702.02
Name:	PAYLESS CASHWAYS
Address:	2901 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	StreetAddress
Reported Date:	1989/04/21 16:00:00+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	467
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported

PAYLESS CASHWAYS (Continued) **1028177023**

WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.965230423
Y Coord:	32.189343493
Latitude:	32.1893434929711
Longitude:	-110.965230423331

Object ID:	462644
Facility ID:	AZ0-007077
Lust ID:	AZ0-007077-702.01
Name:	PAYLESS CASHWAYS
Address:	2901 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	StreetAddress
Reported Date:	1989/04/21 16:00:00+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	467
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.965230423
Y Coord:	32.189343493
Latitude:	32.1893434929711
Longitude:	-110.965230423331

D16
WSW
1/4-1/2
0.266 mi.
1402 ft.

SPANISH TRAILS WEST
3255 SOUTH 4TH AVENUE
TUCSON, AZ 85713

Site 1 of 4 in cluster D

US BROWNFIELDS FINDS | **1024241766 N/A**

Relative:
Lower

Actual:
2454 ft.

US BROWNFIELDS:

Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Comprehensive Asbestos Survey
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	Not reported
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Comprehensive Asbestos Survey
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Comprehensive Asbestos Survey
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-06-28 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-10-16 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301

SPANISH TRAILS WEST (Continued) **1024241766**

Start Date:	2018-06-28 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-10-16 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trail Task 1
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228125
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-025C, 119-01-035B and 119-01-035F
Parcel Size:	1.69
Latitude:	32.186929
Longitude:	-110.9650309
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	1.69
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trail Task 1
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228125
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-025C, 119-01-035B and 119-01-035F
Parcel Size:	1.69
Latitude:	32.186929
Longitude:	-110.9650309
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2015-03-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2015-04-22 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	1.69
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum

SPANISH TRAILS WEST (Continued) **1024241766**

Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Comprehensive Asbestos Survey
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-06-28 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-10-16 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118

SPANISH TRAILS WEST (Continued) **1024241766**

Unemployed Percent:	7.21
Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	Not reported
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

Name:	Spanish Trails West
Address:	3255 South 4th Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238601
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-035B and 119-01-035F
Parcel Size:	1.05
Latitude:	32.1869011
Longitude:	-110.9650536
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Comprehensive Asbestos Survey
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Asbestos
Contaminants Found at Actionable Level:	Asbestos
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-06-28 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-10-16 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported

SPANISH TRAILS WEST (Continued) **1024241766**

Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	701
Below Poverty Percent:	42.85
Meidan Income:	4903
Meidan Income Number:	1161
Meidan Income Percent:	70.97
Vacant Housing Number:	75
Vacant Housing Percent:	11.65
Unemployed Number:	118
Unemployed Percent:	7.21

FINDS:
Registry ID: 110070247576

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

D17 **SOUTH TUCSON HOSPITALITY GROUP** **UST FINDER** **1028174750**
WSW **3255 S 4TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ**
0.266 mi.
1402 ft. **Site 2 of 4 in cluster D**

Relative:
Lower

Actual:
2454 ft.

UST FINDER:

Object ID:	22865
Facility ID:	AZ0-004587
Name:	SOUTH TUCSON HOSPITALITY GROUP
Address:	3255 S 4TH AVE
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	4
TOS USTs:	0
Population 1500ft:	292
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported

SOUTH TUCSON HOSPITALITY GROUP (Continued) **1028174750**

SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.965030326
Y Coord:	32.1868697960001
Latitude:	32.186869796
Longitude:	-110.965030326

UST FINDER:

Object ID:	60249
Facility ID:	AZ0-004587
Tank ID:	AZ0-004587_2
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	2000/06/21 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Not reported

Object ID:	60250
Facility ID:	AZ0-004587
Tank ID:	AZ0-004587_4
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	2000/06/21 15:59:59+00
Tank Capacity:	280
Substances:	(Null)
Tank Wall Type:	Not reported

Object ID:	60251
Facility ID:	AZ0-004587
Tank ID:	AZ0-004587_3
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	2000/06/21 15:59:59+00
Tank Capacity:	10000
Substances:	Diesel
Tank Wall Type:	Not reported

Object ID:	60252
Facility ID:	AZ0-004587
Tank ID:	AZ0-004587_1
Tank Status:	Closed
Installation Date:	Not reported
Removal Date:	2000/06/21 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Not reported

SOUTH TUCSON HOSPITALITY GROUP (Continued) **1028174750**

UST FINDER RELEASE:

Object ID:	460084
Facility ID:	AZ0-004587
Lust ID:	AZ0-004587-5215.01
Name:	SOUTH TUCSON HOSPITALITY GROUP
Address:	3255 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2000/07/27 15:59:59+00
Status:	No Further Action
Substance:	Diesel
Population within 1500ft:	284
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.964987
Y Coord:	32.1867270000001
Latitude:	32.186727
Longitude:	-110.964987

D18 **SOUTH TUCSON HOSPITALITY GROUP** **LUST** **U001157534**
WSW **3255 S 4TH AVE** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **EMAP**
0.266 mi.
1402 ft. **Site 3 of 4 in cluster D**

Relative: **Lower**

Actual: **2454 ft.**

LUST:

Name:	SOUTH TUCSON HOSPITALITY GROUP
Address:	3255 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004587
Lust Number:	5215.01
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	07/27/00
Date Closed:	05/04/05

SOUTH TUCSON HOSPITALITY GROUP (Continued) **U001157534**

UST:

Name:	SOUTH TUCSON HOSPITALITY GROUP
Address:	3255 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004587
Owner:	SPANISH TRAIL INC
Latitude:	32.186869
Longitude:	110.965030

Tank ID:	1
Date Closed:	06/21/2000
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**10000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

Tank ID:	2
Date Closed:	06/21/2000
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**10000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

Tank ID:	3
Date Closed:	06/21/2000
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**10000**
Substance:	**Diesel**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

Tank ID:	4
Date Closed:	06/21/2000
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**280**

SOUTH TUCSON HOSPITALITY GROUP (Continued) **U001157534**

Substance:	**Not reported**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Unknown**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

EMAP:

Name:	SOUTH TUCSON HOSPITALITY GROUP
Address:	3255 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
ID Number:	30766
Township:	Not reported
Range:	Not reported
Section:	Not reported
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.18686980
Longitude:	-110.96503033
Collection Method:	LOCATED FROM COUNTY PARCEL INFORMATION
Place Type:	COMMERCIAL PROPERTY
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	ACTIVE
End Date:	Not reported
Verified:	Y

D19 **SPANISH TRAILS NORTH** **US BROWNFIELDS** **1025961775**
WSW **NE OF 4TH AVENUE AND BENSON HIGHWAY** **FINDS** **N/A**
1/4-1/2 **TUCSON, AZ 85713**
0.279 mi.
1475 ft. **Site 4 of 4 in cluster D**

Relative:
Lower

Actual:
2453 ft.

US BROWNFIELDS:

Name:	Spanish Trails North
Address:	Ne Of 4th Avenue And Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238602
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-020C and 119-01-025C
Parcel Size:	2.35
Latitude:	32.1866447
Longitude:	-110.9653687
Census Tract:	4019002400
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I

SPANISH TRAILS NORTH (Continued) **1025961775**

Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-06-28 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-09-18 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported

SPANISH TRAILS NORTH (Continued) **1025961775**

Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	556
Below Poverty Percent:	39.66
Meidan Income:	4924
Meidan Income Number:	963
Meidan Income Percent:	68.69
Vacant Housing Number:	58
Vacant Housing Percent:	10.67
Unemployed Number:	90
Unemployed Percent:	6.42

Name:	Spanish Trails North
Address:	Ne Of 4th Avenue And Benson Highway
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238602
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-01-020C and 119-01-025C
Parcel Size:	2.35
Latitude:	32.1866447
Longitude:	-110.9653687
Census Tract:	4019002400

SPANISH TRAILS NORTH (Continued) **1025961775**

State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	Not reported
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported

SPANISH TRAILS NORTH (Continued) **1025961775**

Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	556
Below Poverty Percent:	39.66
Meidan Income:	4924
Meidan Income Number:	963
Meidan Income Percent:	68.69
Vacant Housing Number:	58
Vacant Housing Percent:	10.67
Unemployed Number:	90
Unemployed Percent:	6.42

FINDS:
Registry ID: 110070570244

SPANISH TRAILS NORTH (Continued) **1025961775**

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

---

20 West 1/4-1/2 0.309 mi. 1629 ft. **CENTRO CARISMATICO CARISMATICO** **US BROWNFIELDS** **1014933242**
NWC 4TH AVENUE AND BENSON HIGHWAY **N/A**
SOUTH TUCSON, AZ 85713

Relative: Lower

Actual: 2450 ft.

US BROWNFIELDS:

Name:	Centro Carismatico Carismatico
Address:	Nwc 4th Avenue And Benson Highway
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	127941
Property Alias:	Not reported
Recipient Name:	South Tucson, City of
Grant Type:	Petroleum
Property Number:	119-01-0260, -0270, -0280, -0320, -0330, and -0340
Parcel Size:	4.04
Latitude:	32.187836
Longitude:	-110.965935
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	2B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	00T18701
Start Date:	2011-02-28 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2011-03-22 00:00:00
Address of Data Sources (URL if available) 1:	Not reported

CENTRO CARISMATICO CARISMATICO (Continued) **1014933242**

Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	4.04
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported

CENTRO CARISMATICO CARISMATICO (Continued) **1014933242**

Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	885
Below Poverty Percent:	44.61
Meidan Income:	6011
Meidan Income Number:	1432
Meidan Income Percent:	72.18
Vacant Housing Number:	97
Vacant Housing Percent:	12.07
Unemployed Number:	146
Unemployed Percent:	7.36

Name:	Centro Carismatico Carismatico
Address:	Nwc 4th Avenue And Benson Highway
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	133001
Property Alias:	Not reported
Recipient Name:	South Tucson, City of
Grant Type:	Hazardous
Property Number:	119-01-0260, -0270, -0280, -0320, -0330, and -0340
Parcel Size:	4.04
Latitude:	32.187836
Longitude:	-110.965935
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	2B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported

CENTRO CARISMATICO CARISMATICO (Continued) **1014933242**

Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	00T18701
Start Date:	2011-03-30 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2011-05-11 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Not reported
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported

CENTRO CARISMATICO CARISMATICO (Continued) **1014933242**

RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	4.04
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	885
Below Poverty Percent:	44.61
Meidan Income:	6011
Meidan Income Number:	1432
Meidan Income Percent:	72.18
Vacant Housing Number:	97
Vacant Housing Percent:	12.07
Unemployed Number:	146
Unemployed Percent:	7.36

E21 **TUCSON TRUCK ACCESSORIES AND SERVICE** **UST FINDER** **1028175146**
South **750 E EVANS BLVD** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ**
0.337 mi.
1778 ft. **Site 1 of 2 in cluster E**

Relative: **Higher**
Actual: **2468 ft.**

UST FINDER:

Object ID:	23261
Facility ID:	AZ0-005004
Name:	TUCSON TRUCK ACCESSORIES AND SERVICE
Address:	750 E EVANS BLVD
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	3
TOS USTs:	0
Population 1500ft:	49
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported

TUCSON TRUCK ACCESSORIES AND SERVICE (Continued) **1028175146**

SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.959120329
Y Coord:	32.182345217
Latitude:	32.182345217
Longitude:	-110.959120329

UST FINDER:

Object ID:	66903
Facility ID:	AZ0-005004
Tank ID:	AZ0-005004_2
Tank Status:	Closed
Installation Date:	1982/01/01 16:00:00+00
Removal Date:	1993/06/07 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Not reported

Object ID:	66904
Facility ID:	AZ0-005004
Tank ID:	AZ0-005004_3
Tank Status:	Closed
Installation Date:	1982/01/01 16:00:00+00
Removal Date:	1993/06/07 15:59:59+00
Tank Capacity:	10000
Substances:	Diesel
Tank Wall Type:	Not reported

Object ID:	66905
Facility ID:	AZ0-005004
Tank ID:	AZ0-005004_1
Tank Status:	Closed
Installation Date:	1963/01/01 16:00:01+00
Removal Date:	1993/06/07 15:59:59+00
Tank Capacity:	2000
Substances:	Gasoline
Tank Wall Type:	Not reported

UST FINDER RELEASE:

Object ID:	460620
Facility ID:	AZ0-005004
Lust ID:	AZ0-005004-2856.01
Name:	TUCSON TRUCK ACCESSORIES AND SERVICE
Address:	750 E EVANS BLVD
City,State,Zip:	TUCSON, AZ 0

TUCSON TRUCK ACCESSORIES AND SERVICE (Continued) **1028175146**

Address Match Type:	PointAddress
Reported Date:	1993/06/08 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	44
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.958939
Y Coord:	32.182218
Latitude:	32.182218
Longitude:	-110.958939

E22
South
1/4-1/2
0.337 mi.
1778 ft.

TUCSON TRUCK ACCESSORIES AND SERVICE **LUST** **U001627281**
750 E EVANS BLVD **UST** **N/A**
TUCSON, AZ 85713 **AZURITE**
EMAP

Site 2 of 2 in cluster E

Relative:
Higher

Actual:
2468 ft.

LUST:

Name:	TUCSON TRUCK ACCESSORIES AND SERVICE
Address:	750 E EVANS BLVD
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005004
Lust Number:	2856.01
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	06/08/93
Date Closed:	07/25/94

UST:

Name:	TUCSON TRUCK ACCESSORIES AND SERVICE
Address:	750 E EVANS BLVD
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005004
Owner:	BOYLES BROS DRILLING CO
Latitude:	32.182345
Longitude:	110.959120

TUCSON TRUCK ACCESSORIES AND SERVICE (Continued) **U001627281**

Tank ID: 1
Date Closed: 06/07/1993
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1963**
Capacity: **2000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 06/07/1993
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1982**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Not reported**

Tank ID: 3
Date Closed: 06/07/1993
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1982**
Capacity: **10000**
Substance: **Diesel**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Not reported**

AZURITE:
Remediation Level Achieved: HBGL Residential
Name: TUCSON TRUCK ACCESSORIES AND SERVICE
Address: 750 E EVANS BLVD
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 2114
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST2856.01
Type: OTHER
Remediation Start Date: 04/07/1994
Remediation End Date: 07/25/1994
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

TUCSON TRUCK ACCESSORIES AND SERVICE (Continued) **U001627281**

AZURITE:

Remediation Id:	2114
Standard Types:	Health Based Guidance Level
Contaminants:	TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentraction Mg/Kg:	7000
Depth Feet:	Not reported

EMAP:

Name:	TUCSON TRUCK ACCESSORIES AND SERVICE
Address:	750 E EVANS BLVD
City,State,Zip:	TUCSON, AZ 85713
ID Number:	14975
Township:	14
Range:	14
Section:	30
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.18234522
Longitude:	-110.95912033
Collection Method:	LOCATED FROM COUNTY PARCEL INFORMATION
Place Type:	AUTO/VEHICLE REPAIR FACILITY
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	NOT ACTIVE
End Date:	08/31/2011
Verified:	Y

F23 **CUTTING EDGE COLLISION CENTER** **LUST** **U001626103**
NW **2626 S 4TH AVE** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **AZURITE**
0.362 mi. **EMAP**
1913 ft. **Site 1 of 2 in cluster F**

Relative: Lower
Actual: 2443 ft.

LUST:

Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-002721
Lust Number:	2688.01
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	01/27/93
Date Closed:	11/18/98

Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-002721
Lust Number:	2688.02
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	01/06/97
Date Closed:	11/18/98

CUTTING EDGE COLLISION CENTER (Continued) **U001626103**

Name: CUTTING EDGE COLLISION CENTER
Address: 2626 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-002721
Lust Number: 2688.03
Facility Status: CLOSED
Leak Priority: 5R1
Priority Description: Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification: 01/06/97
Date Closed: 11/18/98

UST:
Name: CUTTING EDGE COLLISION CENTER
Address: 2626 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-002721
Owner: HOPKINS, STEVE
Latitude: 32.192043
Longitude: 110.965954

Tank ID: 1
Date Closed: 01/05/1989
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: 01/01/1965
Capacity: 10000
Substance: Unleaded Gasoline
Compartment: COMPARTMENT A
Tank Const Type: Single Walled
Tank Mtrl Type: Asphalt coated or Bare Steel
Pipe Type: Not reported
Pipe Mtrl Type: Not reported
Pipe const Type: Not reported

Tank ID: 2
Date Closed: 01/05/1989
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: 01/01/1965
Capacity: 4000
Substance: Diesel
Compartment: COMPARTMENT A
Tank Const Type: Single Walled
Tank Mtrl Type: Asphalt coated or Bare Steel
Pipe Type: Not reported
Pipe Mtrl Type: Not reported
Pipe const Type: Not reported

Tank ID: 3
Date Closed: 01/05/1989
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: 01/01/1965
Capacity: 4000
Substance: Unleaded Gasoline
Compartment: COMPARTMENT A
Tank Const Type: Single Walled

CUTTING EDGE COLLISION CENTER (Continued) **U001626103**

Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 4
Date Closed: 01/05/1989
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1962**
Capacity: **500**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 5
Date Closed: 12/23/1999
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1985**
Capacity: **1000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Composite (Steel/Fiberglass or Steel/Polyethylene)**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Not reported**

AZURITE:
Remediation Level Achieved: HBGL Residential
Name: CUTTING EDGE COLLISION CENTER
Address: 2626 S 4TH AVE
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 16521
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST2688.01
Type: OTHER
Remediation Start Date: 11/18/1998
Remediation End Date: 11/18/1998
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

AZURITE:
Remediation Id: 16521
Standard Types: Health Based Guidance Level
Contaminants: TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentraction Mg/Kg: 3400
Depth Feet: 3

CUTTING EDGE COLLISION CENTER (Continued) **U001626103**

Remediation Level Achieved:	HBGL Residential
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Remediation ID:	18353
Program:	LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number:	UST2688.02
Type:	OTHER
Remediation Start Date:	11/18/1998
Remediation End Date:	11/18/1998
DEUR Record Date:	Not reported
WPD Dirctrs Approval:	Not reported
VEMUR Record Date:	Not reported
DEUR Release Date:	Not reported

AZURITE:

Remediation Id:	18353
Standard Types:	Health Based Guidance Level
Contaminants:	TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentraction Mg/Kg:	3400
Depth Feet:	3

Remediation Level Achieved:	HBGL Residential
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
Remediation ID:	18358
Program:	LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number:	UST2688.03
Type:	OTHER
Remediation Start Date:	11/18/1998
Remediation End Date:	11/18/1998
DEUR Record Date:	Not reported
WPD Dirctrs Approval:	Not reported
VEMUR Record Date:	Not reported
DEUR Release Date:	Not reported

AZURITE:

Remediation Id:	18358
Standard Types:	Health Based Guidance Level
Contaminants:	TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentraction Mg/Kg:	3400
Depth Feet:	3

EMAP:

Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 85713
ID Number:	13056
Township:	Not reported
Range:	Not reported
Section:	Not reported
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.19204316

CUTTING EDGE COLLISION CENTER (Continued) **U001626103**

Longitude:	-110.96595408
Collection Method:	GPS WITH CORRECTION < 3 METER ERROR
Place Type:	EQUIPMENT YARD
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	ACTIVE
End Date:	Not reported
Verified:	Y

F24 **CUTTING EDGE COLLISION CENTER** **UST FINDER** **1028173021**
NW **2626 S 4TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.362 mi.
1913 ft. **Site 2 of 2 in cluster F**

Relative:
Lower

Actual:
2443 ft.

UST FINDER:

Object ID:	21136
Facility ID:	AZ0-002721
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	5
TOS USTs:	0
Population 1500ft:	1091
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.965954079
Y Coord:	32.192043159
Latitude:	32.192043159
Longitude:	-110.965954079

UST FINDER:

Object ID:	60415
Facility ID:	AZ0-002721
Tank ID:	AZ0-002721_5
Tank Status:	Closed
Installation Date:	1985/01/01 16:00:00+00
Removal Date:	1999/12/23 15:59:59+00
Tank Capacity:	1000
Substances:	Gasoline

CUTTING EDGE COLLISION CENTER (Continued) **1028173021**

Tank Wall Type:	Double
Object ID:	74115
Facility ID:	AZ0-002721
Tank ID:	AZ0-002721_4
Tank Status:	Closed
Installation Date:	1962/01/01 16:00:01+00
Removal Date:	1989/01/05 16:00:00+00
Tank Capacity:	500
Substances:	Used Oil/Waste Oil
Tank Wall Type:	Single
Object ID:	74116
Facility ID:	AZ0-002721
Tank ID:	AZ0-002721_2
Tank Status:	Closed
Installation Date:	1965/01/01 16:00:01+00
Removal Date:	1989/01/05 16:00:00+00
Tank Capacity:	4000
Substances:	Diesel
Tank Wall Type:	Single
Object ID:	74117
Facility ID:	AZ0-002721
Tank ID:	AZ0-002721_1
Tank Status:	Closed
Installation Date:	1965/01/01 16:00:01+00
Removal Date:	1989/01/05 16:00:00+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Single
Object ID:	74118
Facility ID:	AZ0-002721
Tank ID:	AZ0-002721_3
Tank Status:	Closed
Installation Date:	1965/01/01 16:00:01+00
Removal Date:	1989/01/05 16:00:00+00
Tank Capacity:	4000
Substances:	Gasoline
Tank Wall Type:	Single

UST FINDER RELEASE:

Object ID:	458259
Facility ID:	AZ0-002721
Lust ID:	AZ0-002721-2688.02
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1997/01/06 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	1023
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity

CUTTING EDGE COLLISION CENTER (Continued) **1028173021**

Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9660535
Y Coord:	32.1918390000001
Latitude:	32.191839
Longitude:	-110.9660535

Object ID:	458260
Facility ID:	AZ0-002721
Lust ID:	AZ0-002721-2688.01
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1993/01/27 15:59:59+00
Status:	No Further Action
Substance:	Used Oil/Waste Oil
Population within 1500ft:	1023
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9660535

CUTTING EDGE COLLISION CENTER (Continued) **1028173021**

Y Coord:	32.1918390000001
Latitude:	32.191839
Longitude:	-110.9660535
Object ID:	458262
Facility ID:	AZ0-002721
Lust ID:	AZ0-002721-2688.03
Name:	CUTTING EDGE COLLISION CENTER
Address:	2626 S 4TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1997/01/06 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	1023
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9660535
Y Coord:	32.1918390000001
Latitude:	32.191839
Longitude:	-110.9660535

G25 **UNOCAL #3888** **UST FINDER** **1028175393**
SSE **821 E BENSON HWY** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.366 mi.
1935 ft. **Site 1 of 2 in cluster G**

Relative: **Higher**
Actual: **2477 ft.**

UST FINDER:

Object ID:	23508
Facility ID:	AZ0-005278
Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	3
TOS USTs:	0
Population 1500ft:	15

UNOCAL #3888 (Continued) **1028175393**

Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.956695937
Y Coord:	32.18265531
Latitude:	32.18265531
Longitude:	-110.956695937

UST FINDER:

Object ID:	70004
Facility ID:	AZ0-005278
Tank ID:	AZ0-005278_3
Tank Status:	Closed
Installation Date:	1955/04/16 16:00:01+00
Removal Date:	1991/04/03 15:59:59+00
Tank Capacity:	280
Substances:	Used Oil/Waste Oil
Tank Wall Type:	Double

Object ID:	70005
Facility ID:	AZ0-005278
Tank ID:	AZ0-005278_1
Tank Status:	Closed
Installation Date:	1955/04/16 16:00:01+00
Removal Date:	1991/04/03 15:59:59+00
Tank Capacity:	7500
Substances:	Gasoline
Tank Wall Type:	Double

Object ID:	70006
Facility ID:	AZ0-005278
Tank ID:	AZ0-005278_2
Tank Status:	Closed
Installation Date:	1955/04/16 16:00:01+00
Removal Date:	1991/04/03 15:59:59+00
Tank Capacity:	7500
Substances:	Gasoline
Tank Wall Type:	Double

UST FINDER RELEASE:

Object ID:	461022

UNOCAL #3888 (Continued) **1028175393**

Facility ID:	AZ0-005278
Lust ID:	AZ0-005278-632.01
Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1988/10/17 16:00:00+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	15
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956734
Y Coord:	32.182578
Latitude:	32.182578
Longitude:	-110.956734

Object ID:	461023
Facility ID:	AZ0-005278
Lust ID:	AZ0-005278-632.02
Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1988/10/17 16:00:00+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	15
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water

UNOCAL #3888 (Continued) **1028175393**

WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956734
Y Coord:	32.182578
Latitude:	32.182578
Longitude:	-110.956734

Object ID:	461025
Facility ID:	AZ0-005278
Lust ID:	AZ0-005278-632.03
Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1988/10/17 16:00:00+00
Status:	No Further Action
Substance:	Used Oil/Waste Oil
Population within 1500ft:	15
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956734
Y Coord:	32.182578
Latitude:	32.182578
Longitude:	-110.956734

G26 **UNOCAL #3888** **LUST** **U003050280**
SSE **821 E BENSON HWY** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **AZURITE**
0.366 mi. **EMAP**
1935 ft. **Site 2 of 2 in cluster G**

Relative:
Higher

Actual:
2477 ft.

LUST:

Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005278
Lust Number:	0632.02
Facility Status:	CLOSED
Leak Priority:	5G1
Priority Description:	Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification:	10/17/88
Date Closed:	09/30/02

Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005278
Lust Number:	0632.03
Facility Status:	CLOSED
Leak Priority:	5G1
Priority Description:	Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification:	10/17/88
Date Closed:	09/30/02

Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005278
Lust Number:	0632.01
Facility Status:	CLOSED
Leak Priority:	5G1
Priority Description:	Closed groundwater and soil CoC levels meet RBCA Tier 1 standards
Notification:	10/17/88
Date Closed:	09/30/02

UST:

Name:	UNOCAL #3888
Address:	821 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005278
Owner:	UNOCAL CORP
Latitude:	32.182655
Longitude:	110.956695

Tank ID:	1
Date Closed:	04/03/1991
Tank Status:	**Perm Closure**
Closure Type:	**Closed In Place**
Tank Inst Date:	**04/16/1955**
Capacity:	**7500**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Double Walled**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**

UNOCAL #3888 (Continued) **U003050280**

Pipe Type: **Pressure**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 04/03/1991
Tank Status: **Perm Closure**
Closure Type: **Closed In Place**
Tank Inst Date: **04/16/1955**
Capacity: **7500**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 3
Date Closed: 04/03/1991
Tank Status: **Perm Closure**
Closure Type: **Closed In Place**
Tank Inst Date: **04/16/1955**
Capacity: **280**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Gravity Feed**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

AZURITE:
Remediation Level Achieved: AWQS - Residential
Name: UNOCAL #3888
Address: 821 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 1103
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0632.01
Type: OTHER
Remediation Start Date: 05/01/1989
Remediation End Date: 09/30/2002
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

AZURITE:
Remediation Id: 1103
Standard Types: Aquifer Water Quality Standard
Contaminants: 1,2-DICHLOROETHANE
Concentraction Mg/Kg: 2.5
Depth Feet: 115

Remediation Id: 1103
Standard Types: Aquifer Water Quality Standard

UNOCAL #3888 (Continued) **U003050280**

Contaminants: BENZENE
Concentraction Mg/Kg: 3
Depth Feet: 115

Remediation Id: 1103
Standard Types: Aquifer Water Quality Standard
Contaminants: METHYL TERT BUTYL ETHER (MTBE)
Concentraction Mg/Kg: 7.9
Depth Feet: 115

Remediation Level Achieved: AWQS - Residential
Name: UNOCAL #3888
Address: 821 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 21949
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0632.02
Type: OTHER
Remediation Start Date: 05/01/1989
Remediation End Date: 09/30/2002
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

AZURITE:
Remediation Id: 21949
Standard Types: Aquifer Water Quality Standard
Contaminants: 1,2-DICHLOROETHANE
Concentraction Mg/Kg: 2.5
Depth Feet: 115

Remediation Id: 21949
Standard Types: Aquifer Water Quality Standard
Contaminants: BENZENE
Concentraction Mg/Kg: 3
Depth Feet: 115

Remediation Id: 21949
Standard Types: Aquifer Water Quality Standard
Contaminants: METHYL TERT BUTYL ETHER (MTBE)
Concentraction Mg/Kg: 7.9
Depth Feet: 115

Remediation Level Achieved: Other
Name: UNOCAL #3888
Address: 821 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 21951
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST0632.03
Type: OTHER
Remediation Start Date: 05/01/1989
Remediation End Date: 09/30/2002
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported

UNOCAL #3888 (Continued) **U003050280**

VEMUR Record Date: Not reported
DEUR Release Date: Not reported

AZURITE:
Remediation Id: 21951
Standard Types: Aquifer Water Quality Standard
Contaminants: 1,2-DICHLOROETHANE
Concentration Mg/Kg: 2.5
Depth Feet: 115

Remediation Id: 21951
Standard Types: Aquifer Water Quality Standard
Contaminants: BENZENE
Concentration Mg/Kg: 3
Depth Feet: 115

Remediation Id: 21951
Standard Types: Aquifer Water Quality Standard
Contaminants: METHYL TERT BUTYL ETHER (MTBE)
Concentration Mg/Kg: 7.9
Depth Feet: 115

Remediation Id: 21951
Standard Types: Health Based Guidance Level
Contaminants: TOTAL PETROLEUM HYDROCARBONS (TPH)
Concentration Mg/Kg: 29.8
Depth Feet: 15

EMAP:
Name: UNOCAL #3888
Address: 821 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
ID Number: 3599
Township: 14
Range: 14
Section: 30
Quarter 1: c
Quarter 2: Not reported
Quarter 3: Not reported
Latitude: 32.18265531
Longitude: -110.95669594
Collection Method: GPS WITH CORRECTION < 3 METER ERROR
Place Type: GAS FILLING STATION - COMMERCIAL
Place Type Code: PP
Place C Code: PHYSICAL PROPERTIES
Facility Status: NOT ACTIVE
End Date: 08/24/2011
Verified: Y

H27 **HEDLUND 310** **US BROWNFIELDS** **1027609142**
NW **310 EAST 35TH STREET** **N/A**
1/4-1/2 **TUCSON, AZ 85713**
0.405 mi.
2137 ft. **Site 1 of 2 in cluster H**

Relative:
Lower

Actual:
2442 ft.

US BROWNFIELDS:

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	2018-08-03 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2018-11-14 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

HEDLUND 310 (Continued) **1027609142**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

HEDLUND 310 (Continued) **1027609142**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported

HEDLUND 310 (Continued) **1027609142**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

HEDLUND 310 (Continued) **1027609142**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001

HEDLUND 310 (Continued) **1027609142**

Start Date:	2022-03-09 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2022-05-18 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported

HEDLUND 310 (Continued) **1027609142**

RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported

HEDLUND 310 (Continued) **1027609142**

Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

HEDLUND 310 (Continued) **1027609142**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported

HEDLUND 310 (Continued) **1027609142**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	2022-07-15 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2023-02-24 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported

HEDLUND 310 (Continued) **1027609142**

RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported

HEDLUND 310 (Continued) **1027609142**

Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase II Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	2022-07-15 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2023-02-24 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported

HEDLUND 310 (Continued) **1027609142**

Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336

HEDLUND 310 (Continued) **1027609142**

Unemployed Percent:	9.05
Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported

HEDLUND 310 (Continued) **1027609142**

Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported

HEDLUND 310 (Continued) **1027609142**

Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T61301
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported

HEDLUND 310 (Continued) **1027609142**

Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported

HEDLUND 310 (Continued) **1027609142**

Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Phase I Environmental Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	2022-03-09 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported

HEDLUND 310 (Continued) **1027609142**

Completion Date:	2022-05-18 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported

HEDLUND 310 (Continued) **1027609142**

RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	Not reported
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	Not reported
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Name:	Hedlund 310
Address:	310 East 35th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	238603
Property Alias:	2501 South 4th Avenue
Recipient Name:	City of South Tucson
Grant Type:	Not reported
Property Number:	118-25-3010
Parcel Size:	0.15
Latitude:	32.193312329
Longitude:	-110.96473907
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Not reported
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II Environmental Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported

HEDLUND 310 (Continued) **1027609142**

Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	98T07001
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	U
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported

HEDLUND 310 (Continued) **1027609142**

RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1777
Below Poverty Percent:	47.88
Meidan Income:	4532
Meidan Income Number:	2886
Meidan Income Percent:	77.77
Vacant Housing Number:	264
Vacant Housing Percent:	17.02
Unemployed Number:	336
Unemployed Percent:	9.05

Click this hyperlink while viewing on your computer to access additional US BROWNFIELDS: detail in the EDR Site Report.

I28 **ORION LEASING, REALTY, AND INVESTMENT INC. PROPERT** **US BROWNFIELDS** **1014475692**
West **SEC 39TH STREET AND 6TH AVENUE** **FINDS** **N/A**
1/4-1/2 **SOUTH TUCSON, AZ 85713**
0.424 mi.
2238 ft. **Site 1 of 3 in cluster I**

Relative: US BROWNFIELDS:
Lower

Name:	Orion Leasing, Realty, And Investment Inc. Property
Address:	Sec 39th Street And 6th Avenue
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	108601
Property Alias:	Not reported
Recipient Name:	South Tucson, City of
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730, and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189059

Actual:
2442 ft.

ORION LEASING, REALTY, AND INVESTMENT INC. PROPERTY (Continued) **1014475692**

Longitude:	-110.96787
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	2B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	00T18701
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported

ORION LEASING, REALTY, AND INVESTMENT INC. PROPERTY (Continued) **1014475692**

Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.89
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	0.89
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1391
Below Poverty Percent:	50.6
Meidan Income:	3028
Meidan Income Number:	2100
Meidan Income Percent:	76.39
Vacant Housing Number:	142
Vacant Housing Percent:	12.66
Unemployed Number:	220
Unemployed Percent:	8

Name:	Orion Leasing, Realty, And Investment Inc. Property

ORION LEASING, REALTY, AND INVESTMENT INC. PROPERTY (Continued) **1014475692**

Address:	Sec 39th Street And 6th Avenue
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	108601
Property Alias:	Not reported
Recipient Name:	South Tucson, City of
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730, and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189059
Longitude:	-110.96787
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	2B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	U.S. EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	00T18701
Start Date:	2009-09-29 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2009-10-27 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported

ORION LEASING, REALTY, AND INVESTMENT INC. PROPERTY (Continued) **1014475692**

Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.89
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	0.89
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1391
Below Poverty Percent:	50.6

ORION LEASING, REALTY, AND INVESTMENT INC. PROPERTY (Continued) **1014475692**

Meidan Income:	3028
Meidan Income Number:	2100
Meidan Income Percent:	76.39
Vacant Housing Number:	142
Vacant Housing Percent:	12.66
Unemployed Number:	220
Unemployed Percent:	8

FINDS:
Registry ID: 110043317256

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

I29 West 1/4-1/2 0.430 mi. 2270 ft. **ORION LEASING REALTY & INVESTMENT** **US BROWNFIELDS 1024241772**
101 E. 40TH STREET **FINDS N/A**
TUCSON, AZ 85713

Site 2 of 3 in cluster I

Relative: Lower
Actual: 2442 ft.

US BROWNFIELDS:

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-03-07 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-07-28 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028
Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-08-01 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-09-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028
Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028
Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-03-07 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-07-28 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028
Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

Name:	Orion Leasing Realty & Investment
Address:	101 E. 40th Street
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228265
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Petroleum
Property Number:	119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770
Parcel Size:	0.89
Latitude:	32.189
Longitude:	-110.9679
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-08-01 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-09-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported

ORION LEASING REALTY & INVESTMENT (Continued) **1024241772**

NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1170
Below Poverty Percent:	48.15
Meidan Income:	3028
Meidan Income Number:	1807
Meidan Income Percent:	74.36
Vacant Housing Number:	115
Vacant Housing Percent:	11.81
Unemployed Number:	185
Unemployed Percent:	7.61

FINDS:
Registry ID: 110070247583

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

H30 **FORMER CHILE RELLENOS RESTAURANT** **US BROWNFIELDS** **1024241752**
NW **2433 S. 4TH AVE.** **FINDS** **N/A**
1/4-1/2 **SOUTH TUCSON, AZ 85713**
0.431 mi.
2278 ft. **Site 2 of 2 in cluster H**

Relative:
Lower

Actual:
2441 ft.

US BROWNFIELDS:

Name:	Former Chile Rellenos Restaurant
Address:	2433 S. 4th Ave.
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	227761
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	118-25-2410
Parcel Size:	0.15
Latitude:	32.193629
Longitude:	-110.964995
Census Tract:	4019002300

FORMER CHILE RELLENOS RESTAURANT (Continued) **1024241752**

State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I, Comprehensive Asbestos Survey, and Lead-Based Paint Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Asbestos Lead
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported

FORMER CHILE RELLENOS RESTAURANT (Continued) **1024241752**

Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.15
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1840
Below Poverty Percent:	48.51
Meidan Income:	6063
Meidan Income Number:	2924
Meidan Income Percent:	77.09
Vacant Housing Number:	267
Vacant Housing Percent:	16.69
Unemployed Number:	330
Unemployed Percent:	8.7

Name:	Former Chile Rellenos Restaurant
Address:	2433 S. 4th Ave.

FORMER CHILE RELLENOS RESTAURANT (Continued) **1024241752**

City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	227761
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	118-25-2410
Parcel Size:	0.15
Latitude:	32.193629
Longitude:	-110.964995
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I, Comprehensive Asbestos Survey, and Lead-Based Paint Assessment
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I, Comprehensive Asbestos Survey, and Lead-Based Paint Assessment
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Asbestos Lead
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-08-17 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-09-23 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported

FORMER CHILE RELLENOS RESTAURANT (Continued) **1024241752**

Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Building Materials
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.15
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1840

FORMER CHILE RELLENOS RESTAURANT (Continued) **1024241752**

Below Poverty Percent:	48.51
Meidan Income:	6063
Meidan Income Number:	2924
Meidan Income Percent:	77.09
Vacant Housing Number:	267
Vacant Housing Percent:	16.69
Unemployed Number:	330
Unemployed Percent:	8.7

FINDS:
Registry ID: 110070247561

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

J31 **PARK AVE SHELL** **LUST** **U001157329**
SSE **880 E BENSON HWY** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **EMAP**
0.432 mi. **Enforcement**
2279 ft. **Site 1 of 2 in cluster J**

Relative:
Higher

Actual:
2476 ft.

LUST:

Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004960
Lust Number:	5347.03
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	12/14/15
Date Closed:	07/28/20

Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004960
Lust Number:	5347.05
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	10/20/16
Date Closed:	12/19/18

Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004960
Lust Number:	5347.01
Facility Status:	CLOSED

PARK AVE SHELL (Continued) **U001157329**

Leak Priority: 5R3
Priority Description: Closed soil-only CoC levels meet RBCA Tier 3 standards
Notification: 11/14/03
Date Closed: 09/17/13

Name: PARK AVE SHELL
Address: 880 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-004960
Lust Number: 5347.02
Facility Status: CLOSED
Leak Priority: 5G4
Priority Description: Closed soil and groundwater CoC levels meet RBCA Tier 2 or 3 standards under R18-12-263.04
Notification: 12/14/15
Date Closed: 05/31/22

Name: PARK AVE SHELL
Address: 880 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-004960
Lust Number: 5347.04
Facility Status: CLOSED
Leak Priority: 5R1
Priority Description: Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification: 12/14/15
Date Closed: 12/19/18

UST:
Name: PARK AVE SHELL
Address: 880 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-004960
Owner: EQUILON ENTERPRISES LLC
Latitude: 32.181675
Longitude: 110.956648

Tank ID: 1
Date Closed: 09/01/2016
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: 01/01/1984
Capacity: 12000
Substance: Unleaded Gasoline
Compartment: COMPARTMENT A
Tank Const Type: Single Walled
Tank Mtrl Type: Fiberglass Reinforced Plastic
Pipe Type: Pressure
Pipe Mtrl Type: Fiberglass Reinforced Plastic
Pipe const Type: Double Walled

Tank ID: 2
Date Closed: 09/01/2016
Tank Status: Perm Closure
Closure Type: Removal
Tank Inst Date: 01/01/1984
Capacity: 10000

PARK AVE SHELL (Continued) **U001157329**

Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 3
Date Closed: 09/01/2016
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1984**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 4
Date Closed: 09/01/2016
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1984**
Capacity: **8000**
Substance: **Diesel**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 5
Date Closed: 09/01/2016
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1984**
Capacity: **550**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Gravity Feed**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Not reported**

EMAP:
Name: PARK AVE SHELL
Address: 880 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
ID Number: 31097
Township: Not reported
Range: Not reported

PARK AVE SHELL (Continued) **U001157329**

Section:	Not reported
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.18167566
Longitude:	-110.95664805
Collection Method:	LOCATED FROM COUNTY PARCEL INFORMATION
Place Type:	GAS FILLING STATION - COMMERCIAL
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	ACTIVE
End Date:	Not reported
Verified:	Y

ENF:

Facility ID:	31097
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Case ID:	141049
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Not reported
Notice Issue Date:	05/29/2013
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	Not reported
Faciltiy Status:	Open NOV
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	Not reported

Facility ID:	31097
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Case ID:	92452
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Not reported
Notice Issue Date:	01/15/2008
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	03/13/2008
Faciltiy Status:	Case Closed
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	Not reported

Facility ID:	31097
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Case ID:	166000
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Notice of Violations
Notice Issue Date:	07/12/2016
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	09/01/2016
Faciltiy Status:	Case Closed

PARK AVE SHELL (Continued) **U001157329**

Env Program: UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code: NOV

J32 **PARK AVE SHELL** **UST FINDER** **1028175103**
SSE **880 E BENSON HWY** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.432 mi.
2279 ft. **Site 2 of 2 in cluster J**

Relative:
Higher

Actual:
2476 ft.

UST FINDER:
Object ID: 23218
Facility ID: AZ0-004960
Name: PARK AVE SHELL
Address: 880 E BENSON HWY
City,State,Zip: TUCSON, AZ
Address Match Type: Not reported
Open USTs: 0
Closed USTs: 5
TOS USTs: 0
Population 1500ft: 6
Private Wells 1500ft: 0
Within 100yr Floodplain: No
Land Use: Developed, Medium Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: Yes
WHPA PWS Facility ID: AZ0420092_4596
WHPA Water Type: GW - Ground water
WHPA Facility Type: WL - Well
WHPA HUC12: 150503010904
Facility Status: Closed UST(s)
Date of Last Inspection: Not reported
EPA Region: 9
Tribe: Not reported
Coordinate Source: State
X Coord: -110.956648047
Y Coord: 32.181675661
Latitude: 32.181675661
Longitude: -110.956648047

UST FINDER:
Object ID: 56424
Facility ID: AZ0-004960
Tank ID: AZ0-004960_4
Tank Status: Closed
Installation Date: 1984/01/01 16:00:00+00
Removal Date: 2016/09/01 15:59:59+00
Tank Capacity: 8000
Substances: Diesel
Tank Wall Type: Single

Object ID: 56425
Facility ID: AZ0-004960
Tank ID: AZ0-004960_2
Tank Status: Closed

PARK AVE SHELL (Continued) **1028175103**

Installation Date:	1984/01/01 16:00:00+00
Removal Date:	2016/09/01 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Single
Object ID:	56426
Facility ID:	AZ0-004960
Tank ID:	AZ0-004960_5
Tank Status:	Closed
Installation Date:	1984/01/01 16:00:00+00
Removal Date:	2016/09/01 15:59:59+00
Tank Capacity:	550
Substances:	Used Oil/Waste Oil
Tank Wall Type:	Single
Object ID:	56427
Facility ID:	AZ0-004960
Tank ID:	AZ0-004960_3
Tank Status:	Closed
Installation Date:	1984/01/01 16:00:00+00
Removal Date:	2016/09/01 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Single
Object ID:	56428
Facility ID:	AZ0-004960
Tank ID:	AZ0-004960_1
Tank Status:	Closed
Installation Date:	1984/01/01 16:00:00+00
Removal Date:	2016/09/01 15:59:59+00
Tank Capacity:	12000
Substances:	Gasoline
Tank Wall Type:	Single

UST FINDER RELEASE:

Object ID:	460534
Facility ID:	AZ0-004960
Lust ID:	AZ0-004960-5347.02
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2015/12/14 15:59:59+00
Status:	Open
Substance:	Diesel,Gasoline (UL)
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes

PARK AVE SHELL (Continued) **1028175103**

WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956716
Y Coord:	32.1815250000001
Latitude:	32.181525
Longitude:	-110.956716

Object ID:	460535
Facility ID:	AZ0-004960
Lust ID:	AZ0-004960-5347.05
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2016/10/20 15:59:59+00
Status:	No Further Action
Substance:	Used Oil/Waste Oil,Gasoline,Diesel
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956716
Y Coord:	32.1815250000001
Latitude:	32.181525
Longitude:	-110.956716

Object ID:	460536
Facility ID:	AZ0-004960

PARK AVE SHELL (Continued) **1028175103**

Lust ID:	AZ0-004960-5347.01
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2003/11/14 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956716
Y Coord:	32.1815250000001
Latitude:	32.181525
Longitude:	-110.956716

Object ID:	460537
Facility ID:	AZ0-004960
Lust ID:	AZ0-004960-5347.04
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2015/12/14 15:59:59+00
Status:	No Further Action
Substance:	Gasoline (UL)
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well

PARK AVE SHELL (Continued) **1028175103**

WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956716
Y Coord:	32.1815250000001
Latitude:	32.181525
Longitude:	-110.956716

Object ID:	460538
Facility ID:	AZ0-004960
Lust ID:	AZ0-004960-5347.03
Name:	PARK AVE SHELL
Address:	880 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2015/12/14 15:59:59+00
Status:	Open
Substance:	Gasoline (UL)
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.956716
Y Coord:	32.1815250000001
Latitude:	32.181525
Longitude:	-110.956716

I33
West
1/4-1/2
0.440 mi.
2325 ft.

PRIMAVERA PROPERTY
2901 S. SIXTH AVENUE
TUCSON, AZ 85713

Site 3 of 3 in cluster I

US BROWNFIELDS FINDS | **1024241771** | **N/A**

Relative:
Lower

Actual:
2441 ft.

US BROWNFIELDS:

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals
Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-07-15 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-07-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245
Unemployed Percent:	8.17

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals
Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-08-12 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-09-10 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245
Unemployed Percent:	8.17

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase I
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals
Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201

PRIMAVERA PROPERTY (Continued) **1024241771**

Start Date:	2016-07-15 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-07-30 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245
Unemployed Percent:	8.17

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Phase II
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals

PRIMAVERA PROPERTY (Continued) **1024241771**

Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	2016-08-12 00:00:00
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	2016-09-10 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245
Unemployed Percent:	8.17

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous
Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase I
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals
Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245
Unemployed Percent:	8.17

Name:	Primavera Property
Address:	2901 S. Sixth Avenue
City,State,Zip:	TUCSON, AZ 85713
Property ID:	228264
Property Alias:	Not reported
Recipient Name:	City of South Tucson
Grant Type:	Hazardous

PRIMAVERA PROPERTY (Continued) **1024241771**

Property Number:	119-01-051F
Parcel Size:	1.17
Latitude:	32.188294
Longitude:	-110.970142
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	BF
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Phase II
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Lead Other Metals
Contaminants Found at Actionable Level:	Lead Other Metals
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	Not reported
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	99T23201
Start Date:	Not reported
Ownership Entity:	Not reported
Additional Institutional Controls Information:	Not reported
Completion Date:	Not reported
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	N
Indicates Cleanup/Treatment Tech Implemented:	Not reported
Institutional Controls Required:	N
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported

PRIMAVERA PROPERTY (Continued) **1024241771**

Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Ground Water Soil
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	1.17
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	Not reported
NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	1539
Below Poverty Percent:	51.35
Meidan Income:	3028
Meidan Income Number:	2298
Meidan Income Percent:	76.68
Vacant Housing Number:	152
Vacant Housing Percent:	12.51
Unemployed Number:	245

PRIMAVERA PROPERTY (Continued) **1024241771**

Unemployed Percent: 8.17

FINDS:
Registry ID: 110070247582

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:
The Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on Brownfields properties assessed or cleaned up with grant funding, as well as information on Targeted Brownfields Assessments (TBA) performed by EPA Regions.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

K34 **GIANT 6619** **UST FINDER** **1028171446**
SSE **1001 E BENSON HWY** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.450 mi.
2374 ft. **Site 1 of 2 in cluster K**

Relative:
Higher

Actual:
2477 ft.

UST FINDER:

Object ID:	19561
Facility ID:	AZ0-001052
Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	8
TOS USTs:	0
Population 1500ft:	7
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.955707211
Y Coord:	32.1820330150001
Latitude:	32.182033015
Longitude:	-110.955707211

UST FINDER:

Object ID:	60762

GIANT 6619 (Continued) **1028171446**

Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_8
Tank Status:	Closed
Installation Date:	1988/06/01 16:00:00+00
Removal Date:	1999/06/15 15:59:59+00
Tank Capacity:	1000
Substances:	Used Oil/Waste Oil
Tank Wall Type:	Double

Object ID:	56339
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_5
Tank Status:	Closed
Installation Date:	1988/06/01 16:00:00+00
Removal Date:	2017/12/07 15:59:59+00
Tank Capacity:	12000
Substances:	Gasoline (UL)
Tank Wall Type:	Double

Object ID:	56340
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_7
Tank Status:	Closed
Installation Date:	1988/06/01 16:00:00+00
Removal Date:	2017/12/07 15:59:59+00
Tank Capacity:	10000
Substances:	Diesel
Tank Wall Type:	Double

Object ID:	56341
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_6
Tank Status:	Closed
Installation Date:	1988/06/01 16:00:00+00
Removal Date:	2017/12/07 15:59:59+00
Tank Capacity:	10000
Substances:	Gasoline (PUL)
Tank Wall Type:	Double

Object ID:	75828
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_2
Tank Status:	Closed
Installation Date:	1972/01/01 16:00:00+00
Removal Date:	1988/05/01 16:00:00+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Not reported

Object ID:	75829
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_4
Tank Status:	Closed
Installation Date:	1972/01/01 16:00:00+00
Removal Date:	1988/05/01 16:00:00+00
Tank Capacity:	1500
Substances:	Used Oil/Waste Oil

GIANT 6619 (Continued) **1028171446**

Tank Wall Type:	Not reported
Object ID:	75830
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_1
Tank Status:	Closed
Installation Date:	1972/01/01 16:00:00+00
Removal Date:	1988/05/01 16:00:00+00
Tank Capacity:	10000
Substances:	Gasoline
Tank Wall Type:	Not reported
Object ID:	75831
Facility ID:	AZ0-001052
Tank ID:	AZ0-001052_3
Tank Status:	Closed
Installation Date:	1972/01/01 16:00:00+00
Removal Date:	1988/05/01 16:00:00+00
Tank Capacity:	5000
Substances:	Gasoline
Tank Wall Type:	Not reported

UST FINDER RELEASE:

Object ID:	456261
Facility ID:	AZ0-001052
Lust ID:	AZ0-001052-4234.01
Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1995/10/11 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9556765

GIANT 6619 (Continued) **1028171446**

Y Coord:	32.1820020000001
Latitude:	32.182002
Longitude:	-110.9556765
Object ID:	456262
Facility ID:	AZ0-001052
Lust ID:	AZ0-001052-4234.03
Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	2018/01/18 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9556765
Y Coord:	32.1820020000001
Latitude:	32.182002
Longitude:	-110.9556765
Object ID:	456263
Facility ID:	AZ0-001052
Lust ID:	AZ0-001052-4234.02
Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1995/10/31 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	6
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported

GIANT 6619 (Continued) **1028171446**

SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	Yes
WHPA PWS Facility ID:	AZ0420092_4596
WHPA Water Type:	GW - Ground water
WHPA Facility Type:	WL - Well
WHPA HUC12:	150503010904
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9556765
Y Coord:	32.1820020000001
Latitude:	32.182002
Longitude:	-110.9556765

K35 **GIANT 6619** **LUST** **U003049525**
SSE **1001 E BENSON HWY** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **AZURITE**
0.450 mi. **EMAP**
2374 ft. **Site 2 of 2 in cluster K** **Enforcement**

Relative:
Higher

Actual:
2477 ft.

LUST:

Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-001052
Lust Number:	4234.03
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	01/18/18
Date Closed:	07/06/18

Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-001052
Lust Number:	4234.02
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	10/31/95
Date Closed:	07/22/96

Name:	GIANT 6619
Address:	1001 E BENSON HWY
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-001052
Lust Number:	4234.01
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards

GIANT 6619 (Continued) **U003049525**

Notification: 10/11/95
Date Closed: 07/22/96

UST:
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Facility ID: 0-001052
Owner: CHEVRON PRODUCTS CO
Latitude: 32.182033
Longitude: 110.955707

Tank ID: 1
Date Closed: 05/01/1988
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1972**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 05/01/1988
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1972**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 3
Date Closed: 05/01/1988
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1972**
Capacity: **5000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 4
Date Closed: 05/01/1988
Tank Status: **Perm Closure**

GIANT 6619 (Continued) **U003049525**

Closure Type: **Removal**
Tank Inst Date: **01/01/1972**
Capacity: **1500**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Not reported**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Not reported**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

Tank ID: 5
Date Closed: 12/07/2017
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **06/01/1988**
Capacity: **12000**
Substance: **Gasoline (UL)**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 6
Date Closed: 12/07/2017
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **06/01/1988**
Capacity: **10000**
Substance: **Premium Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 7
Date Closed: 12/07/2017
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **06/01/1988**
Capacity: **10000**
Substance: **Diesel**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 8
Date Closed: 06/15/1999
Tank Status: **Perm Closure**
Closure Type: **Removal**

GIANT 6619 (Continued) **U003049525**

Tank Inst Date: **06/01/1988**
Capacity: **1000**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Gravity Feed**
Pipe Mtrl Type: **Not reported**
Pipe const Type: **Not reported**

AZURITE:
Remediation Level Achieved: HBGL Residential
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 1141
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST4234.01
Type: OTHER
Remediation Start Date: 01/02/1996
Remediation End Date: 07/22/1996
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

Remediation Level Achieved: HBGL Residential
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 2454
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST4234.02
Type: OTHER
Remediation Start Date: 01/02/1996
Remediation End Date: 07/22/1996
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

EMAP:
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
ID Number: 7435
Township: Not reported
Range: Not reported
Section: Not reported
Quarter 1: Not reported
Quarter 2: Not reported
Quarter 3: Not reported
Latitude: 32.18203302
Longitude: -110.95570721
Collection Method: LOCATED FROM COUNTY PARCEL INFORMATION
Place Type: GAS FILLING STATION - COMMERCIAL

GIANT 6619 (Continued) **U003049525**

Place Type Code: PP
Place C Code: PHYSICAL PROPERTIES
Facility Status: ACTIVE
End Date: Not reported
Verified: Y

ENF:
Facility ID: 7435
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Case ID: 141057
Facility Type: GAS FILLING STATION - COMMERCIAL
Notice Type: Not reported
Notice Issue Date: 05/29/2013
Order Type: Not reported
Order Issue Date: Not reported
Closed Date: 10/07/2013
Faciltiy Status: Case Closed
Env Program: UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code: Not reported

Facility ID: 7435
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Case ID: 108288
Facility Type: GAS FILLING STATION - COMMERCIAL
Notice Type: Not reported
Notice Issue Date: 03/24/2009
Order Type: Not reported
Order Issue Date: Not reported
Closed Date: 04/09/2009
Faciltiy Status: Case Closed
Env Program: UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code: Not reported

Facility ID: 7435
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Case ID: 74918
Facility Type: GAS FILLING STATION - COMMERCIAL
Notice Type: Not reported
Notice Issue Date: 08/24/2006
Order Type: Not reported
Order Issue Date: Not reported
Closed Date: 12/08/2006
Faciltiy Status: Case Closed
Env Program: UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code: Not reported

Facility ID: 7435
Name: GIANT 6619
Address: 1001 E BENSON HWY
City,State,Zip: TUCSON, AZ 85713
Case ID: 164239

GIANT 6619 (Continued) **U003049525**

Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Not reported
Notice Issue Date:	08/02/2016
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	09/06/2016
Faciltiy Status:	Case Closed
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	Not reported

36
NW
1/4-1/2
0.469 mi.
2477 ft.

KUNZ SOUTH PROPERTY **US BROWNFIELDS** **1014933637**
2413 S. 4TH AVENUE **N/A**
SOUTH TUCSON, AZ 85713

Relative:
Lower

Actual:
2440 ft.

US BROWNFIELDS:

Name:	Kunz South Property
Address:	2413 S. 4th Avenue
City,State,Zip:	SOUTH TUCSON, AZ 85713
Property ID:	131261
Property Alias:	Not reported
Recipient Name:	South Tucson, City of
Grant Type:	Petroleum
Property Number:	18-25-2350
Parcel Size:	0.6
Latitude:	32.194225
Longitude:	-110.964908
Census Tract:	4019002300
State or Tribal Voluntary Response Program:	Y
Program Name:	2B
AA Activity Funded:	Not reported
Start Date:	Not reported
Redev Completition Date:	Not reported
Completed Date:	Not reported
Cleanup Funding:	Not reported
Cleanup Funding Source:	Not reported
Activity Funded:	Not reported
Assessment Funding:	Not reported
Assessment Funding Source:	Not reported
Redevelopment Funding:	Not reported
Contaminants REC:	Not reported
Contaminants Found at Actionable Level:	Not reported
Redev. Funding Source:	Not reported
Redev. Funding Entity Name:	Not reported
Contaminants Found Below Actionable Level:	Not reported
Redevelopment Start Date:	Not reported
Assessment Funding Entity:	EPA
Cleanup Funding Entity:	Not reported
Climate Adapt Mitig - Planning or Assessment:	Not reported
Cooperative Agreement Number:	00T18701
Start Date:	2011-03-28 00:00:00
Ownership Entity:	Private
Additional Institutional Controls Information:	Not reported
Completion Date:	2011-04-25 00:00:00
Address of Data Sources (URL if available) 1:	Not reported
Cleanup Required:	U
Indicates Cleanup/Treatment Tech Implemented:	Not reported

KUNZ SOUTH PROPERTY (Continued) **1014933637**

Institutional Controls Required:	U
IC Category Proprietary Controls:	Not reported
Excavation and Disposal of Soils:	Not reported
Extraction of contaminants:	Not reported
IC Cat. Info. Devices:	Not reported
Removal of materials (tanks and piping, etc.):	Not reported
IC Cat. Gov. Controls:	Not reported
Reduction of Contam Bioremediation/Phytoremediation:	Not reported
IC Cat. Enforcement Permit Tools:	Not reported
Cleanup of structures:	Not reported
IC in place date:	Not reported
Additional Cleanup/Treatment Tech Info:	Not reported
IC in place:	Not reported
Address of Data Source (URL if available) 2:	Not reported
Indicate whether Engineering Controls are required:	Not reported
State/tribal program ID:	Not reported
Cover Technologies (e.g., Capping):	Not reported
Security (e.g., Guard, Fence):	Not reported
Immobilization Process:	Not reported
Engineering Barriers (e.g., Slurry Walls, Sheet):	Not reported
Other:	Not reported
Additional Engineering Controls Information:	Not reported
Address of Data Source (URL if available) 3:	Not reported
Indicate whether Engineering Controls are in place:	Not reported
Date Engineering Controls put into place:	Not reported
ACRES Cleaned Up:	Not reported
Section 128(a) State/Tribal:	Not reported
Multipurpose - Cost Share Amount:	Not reported
Cleanup - Cost Share Amount:	Not reported
RLF Loan - Total Loan Amount:	Not reported
RLF - Loan Signed Date:	Not reported
RLF Loan - Anticipated Repayment Start Date:	Not reported
RLF Loan - Anticipated Repayment End Date:	Not reported
RLF Loan - Interest Rate:	Not reported
RLF Loan - EPA Funds Used:	Not reported
Contaminant Cleanup:	Not reported
RLF Loan - Cost Share Used:	Not reported
Media Affected:	Unknown
RLF Loan - Program Income Used:	Not reported
Media Cleanup:	Not reported
RLF Loan - Discounted:	Not reported
RLF Loan - Discount Percentage:	Not reported
RLF Subgrant - Total Subgrant Amount:	Not reported
RLF Subgrant - Signed Date:	Not reported
RLF Subgrant - EPA Funds Used:	Not reported
RLF Subgrant - Cost Share Used:	Not reported
RLF Subgrant - Program Income Used:	Not reported
RLF Direct Cleanup - Total Funding Amt:	Not reported
Num. of cleanup and re-dev. jobs:	Not reported
RLF Direct Cleanup - Source of Funding:	Not reported
RLF Leveraged - Funding Source Type:	Not reported
Past use greenspace acreage:	Not reported
Past use residential acreage:	Not reported
RLF Leveraged - Entity Providing Funding:	Not reported
RLF Leveraged - Funding Amount:	Not reported
Cleanup Completion Doc - NFA Letter Received:	N
Past use commercial acreage:	0.6

KUNZ SOUTH PROPERTY (Continued) **1014933637**

NFA Letter Date Received:	Not reported
Past use industrial acreage:	Not reported
Cleanup Comp Doc - Letter/Signed Rep Qualified Pro:	N
Future use greenspace acreage:	Not reported
Letter/Signed Report Date Received:	Not reported
Future use residential acreage:	Not reported
Future use commercial acreage:	Not reported
Cleanup Completion Doc- Other forms of Doc:	Not reported
Future use industrial acreage:	Not reported
Climate Adapt and Mitiga - Demo or Cleanup:	Not reported
ReDev Activity Funded:	Not reported
Amount of Funding Expended on this Activity 2:	Not reported
Number of Redevelopment Jobs Leveraged:	Not reported
Climate Adaptation and Mitigation Redevelopment:	Not reported
Radius:	0.5
Below Poverty Number:	2012
Below Poverty Percent:	49.84
Meidan Income:	6229
Meidan Income Number:	3173
Meidan Income Percent:	78.6
Vacant Housing Number:	288
Vacant Housing Percent:	17.1
Unemployed Number:	358
Unemployed Percent:	8.87

L37 **CHEVRON #9-0965** **UST FINDER** **1028175826**
West **3002 S 6TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.473 mi.
2499 ft. **Site 1 of 2 in cluster L**

Relative: **Lower**
Actual: **2441 ft.**

UST FINDER:

Object ID:	23941
Facility ID:	AZ0-005748
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	4
TOS USTs:	0
Population 1500ft:	615
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9

CHEVRON #9-0965 (Continued) **1028175826**

Tribe: Not reported
Coordinate Source: State
X Coord: -110.968696394
Y Coord: 32.1884848940001
Latitude: 32.188484894
Longitude: -110.968696394

UST FINDER:
Object ID: 56223
Facility ID: AZ0-005748
Tank ID: AZ0-005748_1
Tank Status: Closed
Installation Date: 1987/01/01 16:00:00+00
Removal Date: 2017/04/12 15:59:59+00
Tank Capacity: 10000
Substances: Gasoline
Tank Wall Type: Double

Object ID: 56224
Facility ID: AZ0-005748
Tank ID: AZ0-005748_2
Tank Status: Closed
Installation Date: 1987/01/01 16:00:00+00
Removal Date: 2017/04/12 15:59:59+00
Tank Capacity: 10000
Substances: Gasoline
Tank Wall Type: Double

Object ID: 56225
Facility ID: AZ0-005748
Tank ID: AZ0-005748_3
Tank Status: Closed
Installation Date: 1987/01/01 16:00:00+00
Removal Date: 2017/04/12 15:59:59+00
Tank Capacity: 10000
Substances: Gasoline
Tank Wall Type: Double

Object ID: 76954
Facility ID: AZ0-005748
Tank ID: AZ0-005748_4
Tank Status: Closed
Installation Date: 1971/01/01 16:00:00+00
Removal Date: 1987/01/01 16:00:00+00
Tank Capacity: 1000
Substances: Used Oil/Waste Oil
Tank Wall Type: Single

UST FINDER RELEASE:
Object ID: 461670
Facility ID: AZ0-005748
Lust ID: AZ0-005748-4855.04
Name: CHEVRON #9-0965
Address: 3002 S 6TH AVE
City,State,Zip: TUCSON, AZ 0
Address Match Type: PointAddress

CHEVRON #9-0965 (Continued) **1028175826**

Reported Date:	2017/05/02 15:59:59+00
Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	647
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9688795
Y Coord:	32.1883020000001
Latitude:	32.188302
Longitude:	-110.9688795

Object ID:	461673
Facility ID:	AZ0-005748
Lust ID:	AZ0-005748-4855.03
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1998/09/16 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	647
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported

CHEVRON #9-0965 (Continued) **1028175826**

NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9688795
Y Coord:	32.1883020000001
Latitude:	32.188302
Longitude:	-110.9688795
Object ID:	461675
Facility ID:	AZ0-005748
Lust ID:	AZ0-005748-4855.02
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1998/07/27 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	647
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.9688795
Y Coord:	32.1883020000001
Latitude:	32.188302
Longitude:	-110.9688795

L38 **CHEVRON #9-0965** **LUST** **U001157275**
West **3002 S 6TH AVE** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **EMAP**
0.473 mi. **Enforcement**
2499 ft. **Site 2 of 2 in cluster L**

Relative: LUST:
Lower

Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005748

Actual:
2441 ft.

CHEVRON #9-0965 (Continued) **U001157275**

Lust Number:	4855.02
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	07/27/98
Date Closed:	10/22/01

Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005748
Lust Number:	4855.03
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	09/16/98
Date Closed:	10/22/01

Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005748
Lust Number:	4855.04
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	05/02/17
Date Closed:	09/18/17

UST:

Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-005748
Owner:	MAQSOOD AND SONS LLC
Latitude:	32.188484
Longitude:	110.968696

Tank ID:	1
Date Closed:	04/12/2017
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**01/01/1987**
Capacity:	**10000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Double Walled**
Tank Mtrl Type:	**Fiberglass Reinforced Plastic**
Pipe Type:	**Pressure**
Pipe Mtrl Type:	**Fiberglass Reinforced Plastic**
Pipe const Type:	**Double Walled**

Tank ID:	2
Date Closed:	04/12/2017
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**01/01/1987**

CHEVRON #9-0965 (Continued) **U001157275**

Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 3
Date Closed: 04/12/2017
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1987**
Capacity: **10000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Double Walled**
Tank Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe Type: **Pressure**
Pipe Mtrl Type: **Fiberglass Reinforced Plastic**
Pipe const Type: **Double Walled**

Tank ID: 4
Date Closed: 01/01/1987
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1971**
Capacity: **1000**
Substance: **Used Oil/Waste Oil**
Compartment: **COMPARTMENT A**
Tank Const Type: **Single Walled**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Gravity Feed**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Single Walled**

EMAP:
Name: CHEVRON #9-0965
Address: 3002 S 6TH AVE
City,State,Zip: TUCSON, AZ 85713
ID Number: 19093
Township: Not reported
Range: Not reported
Section: Not reported
Quarter 1: Not reported
Quarter 2: Not reported
Quarter 3: Not reported
Latitude: 32.18829600
Longitude: -110.96876
Collection Method: LOCATED FROM COUNTY PARCEL INFORMATION
Place Type: GAS FILLING STATION - COMMERCIAL
Place Type Code: PP
Place C Code: PHYSICAL PROPERTIES
Facility Status: ACTIVE
End Date: Not reported
Verified: Y

CHEVRON #9-0965 (Continued) **U001157275**

ENF:

Facility ID:	19093
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Case ID:	142159
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Not reported
Notice Issue Date:	06/26/2013
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	02/25/2014
Faciltiy Status:	Case Closed
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	Not reported

Facility ID:	19093
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Case ID:	96206
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Not reported
Notice Issue Date:	04/17/2008
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	07/11/2008
Faciltiy Status:	Case Closed
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	Not reported

Facility ID:	19093
Name:	CHEVRON #9-0965
Address:	3002 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Case ID:	167020
Facility Type:	GAS FILLING STATION - COMMERCIAL
Notice Type:	Notice of Violations
Notice Issue Date:	11/29/2016
Order Type:	Not reported
Order Issue Date:	Not reported
Closed Date:	05/12/2017
Faciltiy Status:	Case Closed
Env Program:	UNDERGROUND STORAGE TANK PROGRAM
Notice Type Code:	NOV

M39 **TOOT-N-MOO** **LUST U004119915**
WNW **2802 S 6TH AVE** **UST N/A**
1/4-1/2 **TUCSON, AZ 85713** **EMAP**
0.476 mi.
2512 ft. **Site 1 of 2 in cluster M**

Relative:
Lower

Actual:
2438 ft.

LUST:

Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-009043

TOOT-N-MOO (Continued) **U004119915**

Lust Number:	4664.01
Facility Status:	CLOSED
Leak Priority:	5G4
Priority Description:	Closed soil and groundwater CoC levels meet RBCA Tier 2 or 3 standards under R18-12-263.04
Notification:	01/10/97
Date Closed:	11/14/08

Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-009043
Lust Number:	4664.02
Facility Status:	CLOSED
Leak Priority:	5G4
Priority Description:	Closed soil and groundwater CoC levels meet RBCA Tier 2 or 3 standards under R18-12-263.04
Notification:	01/10/97
Date Closed:	11/14/08

UST:

Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-009043
Owner:	CASTINE, EDITH B.
Latitude:	32.190089
Longitude:	110.968748

Tank ID:	1
Date Closed:	11/30/1993
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**8000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Double Walled**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

Tank ID:	2
Date Closed:	11/30/1993
Tank Status:	**Perm Closure**
Closure Type:	**Removal**
Tank Inst Date:	**Not reported**
Capacity:	**8000**
Substance:	**Unleaded Gasoline**
Compartment:	**COMPARTMENT A**
Tank Const Type:	**Double Walled**
Tank Mtrl Type:	**Asphalt coated or Bare Steel**
Pipe Type:	**Not reported**
Pipe Mtrl Type:	**Not reported**
Pipe const Type:	**Not reported**

TOOT-N-MOO (Continued) **U004119915**

EMAP:

Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
ID Number:	5105
Township:	Not reported
Range:	Not reported
Section:	Not reported
Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.19008968
Longitude:	-110.96874801
Collection Method:	LOCATED FROM COUNTY PARCEL INFORMATION
Place Type:	GAS FILLING STATION - COMMERCIAL
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	NOT ACTIVE
End Date:	08/29/2012
Verified:	Y

M40 **TOOT-N-MOO** **UST FINDER** **1028178536**
WNW **2802 S 6TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ 0**
0.476 mi.
2512 ft. **Site 2 of 2 in cluster M**

Relative:
Lower

Actual:
2438 ft.

UST FINDER:

Object ID:	26651
Facility ID:	AZ0-009043
Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0
Closed USTs:	2
TOS USTs:	0
Population 1500ft:	771
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.968748008

TOOT-N-MOO (Continued) **1028178536**

Y Coord: 32.1900896760001
Latitude: 32.190089676
Longitude: -110.968748008

UST FINDER:
Object ID: 66231
Facility ID: AZ0-009043
Tank ID: AZ0-009043_1
Tank Status: Closed
Installation Date: Not reported
Removal Date: 1993/11/30 15:59:59+00
Tank Capacity: 8000
Substances: Gasoline
Tank Wall Type: Double

Object ID: 66232
Facility ID: AZ0-009043
Tank ID: AZ0-009043_2
Tank Status: Closed
Installation Date: Not reported
Removal Date: 1993/11/30 15:59:59+00
Tank Capacity: 8000
Substances: Gasoline
Tank Wall Type: Double

UST FINDER RELEASE:
Object ID: 463773
Facility ID: AZ0-009043
Lust ID: AZ0-009043-4664.02
Name: TOOT-N-MOO
Address: 2802 S 6TH AVE
City,State,Zip: TUCSON, AZ 0
Address Match Type: PointAddress
Reported Date: 1997/01/10 15:59:59+00
Status: No Further Action
Substance: Gasoline,Diesel
Population within 1500ft: 783
Domestic Wells within 1500ft: 0
Land Use: Developed, Medium Intensity
Within SPA: No
SPA PWS Facility ID: Not reported
SPA Water Type: Not reported
SPA Facility Type: Not reported
SPA HUC12: Not reported
Within WHPA: No
WHPA PWS Facility ID: Not reported
WHPA Water Type: Not reported
WHPA Facility Type: Not reported
WHPA HUC12: Not reported
Within 100yr Floodplain: No
Tribe: Not reported
EPA Region: 9
NFA Letter 1: Not reported
NFA Letter 2: Not reported
NFA Letter 3: Not reported
NFA Letter 4: Not reported

TOOT-N-MOO (Continued) **1028178536**

Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.968749
Y Coord:	32.190165
Latitude:	32.190165
Longitude:	-110.968749
Object ID:	463774
Facility ID:	AZ0-009043
Lust ID:	AZ0-009043-4664.01
Name:	TOOT-N-MOO
Address:	2802 S 6TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1997/01/10 15:59:59+00
Status:	No Further Action
Substance:	Gasoline
Population within 1500ft:	783
Domestic Wells within 1500ft:	0
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.968749
Y Coord:	32.190165
Latitude:	32.190165
Longitude:	-110.968749

N41 **SALVATION ARMY - ADULT REHABILITATION CENTER** **UST FINDER** **1028174500**
WNW **2717 S 6TH AVE** **UST FINDER RELEASE** **N/A**
1/4-1/2 **TUCSON, AZ**
0.485 mi.
2559 ft. **Site 1 of 2 in cluster N**

Relative: **Lower**
Actual: **2436 ft.**

UST FINDER:

Object ID:	22615
Facility ID:	AZ0-004319
Name:	SALVATION ARMY - ADULT REHABILITATION CENTER
Address:	2717 S 6TH AVE
City,State,Zip:	TUCSON, AZ
Address Match Type:	Not reported
Open USTs:	0

SALVATION ARMY - ADULT REHABILITATION CENTER (Continued) **1028174500**

Closed USTs:	2
TOS USTs:	0
Population 1500ft:	715
Private Wells 1500ft:	0
Within 100yr Floodplain:	No
Land Use:	Developed, Medium Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Facility Status:	Closed UST(s)
Date of Last Inspection:	Not reported
EPA Region:	9
Tribe:	Not reported
Coordinate Source:	State
X Coord:	-110.967531356
Y Coord:	32.1904351330001
Latitude:	32.190435133
Longitude:	-110.967531356

UST FINDER:

Object ID:	66015
Facility ID:	AZ0-004319
Tank ID:	AZ0-004319_2
Tank Status:	Closed
Installation Date:	1976/01/01 16:00:00+00
Removal Date:	1994/01/05 15:59:59+00
Tank Capacity:	6000
Substances:	Diesel
Tank Wall Type:	Not reported

Object ID:	66017
Facility ID:	AZ0-004319
Tank ID:	AZ0-004319_1
Tank Status:	Closed
Installation Date:	1968/01/01 16:00:01+00
Removal Date:	1994/01/05 15:59:59+00
Tank Capacity:	1000
Substances:	Gasoline
Tank Wall Type:	Not reported

UST FINDER RELEASE:

Object ID:	459853
Facility ID:	AZ0-004319
Lust ID:	AZ0-004319-3771.01
Name:	SALVATION ARMY - ADULT REHABILITATION CENTER
Address:	2717 S 6TH AVE
City,State,Zip:	TUCSON, AZ 0
Address Match Type:	PointAddress
Reported Date:	1994/10/21 15:59:59+00

SALVATION ARMY - ADULT REHABILITATION CENTER (Continued) **1028174500**

Status:	No Further Action
Substance:	Not reported
Population within 1500ft:	828
Domestic Wells within 1500ft:	0
Land Use:	Developed, High Intensity
Within SPA:	No
SPA PWS Facility ID:	Not reported
SPA Water Type:	Not reported
SPA Facility Type:	Not reported
SPA HUC12:	Not reported
Within WHPA:	No
WHPA PWS Facility ID:	Not reported
WHPA Water Type:	Not reported
WHPA Facility Type:	Not reported
WHPA HUC12:	Not reported
Within 100yr Floodplain:	No
Tribe:	Not reported
EPA Region:	9
NFA Letter 1:	Not reported
NFA Letter 2:	Not reported
NFA Letter 3:	Not reported
NFA Letter 4:	Not reported
Closed With Residual Contaminate:	Not reported
Coordinate Source:	Geocode
X Coord:	-110.967921
Y Coord:	32.1908760000001
Latitude:	32.190876
Longitude:	-110.967921

N42 **SALVATION ARMY - ADULT REHABILITATION CENTER** **LUST** **U001626919**
WNW **2717 S 6TH AVE** **UST** **N/A**
1/4-1/2 **TUCSON, AZ 85713** **AZURITE**
0.485 mi. **EMAP**
2559 ft. **Site 2 of 2 in cluster N**

Relative:
Lower

Actual:
2436 ft.

LUST:

Name:	SALVATION ARMY - ADULT REHABILITATION CENTER
Address:	2717 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004319
Lust Number:	3771.01
Facility Status:	CLOSED
Leak Priority:	5R1
Priority Description:	Closed soil-only CoC levels meet RBCA Tier 1 standards
Notification:	10/21/94
Date Closed:	04/13/95

UST:

Name:	SALVATION ARMY - ADULT REHABILITATION CENTER
Address:	2717 S 6TH AVE
City,State,Zip:	TUCSON, AZ 85713
Facility ID:	0-004319
Owner:	SALVATION ARMY ADULT REHAB
Latitude:	32.190435
Longitude:	110.967531
Tank ID:	1

SALVATION ARMY - ADULT REHABILITATION CENTER (Continued) **U001626919**

Date Closed: 01/05/1994
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1968**
Capacity: **1000**
Substance: **Unleaded Gasoline**
Compartment: **COMPARTMENT A**
Tank Const Type: **Unknown**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Not reported**

Tank ID: 2
Date Closed: 01/05/1994
Tank Status: **Perm Closure**
Closure Type: **Removal**
Tank Inst Date: **01/01/1976**
Capacity: **6000**
Substance: **Diesel**
Compartment: **COMPARTMENT A**
Tank Const Type: **Unknown**
Tank Mtrl Type: **Asphalt coated or Bare Steel**
Pipe Type: **Suction - Check Valve at the Tank Top**
Pipe Mtrl Type: **Bare or Galvanized Steel**
Pipe const Type: **Not reported**

AZURITE:
Remediation Level Achieved: HBGL Residential
Name: SALVATION ARMY - ADULT REHABILITATION CENTER
Address: 2717 S 6TH AVE
City,State,Zip: TUCSON, AZ 85713
Remediation ID: 1849
Program: LEAKING UNDERGROUND STORAGE TANK PROGRAM
Program File Number: UST3771.01
Type: OTHER
Remediation Start Date: 04/13/1995
Remediation End Date: 04/13/1995
DEUR Record Date: Not reported
WPD Dirctrs Approval: Not reported
VEMUR Record Date: Not reported
DEUR Release Date: Not reported

EMAP:
Name: SALVATION ARMY - ADULT REHABILITATION CENTER
Address: 2717 S 6TH AVE
City,State,Zip: TUCSON, AZ 85713
ID Number: 5624
Township: Not reported
Range: Not reported
Section: Not reported
Quarter 1: Not reported
Quarter 2: Not reported
Quarter 3: Not reported
Latitude: 32.19043513
Longitude: -110.96753136

SALVATION ARMY - ADULT REHABILITATION CENTER (Continued) **U001626919**

Collection Method:	GPS WITH CORRECTION < 3 METER ERROR
Place Type:	GASOLINE FILLING STATION - FLEET
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	NOT ACTIVE
End Date:	08/29/2012
Verified:	Y

---

43 **OPTICAL ELECTRONICS INC.** **SHWS** **1000486411**
SSE **3939 S. PARK AVE/180** **N/A**
1/2-1 **TUCSON, AZ 85714**
0.772 mi.
4075 ft.

Relative:
Higher

Actual:
2477 ft.

SHWS:

EPA ID:	AZD983474628
Program:	PA/SI
Site Code:	Not reported
Facility Id:	1050
Discovery Date:	01/01/1900
Source:	Not reported
Operable Unit:	Not reported
QWARF Area:	Not reported
Lat:	Not reported
Long:	Not reported
Lat/Long Method:	99
Comments:	Not reported

---

44 **VEGA BIOCHEMICAL INC (OLD SITE)** **SHWS** **S101571036**
South **420 E COLUMBIA ST** **EMAP** **N/A**
1/2-1 **TUCSON, AZ 85719**
0.990 mi.
5227 ft.

Relative:
Higher

Actual:
2484 ft.

SHWS:

EPA ID:	AZD980817340
Program:	PA/SI
Site Code:	Not reported
Facility Id:	298
Discovery Date:	01/01/1981
Source:	Not reported
Operable Unit:	Not reported
QWARF Area:	Not reported
Lat:	Not reported
Long:	Not reported
Lat/Long Method:	10
Comments:	Not reported

EMAP:

Name:	AKER SOLUTIONS
Address:	420 E COLUMBIA ST
City,State,Zip:	TUCSON, AZ 85714
ID Number:	142922
Township:	Not reported
Range:	Not reported
Section:	Not reported

VEGA BIOCHEMICAL INC (OLD SITE) (Continued) **S101571036**

Quarter 1:	Not reported
Quarter 2:	Not reported
Quarter 3:	Not reported
Latitude:	32.17293333
Longitude:	-110.96173611
Collection Method:	LOCATED FROM COUNTY PARCEL INFORMATION
Place Type:	COMMERCIAL PROPERTY
Place Type Code:	PP
Place C Code:	PHYSICAL PROPERTIES
Facility Status:	ACTIVE
End Date:	Not reported
Verified:	Y

Count: 3 records. ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
TUCSON	S113878980	VARSITY CLEANERS	921 E 3RD		DRYCLEANERS
TUCSON	S113876605	CAMPUS CLEANERS	922 E 3RD		DRYCLEANERS
TUCSON	S113878640	SUPER CLEANERS TUCSON	515 GRANT ROAD		DRYCLEANERS

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 3
Telephone 215-814-5418

EPA Region 4
Telephone 404-562-8033

EPA Region 5
Telephone 312-886-6686

EPA Region 10
Telephone 206-553-8665

EPA Region 6
Telephone: 214-655-6659

EPA Region 7
Telephone: 913-551-7247

EPA Region 8
Telephone: 303-312-6774

EPA Region 9
Telephone: 415-947-4246

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: N/A
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/20/2024
Date Data Arrived at EDR: 12/18/2024
Date Made Active in Reports: 12/20/2024
Number of Days to Update: 2

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that. based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: (415) 495-8895
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: (415) 495-8895
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: (415) 495-8895
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: (415) 495-8895
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 11/11/2024
Date Data Arrived at EDR: 11/25/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 85

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 03/04/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 11/04/2024
Date Data Arrived at EDR: 11/15/2024
Date Made Active in Reports: 02/11/2025
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 02/18/2025
Next Scheduled EDR Contact: 12/02/2024
Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 11/04/2024
Date Data Arrived at EDR: 11/15/2024
Date Made Active in Reports: 02/11/2025
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 703-603-0695
Last EDR Contact: 02/18/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/03/2024
Date Data Arrived at EDR: 12/11/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 69

Source: National Response Center, United States Coast Guard
Telephone: 202-267-2180
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

Lists of state- and tribal (Superfund) equivalent sites

AZ NPL: NPL Detail Listing

Detailed site information for NPL sites from the Arizona Department of Environmental Quality.

Date of Government Version: 03/31/2023
Date Data Arrived at EDR: 05/25/2023
Date Made Active in Reports: 08/14/2023
Number of Days to Update: 81

Source: Department of Environmental Quality
Telephone: 602-771-4609
Last EDR Contact: 02/05/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Varies

WQARF: Water Quality Assurance Revolving Fund Sites

Sites which may have an actual or potential impact upon the waters of the state, cause by hazardous substances. The WQARF program provides matching funds to political subdivisions and other state agencies for clean-up activities.

Date of Government Version: 04/03/2024
Date Data Arrived at EDR: 05/02/2024
Date Made Active in Reports: 07/24/2024
Number of Days to Update: 83

Source: Department of Environmental Quality
Telephone: 602-771-4360
Last EDR Contact: 02/05/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Annually

Lists of state- and tribal hazardous waste facilities

SPL: Superfund Program List

The list is representative of the sites and potential sites within the jurisdiction of the Superfund Program Section. It is comprised of the following elements: 1) Water Quality Assurance Revolving Fund Registry Sites; 2) Potential WQARF Registry sites; 3) NPL sites; and 4) Department of Defense sites requiring SPS oversight.

Date of Government Version: 08/25/2004
Date Data Arrived at EDR: 04/04/2018
Date Made Active in Reports: 05/17/2018
Number of Days to Update: 43

Source: Department of Environmental Quality
Telephone: 602-771-4360
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: No Update Planned

SHWS: ZipAcids List

The ACIDS list consists of more than 750 locations subject to investigation under the State Water Quality Assurance Revolving Fund (WQARF) and Federal CERCLA programs. The list is no longer updated by the state.

Date of Government Version: 01/03/2000
Date Data Arrived at EDR: 04/11/2000
Date Made Active in Reports: 05/16/2000
Number of Days to Update: 35

Source: Department of Environmental Quality
Telephone: 602-771-4360
Last EDR Contact: 03/05/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: No Update Planned

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Directory of Solid Waste Facilities

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 12/04/2024
Date Data Arrived at EDR: 12/27/2024
Date Made Active in Reports: 03/14/2025
Number of Days to Update: 77

Source: Department of Environmental Quality
Telephone: 602-771-2300
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

Lists of state and tribal leaking storage tanks

LUST: Leaking Underground Storage Tank Listing

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 12/11/2024
Date Data Arrived at EDR: 12/30/2024
Date Made Active in Reports: 03/14/2025
Number of Days to Update: 74

Source: Department of Environmental Quality
Telephone: 602-771-4345
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Semi-Annually

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 4
Telephone: 404-562-8677
Last EDR Contact: 01/16/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA, Region 5
Telephone: 312-886-7439
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81
Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81
Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81
Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing
A listing of all FEMA owned underground storage tanks.

Date of Government Version: 04/08/2025
Date Data Arrived at EDR: 04/23/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 1
Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

UST: Underground Storage Tank Listing
Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 12/11/2024
Date Data Arrived at EDR: 12/27/2024
Date Made Active in Reports: 03/14/2025
Number of Days to Update: 77
Source: Department of Environmental Quality
Telephone: 602-771-4345
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Annually

AST 2: Aboveground Storage Tank Listing
A listing of aboveground storage tank site locations.

Date of Government Version: 11/12/2024
Date Data Arrived at EDR: 12/04/2024
Date Made Active in Reports: 02/19/2025
Number of Days to Update: 77
Source: Department of Environmental Quality
Telephone: 602-771-4380
Last EDR Contact: 02/26/2025
Next Scheduled EDR Contact: 06/16/2025
Data Release Frequency: Varies

AST: List of Aboveground Storage Tanks
Aboveground storage tanks that the Dept. of Building & Fire Safety have permitted.

Date of Government Version: 12/05/2019
Date Data Arrived at EDR: 12/06/2019
Date Made Active in Reports: 01/31/2020
Number of Days to Update: 56

Source: Department of Building & Fire Safety
Telephone: 602-364-1003
Last EDR Contact: 02/26/2025
Next Scheduled EDR Contact: 06/16/2025
Data Release Frequency: No Update Planned

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 11/08/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/15/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 11/18/2024
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/16/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 81

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

AZURITE: Remediation and DEUR/VEMUR Tracking System

ADEQ maintains a repository listing sites remediated under programs administered by the department.

Date of Government Version: 03/12/2024
Date Data Arrived at EDR: 03/14/2024
Date Made Active in Reports: 06/04/2024
Number of Days to Update: 82

Source: Department of Environmental Quality
Telephone: 602-771-4397
Last EDR Contact: 03/05/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: Varies

AUL: DEUR Database

Activity and use limitations include both engineering controls and institutional controls. DEUR and VEMUR sites. DEUR: Declaration of Environmental Use Restriction. A restrictive land use covenant that is required when a property owner elects to use an institutional (i.e., administrative) control or engineering (i.e., physical) control as a means to meet remediation goals. The DEUR runs with and burdens the land, and requires maintenance of any institutional or engineering controls. VEMUR: Voluntary Environmental Mitigation Use Restriction. A restrictive land use covenant that, prior to July 18, 2000, was required when a property owner elected to remediate the property to non-residential uses. Effective July 18, 2000, the DEUR replaced the VEMUR as a restrictive use covenant.

Date of Government Version: 03/12/2024
Date Data Arrived at EDR: 03/14/2024
Date Made Active in Reports: 06/04/2024
Number of Days to Update: 82

Source: Department of Environmental Quality
Telephone: 602-771-4397
Last EDR Contact: 03/05/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: Varies

Lists of state and tribal voluntary cleanup sites

VCP: Voluntary Remediation Program Sites

Sites involved in the Voluntary Remediation Program.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 01/03/2025
Date Made Active in Reports: 03/19/2025
Number of Days to Update: 75

Source: Department of Environmental Quality
Telephone: 602-771-4411
Last EDR Contact: 03/19/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing
A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142
Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 03/12/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng
A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27
Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

BROWNFIELDS: Brownfields Tracking System
Information relating to Brownfields sites in Arizona.

Date of Government Version: 09/08/2022
Date Data Arrived at EDR: 09/09/2022
Date Made Active in Reports: 12/08/2022
Number of Days to Update: 90
Source: Department of Environmental Quality
Telephone: 602-771-4401
Last EDR Contact: 03/25/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites
Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 09/09/2024
Date Data Arrived at EDR: 09/11/2024
Date Made Active in Reports: 12/06/2024
Number of Days to Update: 86
Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 03/12/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWTIRE: Solid Waste Tire Facilities
A waste tire "facility" means a solid waste facility at which waste tires are stored outdoors on any day.

Date of Government Version: 11/20/2024
Date Data Arrived at EDR: 11/22/2024
Date Made Active in Reports: 02/14/2025
Number of Days to Update: 84
Source: Department of Environmental Quality
Telephone: 602-771-4132
Last EDR Contact: 02/12/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands
Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52
Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 04/21/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations
A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137
Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: No Update Planned

ODI: Open Dump Inventory
An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39
Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land
A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 02/07/2024
Date Data Arrived at EDR: 11/13/2024
Date Made Active in Reports: 11/19/2024
Number of Days to Update: 6
Source: Department of Health & Human Serivces, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 11/13/2024
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register
A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 05/20/2024
Date Data Arrived at EDR: 08/19/2024
Date Made Active in Reports: 10/09/2024
Number of Days to Update: 51
Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/20/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: No Update Planned

CDL: Clandestine Drug Labs
A listing of drug lab seizures in Arizona.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/30/2019
Date Made Active in Reports: 12/12/2019
Number of Days to Update: 43
Source: Board of Technical Registration
Telephone: 602-364-4931
Last EDR Contact: 03/12/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Varies

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 05/20/2024
Date Data Arrived at EDR: 08/19/2024
Date Made Active in Reports: 10/09/2024
Number of Days to Update: 51

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/20/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Quarterly

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/10/2024
Date Data Arrived at EDR: 12/11/2024
Date Made Active in Reports: 02/27/2025
Number of Days to Update: 78

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

SPILLS: Hazardous Material Logbook

Chemical spills and incidents referred to the Emergency Response Unit.

Date of Government Version: 11/15/2024
Date Data Arrived at EDR: 12/03/2024
Date Made Active in Reports: 02/19/2025
Number of Days to Update: 78

Source: Department of Environmental Quality
Telephone: 602-771-4153
Last EDR Contact: 02/18/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/11/2001
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 02/11/2013
Number of Days to Update: 39

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

Other Ascertainable Records

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: (415) 495-8895
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/30/2025
Date Data Arrived at EDR: 02/11/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 72

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 02/11/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021
Date Data Arrived at EDR: 07/13/2021
Date Made Active in Reports: 03/09/2022
Number of Days to Update: 239

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 04/08/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/11/2018
Date Made Active in Reports: 11/06/2019
Number of Days to Update: 574

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 07/30/2021
Date Data Arrived at EDR: 02/03/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 02/03/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/06/2025
Number of Days to Update: 15

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA Watch List

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 01/27/2025
Next Scheduled EDR Contact: 05/12/2025
Data Release Frequency: No Update Planned

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 01/30/2025
Next Scheduled EDR Contact: 05/12/2025
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 06/14/2022
Date Made Active in Reports: 03/24/2023
Number of Days to Update: 283

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 03/10/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 02/11/2025
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 7

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 02/11/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 01/13/2025
Date Data Arrived at EDR: 01/15/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 82

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/15/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 01/29/2025
Date Data Arrived at EDR: 02/03/2025
Date Made Active in Reports: 02/27/2025
Number of Days to Update: 24

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 06/09/2025
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 01/01/2025
Date Data Arrived at EDR: 01/17/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 80

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 02/26/2025
Date Data Arrived at EDR: 03/03/2025
Date Made Active in Reports: 04/07/2025
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-6023
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 05/12/2025
Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 07/01/2024
Date Data Arrived at EDR: 10/02/2024
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 100

Source: EPA
Telephone: 202-566-0500
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016
Date Data Arrived at EDR: 11/23/2016
Date Made Active in Reports: 02/10/2017
Number of Days to Update: 79

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA
Telephone: 202-566-1667
Last EDR Contact: 08/18/2017
Next Scheduled EDR Contact: 12/04/2017
Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 10/12/2024
Date Data Arrived at EDR: 10/17/2024
Date Made Active in Reports: 11/19/2024
Number of Days to Update: 33

Source: Nuclear Regulatory Commission
Telephone: 301-415-0717
Last EDR Contact: 04/10/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 10/16/2024
Date Made Active in Reports: 01/14/2025
Number of Days to Update: 90

Source: Department of Energy
Telephone: 202-586-8719
Last EDR Contact: 02/24/2025
Next Scheduled EDR Contact: 06/09/2025
Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 11/11/2019
Number of Days to Update: 251
Source: Environmental Protection Agency
Telephone: N/A
Last EDR Contact: 02/24/2025
Next Scheduled EDR Contact: 06/09/2025
Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database
The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019
Date Data Arrived at EDR: 11/06/2019
Date Made Active in Reports: 02/10/2020
Number of Days to Update: 96
Source: Environmental Protection Agency
Telephone: 202-566-0517
Last EDR Contact: 01/30/2025
Next Scheduled EDR Contact: 05/12/2025
Data Release Frequency: Varies

RADINFO: Radiation Information Database
The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019
Date Data Arrived at EDR: 07/01/2019
Date Made Active in Reports: 09/23/2019
Number of Days to Update: 84
Source: Environmental Protection Agency
Telephone: 202-343-9775
Last EDR Contact: 03/20/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing
A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing
A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40
Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data
Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/10/2025
Date Data Arrived at EDR: 01/22/2025
Date Made Active in Reports: 04/21/2025
Number of Days to Update: 89
Source: Department of Transporation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 04/22/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2024
Date Data Arrived at EDR: 01/27/2025
Date Made Active in Reports: 04/21/2025
Number of Days to Update: 84

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2023
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/07/2025
Number of Days to Update: 16

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 03/03/2023
Date Data Arrived at EDR: 03/03/2023
Date Made Active in Reports: 06/09/2023
Number of Days to Update: 98

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 01/23/2025
Next Scheduled EDR Contact: 05/12/2025
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 02/12/2025
Date Data Arrived at EDR: 02/12/2025
Date Made Active in Reports: 02/27/2025
Number of Days to Update: 15

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 02/06/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 03/27/2025
Date Data Arrived at EDR: 04/01/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 04/01/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/03/2025
Date Data Arrived at EDR: 02/18/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 30

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 02/18/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Semi-Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 02/19/2025
Date Data Arrived at EDR: 02/21/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 27

Source: DOL, Mine Safety & Health Admi
Telephone: 202-693-9424
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Quarterly

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 05/02/2024
Date Data Arrived at EDR: 08/20/2024
Date Made Active in Reports: 10/09/2024
Number of Days to Update: 50

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 02/20/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 02/20/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

MINES MRDS: Mineral Resources Data System

Mineral Resources Data System

Date of Government Version: 06/04/2024
Date Data Arrived at EDR: 11/22/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 88

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 02/20/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 12/10/2024
Date Data Arrived at EDR: 12/11/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 69

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 03/12/2025
Next Scheduled EDR Contact: 06/16/2025
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 11/11/2024
Date Data Arrived at EDR: 11/20/2024
Date Made Active in Reports: 02/18/2025
Number of Days to Update: 90

Source: EPA
Telephone: (415) 947-8000
Last EDR Contact: 02/25/2025
Next Scheduled EDR Contact: 06/09/2025
Data Release Frequency: Quarterly

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 12/21/2024
Date Data Arrived at EDR: 12/27/2024
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 09/06/2023
Date Data Arrived at EDR: 09/13/2023
Date Made Active in Reports: 12/11/2023
Number of Days to Update: 89

Source: Department of Defense
Telephone: 703-704-1564
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/21/2025
Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/06/2021
Date Data Arrived at EDR: 05/21/2021
Date Made Active in Reports: 08/11/2021
Number of Days to Update: 82

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 02/12/2025
Next Scheduled EDR Contact: 06/02/2025
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 11/08/2024
Date Data Arrived at EDR: 11/08/2024
Date Made Active in Reports: 01/14/2025
Number of Days to Update: 67

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 02/13/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Quarterly

PFAS NPL: Superfund Sites with PFAS Detections Information

EPA's Office of Land and Emergency Management and EPA Regional Offices maintain data describing what is known about site investigations, contamination, and remedial actions under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) where PFAS is present in the environment.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 703-603-8895
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS FEDERAL SITES: Federal Sites PFAS Information

Several federal entities, such as the federal Superfund program, Department of Defense, National Aeronautics and Space Administration, Department of Transportation, and Department of Energy provided information for sites with known or suspected detections at federal facilities.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS TSCA: PFAS Manufacture and Imports Information

EPA issued the Chemical Data Reporting (CDR) Rule under the Toxic Substances Control Act (TSCA) and requires chemical manufacturers and facilities that manufacture or import chemical substances to report data to EPA. EPA publishes non-confidential business information (non-CBI) and includes descriptive information about each site, corporate parent, production volume, other manufacturing information, and processing and use information.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS TRIS: List of PFAS Added to the TRI

Section 7321 of the National Defense Authorization Act for Fiscal Year 2020 (NDAA) immediately added certain per- and polyfluoroalkyl substances (PFAS) to the list of chemicals covered by the Toxics Release Inventory (TRI) under Section 313 of the Emergency Planning and Community Right-to-Know Act (EPCRA) and provided a framework for additional PFAS to be added to TRI on an annual basis.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-566-0250
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS RCRA MANIFEST: PFAS Transfers Identified In the RCRA Database Listing

To work around the lack of PFAS waste codes in the RCRA database, EPA developed the PFAS Transfers dataset by mining e-Manifest records containing at least one of these common PFAS keywords: PFAS, PFOA, PFOS, PERFL, AFFF, GENX, GEN-X (plus the VT waste codes). These keywords were searched for in the following text fields: Manifest handling instructions (MANIFEST_HANDLING_INSTR), Non-hazardous waste description (NON_HAZ_WASTE_DESCRIPTION), DOT printed information (DOT_PRINTED_INFORMATION), Waste line handling instructions (WASTE_LINE_HANDLING_INSTR), Waste residue comments (WASTE_RESIDUE_COMMENTS).

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS ATSDR: PFAS Contamination Site Location Listing

PFAS contamination site locations from the Department of Health & Human Services, Center for Disease Control & Prevention. ATSDR is involved at a number of PFAS-related sites, either directly or through assisting state and federal partners. As of now, most sites are related to drinking water contamination connected with PFAS production facilities or fire training areas where aqueous film-forming firefighting foam (AFFF) was regularly used.

Date of Government Version: 06/24/2020
Date Data Arrived at EDR: 03/17/2021
Date Made Active in Reports: 11/08/2022
Number of Days to Update: 601

Source: Department of Health & Human Services
Telephone: 202-741-5770
Last EDR Contact: 04/17/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

PFAS WQP: Ambient Environmental Sampling for PFAS

The Water Quality Portal (WQP) is a part of a modernized repository storing ambient sampling data for all environmental media and tissue samples. A wide range of federal, state, tribal and local governments, academic and non-governmental organizations and individuals submit project details and sampling results to this public repository. The information is commonly used for research and assessments of environmental quality.

Date of Government Version: 12/13/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS PROJECT: NORTHEASTERN UNIVERSITY PFAS PROJECT

The PFAS Contamination Site Tracker records qualitative and quantitative data from each site in a chart, specifically examining discovery, contamination levels, government response, litigation, health impacts, media coverage, and community characteristics. All data presented in the chart were extracted from government websites, such as state health departments or the Environmental Protection Agency, and news articles.

Date of Government Version: 05/19/2023
Date Data Arrived at EDR: 04/05/2024
Date Made Active in Reports: 06/06/2024
Number of Days to Update: 62

Source: Social Science Environmental Health Research Institute
Telephone: N/A
Last EDR Contact: 03/06/2025
Next Scheduled EDR Contact: 06/16/2025
Data Release Frequency: Varies

PFAS NPDES: Clean Water Act Discharge Monitoring Information

Any discharger of pollutants to waters of the United States from a point source must have a National Pollutant Discharge Elimination System (NPDES) permit. The process for obtaining limits involves the regulated entity (permittee) disclosing releases in a NPDES permit application and the permitting authority (typically the state but sometimes EPA) deciding whether to require monitoring or monitoring with limits. Caveats and Limitations: Less than half of states have required PFAS monitoring for at least one of their permittees and fewer states have established PFAS effluent limits for permittees. New rulemakings have been initiated that may increase the number of facilities monitoring for PFAS in the future.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/14/2025
Number of Days to Update: 12

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS ECHO: Facilities in Industries that May Be Handling PFAS Listing

Regulators and the public have expressed interest in knowing which regulated entities may be using PFAS. EPA has developed a dataset from various sources that show which industries may be handling PFAS. Approximately 120,000 facilities subject to federal environmental programs have operated or currently operate in industry sectors with processes that may involve handling and/or release of PFAS.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS ECHO FIRE TRAIN: Facilities in Industries that May Be Handling PFAS Listing

A list of fire training sites was added to the Industry Sectors dataset using a keyword search on the permitted facilitys name to identify sites where fire-fighting foam may have been used in training exercises. Additionally, you may view an example spreadsheet of the subset of fire training facility data, as well as the keywords used in selecting or deselecting a facility for the subset. as well as the keywords used in selecting or deselecting a facility for the subset. These keywords were tested to maximize accuracy in selecting facilities that may use fire-fighting foam in training exercises, however, due to the lack of a required reporting field in the data systems for designating fire training sites, this methodology may not identify all fire training sites or may potentially misidentify them.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PFAS PT 139 AIRPORT: All Certified Part 139 Airports PFAS Information Listing

Since July 1, 2006, all certified part 139 airports are required to have fire-fighting foam onsite that meet military specifications (MIL-F-24385) (14 CFR 139.317). To date, these military specification fire-fighting foams are fluorinated and have been historically used for training and extinguishing. The 2018 FAA Reauthorization Act has a provision stating that no later than October 2021, FAA shall not require the use of fluorinated AFFF. This provision does not prohibit the use of fluorinated AFFF at Part 139 civilian airports; it only prohibits FAA from mandating its use. The Federal Aviation Administration?s document AC 150/5210-6D - Aircraft Fire Extinguishing Agents provides guidance on Aircraft Fire Extinguishing Agents, which includes Aqueous Film Forming Foam (AFFF).

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-272-0167
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

AQUEOUS FOAM NRC: Aqueous Foam Related Incidents Listing

The National Response Center (NRC) serves as an emergency call center that fields initial reports for pollution and railroad incidents and forwards that information to appropriate federal/state agencies for response. The spreadsheets posted to the NRC website contain initial incident data that has not been validated or investigated by a federal/state response agency. Response center calls from 1990 to the most recent complete calendar year where there was indication of Aqueous Film Forming Foam (AFFF) usage are included in this dataset. NRC calls may reference AFFF usage in the ?Material Involved? or ?Incident Description? fields.

Date of Government Version: 12/30/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 01/10/2025
Number of Days to Update: 8

Source: Environmental Protection Agency
Telephone: 202-267-2675
Last EDR Contact: 04/02/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PCS ENF: Enforcement data

No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 12/16/2016
Date Data Arrived at EDR: 01/06/2017
Date Made Active in Reports: 03/10/2017
Number of Days to Update: 63

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 03/27/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: No Update Planned

BIOSOLIDS: ICIS-NPDES Biosolids Facility Data

The data reflects compliance information about facilities in the biosolids program.

Date of Government Version: 01/12/2025
Date Data Arrived at EDR: 01/14/2025
Date Made Active in Reports: 03/20/2025
Number of Days to Update: 65

Source: Environmental Protection Agency
Telephone: 202-564-4700
Last EDR Contact: 04/15/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

UST FINDER RELEASE: UST Finder Releases Database

US EPA's UST Finder data is a national composite of leaking underground storage tanks. This data contains information about, and locations of, leaking underground storage tanks. Data was collected from state sources and standardized into a national profile by EPA's Office of Underground Storage Tanks, Office of Research and Development, and the Association of State and Territorial Solid Waste Management Officials.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/31/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 79

Source: Environmental Protecton Agency
Telephone: 202-564-0394
Last EDR Contact: 02/06/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: Semi-Annually

UST FINDER: UST Finder Database

EPA developed UST Finder, a web map application containing a comprehensive, state-sourced national map of underground storage tank (UST) and leaking UST (LUST) data. It provides the attributes and locations of active and closed USTs, UST facilities, and LUST sites from states and from Tribal lands and US territories . UST Finder contains information about proximity of UST facilities and LUST sites to: surface and groundwater public drinking water protection areas; estimated number of private domestic wells and number of people living nearby; and flooding and wildfires.

Date of Government Version: 06/08/2023
Date Data Arrived at EDR: 10/04/2023
Date Made Active in Reports: 01/18/2024
Number of Days to Update: 106

Source: Environmental Protection Agency
Telephone: 202-564-0394
Last EDR Contact: 02/06/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: Varies

E MANIFEST: Hazardous Waste Electronic Manifest System

EPA established a national system for tracking hazardous waste shipments electronically. This system, known as ?e-Manifest,? will modernize the nation?s cradle-to-grave hazardous waste tracking process while saving valuable time, resources, and dollars for industry and states.

Date of Government Version: 02/17/2025
Date Data Arrived at EDR: 02/19/2025
Date Made Active in Reports: 03/14/2025
Number of Days to Update: 23

Source: Environmental Protection Agency
Telephone: 833-501-6826
Last EDR Contact: 03/18/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Varies

PFAS: PFAS Contamination Site Listing

Arizona?s Public Water System Screening for Perfluorooctanoic Acid (PFOA) and Perfluorooctane Sulfonate (PFOS) Final Report. The purpose of the grant was to screen Public Water System (PWS) drinking water wells in Arizona potentially impacted by perfluorooctanoic acid (PFOA) and/or perfluorooctane sulfonate (PFOS) contamination.

Date of Government Version: 09/22/2021
Date Data Arrived at EDR: 05/03/2022
Date Made Active in Reports: 07/20/2022
Number of Days to Update: 78

Source: Department of Environmental Quality
Telephone: 602-364-3118
Last EDR Contact: 04/23/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

AQUEOUS FOAM: Aqueous Film Forming Foam Listing

When AFFF is used, discharged or released to the environment, containment and cleanup may be required to prevent future adverse health or environmental impacts.

Date of Government Version: 11/14/2020
Date Data Arrived at EDR: 03/22/2022
Date Made Active in Reports: 04/26/2022
Number of Days to Update: 35

Source: Department of Environmenatl Quality
Telephone: 602-771-6145
Last EDR Contact: 04/23/2025
Next Scheduled EDR Contact: 08/11/2025
Data Release Frequency: Varies

AIRS: Arizona Airs Database

Arizona major (has the potential to emit over 100 tons of criteria pollutant) and minor (below 100 tons) sources.

Date of Government Version: 12/24/2024
Date Data Arrived at EDR: 01/02/2025
Date Made Active in Reports: 03/19/2025
Number of Days to Update: 76

Source: Department of Environmental Quality
Telephone: 602-771-2344
Last EDR Contact: 03/19/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Semi-Annually

AQUIFER: Aquifer Protection Permits List

Facilities with an Aquifer Protection permit (APP), that discharges either directly to an aquifer or to the land surface or the vadose zone in such a manner that there is a reasonable probability that the pollutant will reach an aquifer.

Date of Government Version: 01/30/2025
Date Data Arrived at EDR: 02/05/2025
Date Made Active in Reports: 04/22/2025
Number of Days to Update: 76

Source: Department of Environmental Quality
Telephone: 602-771-4623
Last EDR Contact: 01/30/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: Semi-Annually

DOD: Department of Defense Sites

These sites are federal facilities that are either being assessed for potential contamination, or have active remediation taking place on them.

Date of Government Version: 03/31/2023
Date Data Arrived at EDR: 05/17/2023
Date Made Active in Reports: 08/04/2023
Number of Days to Update: 79

Source: Department of Environmental Quality
Telephone: 602-771-4360
Last EDR Contact: 02/05/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Annually

DRY WELLS: Drywell Registration

A drywell is a bored, drilled, or driven shaft or hole whose depth is greater than its width and is designed and constructed specifically for the disposal of storm water.

Date of Government Version: 09/12/2024
Date Data Arrived at EDR: 09/26/2024
Date Made Active in Reports: 10/15/2024
Number of Days to Update: 19

Source: Department of Environmental Quality
Telephone: 602-771-4686
Last EDR Contact: 02/05/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Semi-Annually

DRYCLEANERS: Drycleaner Facility Listing

A listing of drycleaner facilities in Arizona.

Date of Government Version: 06/17/2019
Date Data Arrived at EDR: 07/20/2020
Date Made Active in Reports: 10/07/2020
Number of Days to Update: 79

Source: Department of Environmental Quality
Telephone: 602-771-4335
Last EDR Contact: 03/05/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: No Update Planned

EMAP: All Places of Interest Listing

A listing of all places of interest to the Department of Environmental Quality, including air, waste and water sites.

Date of Government Version: 11/22/2024
Date Data Arrived at EDR: 11/22/2024
Date Made Active in Reports: 02/14/2025
Number of Days to Update: 84

Source: Department of Environmental Quality
Telephone: 602-771-4380
Last EDR Contact: 02/19/2025
Next Scheduled EDR Contact: 06/09/2025
Data Release Frequency: Varies

ENF: Enforcement and Violation Listing

A listing of enforcement and violation cases in the state of Arizona.

Date of Government Version: 01/15/2025
Date Data Arrived at EDR: 01/22/2025
Date Made Active in Reports: 04/04/2025
Number of Days to Update: 72

Source: Department of Environmental Quality
Telephone: 602-771-4424
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

FIN ASSURANCE 1: Financial Assurance Information Listing

Financial assurance information for ust sites.

Date of Government Version: 03/13/2025
Date Data Arrived at EDR: 03/18/2025
Date Made Active in Reports: 03/21/2025
Number of Days to Update: 3

Source: Department of Environmental Quality
Telephone: 602-771-4258
Last EDR Contact: 03/12/2025
Next Scheduled EDR Contact: 06/30/2025
Data Release Frequency: Varies

AZ MANIFEST: Manifest Information

Hazardous waste manifest information

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 06/15/2021
Date Made Active in Reports: 09/09/2021
Number of Days to Update: 86

Source: Department of Environmental Quality
Telephone: N/A
Last EDR Contact: 03/05/2025
Next Scheduled EDR Contact: 06/23/2025
Data Release Frequency: Annually

NPDES: Notice of Intent Construction Stormwater General Permits Database
NPDES permit sites

Date of Government Version: 01/07/2025
Date Data Arrived at EDR: 01/09/2025
Date Made Active in Reports: 03/26/2025
Number of Days to Update: 76

Source: Department of Environmental Quality
Telephone: 602-771-4424
Last EDR Contact: 03/26/2025
Next Scheduled EDR Contact: 07/14/2025
Data Release Frequency: Varies

VAPOR: Vapor Intrusion
A listing of vapor intrusion site locations

Date of Government Version: 04/21/2021
Date Data Arrived at EDR: 04/22/2021
Date Made Active in Reports: 07/09/2021
Number of Days to Update: 78

Source: Department of Environmental Quality
Telephone: 602-771-4197
Last EDR Contact: 03/19/2025
Next Scheduled EDR Contact: 07/07/2025
Data Release Frequency: Varies

UIC: Underground Injection Control Wells
Underground injection control wells.

Date of Government Version: 09/30/2015
Date Data Arrived at EDR: 02/05/2016
Date Made Active in Reports: 04/05/2016
Number of Days to Update: 60

Source: Arizona Geological Survey
Telephone: 520-770-3500
Last EDR Contact: 04/16/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Varies

WWFAC: Waste Water Treatment Facilities
Statewide list of waste water treatment facilities.

Date of Government Version: 07/09/2012
Date Data Arrived at EDR: 07/23/2012
Date Made Active in Reports: 09/06/2012
Number of Days to Update: 45

Source: Department of Environmental Quality
Telephone: 602-771-4623
Last EDR Contact: 04/09/2025
Next Scheduled EDR Contact: 07/28/2025
Data Release Frequency: Varies

DRYWELLS HIST: Historical Drywells Listing
Historical listing of registered drywells once maintained and made available by the Arizona Department of Environmental Quality (ADEQ) Water Quality Division. In April 2018, ADEQ stopped accepting paper forms and will no longer be updating this list.

Date of Government Version: 04/30/2018
Date Data Arrived at EDR: 09/26/2024
Date Made Active in Reports: 10/15/2024
Number of Days to Update: 19

Source: Department of Environmental Quality
Telephone: 602-771-4686
Last EDR Contact: 02/05/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: No Update Planned

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants
The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Quality in Arizona.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/02/2014
Number of Days to Update: 185

Source: Department of Environmental Quality
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Quality in Arizona.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/15/2014
Number of Days to Update: 198

Source: Department of Environmental Quality
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank
The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Quality in Arizona.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/02/2014
Number of Days to Update: 185
Source: Department of Environmental Quality
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

PIMA COUNTY:

LF TUCSON: City of Tucson Landfills Listing
Location and area of landfills owned by the City of Tucson.

Date of Government Version: 02/12/2024
Date Data Arrived at EDR: 04/04/2024
Date Made Active in Reports: 06/24/2024
Number of Days to Update: 81
Source: Tucson Department of Environmental and General Services
Telephone: 520-791-3171
Last EDR Contact: 04/03/2025
Next Scheduled EDR Contact: 07/15/2024
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data
Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 02/02/2025
Date Data Arrived at EDR: 02/04/2025
Date Made Active in Reports: 04/24/2025
Number of Days to Update: 79
Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 02/04/2025
Next Scheduled EDR Contact: 05/19/2025
Data Release Frequency: No Update Planned

NY MANIFEST: Facility and Manifest Data
Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 11/30/2023
Date Made Active in Reports: 12/01/2023
Number of Days to Update: 1
Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 04/24/2025
Next Scheduled EDR Contact: 08/04/2025
Data Release Frequency: Quarterly

RI MANIFEST: Manifest information
Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80
Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 02/06/2025
Next Scheduled EDR Contact: 05/26/2025
Data Release Frequency: Annually

WI MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 02/26/2025
Next Scheduled EDR Contact: 06/16/2025
Data Release Frequency: Annually

Oil/Gas Pipelines
Source: Endeavor Business Media
Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data
Source: Endeavor Business Media
This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:
Source: American Hospital Association, Inc.
Telephone: 312-280-5991
The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing
Source: Centers for Medicare & Medicaid Services
Telephone: 410-786-3000
A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes
Source: National Institutes of Health
Telephone: 301-594-6248
Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools
Source: National Center for Education Statistics
Telephone: 202-502-7300
The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facilities & Group Homes
Source: Department of Health Services
Telephone: 602-674-4220

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Riparian Vegetation Associated with Perennial Waters
Source: State Land Department
Telephone: 602-542-4094

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK ®- PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

JTED
751 EAST MARKETPLACE BOULEVARD
TUCSON, AZ 85713

TARGET PROPERTY COORDINATES

Latitude (North):	32.18794 - 32° 11' 16.58''
Longitude (West):	110.959997 - 110° 57' 35.99''
Universal Tranverse Mercator:	Zone 12
UTM X (Meters):	503770.8
UTM Y (Meters):	3561080.2
Elevation:	2461 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	50001019 TUCSON, AZ
Version Date:	2021

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).

TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General NW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

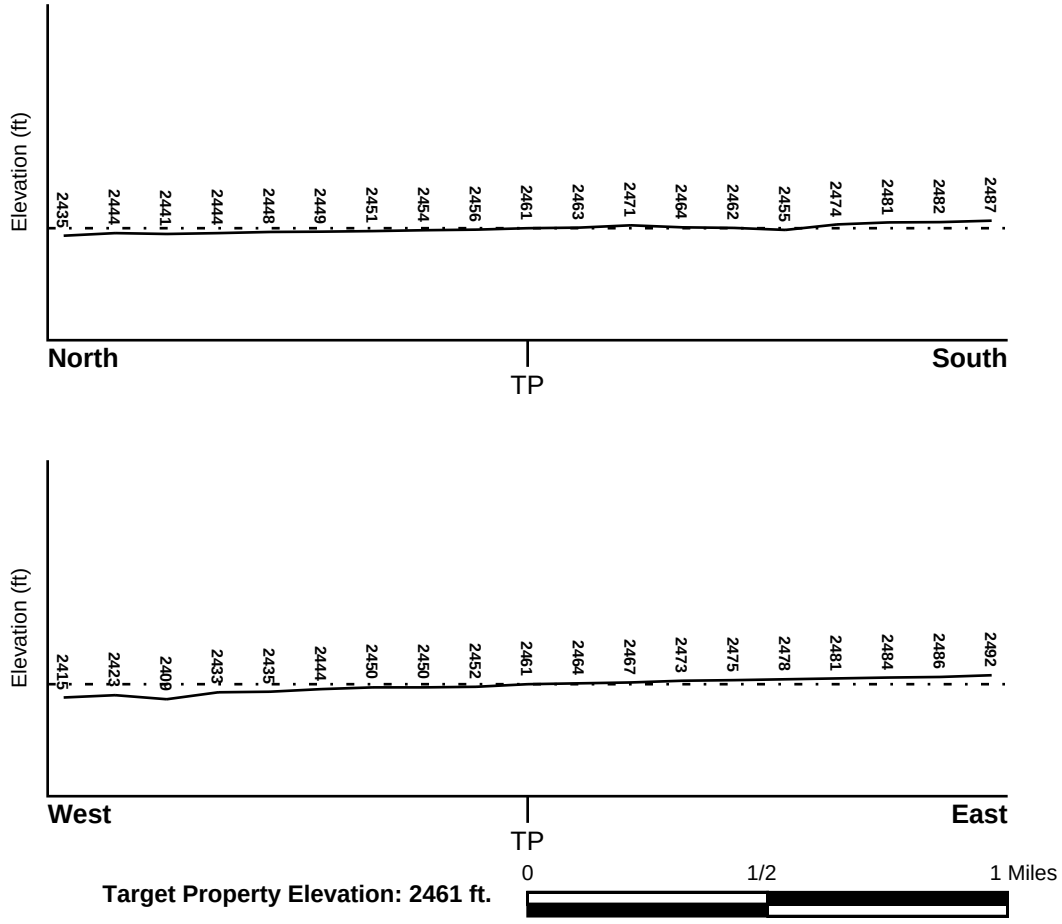

Target Property Elevation: 2461 ft.

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

Flood Plain Panel at Target Property	FEMA Source Type
04019C2279L	FEMA FIRM Flood data

Additional Panels in search area:	FEMA Source Type
04019C2278L	FEMA FIRM Flood data
04019C2287L	FEMA FIRM Flood data
04019C2286L	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

NWI Quad at Target Property	NWI Electronic Data Coverage
TUCSON	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
25	1/4 - 1/2 Mile WNW	Not Reported
K75	1/4 - 1/2 Mile WNW	NW
K115	1/2 - 1 Mile WNW	SW
V213	1/2 - 1 Mile WNW	N
AF284	1/2 - 1 Mile SSE	Not Reported
AR345	1/2 - 1 Mile NNW	NW

* ©1996 Site−specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

MAP ID	LOCATION FROM TP	GENERAL DIRECTION GROUNDWATER FLOW
1G	1/2 - 1 Mile NNW	NW
2G	1/2 - 1 Mile WNW	N
3G	1/2 - 1 Mile WNW	SW
4G	1/4 - 1/2 Mile WNW	Not Reported
5G	1/4 - 1/2 Mile WNW	NW
6G	1/2 - 1 Mile SSE	Not Reported

For additional site information, refer to Physical Setting Source Map Findings.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

Era:	Cenozoic
System:	Quaternary
Series:	Quaternary
Code:	Q *(decoded above as Era, System & Series)*

GEOLOGIC AGE IDENTIFICATION

Category: Stratifed Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 7970166.2s

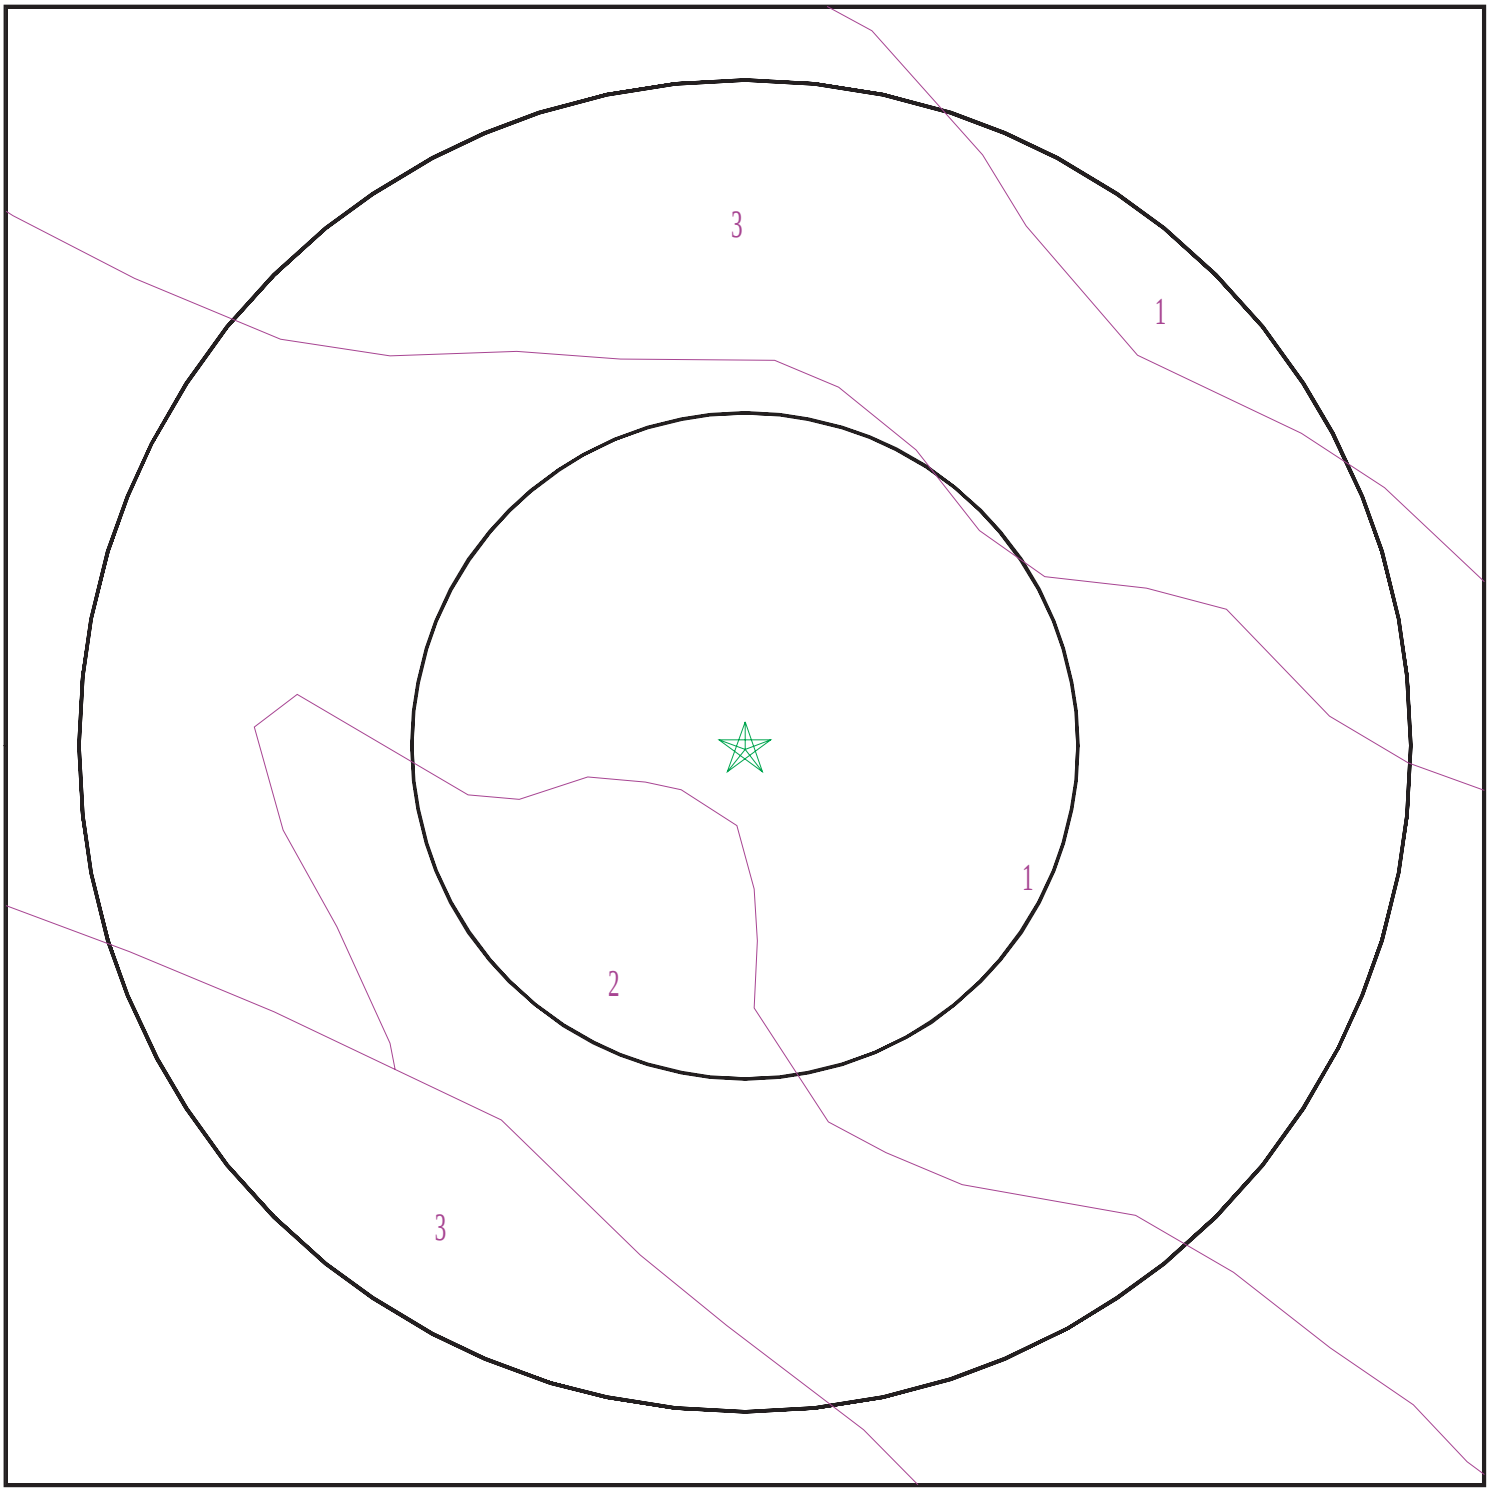

Target Property
SSURGO Soil
Water

0 1/16 1/8 1/4 Miles

N

SITE NAME:	JTED	CLIENT:	Western Technologies, Inc.
ADDRESS:	751 East Marketplace Boulevard Tucson AZ 85713	CONTACT:	Kenna Karjala
LAT/LONG:	32.18794 / 110.959997	INQUIRY #:	7970166.2s
		DATE:	April 25, 2025 4:04 pm

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name:	URBAN LAND
Soil Surface Texture:	
Hydrologic Group:	Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.
Soil Drainage Class:	Well drained
Hydric Status: Unknown	
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 0 inches
Depth to Watertable Min:	> 0 inches

No Layer Information available.

Soil Map ID: 2

Soil Component Name:	URBAN LAND
Soil Surface Texture:	
Hydrologic Group:	Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.
Soil Drainage Class:	Well drained
Hydric Status: Unknown	
Corrosion Potential - Uncoated Steel:	Not Reported
Depth to Bedrock Min:	> 0 inches
Depth to Watertable Min:	> 0 inches

No Layer Information available.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 3

Soil Component Name: SAHUARITA

Soil Surface Texture: very gravelly fine sandy loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep, moderately well and well drained soils with moderately coarse textures.

Soil Drainage Class: Well drained

Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
	Boundary			Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil		
1	0 inches	3 inches	very gravelly fine sandy loam	Not reported	Not reported	Max: 4.2333 Min: 1.4111	Max: 8.4 Min: 7.4
2	3 inches	27 inches	fine sandy loam	Not reported	Not reported	Max: 4.2333 Min: 1.4111	Max: 8.4 Min: 7.4
3	27 inches	44 inches	sandy clay loam	Not reported	Not reported	Max: 4.2333 Min: 1.4111	Max: 8.4 Min: 7.4
4	44 inches	59 inches	very gravelly sandy clay loam	Not reported	Not reported	Max: 4.2333 Min: 1.4111	Max: 8.4 Min: 7.4

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

WELL SEARCH DISTANCE INFORMATION

DATABASE	SEARCH DISTANCE (miles)
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 0.001 miles
State Database	1.000

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
B8	USGS40000037012	1/8 - 1/4 Mile NE
C13	USGS40000037013	1/4 - 1/2 Mile WNW
D17	USGS40000036959	1/4 - 1/2 Mile SW
D18	USGS40000036955	1/4 - 1/2 Mile SSW
50	USGS40000037038	1/4 - 1/2 Mile NNW
X207	USGS40000036950	1/2 - 1 Mile SE
AG280	USGS40000037086	1/2 - 1 Mile North
290	USGS40000036937	1/2 - 1 Mile SW
AN303	USGS40000036956	1/2 - 1 Mile WSW
AM309	USGS40000037102	1/2 - 1 Mile NNE
AM340	USGS40000037101	1/2 - 1 Mile NNE

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
A1	AZDEQ3000000617	0 - 1/8 Mile West
A2	AZDWR1200086052	0 - 1/8 Mile West
A3	AZDWR1200086054	0 - 1/8 Mile West
A4	AZDWR1200086053	0 - 1/8 Mile West
A5	AZDWR1200065910	0 - 1/8 Mile West
A6	AZDWR1200065911	0 - 1/8 Mile West
7	AZDWR1200181614	1/8 - 1/4 Mile WSW
B9	AZDWR1200153190	1/8 - 1/4 Mile NE
B10	AZDEQ3000028957	1/8 - 1/4 Mile NE
C11	AZDEQ3000028697	1/4 - 1/2 Mile WNW
12	AZDWR1200014366	1/4 - 1/2 Mile South
D14	AZDEQ3000028701	1/4 - 1/2 Mile SSW
D15	AZDEQ3000028700	1/4 - 1/2 Mile SSW
D16	AZDEQ3000028702	1/4 - 1/2 Mile SSW
E19	AZDWR1200079937	1/4 - 1/2 Mile SW

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
E20	AZDWR1200079938	1/4 - 1/2 Mile SW
E21	AZDWR1200078139	1/4 - 1/2 Mile SW
E22	AZDWR1200045010	1/4 - 1/2 Mile SW
E23	AZDWR1200079940	1/4 - 1/2 Mile SW
E24	AZDWR1200079939	1/4 - 1/2 Mile SW
26	AZDWR1200142100	1/4 - 1/2 Mile SSW
F27	AZDEQ3000028696	1/4 - 1/2 Mile NNW
F28	AZDWR1200188287	1/4 - 1/2 Mile NNW
G29	AZDWR1200117018	1/4 - 1/2 Mile SSE
G30	AZDWR1200116069	1/4 - 1/2 Mile SSE
G31	AZDWR1200117019	1/4 - 1/2 Mile SSE
G32	AZDWR1200212434	1/4 - 1/2 Mile SSE
G33	AZDWR1200138835	1/4 - 1/2 Mile SSE
G34	AZDWR1200067201	1/4 - 1/2 Mile SSE
G35	AZDWR1200063490	1/4 - 1/2 Mile SSE
G36	AZDWR1200067202	1/4 - 1/2 Mile SSE
G37	AZDWR1200093235	1/4 - 1/2 Mile SSE
G38	AZDWR1200067203	1/4 - 1/2 Mile SSE
G39	AZDWR1200216855	1/4 - 1/2 Mile SSE
G40	AZDWR1200213360	1/4 - 1/2 Mile SSE
G41	AZDWR1200217219	1/4 - 1/2 Mile SSE
G42	AZDWR1200217649	1/4 - 1/2 Mile SSE
G43	AZDWR1200217237	1/4 - 1/2 Mile SSE
G44	AZDWR1200212444	1/4 - 1/2 Mile SSE
G45	AZDWR1200212435	1/4 - 1/2 Mile SSE
G46	AZDWR1200213286	1/4 - 1/2 Mile SSE
G47	AZDWR1200213288	1/4 - 1/2 Mile SSE
G48	AZDWR1200213287	1/4 - 1/2 Mile SSE
G49	AZDEQ3000057953	1/4 - 1/2 Mile SSE
H51	AZDEQ3000057954	1/4 - 1/2 Mile SSE
G52	AZDEQ3000057949	1/4 - 1/2 Mile SSE
G53	AZDEQ3000057945	1/4 - 1/2 Mile SSE
G54	AZDEQ3000057956	1/4 - 1/2 Mile SSE
H55	AZDWR1200149689	1/4 - 1/2 Mile SE
H56	AZDWR1200216853	1/4 - 1/2 Mile SE
G57	AZDEQ3000057944	1/4 - 1/2 Mile SSE
G58	AZDEQ3000057948	1/4 - 1/2 Mile SSE
G59	AZDEQ3000057947	1/4 - 1/2 Mile SSE
G60	AZDEQ3000057946	1/4 - 1/2 Mile SSE
I61	AZDWR1200216854	1/4 - 1/2 Mile ESE
I62	AZDWR1200130190	1/4 - 1/2 Mile ESE
J63	AZDEQ3000036691	1/4 - 1/2 Mile South
G64	AZDEQ3000057951	1/4 - 1/2 Mile SSE
G65	AZDEQ3000058048	1/4 - 1/2 Mile SSE
K66	AZDWR1200111379	1/4 - 1/2 Mile WNW
K67	AZDWR1200111378	1/4 - 1/2 Mile WNW
K68	AZDWR1200118948	1/4 - 1/2 Mile WNW
K69	AZDWR1200112801	1/4 - 1/2 Mile WNW
K70	AZDWR1200112802	1/4 - 1/2 Mile WNW
K71	AZDWR1200118947	1/4 - 1/2 Mile WNW
K72	AZDWR1200118946	1/4 - 1/2 Mile WNW
K73	AZDWR1200136754	1/4 - 1/2 Mile WNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
K74	AZDWR1200136755	1/4 - 1/2 Mile WNW
L76	AZDEQ3000057955	1/4 - 1/2 Mile SSE
H77	AZDWR1200076248	1/4 - 1/2 Mile SSE
M78	AZDWR1200074627	1/2 - 1 Mile ESE
M79	AZDWR1200077670	1/2 - 1 Mile ESE
H80	AZDEQ3000057950	1/2 - 1 Mile SSE
J81	AZDWR1200214818	1/2 - 1 Mile South
J82	AZDWR1200079321	1/2 - 1 Mile South
J83	AZDWR1200079392	1/2 - 1 Mile South
N84	AZDWR1200080169	1/2 - 1 Mile South
O85	AZDWR1200191954	1/2 - 1 Mile SSW
O86	AZDWR1200076250	1/2 - 1 Mile SSW
L87	AZDWR1200076991	1/2 - 1 Mile SSE
L88	AZDWR1200079400	1/2 - 1 Mile SSE
L89	AZDWR1200080136	1/2 - 1 Mile SSE
90	AZDWR1200051336	1/2 - 1 Mile WNW
P91	AZDWR1200100154	1/2 - 1 Mile WSW
P92	AZDWR1200099737	1/2 - 1 Mile WSW
P93	AZDWR1200100155	1/2 - 1 Mile WSW
P94	AZDWR1200112735	1/2 - 1 Mile WSW
P95	AZDWR1200112734	1/2 - 1 Mile WSW
P96	AZDWR1200099736	1/2 - 1 Mile WSW
P97	AZDWR1200096874	1/2 - 1 Mile WSW
P98	AZDWR1200096961	1/2 - 1 Mile WSW
P99	AZDWR1200096962	1/2 - 1 Mile WSW
P100	AZDWR1200099735	1/2 - 1 Mile WSW
P101	AZDWR1200096963	1/2 - 1 Mile WSW
P102	AZDWR1200114195	1/2 - 1 Mile WSW
P103	AZDWR1200130625	1/2 - 1 Mile WSW
P104	AZDWR1200120773	1/2 - 1 Mile WSW
P105	AZDWR1200130627	1/2 - 1 Mile WSW
P106	AZDWR1200130626	1/2 - 1 Mile WSW
P107	AZDWR1200120772	1/2 - 1 Mile WSW
P108	AZDWR1200120769	1/2 - 1 Mile WSW
P109	AZDWR1200120768	1/2 - 1 Mile WSW
P110	AZDWR1200120771	1/2 - 1 Mile WSW
P111	AZDWR1200120770	1/2 - 1 Mile WSW
L112	AZDEQ3000036692	1/2 - 1 Mile SSE
113	AZDWR1200155490	1/2 - 1 Mile ENE
114	AZDEQ3000049373	1/2 - 1 Mile NNE
116	AZDEQ3000036695	1/2 - 1 Mile SSE
Q117	AZDWR1200116858	1/2 - 1 Mile WSW
Q118	AZDWR1200120682	1/2 - 1 Mile WSW
Q119	AZDWR1200099111	1/2 - 1 Mile WSW
Q120	AZDWR1200079399	1/2 - 1 Mile WSW
Q121	AZDWR1200112033	1/2 - 1 Mile WSW
R122	AZDEQ3000036696	1/2 - 1 Mile South
N123	AZDEQ3000036698	1/2 - 1 Mile SSW
R124	AZDEQ3000036701	1/2 - 1 Mile South
125	AZDWR1200123285	1/2 - 1 Mile West
S126	AZDWR1200193216	1/2 - 1 Mile NW
S127	AZDWR1200193217	1/2 - 1 Mile NW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
T128	AZDWR1200078483	1/2 - 1 Mile WNW
T129	AZDWR1200080541	1/2 - 1 Mile WNW
T130	AZDWR1200078481	1/2 - 1 Mile WNW
T131	AZDWR1200078482	1/2 - 1 Mile WNW
T132	AZDWR1200089219	1/2 - 1 Mile WNW
T133	AZDWR1200092449	1/2 - 1 Mile WNW
T134	AZDWR1200092450	1/2 - 1 Mile WNW
T135	AZDWR1200089230	1/2 - 1 Mile WNW
T136	AZDWR1200089241	1/2 - 1 Mile WNW
T137	AZDWR1200070074	1/2 - 1 Mile WNW
T138	AZDWR1200070142	1/2 - 1 Mile WNW
T139	AZDWR1200039836	1/2 - 1 Mile WNW
T140	AZDWR1200070073	1/2 - 1 Mile WNW
T141	AZDWR1200070143	1/2 - 1 Mile WNW
T142	AZDWR1200071553	1/2 - 1 Mile WNW
T143	AZDWR1200078480	1/2 - 1 Mile WNW
T144	AZDWR1200070144	1/2 - 1 Mile WNW
T145	AZDWR1200070145	1/2 - 1 Mile WNW
T146	AZDWR1200092451	1/2 - 1 Mile WNW
T147	AZDWR1200108389	1/2 - 1 Mile WNW
T148	AZDWR1200108388	1/2 - 1 Mile WNW
T149	AZDWR1200108387	1/2 - 1 Mile WNW
T150	AZDWR1200125213	1/2 - 1 Mile WNW
T151	AZDWR1200125212	1/2 - 1 Mile WNW
T152	AZDWR1200108390	1/2 - 1 Mile WNW
T153	AZDWR1200099666	1/2 - 1 Mile WNW
T154	AZDWR1200099665	1/2 - 1 Mile WNW
T155	AZDWR1200098275	1/2 - 1 Mile WNW
T156	AZDWR1200099669	1/2 - 1 Mile WNW
T157	AZDWR1200099668	1/2 - 1 Mile WNW
T158	AZDWR1200099667	1/2 - 1 Mile WNW
R159	AZDWR1200080523	1/2 - 1 Mile South
R160	AZDWR1200101974	1/2 - 1 Mile South
R161	AZDWR1200080137	1/2 - 1 Mile South
R162	AZDWR1200077315	1/2 - 1 Mile South
R163	AZDWR1200079488	1/2 - 1 Mile South
R164	AZDWR1200102050	1/2 - 1 Mile South
R165	AZDWR1200121743	1/2 - 1 Mile South
R166	AZDWR1200102052	1/2 - 1 Mile South
R167	AZDWR1200102051	1/2 - 1 Mile South
R168	AZDWR1200121746	1/2 - 1 Mile South
R169	AZDWR1200121747	1/2 - 1 Mile South
R170	AZDWR1200121744	1/2 - 1 Mile South
R171	AZDWR1200121745	1/2 - 1 Mile South
R172	AZDWR1200102053	1/2 - 1 Mile South
R173	AZDWR1200121740	1/2 - 1 Mile South
R174	AZDWR1200121739	1/2 - 1 Mile South
R175	AZDWR1200121742	1/2 - 1 Mile South
R176	AZDWR1200121741	1/2 - 1 Mile South
R177	AZDWR1200102055	1/2 - 1 Mile South
R178	AZDWR1200102054	1/2 - 1 Mile South
R179	AZDWR1200121738	1/2 - 1 Mile South

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
R180	AZDWR1200102056	1/2 - 1 Mile South
R181	AZDWR1200101977	1/2 - 1 Mile South
R182	AZDWR1200101976	1/2 - 1 Mile South
R183	AZDWR1200102049	1/2 - 1 Mile South
R184	AZDWR1200102048	1/2 - 1 Mile South
R185	AZDWR1200101975	1/2 - 1 Mile South
R186	AZDWR1200121749	1/2 - 1 Mile South
R187	AZDWR1200121748	1/2 - 1 Mile South
R188	AZDWR1200137338	1/2 - 1 Mile South
R189	AZDWR1200137339	1/2 - 1 Mile South
R190	AZDEQ3000036684	1/2 - 1 Mile South
U191	AZDWR1200079322	1/2 - 1 Mile South
U192	AZDWR1200080168	1/2 - 1 Mile South
V193	AZDWR1200078020	1/2 - 1 Mile WNW
194	AZDEQ3000028698	1/2 - 1 Mile WSW
W195	AZDWR1200039546	1/2 - 1 Mile SE
W196	AZDWR1200039547	1/2 - 1 Mile SE
X197	AZDWR1200155491	1/2 - 1 Mile SE
Y198	AZDWR1200014365	1/2 - 1 Mile SSE
Y199	AZDWR1200116517	1/2 - 1 Mile SSE
Y200	AZDWR1200014179	1/2 - 1 Mile SSE
X201	AZDEQ3000028958	1/2 - 1 Mile SE
Z202	AZDWR1200074384	1/2 - 1 Mile NNW
203	AZDEQ3000028956	1/2 - 1 Mile East
AA204	AZDWR1200196732	1/2 - 1 Mile SSE
AA205	AZDEQ3000036693	1/2 - 1 Mile SSE
206	AZDWR1200082244	1/2 - 1 Mile SSW
208	AZDWR1200171675	1/2 - 1 Mile WNW
U209	AZDEQ3000036694	1/2 - 1 Mile SSW
AB210	AZDWR1200079393	1/2 - 1 Mile SSE
AB211	AZDWR1200079323	1/2 - 1 Mile SSE
U212	AZDEQ3000036699	1/2 - 1 Mile SSW
214	AZDWR1200193215	1/2 - 1 Mile NNW
AC215	AZDWR1200073453	1/2 - 1 Mile WNW
AC216	AZDWR1200073522	1/2 - 1 Mile WNW
AC217	AZDWR1200073523	1/2 - 1 Mile WNW
AC218	AZDWR1200073452	1/2 - 1 Mile WNW
Z219	AZDEQ3000049376	1/2 - 1 Mile NNW
220	AZDWR1200082243	1/2 - 1 Mile SSW
AD221	AZDEQ3000036690	1/2 - 1 Mile South
AE222	AZDEQ3000036687	1/2 - 1 Mile South
AD223	AZDEQ3000036685	1/2 - 1 Mile South
AE224	AZDEQ3000036689	1/2 - 1 Mile South
AE225	AZDEQ3000036686	1/2 - 1 Mile South
AF226	AZDWR1200192173	1/2 - 1 Mile SSE
AF227	AZDWR1200019864	1/2 - 1 Mile SSE
AF228	AZDWR1200015127	1/2 - 1 Mile SSE
AF229	AZDWR1200015124	1/2 - 1 Mile SSE
AF230	AZDWR1200130997	1/2 - 1 Mile SSE
AF231	AZDWR1200080521	1/2 - 1 Mile SSE
AF232	AZDWR1200019865	1/2 - 1 Mile SSE
AG233	AZDWR1200152109	1/2 - 1 Mile North

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
AG234	AZDEQ3000028695	1/2 - 1 Mile North
AE235	AZDWR1200096771	1/2 - 1 Mile South
AE236	AZDWR1200096770	1/2 - 1 Mile South
AE237	AZDWR1200096772	1/2 - 1 Mile South
AE238	AZDWR1200101933	1/2 - 1 Mile South
AE239	AZDWR1200101932	1/2 - 1 Mile South
AE240	AZDWR1200093459	1/2 - 1 Mile South
AE241	AZDWR1200077388	1/2 - 1 Mile South
AE242	AZDWR1200077386	1/2 - 1 Mile South
AE243	AZDWR1200092224	1/2 - 1 Mile South
AE244	AZDWR1200093458	1/2 - 1 Mile South
AE245	AZDWR1200092225	1/2 - 1 Mile South
AE246	AZDWR1200109103	1/2 - 1 Mile South
AE247	AZDWR1200109091	1/2 - 1 Mile South
AE248	AZDWR1200209108	1/2 - 1 Mile South
AE249	AZDWR1200226210	1/2 - 1 Mile South
AE250	AZDWR1200209109	1/2 - 1 Mile South
AE251	AZDWR1200109090	1/2 - 1 Mile South
AE252	AZDWR1200109086	1/2 - 1 Mile South
AE253	AZDWR1200102334	1/2 - 1 Mile South
AE254	AZDWR1200109087	1/2 - 1 Mile South
AE255	AZDWR1200109089	1/2 - 1 Mile South
AE256	AZDWR1200109088	1/2 - 1 Mile South
AE257	AZDWR1200077384	1/2 - 1 Mile South
AE258	AZDWR1200014368	1/2 - 1 Mile South
AE259	AZDWR1200014367	1/2 - 1 Mile South
AE260	AZDWR1200074869	1/2 - 1 Mile South
AE261	AZDWR1200077382	1/2 - 1 Mile South
AE262	AZDWR1200076858	1/2 - 1 Mile South
263	AZDWR1200071280	1/2 - 1 Mile North
AH264	AZDWR1200103244	1/2 - 1 Mile WNW
AH265	AZDWR1200103243	1/2 - 1 Mile WNW
AH266	AZDWR1200102825	1/2 - 1 Mile WNW
AH267	AZDWR1200103245	1/2 - 1 Mile WNW
AH268	AZDWR1200104042	1/2 - 1 Mile WNW
AH269	AZDWR1200104041	1/2 - 1 Mile WNW
AH270	AZDWR1200103622	1/2 - 1 Mile WNW
AE271	AZDEQ3000036681	1/2 - 1 Mile South
AD272	AZDWR1200077387	1/2 - 1 Mile South
AD273	AZDWR1200080522	1/2 - 1 Mile South
AE274	AZDEQ3000036683	1/2 - 1 Mile South
AI275	AZDWR1200077381	1/2 - 1 Mile SSE
AI276	AZDWR1200077385	1/2 - 1 Mile SSE
AI277	AZDWR1200080520	1/2 - 1 Mile SSE
AE278	AZDEQ3000036682	1/2 - 1 Mile South
AD279	AZDEQ3000036703	1/2 - 1 Mile South
AF281	AZDEQ3000036702	1/2 - 1 Mile SSE
AF282	AZDEQ3000036697	1/2 - 1 Mile SSE
AI283	AZDEQ3000036700	1/2 - 1 Mile SSE
285	AZDWR1200155488	1/2 - 1 Mile ESE
AJ286	AZDEQ3000049339	1/2 - 1 Mile North
AK287	AZDWR1200080900	1/2 - 1 Mile SSW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
AK288	AZDWR1200080901	1/2 - 1 Mile SSW
AK289	AZDWR1200081272	1/2 - 1 Mile SSW
AL291	AZDEQ3000036680	1/2 - 1 Mile South
AJ292	AZDWR1200070729	1/2 - 1 Mile North
AL293	AZDWR1200077383	1/2 - 1 Mile South
AL294	AZDWR1200077389	1/2 - 1 Mile South
295	AZDWR1200080902	1/2 - 1 Mile South
296	AZDWR1200192896	1/2 - 1 Mile WSW
AM297	AZDEQ3000028915	1/2 - 1 Mile NNE
AM298	AZDEQ3000028916	1/2 - 1 Mile NNE
AL299	AZDEQ3000036688	1/2 - 1 Mile South
AN300	AZDEQ3000028699	1/2 - 1 Mile WSW
AN301	AZDWR1200153186	1/2 - 1 Mile WSW
AN302	AZDWR1200153187	1/2 - 1 Mile WSW
AO304	AZDWR1200203018	1/2 - 1 Mile NNE
AO305	AZDWR1200204843	1/2 - 1 Mile NNE
AO306	AZDWR1200101522	1/2 - 1 Mile NNE
AO307	AZDWR1200199488	1/2 - 1 Mile NNE
AO308	AZDWR1200199487	1/2 - 1 Mile NNE
310	AZDWR1200080899	1/2 - 1 Mile SSW
AP311	AZDWR1200199358	1/2 - 1 Mile NW
AP312	AZDWR1200205461	1/2 - 1 Mile NW
AP313	AZDWR1200016626	1/2 - 1 Mile NW
AP314	AZDWR1200016627	1/2 - 1 Mile NW
AP315	AZDWR1200016628	1/2 - 1 Mile NW
AP316	AZDWR1200015989	1/2 - 1 Mile NW
AP317	AZDWR1200015990	1/2 - 1 Mile NW
AP318	AZDWR1200016625	1/2 - 1 Mile NW
AP319	AZDWR1200016632	1/2 - 1 Mile NW
AP320	AZDWR1200016818	1/2 - 1 Mile NW
AP321	AZDWR1200017580	1/2 - 1 Mile NW
AP322	AZDWR1200016629	1/2 - 1 Mile NW
AP323	AZDWR1200016630	1/2 - 1 Mile NW
AP324	AZDWR1200016631	1/2 - 1 Mile NW
AP325	AZDWR1200205463	1/2 - 1 Mile NW
AP326	AZDWR1200015988	1/2 - 1 Mile NW
AP327	AZDWR1200012261	1/2 - 1 Mile NW
AP328	AZDWR1200012260	1/2 - 1 Mile NW
AP329	AZDWR1200205878	1/2 - 1 Mile NW
AP330	AZDWR1200205464	1/2 - 1 Mile NW
AM331	AZDWR1200193638	1/2 - 1 Mile NNE
AM332	AZDWR1200153189	1/2 - 1 Mile NNE
AM333	AZDWR1200153188	1/2 - 1 Mile NNE
334	AZDWR1200069830	1/2 - 1 Mile NW
AQ335	AZDWR1200200567	1/2 - 1 Mile NW
AQ336	AZDWR1200112034	1/2 - 1 Mile NW
AQ337	AZDWR1200116857	1/2 - 1 Mile NW
AQ338	AZDWR1200193213	1/2 - 1 Mile NW
AQ339	AZDWR1200099110	1/2 - 1 Mile NW
341	AZDWR1200076247	1/2 - 1 Mile SSE
AR342	AZDEQ3000049463	1/2 - 1 Mile NNW
AR343	AZDEQ3000049462	1/2 - 1 Mile NNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
344	AZDWR1200116725	1/2 - 1 Mile WNW
346	AZDWR1200076249	1/2 - 1 Mile SSW
347	AZDWR1200193203	1/2 - 1 Mile NNE
AR348	AZDWR1200214488	1/2 - 1 Mile NNW
AR349	AZDWR1200212794	1/2 - 1 Mile NNW
AR350	AZDWR1200216234	1/2 - 1 Mile NNW
AR351	AZDWR1200216233	1/2 - 1 Mile NNW

PHYSICAL SETTING SOURCE MAP - 7970166.2s

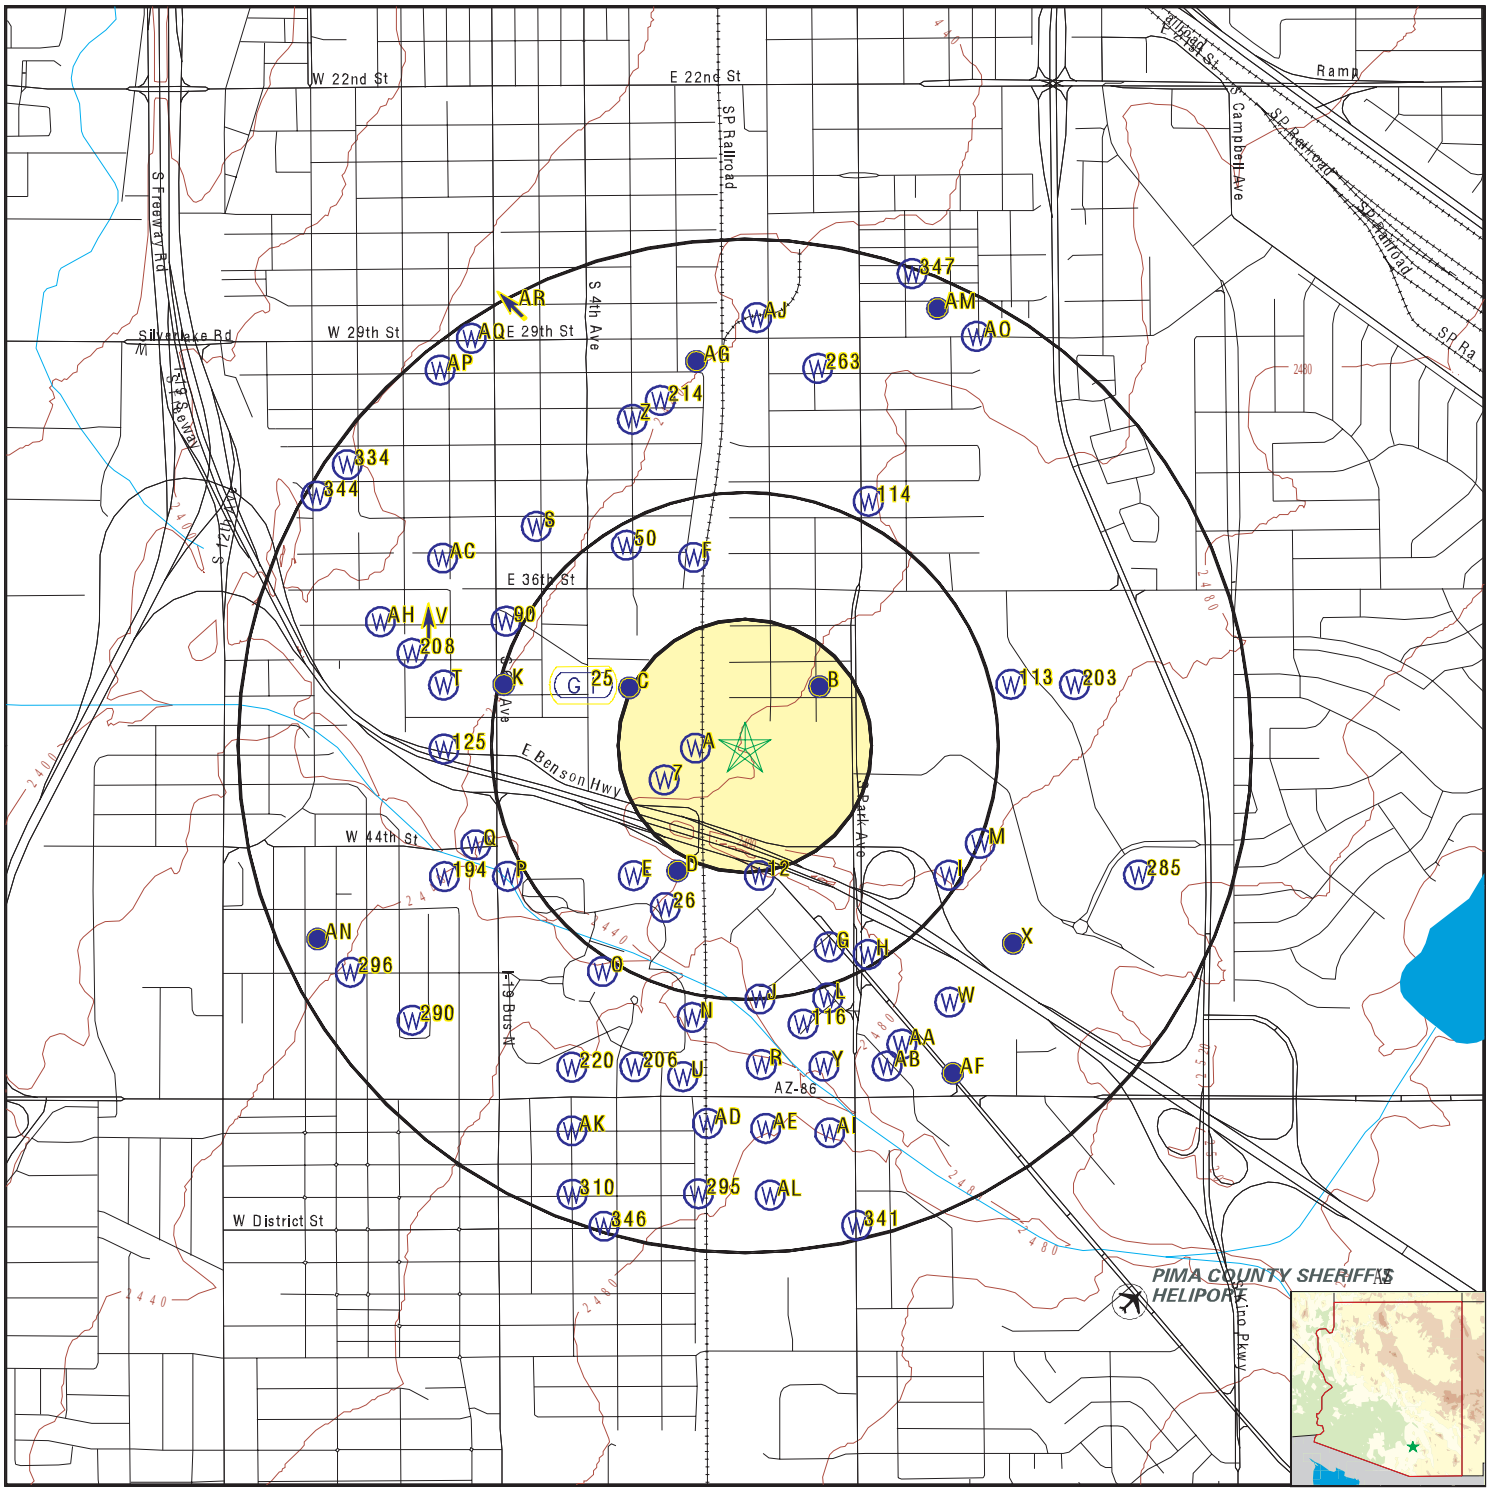

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons
- Groundwater Flow Direction
- GI Indeterminate Groundwater Flow at Location
- GV Groundwater Flow Varies at Location
- HD Closest Hydrogeological Data
- Oil, gas or related wells

SITE NAME: JTED	CLIENT: Western Technologies, Inc.
ADDRESS: 751 East Marketplace Boulevard Tucson AZ 85713	CONTACT: Kenna Karjala
LAT/LONG: 32.18794 / 110.959997	INQUIRY #: 7970166.2s DATE: April 25, 2025 4:04 pm

Copyright © 2025 EDR, Inc. © 2015 TomTom Rel. 2015.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

A1
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDEQ3000000617**

DWR Number:	Not Reported	DEQ Well #:	001011
Agency Well #:	001011	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	TUCSON AREA AIRPORT
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

A2
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDWR1200086052**

Program:	55	Registry ID:	545663
Owner Name:	PAYLESS CASHWAYS,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	23-SEP-94	Approved:	Not Reported
Installed Date:	05-OCT-94	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	88
AMA or INA:	TUCSON	Casing Depth (ft):	110
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

A3
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDWR1200086054**

Program:	55	Registry ID:	545665
Owner Name:	PAYLESS CASHWAYS,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	23-SEP-94	Approved:	Not Reported
Installed Date:	23-NOV-94	Well Depth (ft):	100
Casing Type:	PLASTIC OR PVC	Water Level (ft):	88
AMA or INA:	TUCSON	Casing Depth (ft):	100
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

A4
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDWR1200086053**

Program:	55	Registry ID:	545664
Owner Name:	PAYLESS CASHWAYS,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	23-SEP-94	Approved:	Not Reported
Installed Date:	23-NOV-94	Well Depth (ft):	100
Casing Type:	PLASTIC OR PVC	Water Level (ft):	88
AMA or INA:	TUCSON	Casing Depth (ft):	100
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

A5
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDWR1200065910**

Program:	55	Registry ID:	526217
Owner Name:	PAYLESS CASHWAYS INC,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	215
Application:	18-OCT-89	Approved:	Not Reported
Installed Date:	29-NOV-89	Well Depth (ft):	60
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	50
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

A6
West
0 - 1/8 Mile
Lower

AZ WELLS **AZDWR1200065911**

Program:	55	Registry ID:	526218
Owner Name:	PAYLESS CASHWAYS INC,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	215
Application:	18-OCT-89	Approved:	Not Reported
Installed Date:	28-NOV-89	Well Depth (ft):	90
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	85
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

7
WSW **AZ WELLS** **AZDWR1200181614**
1/8 - 1/4 Mile
Lower

Program:	55	Registry ID:	639381
Owner Name:	SPANISH TRAIL RESORT,	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	14-JUN-82	Approved:	Not Reported
Installed Date:	01-JAN-42	Well Depth (ft):	435
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	175
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

B8
NE **FED USGS** **USGS40000037012**
1/8 - 1/4 Mile
Higher

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-14 30BBD	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	195008
Well Depth:	833	Well Depth Units:	ft
Well Hole Depth:	860	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	25	Level reading date:	1985-12-31
Feet below surface:	115.70	Feet to sea level:	Not Reported
Note:	Not Reported		

Level reading date:	1985-01-11	Feet below surface:	118.60
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1984-01-05	Feet below surface:	132.70
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1982-12-01	Feet below surface:	148.10
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1981-12-29	Feet below surface:	145.40
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1970-03-03	Feet below surface:	122.10
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1969-02-25	Feet below surface:	117.62
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1968-03-21	Feet below surface:	113.20
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-10-10	Feet below surface:	100.0
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-03-17	Feet below surface:	95.73
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-03-06	Feet below surface:	94.40
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-03-07	Feet below surface:	93.58
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-03-13	Feet below surface:	94.00
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1961-03-21	Feet below surface:	94.71
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1960-04-06	Feet below surface:	90.11
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1959-03-30	Feet below surface:	89.88
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1958-03-13	Feet below surface:	95.33
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1957-04-10	Feet below surface:	99.21
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-03-30	Feet below surface:	89.13
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1955-03-28	Feet below surface:	88.21
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-03-08	Feet below surface:	91.23
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1953-03	Feet below surface:	90.45
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1952-03-10	Feet below surface:	88.56
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1951-04-06	Feet below surface:	92.34
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1950-08-01	Feet below surface:	75.00
Feet to sea level:	Not Reported	Note:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

B9
NE
1/8 - 1/4 Mile
Higher

AZ WELLS **AZDWR1200153190**

Program:	55	Registry ID:	620199
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	01-AUG-50	Well Depth (ft):	861
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	145	AMA or INA:	TUCSON
Casing Depth (ft):	861	Casing Diameter (in):	12
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

B10
NE
1/8 - 1/4 Mile
Higher

AZ WELLS **AZDEQ3000028957**

DWR Number:	55-620199	DEQ Well #:	37719
Agency Well #:	37719	Start Date:	01-AUG-50
End Date:	Not Reported	Station Alt Name:	D-14-14 30BBD
well Depth:	Not Reported	Drill Depth:	860
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

C11
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDEQ3000028697**

DWR Number:	Not Reported	DEQ Well #:	37459
Agency Well #:	37459	Start Date:	01-JAN-51
End Date:	Not Reported	Station Alt Name:	D-14-13 25AAC
well Depth:	Not Reported	Drill Depth:	411
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

12
South
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200014366**

Program:	55	Registry ID:	212263
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-MAY-06	Approved:	23-MAY-06
Installed Date:	Not Reported	Well Depth (ft):	123
Casing Type:	PLASTIC OR PVC	Water Level (ft):	116
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	6	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

C13
WNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000037013**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 25AAC	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1951
Well Depth:	411	Well Depth Units:	ft
Well Hole Depth:	411	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	2	Level reading date:	1965-03-01
Feet below surface:	95.70	Feet to sea level:	Not Reported
Note:	Not Reported		

Level reading date:	1951-01-01	Feet below surface:	110.00
Feet to sea level:	Not Reported	Note:	Not Reported

D14
SSW
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000028701**

DWR Number:	Not Reported	DEQ Well #:	37463
Agency Well #:	37463	Start Date:	31-OCT-39
End Date:	Not Reported	Station Alt Name:	D-14-13 25DAA2
well Depth:	Not Reported	Drill Depth:	500
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

D15
SSW
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000028700**

DWR Number:	55-610147	DEQ Well #:	37462
Agency Well #:	37462	Start Date:	23-SEP-29
End Date:	Not Reported	Station Alt Name:	D-14-13 25DAA1
well Depth:	Not Reported	Drill Depth:	502

Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

D16
SSW **AZ WELLS** **AZDEQ3000028702**
1/4 - 1/2 Mile
Lower

DWR Number:	55-503192	DEQ Well #:	37464
Agency Well #:	37464	Start Date:	30-JUL-82
End Date:	Not Reported	Station Alt Name:	VETERANS MEDICAL CENTER
well Depth:	Not Reported	Drill Depth:	615
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Used To Supply Household Needs Of Less Than Three Homes (Drinking, Cooking, Washing, Sanitary Purposes, Lawn Watering, Pet Care, One Classroom Schools, Turnpike Gates And Similar Purposes).		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

D17
SW **FED USGS** **USGS40000036959**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 25DAA1	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19290923
Well Depth:	502	Well Depth Units:	ft
Well Hole Depth:	502	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	14	Level reading date:	1987-12-04
Feet below surface:	146.16	Feet to sea level:	Not Reported
Note:	Not Reported		
Level reading date:	1981-12-28	Feet below surface:	150.1
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1969-02-12	Feet below surface:	116.5
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-02-03	Feet below surface:	112.82
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-01-29	Feet below surface:	113.91
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-02-04	Feet below surface:	108.21
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-01-26	Feet below surface:	104.21
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1961-01-31	Feet below surface:	102.41

Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1960-01-29	Feet below surface:	98.85
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1959-01-29	Feet below surface:	101.21
Feet to sea level:	Not Reported		
Note:	A nearby site that taps the same aquifer was being pumped.		
Level reading date:	1958-01-28	Feet below surface:	98.03
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1957-02-11	Feet below surface:	95.91
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-02-10	Feet below surface:	92.0
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-02-11	Feet below surface:	101.56
Feet to sea level:	Not Reported	Note:	Not Reported

D18
SSW **FED USGS** **USGS40000036955**
1/4 - 1/2 Mile
Lower

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 25DAA2	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	19391031
Well Depth:	500	Well Depth Units:	ft
Well Hole Depth:	500	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	15	Level reading date:	1987-12-03
Feet below surface:	161.90	Feet to sea level:	Not Reported
Note:	Not Reported		
Level reading date:	1981-12-28	Feet below surface:	167.65
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1968-02-02	Feet below surface:	122.52
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-02-03	Feet below surface:	111.53
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-01-29	Feet below surface:	115.69
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-02-04	Feet below surface:	109.74
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-01-26	Feet below surface:	104.43
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1961-01-31	Feet below surface:	102.25
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1960-01-29	Feet below surface:	98.41
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1958-01-28	Feet below surface:	98.21
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1957-02-01	Feet below surface:	95.65
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-02-10	Feet below surface:	91.4
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1955-02-07	Feet below surface:	98.3
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-02-08	Feet below surface:	102.68
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1953-02-06	Feet below surface:	99.38
Feet to sea level:	Not Reported	Note:	Not Reported

E19
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200079937**

Program:	55	Registry ID:	540775
Owner Name:	DEPT OF VA MEDICAL,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-93	Approved:	Not Reported
Installed Date:	17-OCT-93	Well Depth (ft):	105
Casing Type:	PLASTIC OR PVC	Water Level (ft):	95
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

E20
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200079938**

Program:	55	Registry ID:	540776
Owner Name:	DEPT OF VA MEDICAL,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-93	Approved:	Not Reported
Installed Date:	19-OCT-93	Well Depth (ft):	105
Casing Type:	PLASTIC OR PVC	Water Level (ft):	97
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X

Watershed: SANTA CRUZ RIVER

E21
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200078139**

Program:	55	Registry ID:	538906
Owner Name:	VA MEDICAL CENTER,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	22-APR-93	Approved:	Not Reported
Installed Date:	29-APR-93	Well Depth (ft):	175
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	175
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

E22
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200045010**

Program:	55	Registry ID:	503192
Owner Name:	VA MEDICAL CENTER,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	22-JUN-82	Approved:	Not Reported
Installed Date:	30-JUL-82	Well Depth (ft):	615
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	150	AMA or INA:	TUCSON
Casing Depth (ft):	300	Casing Diameter (in):	11
RGR Pump Data:	YES	Pump Type:	TURBINE
Pump Power:	ELECTRIC MOTOR 16 - 100 HP	Pump Rate:	1100
Tested Rate:	1100	Draw Down:	264
Completion:	X	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

E23
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200079940**

Program:	55	Registry ID:	540778
Owner Name:	DEPT OF VA MEDICAL,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-93	Approved:	Not Reported
Installed Date:	16-OCT-93	Well Depth (ft):	180
Casing Type:	PLASTIC OR PVC	Water Level (ft):	124
AMA or INA:	TUCSON	Casing Depth (ft):	155
Casing Diameter (in):	4	RGR Pump Data:	NO

Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

E24
SW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200079939**

Program:	55	Registry ID:	540777
Owner Name:	DEPT OF VA MEDICAL,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-93	Approved:	Not Reported
Installed Date:	18-OCT-93	Well Depth (ft):	105
Casing Type:	PLASTIC OR PVC	Water Level (ft):	95
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

25
WNW
1/4 - 1/2 Mile
Lower

Site ID:	007077
Groundwater Flow:	Not Reported
Shallowest Water Table Depth:	Not Reported
Deepest Water Table Depth:	Not Reported
Average Water Table Depth:	89 ft
Date:	03/09/1995

AQUIFLOW **49572**

26
SSW
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200142100**

Program:	55	Registry ID:	610147
Owner Name:	VA MEDICAL CENTER,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	14-JUN-82	Approved:	Not Reported
Installed Date:	23-SEP-29	Well Depth (ft):	500
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	165	AMA or INA:	TUCSON
Casing Depth (ft):	500	Casing Diameter (in):	12
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	320
Tested Rate:	320	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

F27
NNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDEQ3000028696**

DWR Number:	Not Reported	DEQ Well #:	37458
Agency Well #:	37458	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	D-14-13 24DDD
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

F28
NNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200188287**

Program:	55	Registry ID:	807282
Owner Name:	CITY OF TUCSON/TUCSON WATER	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	MUNICIPAL USES
Basin Name:	TUCSON AMA	Driller License #:	388
Application:	07-JUN-96	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	300
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	12
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

G29
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200117018**

Program:	55	Registry ID:	584361
Owner Name:	UNOCAL CORPORATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	269
Application:	03-NOV-00	Approved:	20-NOV-00
Installed Date:	20-DEC-00	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	112
AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

G30
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200116069**

Program:	55	Registry ID:	582996
Owner Name:	UNOCAL CORPORATION	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	269
Application:	24-AUG-00	Approved:	29-AUG-00
Installed Date:	20-SEP-00	Well Depth (ft):	110
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G31
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200117019**

Program:	55	Registry ID:	584362
Owner Name:	UNOCAL CORPORATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	269
Application:	03-NOV-00	Approved:	20-NOV-00
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

G32
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200212434**

Program:	55	Registry ID:	923490
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	226	Application:	17-OCT-19
Approved:	17-OCT-19	Installed Date:	16-OCT-19
Well Depth (ft):	125	Casing Type:	PLASTIC OR PVC
Water Level (ft):	110	AMA or INA:	TUCSON
Casing Depth (ft):	125	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0

Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

G33
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200138835**

Program:	55	Registry ID:	591174
Owner Name:	UNOCAL RRMC 3888	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	Not Reported
Basin Name:	TUCSON AMA	Driller License #:	269
Application:	26-FEB-02	Approved:	05-MAR-02
Installed Date:	21-MAR-02	Well Depth (ft):	110
Casing Type:	Not Reported	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G34
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200067201**

Program:	55	Registry ID:	526945
Owner Name:	UNOCAL REFINING,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	14-NOV-02	Approved:	Not Reported
Installed Date:	08-FEB-90	Well Depth (ft):	145
Casing Type:	PLASTIC OR PVC	Water Level (ft):	130
AMA or INA:	TUCSON	Casing Depth (ft):	145
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G35
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200063490**

Program:	55	Registry ID:	523008
Owner Name:	UNOCAL REFINING &,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	314
Application:	14-NOV-02	Approved:	Not Reported
Installed Date:	17-DEC-88	Well Depth (ft):	118
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110

AMA or INA:	TUCSON	Casing Depth (ft):	10
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G36
SSE **AZ WELLS** **AZDWR1200067202**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	526946
Owner Name:	UNOCAL REFINING,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	14-NOV-02	Approved:	Not Reported
Installed Date:	08-FEB-90	Well Depth (ft):	145
Casing Type:	PLASTIC OR PVC	Water Level (ft):	130
AMA or INA:	TUCSON	Casing Depth (ft):	195
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G37
SSE **AZ WELLS** **AZDWR1200093235**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	555098
Owner Name:	UNOCAL,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	269
Application:	14-NOV-02	Approved:	Not Reported
Installed Date:	15-FEB-96	Well Depth (ft):	115
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	114
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G38
SSE **AZ WELLS** **AZDWR1200067203**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	526947
Owner Name:	UNOCAL REFINING,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	473
Application:	14-NOV-02	Approved:	Not Reported
Installed Date:	08-FEB-90	Well Depth (ft):	145
Casing Type:	PLASTIC OR PVC	Water Level (ft):	130
AMA or INA:	TUCSON	Casing Depth (ft):	145
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G39
SSE **AZ WELLS** **AZDWR1200216855**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	925120
Owner Name:	ADEQ	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	05-NOV-20	Approved:	05-NOV-20
Installed Date:	12-NOV-20	Well Depth (ft):	129
Casing Type:	PLASTIC OR PVC	Water Level (ft):	111
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G40
SSE **AZ WELLS** **AZDWR1200213360**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	924464
Owner Name:	ADEQ	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	10-JUN-20	Approved:	10-JUN-20
Installed Date:	Not Reported	Well Depth (ft):	130
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

G41
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200217219**

Program:	55	Registry ID:	924255
Owner Name:	ADEQ-RICK BRUNTON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	24-APR-20	Approved:	24-APR-20
Installed Date:	05-MAY-20	Well Depth (ft):	130
Casing Type:	PLASTIC OR PVC	Water Level (ft):	111
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G42
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200217649**

Program:	55	Registry ID:	924282
Owner Name:	ADEQ-RICK BRUNTON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	30-APR-20	Approved:	30-APR-20
Installed Date:	Not Reported	Well Depth (ft):	130
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110
AMA or INA:	TUCSON	Casing Depth (ft):	130
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G43
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200217237**

Program:	55	Registry ID:	924274
Owner Name:	ADEQ-RICK BRUNTON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	29-APR-20	Approved:	29-APR-20
Installed Date:	Not Reported	Well Depth (ft):	135
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110
AMA or INA:	TUCSON	Casing Depth (ft):	130
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G44
SSE **AZ WELLS** **AZDWR1200212444**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	923500
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	226	Application:	18-OCT-19
Approved:	18-OCT-19	Installed Date:	18-OCT-19
Well Depth (ft):	125	Casing Type:	PLASTIC OR PVC
Water Level (ft):	109	AMA or INA:	TUCSON
Casing Depth (ft):	125	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

G45
SSE **AZ WELLS** **AZDWR1200212435**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	923491
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	226	Application:	17-OCT-19
Approved:	17-OCT-19	Installed Date:	17-OCT-19
Well Depth (ft):	125	Casing Type:	PLASTIC OR PVC
Water Level (ft):	111	AMA or INA:	TUCSON
Casing Depth (ft):	125	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

G46
SSE **AZ WELLS** **AZDWR1200213286**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	923537
Owner Name:	ARIZONA DEPARTMENT OF ENVIROMENTAL QUALITY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	226	Application:	25-OCT-19
Approved:	25-OCT-19	Installed Date:	22-OCT-19
Well Depth (ft):	125	Casing Type:	PLASTIC OR PVC

Water Level (ft):	111	AMA or INA:	TUCSON
Casing Depth (ft):	125	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

G47
SSE **AZ WELLS** **AZDWR1200213288**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	923539
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING		
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	25-OCT-19	Approved:	25-OCT-19
Installed Date:	24-OCT-19	Well Depth (ft):	100
Casing Type:	PLASTIC OR PVC	Water Level (ft):	111
AMA or INA:	TUCSON	Casing Depth (ft):	100
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G48
SSE **AZ WELLS** **AZDWR1200213287**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	923538
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	226	Application:	25-OCT-19
Approved:	25-OCT-19	Installed Date:	25-OCT-19
Well Depth (ft):	125	Casing Type:	PLASTIC OR PVC
Water Level (ft):	110	AMA or INA:	TUCSON
Casing Depth (ft):	125	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

G49
SSE **AZ WELLS** **AZDEQ3000057953**
1/4 - 1/2 Mile
Higher

DWR Number:	55-925119	DEQ Well #:	82300
Agency Well #:	Not Reported	Start Date:	Not Reported

End Date:	Not Reported	Station Alt Name:	CA MW-11
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

50
NNW
1/4 - 1/2 Mile
Lower

FED USGS **USGS40000037038**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 24DDD	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	800	Well Depth Units:	ft
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

---

H51
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057954**

DWR Number:	55-925120	DEQ Well #:	82301
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-12
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G52
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057949**

DWR Number:	55-924274	DEQ Well #:	82297
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-8
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G53
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057945**

DWR Number:	55-923500	DEQ Well #:	82293
Agency Well #:	Not Reported	Start Date:	Not Reported

End Date:	Not Reported	Station Alt Name:	CA MW-3
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G54
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057956**

DWR Number:	55-923490	DEQ Well #:	82303
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-1
well Depth:	Not Reported	Drill Depth:	126
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

H55
SE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200149689**

Program:	55	Registry ID:	605205
Owner Name:	MERIT HOMES,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	22-MAR-82	Approved:	Not Reported
Installed Date:	31-MAR-86	Well Depth (ft):	300
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	175	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	8
RGR Pump Data:	YES	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	55
Tested Rate:	55	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

H56
SE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDWR1200216853**

Program:	55	Registry ID:	925117
Owner Name:	ADEQ	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	05-NOV-20	Approved:	05-NOV-20
Installed Date:	11-NOV-20	Well Depth (ft):	130
Casing Type:	PLASTIC OR PVC	Water Level (ft):	107
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported

Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

G57
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057944**

DWR Number:	55-923491	DEQ Well #:	82292
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-2
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G58
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057948**

DWR Number:	55-924255	DEQ Well #:	82296
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-7
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G59
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057947**

DWR Number:	55-923538	DEQ Well #:	82295
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-5
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

G60
SSE
1/4 - 1/2 Mile
Higher

AZ WELLS **AZDEQ3000057946**

DWR Number:	55-923537	DEQ Well #:	82294
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-4
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

I61
ESE **AZ WELLS** **AZDWR1200216854**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	925119
Owner Name:	ADEQ	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	05-NOV-20	Approved:	05-NOV-20
Installed Date:	10-NOV-20	Well Depth (ft):	130
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

I62
ESE **AZ WELLS** **AZDWR1200130190**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	598745
Owner Name:	CHEVRON USA	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	29-MAY-03	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

J63
South **AZ WELLS** **AZDEQ3000036691**
1/4 - 1/2 Mile
Higher

DWR Number:	55-539210	DEQ Well #:	46463
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-219
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

	Database	EDR ID Number
G64 **SSE** **1/4 - 1/2 Mile** **Higher**	**AZ WELLS**	**AZDEQ3000057951**

DWR Number:	55-924282	DEQ Well #:	82299
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-10
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

	Database	EDR ID Number
G65 **SSE** **1/4 - 1/2 Mile** **Higher**	**AZ WELLS**	**AZDEQ3000058048**

DWR Number:	55-927172	DEQ Well #:	82388
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-16
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

	Database	EDR ID Number
K66 **WNW** **1/4 - 1/2 Mile** **Lower**	**AZ WELLS**	**AZDWR1200111379**

Program:	55	Registry ID:	585356
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	23-JAN-01
Approved:	05-FEB-01	Installed Date:	21-FEB-01
Well Depth (ft):	92	Casing Type:	PLASTIC OR PVC
Water Level (ft):	77	AMA or INA:	TUCSON
Casing Depth (ft):	87	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

	Database	EDR ID Number
K67 **WNW** **1/4 - 1/2 Mile** **Lower**	**AZ WELLS**	**AZDWR1200111378**

Program:	55	Registry ID:	585355
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR

Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	23-JAN-01
Approved:	05-FEB-01	Installed Date:	22-FEB-01
Well Depth (ft):	95	Casing Type:	PLASTIC OR PVC
Water Level (ft):	77	AMA or INA:	TUCSON
Casing Depth (ft):	65	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

K68
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200118948**

Program:	55	Registry ID:	580459
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - VADOSE ZONE	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	31-MAR-00
Approved:	20-APR-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

K69
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200112801**

Program:	55	Registry ID:	587217
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	31-MAY-01
Approved:	05-JUN-01	Installed Date:	19-JUN-01
Well Depth (ft):	95	Casing Type:	PLASTIC OR PVC
Water Level (ft):	75	AMA or INA:	TUCSON
Casing Depth (ft):	60	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

K70
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200112802**

Program:	55	Registry ID:	587218
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	31-MAY-01
Approved:	05-JUN-01	Installed Date:	20-JUN-01
Well Depth (ft):	90	Casing Type:	PLASTIC OR PVC
Water Level (ft):	75	AMA or INA:	TUCSON
Casing Depth (ft):	85	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

K71
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200118947**

Program:	55	Registry ID:	580458
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - VADOSE ZONE	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	06-APR-00
Approved:	Not Reported	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

K72
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200118946**

Program:	55	Registry ID:	580457
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	ENV - VADOSE ZONE	Well Type Group:	OTHER
Water Use:	REMEDIATION	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	27-MAR-00
Approved:	20-APR-00	Installed Date:	Not Reported
Well Depth (ft):	70	Casing Type:	PLASTIC OR PVC
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	70	Casing Diameter (in):	5
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0

Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

K73
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200136754**

Program:	55	Registry ID:	592897
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	04-JUN-02
Approved:	13-JUN-02	Installed Date:	19-JUN-02
Well Depth (ft):	90	Casing Type:	PLASTIC OR PVC
Water Level (ft):	75	AMA or INA:	TUCSON
Casing Depth (ft):	89	Casing Diameter (in):	3
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

K74
WNW
1/4 - 1/2 Mile
Lower

AZ WELLS **AZDWR1200136755**

Program:	55	Registry ID:	592898
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY/UST HYDROLOGY		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST	Basin Name:	TUCSON AMA
Driller License #:	752	Application:	04-JUN-02
Approved:	13-JUN-02	Installed Date:	20-JUN-02
Well Depth (ft):	91	Casing Type:	PLASTIC OR PVC
Water Level (ft):	75	AMA or INA:	TUCSON
Casing Depth (ft):	90	Casing Diameter (in):	3
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

K75
WNW
1/4 - 1/2 Mile
Lower

AQUIFLOW **49591**

Site ID:	007039
Groundwater Flow:	NW
Shallowest Water Table Depth:	Not Reported
Deepest Water Table Depth:	Not Reported
Average Water Table Depth:	124ft
Date:	02/09/1990

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

L76
SSE **AZ WELLS** **AZDEQ3000057955**
1/4 - 1/2 Mile
Higher

DWR Number:	55-925117	DEQ Well #:	82302
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-13
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

H77
SSE **AZ WELLS** **AZDWR1200076248**
1/4 - 1/2 Mile
Higher

Program:	55	Registry ID:	535510
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JUN-92	Approved:	Not Reported
Installed Date:	06-AUG-92	Well Depth (ft):	190
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	83
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

M78
ESE **AZ WELLS** **AZDWR1200074627**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	535080
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	23-APR-92	Approved:	Not Reported
Installed Date:	06-MAY-92	Well Depth (ft):	105
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

M79
ESE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077670**

Program:	55	Registry ID:	536973
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	15-OCT-92	Approved:	Not Reported
Installed Date:	05-OCT-92	Well Depth (ft):	105
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

H80
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000057950**

DWR Number:	55-924464	DEQ Well #:	82298
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CA MW-9
well Depth:	Not Reported	Drill Depth:	125
Watershed:	Not Reported	Basin:	Not Reported
Aquifer Type:	Not Reported	Water Use:	Not Reported
Well Type:	Not Reported		

J81
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200214818**

Program:	55	Registry ID:	927172
Owner Name:	ADEQ	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	26-OCT-21	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

J82
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079321**

Program:	55	Registry ID:	539210
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	27-MAY-93	Approved:	Not Reported
Installed Date:	24-JUN-93	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

J83
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079392**

Program:	55	Registry ID:	539213
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	27-MAY-93	Approved:	Not Reported
Installed Date:	08-JUN-93	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

N84
South
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200080169**

Program:	55	Registry ID:	540143
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	27-OCT-99	Approved:	Not Reported
Installed Date:	20-AUG-93	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	1200	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0

Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

O85
SSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200191954**

Program:	55	Registry ID:	803802
Owner Name:	WENDT, GENE,I	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	Not Reported
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	12-JUN-86	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	OTHER - BLACK STEEL - IRON - SEAMLESS		
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	8
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	A	Well Cancelled:	N
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

O86
SSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200076250**

Program:	55	Registry ID:	535512
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JUN-92	Approved:	Not Reported
Installed Date:	27-JUN-92	Well Depth (ft):	190
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	83
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

L87
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200076991**

Program:	55	Registry ID:	537527
Owner Name:	ARCO PETROLEUM PROD,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-DEC-92	Approved:	Not Reported
Installed Date:	09-DEC-92	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	110

AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

L88
SSE **AZ WELLS** **AZDWR1200079400**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	539221
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	18-MAY-93	Approved:	Not Reported
Installed Date:	11-JUN-93	Well Depth (ft):	125
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

L89
SSE **AZ WELLS** **AZDWR1200080136**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	539770
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	02-JUL-93	Approved:	Not Reported
Installed Date:	04-JUN-93	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

90
WNW **AZ WELLS** **AZDWR1200051336**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	510277
Owner Name:	GREGAN DEVELOPMENT,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE

Basin Name:	TUCSON AMA	Driller License #:	263
Application:	07-FEB-85	Approved:	Not Reported
Installed Date:	14-FEB-85	Well Depth (ft):	140
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P91
WSW **AZ WELLS** **AZDWR1200100154**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	566719
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JAN-98	Approved:	11-FEB-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P92
WSW **AZ WELLS** **AZDWR1200099737**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	566718
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JAN-98	Approved:	11-FEB-98
Installed Date:	25-AUG-98	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	74
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

P93
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200100155**

Program:	55	Registry ID:	566720
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JAN-98	Approved:	11-FEB-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P94
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200112735**

Program:	55	Registry ID:	585887
Owner Name:	TOSCO MARKETING COMPANY #1431	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-FEB-01	Approved:	23-JUL-01
Installed Date:	03-AUG-01	Well Depth (ft):	100
Casing Type:	PLASTIC OR PVC	Water Level (ft):	80
AMA or INA:	TUCSON	Casing Depth (ft):	69
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P95
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200112734**

Program:	55	Registry ID:	585886
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-FEB-01	Approved:	20-MAR-01
Installed Date:	25-AUG-01	Well Depth (ft):	100
Casing Type:	PLASTIC OR PVC	Water Level (ft):	80
AMA or INA:	TUCSON	Casing Depth (ft):	99
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P96
WSW **AZ WELLS** **AZDWR1200099736**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	566717
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JAN-98	Approved:	11-FEB-98
Installed Date:	24-AUG-98	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	74
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P97
WSW **AZ WELLS** **AZDWR1200096874**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	558869
Owner Name:	TEXACO REFINING,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	529
Application:	11-JUL-96	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P98
WSW **AZ WELLS** **AZDWR1200096961**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	558888
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	214
Application:	18-JUL-96	Approved:	Not Reported
Installed Date:	08-AUG-96	Well Depth (ft):	115
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	80

AMA or INA:	TUCSON	Casing Depth (ft):	65
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P99
WSW **AZ WELLS** **AZDWR1200096962**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	558889
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	214
Application:	18-JUL-96	Approved:	Not Reported
Installed Date:	10-AUG-96	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	80
AMA or INA:	TUCSON	Casing Depth (ft):	65
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P100
WSW **AZ WELLS** **AZDWR1200099735**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	566716
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JAN-98	Approved:	11-FEB-98
Installed Date:	26-FEB-98	Well Depth (ft):	85
Casing Type:	PLASTIC OR PVC	Water Level (ft):	73
AMA or INA:	TUCSON	Casing Depth (ft):	85
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P101
WSW **AZ WELLS** **AZDWR1200096963**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	558890
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	214
Application:	18-JUL-96	Approved:	Not Reported
Installed Date:	12-AUG-96	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	80
AMA or INA:	TUCSON	Casing Depth (ft):	65
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P102
WSW **AZ WELLS** **AZDWR1200114195**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	588186
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	30-JUL-01	Approved:	02-AUG-01
Installed Date:	30-JUL-01	Well Depth (ft):	99
Casing Type:	PLASTIC OR PVC	Water Level (ft):	78
AMA or INA:	TUCSON	Casing Depth (ft):	69
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P103
WSW **AZ WELLS** **AZDWR1200130625**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	599197
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JUN-03	Approved:	27-JUN-03
Installed Date:	15-AUG-03	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

P104
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200120773**

Program:	55	Registry ID:	574273
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P105
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200130627**

Program:	55	Registry ID:	599199
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JUN-03	Approved:	27-JUN-03
Installed Date:	12-AUG-03	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P106
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200130626**

Program:	55	Registry ID:	599198
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	27-JUN-03	Approved:	27-JUN-03
Installed Date:	13-AUG-03	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P107
WSW **AZ WELLS** **AZDWR1200120772**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	574272
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P108
WSW **AZ WELLS** **AZDWR1200120769**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	574269
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	16-FEB-00	Well Depth (ft):	98
Casing Type:	PLASTIC OR PVC	Water Level (ft):	78
AMA or INA:	TUCSON	Casing Depth (ft):	98
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P109
WSW **AZ WELLS** **AZDWR1200120768**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	574268
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	14-FEB-00	Well Depth (ft):	98
Casing Type:	PLASTIC OR PVC	Water Level (ft):	78

AMA or INA:	TUCSON	Casing Depth (ft):	98
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

P110
WSW **AZ WELLS** **AZDWR1200120771**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	574271
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

P111
WSW **AZ WELLS** **AZDWR1200120770**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	574270
Owner Name:	CONOCO PHILLIPS COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-APR-99	Approved:	10-MAY-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

L112
SSE **AZ WELLS** **AZDEQ3000036692**
1/2 - 1 Mile
Higher

DWR Number:	55-539211	DEQ Well #:	46464
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-220

well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

113
ENE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200155490**

Program:	55	Registry ID:	622175
Owner Name:	ARIZONA BOARD OF REGENTS	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC, INDUSTRIAL
Basin Name:	TUCSON AMA	Driller License #:	323
Application:	14-JUN-82	Approved:	Not Reported
Installed Date:	25-MAY-48	Well Depth (ft):	225
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	85	AMA or INA:	TUCSON
Casing Depth (ft):	225	Casing Diameter (in):	8
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	25
Tested Rate:	25	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

114
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000049373**

DWR Number:	55-531293	DEQ Well #:	63101
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	23
well Depth:	Not Reported	Drill Depth:	228
Watershed:	Not Reported	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Miscellaneous Uses Not Included In Any Other Category.		
Well Type:	Anode Is A Hole Used As An Electrical Anode, Include In This Category Wells Used Solely To Ground Pipelines Or Electronic Relays And Other Installations.		

K115
WNW
1/2 - 1 Mile
Lower

AQUIFLOW **49681**

Site ID:	009043
Groundwater Flow:	SW
Shallowest Water Table Depth:	40 ft
Deepest Water Table Depth:	75 ft
Average Water Table Depth:	Not Reported
Date:	06/09/1997

116
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036695**

DWR Number:	55-539214	DEQ Well #:	46467
Agency Well #:	Not Reported	Start Date:	Not Reported

End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-223
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

Q117
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200116858**

Program:	55	Registry ID:	581688
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	161	Application:	12-JUN-00
Approved:	27-JUN-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	N
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Q118
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200120682**

Program:	55	Registry ID:	580118
Owner Name:	ARIZONA DEPARTMENT OF ENVIRONMENTAL QUALITY		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	10-MAR-00
Approved:	28-MAR-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Q119
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099111**

Program:	55	Registry ID:	571455
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA

Driller License #:	498	Application:	09-NOV-98
Approved:	08-JAN-99	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Q120
WSW **AZ WELLS** **AZDWR1200079399**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	539220
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	18-MAY-93	Approved:	Not Reported
Installed Date:	07-JUL-93	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	105
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Q121
WSW **AZ WELLS** **AZDWR1200112033**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	581825
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	20-JUN-00
Approved:	06-JUL-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R122
South
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000036696**

DWR Number:	55-539770	DEQ Well #:	46468
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-224
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

N123
SSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000036698**

DWR Number:	55-541753	DEQ Well #:	46470
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-226
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

R124
South
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000036701**

DWR Number:	55-540681	DEQ Well #:	46473
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-229
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

125
West
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200123285**

Program:	55	Registry ID:	579386
Owner Name:	CHEVRON USA	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	01-FEB-00	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0

AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

S126
NW **AZ WELLS** **AZDWR1200193216**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	700377
Owner Name:	Not Reported	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	116
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	6	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

S127
NW **AZ WELLS** **AZDWR1200193217**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	700378
Owner Name:	Not Reported	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	166
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	6	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T128
WNW **AZ WELLS** **AZDWR1200078483**
1/2 - 1 Mile
Lower

Program:	55	Registry ID:	538631
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	533
Application:	30-MAR-93	Approved:	Not Reported
Installed Date:	14-APR-93	Well Depth (ft):	90
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	69	AMA or INA:	TUCSON
Casing Depth (ft):	90	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T129
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200080541**

Program:	55	Registry ID:	540584
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	03-SEP-93	Approved:	Not Reported
Installed Date:	22-SEP-93	Well Depth (ft):	90
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	88
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T130
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200078481**

Program:	55	Registry ID:	538629
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	30-MAR-93	Approved:	Not Reported
Installed Date:	09-APR-93	Well Depth (ft):	90
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	70	AMA or INA:	TUCSON
Casing Depth (ft):	90	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

T131
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200078482**

Program:	55	Registry ID:	538630
Owner Name:	PIMA COUNTY DEPARTMENT OF TRANSPORTATION		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	31-MAR-93
Approved:	27-DEC-00	Installed Date:	10-APR-93
Well Depth (ft):	90	Casing Type:	STEEL - PERFORATED OR SLOTTED CASING
Water Level (ft):	70	AMA or INA:	TUCSON
Casing Depth (ft):	90	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T132
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200089219**

Program:	55	Registry ID:	548709
Owner Name:	PIMA COUNTY RIST MGT,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	19-MAY-95	Approved:	Not Reported
Installed Date:	08-JUN-95	Well Depth (ft):	90
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	75	AMA or INA:	TUCSON
Casing Depth (ft):	70	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	X	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T133
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200092449**

Program:	55	Registry ID:	553245
Owner Name:	PIMA COUNTY RISK,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	28-NOV-95	Approved:	Not Reported
Installed Date:	20-DEC-95	Well Depth (ft):	85
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	78	AMA or INA:	TUCSON
Casing Depth (ft):	65	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0

Tested Rate:	0	Draw Down:	0
Completion:	X	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T134
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200092450**

Program:	55	Registry ID:	553246
Owner Name:	PIMA COUNTY RISK,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	28-NOV-95	Approved:	Not Reported
Installed Date:	26-DEC-95	Well Depth (ft):	85
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	76	AMA or INA:	TUCSON
Casing Depth (ft):	65	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	X	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T135
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200089230**

Program:	55	Registry ID:	549078
Owner Name:	PIMA COUNTY RISK MGT,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	22-MAY-95	Approved:	Not Reported
Installed Date:	07-JUN-95	Well Depth (ft):	85
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	73	AMA or INA:	TUCSON
Casing Depth (ft):	60	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T136
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200089241**

Program:	55	Registry ID:	549089
Owner Name:	PIMA COUNTY RISK MGT,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	23-MAY-95	Approved:	Not Reported
Installed Date:	06-JUN-95	Well Depth (ft):	90
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		

Water Level (ft):	81	AMA or INA:	TUCSON
Casing Depth (ft):	70	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	X	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T137
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070074**

Program:	55	Registry ID:	530265
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T138
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070142**

Program:	55	Registry ID:	530266
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T139
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200039836**

Program:	55	Registry ID:	400198
Owner Name:	PIMA COUNTY WASTEWATER	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE

Basin Name:	TUCSON AMA	Driller License #:	307
Application:	04-MAY-00	Approved:	11-MAY-00
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T140
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070073**

Program:	55	Registry ID:	530264
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T141
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070143**

Program:	55	Registry ID:	530267
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

T142
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200071553**

Program:	55	Registry ID:	531365
Owner Name:	SOUTHWEST GAS CORP,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	499
Application:	25-MAR-91	Approved:	Not Reported
Installed Date:	16-APR-91	Well Depth (ft):	228
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T143
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200078480**

Program:	55	Registry ID:	538628
Owner Name:	PIMA COUNTY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	31-MAR-93	Approved:	27-DEC-00
Installed Date:	08-APR-93	Well Depth (ft):	90
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	72	AMA or INA:	TUCSON
Casing Depth (ft):	90	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T144
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070144**

Program:	55	Registry ID:	530268
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T145
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070145**

Program:	55	Registry ID:	530269
Owner Name:	TUCSON, CITY SOUTH,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T146
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200092451**

Program:	55	Registry ID:	553247
Owner Name:	PIMA COUNTY RISK,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	28-NOV-95	Approved:	Not Reported
Installed Date:	27-DEC-95	Well Depth (ft):	85
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	68	AMA or INA:	TUCSON
Casing Depth (ft):	60	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	X	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

T147
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200108389**

Program:	55	Registry ID:	565487
Owner Name:	SOUTH TUCSON, CITY OF	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	07-NOV-97	Approved:	05-DEC-97
Installed Date:	12-OCT-98	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	74

AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T148
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200108388**

Program:	55	Registry ID:	565486
Owner Name:	SOUTH TUCSON, CITY OF	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	07-NOV-97	Approved:	05-DEC-97
Installed Date:	28-OCT-98	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	74
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T149
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200108387**

Program:	55	Registry ID:	565485
Owner Name:	SOUTH TUCSON, CITY OF	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	07-NOV-97	Approved:	05-DEC-97
Installed Date:	01-OCT-98	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	74
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T150
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200125213**

Program:	55	Registry ID:	575008
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST

Basin Name:	TUCSON AMA	Driller License #:	604
Application:	12-MAY-99	Approved:	25-JUN-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T151
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200125212**

Program:	55	Registry ID:	575007
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	12-MAY-99	Approved:	25-JUN-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T152
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200108390**

Program:	55	Registry ID:	565488
Owner Name:	SOUTH TUCSON, CITY OF	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	07-NOV-97	Approved:	05-DEC-97
Installed Date:	15-DEC-98	Well Depth (ft):	97
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

T153
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099666**

Program:	55	Registry ID:	573314
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	12-FEB-99	Approved:	24-JUN-99
Installed Date:	21-MAY-99	Well Depth (ft):	97
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	70
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T154
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099665**

Program:	55	Registry ID:	573313
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	12-FEB-99	Approved:	24-JUN-99
Installed Date:	18-MAY-99	Well Depth (ft):	97
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	70
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T155
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200098275**

Program:	55	Registry ID:	571871
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	752
Application:	26-OCT-98	Approved:	23-NOV-98
Installed Date:	06-JAN-99	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	75
AMA or INA:	TUCSON	Casing Depth (ft):	95
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

T156
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099669**

Program:	55	Registry ID:	573317
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	12-FEB-99	Approved:	01-MAR-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T157
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099668**

Program:	55	Registry ID:	573316
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	12-FEB-99	Approved:	01-MAR-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

T158
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099667**

Program:	55	Registry ID:	573315
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	12-FEB-99	Approved:	01-MAR-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0

AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R159
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080523**

Program:	55	Registry ID:	540223
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-AUG-93	Approved:	Not Reported
Installed Date:	13-AUG-93	Well Depth (ft):	190
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

R160
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101974**

Program:	55	Registry ID:	568061
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	09-APR-98	Approved:	23-APR-98
Installed Date:	04-MAY-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	98
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R161
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080137**

Program:	55	Registry ID:	539771
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	498
Application:	02-JUL-93	Approved:	Not Reported
Installed Date:	02-JUN-94	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R162
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077315**

Program:	55	Registry ID:	536884
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	13-OCT-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	83	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

R163
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079488**

Program:	55	Registry ID:	540681
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	14-SEP-93	Approved:	Not Reported
Installed Date:	24-SEP-93	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R164
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102050**

Program:	55	Registry ID:	569417
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	08-AUG-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R165
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121743**

Program:	55	Registry ID:	575675
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	10-JAN-00	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R166
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102052**

Program:	55	Registry ID:	569419
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	11-AUG-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R167
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102051**

Program:	55	Registry ID:	569418
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	10-AUG-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R168
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121746**

Program:	55	Registry ID:	575678
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R169
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121747**

Program:	55	Registry ID:	575679
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0

AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R170
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121744**

Program:	55	Registry ID:	575676
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	23-JAN-00	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R171
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121745**

Program:	55	Registry ID:	575677
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R172
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102053**

Program:	55	Registry ID:	569420
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST

Basin Name:	TUCSON AMA	Driller License #:	161
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	27-JAN-99	Well Depth (ft):	125
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	120
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R173
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121740**

Program:	55	Registry ID:	575672
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	23-JAN-00	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R174
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121739**

Program:	55	Registry ID:	575671
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	10-JAN-00	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R175
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121742**

Program:	55	Registry ID:	575674
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	23-JAN-00	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R176
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121741**

Program:	55	Registry ID:	575673
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	07-JAN-00	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R177
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102055**

Program:	55	Registry ID:	569422
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	03-FEB-99	Well Depth (ft):	120
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R178
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102054**

Program:	55	Registry ID:	569421
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	29-JAN-99	Well Depth (ft):	122
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	120
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R179
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121738**

Program:	55	Registry ID:	575670
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	23-JAN-00	Well Depth (ft):	115
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	115
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R180
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102056**

Program:	55	Registry ID:	569423
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	05-FEB-99	Well Depth (ft):	112
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	110

AMA or INA:	TUCSON	Casing Depth (ft):	112
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R181
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101977**

Program:	55	Registry ID:	568064
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	09-APR-98	Approved:	23-APR-98
Installed Date:	28-APR-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	98
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R182
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101976**

Program:	55	Registry ID:	568063
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	09-APR-98	Approved:	23-APR-98
Installed Date:	30-APR-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	98
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R183
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102049**

Program:	55	Registry ID:	569416
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST

Basin Name:	TUCSON AMA	Driller License #:	611
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	07-AUG-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R184
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102048**

Program:	55	Registry ID:	569415
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	26-JUN-98	Approved:	08-JUL-98
Installed Date:	04-AUG-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R185
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101975**

Program:	55	Registry ID:	568062
Owner Name:	CITY OF TUCSON-ENVIRONMENTAL SERVICES		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	739	Application:	09-APR-98
Approved:	27-JUN-12	Installed Date:	07-MAY-98
Well Depth (ft):	120	Casing Type:	PLASTIC OR PVC
Water Level (ft):	98	AMA or INA:	TUCSON
Casing Depth (ft):	80	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

R186
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121749**

Program:	55	Registry ID:	575681
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R187
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200121748**

Program:	55	Registry ID:	575680
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	18-JUN-99	Approved:	01-JUL-99
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

R188
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200137338**

Program:	55	Registry ID:	588365
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	09-AUG-01	Approved:	21-AUG-01
Installed Date:	17-APR-02	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	6	RGR Pump Data:	YES
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R189
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200137339**

Program:	55	Registry ID:	588366
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	09-AUG-01	Approved:	21-AUG-01
Installed Date:	20-NOV-01	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	95
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

R190
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036684**

DWR Number:	55-536884	DEQ Well #:	46456
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-212
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

U191
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079322**

Program:	55	Registry ID:	539211
Owner Name:	CITY OF TUCSON ENVIRONMENTAL SERVICES		
Well Type:	ENV - MONITOR OR PIEZOMETER	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	739	Application:	27-MAY-93
Approved:	Not Reported	Installed Date:	08-JUL-93
Well Depth (ft):	120	Casing Type:	PLASTIC OR PVC
Water Level (ft):	105	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported

Driller Log:	X	Watershed:	SANTA CRUZ RIVER

U192
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080168**

Program:	55	Registry ID:	540142
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-AUG-93	Approved:	Not Reported
Installed Date:	19-AUG-93	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

V193
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200078020**

Program:	55	Registry ID:	537055
Owner Name:	PIMA COUNTY,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	363
Application:	16-OCT-92	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

194
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000028698**

DWR Number:	Not Reported	DEQ Well #:	37460
Agency Well #:	37460	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	D-14-13 25CAA
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

W195
SE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200039546**

Program:	55	Registry ID:	481747
Owner Name:	NORMAC LLC	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	521
Application:	23-JAN-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

W196
SE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200039547**

Program:	55	Registry ID:	481748
Owner Name:	NORMAC LLC	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	521
Application:	23-JAN-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

X197
SE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200155491**

Program:	55	Registry ID:	622176
Owner Name:	TUCSON RETAIL LLC	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC, INDUSTRIAL
Basin Name:	TUCSON AMA	Driller License #:	323
Application:	14-JUN-82	Approved:	06-SEP-50
Installed Date:	28-AUG-50	Well Depth (ft):	545
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	91	AMA or INA:	TUCSON
Casing Depth (ft):	545	Casing Diameter (in):	8
RGR Pump Data:	NO	Pump Type:	TURBINE
Pump Power:	ELECTRIC MOTOR 16 - 100 HP	Pump Rate:	500

Tested Rate:	500	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Y198
SSE **AZ WELLS** **AZDWR1200014365**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	212262
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-MAY-06	Approved:	15-MAY-06
Installed Date:	20-JUN-06	Well Depth (ft):	0
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	6	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Y199
SSE **AZ WELLS** **AZDWR1200116517**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	583453
Owner Name:	CITY OF TUCSON - ENVIRONMENTAL MANAGEMENT DIVISION		
Well Type:	NON-EXEMPT - WITHDRAWAL PERMIT	Well Type Group:	NON-EXEMPT
Water Use:	OTHER - PRODUCTION	Basin Name:	TUCSON AMA
Driller License #:	611	Application:	30-NOV-01
Approved:	13-FEB-01	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	YES	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Y200
SSE **AZ WELLS** **AZDWR1200014179**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	212643
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	09-JUN-06	Approved:	14-JUN-06
Installed Date:	23-JUN-06	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	117

AMA or INA:	TUCSON	Casing Depth (ft):	110
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

X201
SE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000028958**

DWR Number:	55-622176	DEQ Well #:	37720
Agency Well #:	37720	Start Date:	01-AUG-50
End Date:	Not Reported	Station Alt Name:	D-14-14 30DBC
well Depth:	Not Reported	Drill Depth:	545
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

Z202
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200074384**

Program:	55	Registry ID:	534291
Owner Name:	SOUTHWEST GAS CORP,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	392
Application:	23-JAN-92	Approved:	Not Reported
Installed Date:	05-MAY-92	Well Depth (ft):	230
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	59
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

203
East
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000028956**

DWR Number:	55-622175	DEQ Well #:	37718
Agency Well #:	37718	Start Date:	01-APR-46
End Date:	Not Reported	Station Alt Name:	D-14-14 30ABD
well Depth:	Not Reported	Drill Depth:	225
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AA204
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200196732**

Program:	55	Registry ID:	801479
Owner Name:	SUN AIR LODGE,	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-MAY-84	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	210
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	14	Tested Rate:	14
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AA205
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036693**

DWR Number:	55-539212	DEQ Well #:	46465
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-221
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

206
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200082244**

Program:	55	Registry ID:	541754
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	27-OCT-99	Approved:	Not Reported
Installed Date:	21-DEC-93	Well Depth (ft):	190
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	119	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

X207
SE
1/2 - 1 Mile
Higher

FED USGS **USGS40000036950**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-14 30DBC	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	195008
Well Depth:	545	Well Depth Units:	ft
Well Hole Depth:	545	Well Hole Depth Units:	ft

208
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200171675**

Program:	55	Registry ID:	628990
Owner Name:	B77 DEVELOPMENT LLC	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	IRRIGATION, DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	521
Application:	21-JUN-82	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

U209
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036694**

DWR Number:	55-539213	DEQ Well #:	46466
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-222
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AB210
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079393**

Program:	55	Registry ID:	539214
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	27-MAY-93	Approved:	Not Reported
Installed Date:	23-JUN-93	Well Depth (ft):	125
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	125
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AB211
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200079323**

Program:	55	Registry ID:	539212
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	27-MAY-93	Approved:	Not Reported
Installed Date:	16-JUN-93	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

U212
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036699**

DWR Number:	55-540142	DEQ Well #:	46471
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-227
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

Map ID
Direction
Distance
Elevation

			Database	EDR ID Number
V213 **WNW** **1/2 - 1 Mile** **Lower**	Site ID:	008100	**AQUIFLOW**	**49669**
	Groundwater Flow:	N		
	Shallowest Water Table Depth:	Not Reported		
	Deepest Water Table Depth:	Not Reported		
	Average Water Table Depth:	100 f		
	Date:	05/1993		

214
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200193215**

Program:	55	Registry ID:	700376
Owner Name:	Not Reported	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	74
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AC215
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200073453**

Program:	55	Registry ID:	533340
Owner Name:	CHEVRON USA,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-OCT-91	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AC216
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200073522**

Program:	55	Registry ID:	533341
Owner Name:	CHEVRON USA	Well Type:	ENV - MONITOR OR PIEZOMETER

Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-OCT-91	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AC217
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200073523**

Program:	55	Registry ID:	533342
Owner Name:	CHEVRON USA,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-OCT-91	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AC218
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200073452**

Program:	55	Registry ID:	533339
Owner Name:	CHEVRON USA,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-OCT-91	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

Z219
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000049376**

DWR Number:	55-534291	DEQ Well #:	63104
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	253
well Depth:	Not Reported	Drill Depth:	230
Watershed:	Not Reported	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Miscellaneous Uses Not Included In Any Other Category.		
Well Type:	Anode Is A Hole Used As An Electrical Anode, Include In This Category Wells Used Solely To Ground Pipelines Or Electronic Relays And Other Installations.		

220
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200082243**

Program:	55	Registry ID:	541753
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	10-DEC-93	Approved:	Not Reported
Installed Date:	06-JAN-94	Well Depth (ft):	192
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	108	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AD221
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036690**

DWR Number:	55-536891	DEQ Well #:	46462
Agency Well #:	Not Reported	Start Date:	09-NOV-92
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-218
well Depth:	Not Reported	Drill Depth:	194
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AE222
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036687**

DWR Number:	55-536890	DEQ Well #:	46459
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-215
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AD223
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036685**

DWR Number:	55-536888	DEQ Well #:	46457
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-213
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AE224
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036689**

DWR Number:	55-536892	DEQ Well #:	46461
Agency Well #:	Not Reported	Start Date:	12-NOV-92
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-217
well Depth:	Not Reported	Drill Depth:	194
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AE225
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036686**

DWR Number:	55-536886	DEQ Well #:	46458
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-214
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		

Well Type: Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type

---

AF226
SSE **AZ WELLS** **AZDWR1200192173**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	801581
Owner Name:	D L MCPHERSON	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	04-JUN-54	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	116
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	190
Casing Diameter (in):	8	RGR Pump Data:	YES
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	53	Tested Rate:	53
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AF227
SSE **AZ WELLS** **AZDWR1200019864**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	217301
Owner Name:	CITY OF TUCSON ENVIRONMENTAL SERVICES		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	7	Application:	19-FEB-08
Approved:	21-FEB-08	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AF228
SSE **AZ WELLS** **AZDWR1200015127**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	214236
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-DEC-06	Approved:	13-DEC-06
Installed Date:	25-JAN-07	Well Depth (ft):	122
Casing Type:	PLASTIC OR PVC	Water Level (ft):	109
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	5	RGR Pump Data:	NO

Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AF229
SSE **AZ WELLS** **AZDWR1200015124**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	214233
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-DEC-06	Approved:	13-DEC-06
Installed Date:	25-JAN-07	Well Depth (ft):	122
Casing Type:	PLASTIC OR PVC	Water Level (ft):	109
AMA or INA:	TUCSON	Casing Depth (ft):	150
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AF230
SSE **AZ WELLS** **AZDWR1200130997**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	598364
Owner Name:	CHEVRON USA	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	06-MAY-03	Approved:	06-MAY-03
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AF231
SSE **AZ WELLS** **AZDWR1200080521**
1/2 - 1 Mile
Higher

Program:	55	Registry ID:	540221
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-AUG-93	Approved:	Not Reported

Installed Date:	10-AUG-93	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AF232
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200019865**

Program:	55	Registry ID:	217302
Owner Name:	CITY OF TUCSON ENVIRONMENTAL SERVICES		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	MONITORING	Basin Name:	TUCSON AMA
Driller License #:	7	Application:	19-FEB-08
Approved:	21-FEB-08	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AG233
North
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200152109**

Program:	55	Registry ID:	620143
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES, RESERVED
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	01-AUG-41	Well Depth (ft):	800
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	145	AMA or INA:	TUCSON
Casing Depth (ft):	800	Casing Diameter (in):	16
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AG234
North
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000028695**

DWR Number:	55-620143	DEQ Well #:	37457
Agency Well #:	37457	Start Date:	01-JAN-41
End Date:	Not Reported	Station Alt Name:	D-14-13 24DAA
well Depth:	Not Reported	Drill Depth:	800
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Observation Well Is A Cased Well Drilled For Water Level Or Water Quality Observations. Do Not Use For An Oil Test Hole, Or Water Supply Well Used Only Incidentally As An Observation Well.		

AE235
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200096771**

Program:	55	Registry ID:	558833
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	529
Application:	09-JUL-96	Approved:	Not Reported
Installed Date:	03-AUG-96	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	117
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE236
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200096770**

Program:	55	Registry ID:	558832
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	529
Application:	09-JUL-96	Approved:	Not Reported
Installed Date:	01-AUG-96	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	117
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AE237
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200096772**

Program:	55	Registry ID:	558834
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	529
Application:	09-JUL-96	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AE238
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101933**

Program:	55	Registry ID:	566864
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	06-FEB-98	Approved:	26-FEB-98
Installed Date:	05-MAY-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	107
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE239
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200101932**

Program:	55	Registry ID:	566863
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	06-FEB-98	Approved:	26-FEB-98
Installed Date:	13-MAY-98	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	97
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE240
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200093459**

Program:	55	Registry ID:	553516
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JAN-96	Approved:	Not Reported
Installed Date:	23-JAN-96	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	90
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE241
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077388**

Program:	55	Registry ID:	536892
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	360
Application:	01-OCT-92	Approved:	Not Reported
Installed Date:	12-NOV-92	Well Depth (ft):	194
Casing Type:	PLASTIC OR PVC	Water Level (ft):	113
AMA or INA:	TUCSON	Casing Depth (ft):	190
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE242
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077386**

Program:	55	Registry ID:	536890
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	21-AUG-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		

Water Level (ft):	84	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AE243
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200092224**

Program:	55	Registry ID:	552452
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-95	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AE244
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200093458**

Program:	55	Registry ID:	553515
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JAN-96	Approved:	Not Reported
Installed Date:	22-JAN-96	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	90
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE245
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200092225**

Program:	55	Registry ID:	552453
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	473
Application:	04-OCT-95	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AE246
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109103**

Program:	55	Registry ID:	564639
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	11-SEP-97	Approved:	Not Reported
Installed Date:	17-OCT-97	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	98
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE247
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109091**

Program:	55	Registry ID:	564627
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	22-SEP-97
Installed Date:	15-NOV-97	Well Depth (ft):	122
Casing Type:	PLASTIC OR PVC	Water Level (ft):	118
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AE248
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200209108**

Program:	55	Registry ID:	905127
Owner Name:	CITY OF TUCSON	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	29-JUN-06	Approved:	29-JUN-06
Installed Date:	12-JUL-06	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	102
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE249
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200226210**

Program:	55	Registry ID:	927547
Owner Name:	CITY OF TUCSON	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	226
Application:	20-JAN-22	Approved:	20-JAN-22
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AE250
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200209109**

Program:	55	Registry ID:	905128
Owner Name:	CITY OF TUCSON	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	29-JUN-06	Approved:	29-JUN-06
Installed Date:	12-JUL-06	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	102
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE251
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109090**

Program:	55	Registry ID:	564626
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	22-SEP-97
Installed Date:	23-NOV-97	Well Depth (ft):	114
Casing Type:	PLASTIC OR PVC	Water Level (ft):	106
AMA or INA:	TUCSON	Casing Depth (ft):	110
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE252
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109086**

Program:	55	Registry ID:	564622
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AE253
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200102334**

Program:	55	Registry ID:	566414
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	611
Application:	19-DEC-97	Approved:	07-JAN-98
Installed Date:	09-JAN-98	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	90

AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE254
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109087**

Program:	55	Registry ID:	564623
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	22-SEP-97
Installed Date:	15-NOV-97	Well Depth (ft):	122
Casing Type:	PLASTIC OR PVC	Water Level (ft):	118
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE255
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109089**

Program:	55	Registry ID:	564625
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	22-SEP-97
Installed Date:	20-NOV-97	Well Depth (ft):	120
Casing Type:	PLASTIC OR PVC	Water Level (ft):	106
AMA or INA:	TUCSON	Casing Depth (ft):	110
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE256
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200109088**

Program:	55	Registry ID:	564624
Owner Name:	CITY OF TUCSON - (OEM)	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	15-SEP-97	Approved:	22-SEP-97
Installed Date:	05-NOV-97	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	101
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE257
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077384**

Program:	55	Registry ID:	536888
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	15-OCT-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	83	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AE258
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200014368**

Program:	55	Registry ID:	212265
Owner Name:	CITY OF TUCSON	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)
Well Type Group:	OTHER	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-MAY-06	Approved:	24-MAY-06
Installed Date:	29-JUN-06	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	101
AMA or INA:	TUCSON	Casing Depth (ft):	120
Casing Diameter (in):	1	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database | EDR ID Number

AE259
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200014367**

Program:	55	Registry ID:	212264
Owner Name:	CITY OF TUCSON	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)
Well Type Group:	OTHER	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	7
Application:	11-MAY-06	Approved:	24-MAY-06
Installed Date:	30-JUN-06	Well Depth (ft):	121
Casing Type:	PLASTIC OR PVC	Water Level (ft):	101
AMA or INA:	TUCSON	Casing Depth (ft):	55
Casing Diameter (in):	1	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE260
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200074869**

Program:	55	Registry ID:	534790
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	31-MAR-92	Approved:	Not Reported
Installed Date:	23-APR-92	Well Depth (ft):	105
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	100
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE261
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077382**

Program:	55	Registry ID:	536886
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	19-OCT-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	84	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0

Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AE262
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200076858**

Program:	55	Registry ID:	536763
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	15-OCT-92	Approved:	Not Reported
Installed Date:	27-AUG-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	84	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

263
North
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200071280**

Program:	55	Registry ID:	531293
Owner Name:	SOUTHWEST GAS CORP,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	499
Application:	18-MAR-91	Approved:	Not Reported
Installed Date:	02-APR-91	Well Depth (ft):	228
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AH264
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200103244**

Program:	55	Registry ID:	566925
Owner Name:	ARIZONA'S CHILDREN ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	09-FEB-98	Approved:	09-MAR-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0

AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AH265
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200103243**

Program:	55	Registry ID:	566924
Owner Name:	ARIZONA'S CHILDREN ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	09-FEB-98	Approved:	09-MAR-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AH266
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200102825**

Program:	55	Registry ID:	566923
Owner Name:	ARIZONA'S CHILDREN ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	604
Application:	09-FEB-98	Approved:	09-MAR-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AH267
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200103245**

Program:	55	Registry ID:	566926
Owner Name:	ARIZONA'S CHILDREN ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	604
Application:	09-FEB-98	Approved:	09-MAR-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AH268
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200104042**

Program:	55	Registry ID:	573134
Owner Name:	ARIZONA CHILDREN'S ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	04-FEB-99	Approved:	01-MAR-99
Installed Date:	11-MAR-99	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	86
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AH269
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200104041**

Program:	55	Registry ID:	573133
Owner Name:	ARIZONA CHILDREN'S ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	04-FEB-99	Approved:	01-MAR-99
Installed Date:	10-MAR-99	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	88
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AH270
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200103622**

Program:	55	Registry ID:	573132
Owner Name:	ARIZONA CHILDREN'S ASSOCIATION	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	TEST
Basin Name:	TUCSON AMA	Driller License #:	533
Application:	04-FEB-99	Approved:	01-MAR-99
Installed Date:	10-MAR-99	Well Depth (ft):	96
Casing Type:	PLASTIC OR PVC	Water Level (ft):	88
AMA or INA:	TUCSON	Casing Depth (ft):	96
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AE271
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036681**

DWR Number:	55-536763	DEQ Well #:	46453
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-209
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AD272
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077387**

Program:	55	Registry ID:	536891
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	360
Application:	01-OCT-92	Approved:	Not Reported
Installed Date:	09-NOV-92	Well Depth (ft):	194
Casing Type:	PLASTIC OR PVC	Water Level (ft):	114
AMA or INA:	TUCSON	Casing Depth (ft):	190
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AD273
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080522**

Program:	55	Registry ID:	540222
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-AUG-93	Approved:	Not Reported
Installed Date:	11-AUG-93	Well Depth (ft):	190
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AE274
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036683**

DWR Number:	55-536889	DEQ Well #:	46455
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-211
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AI275
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077381**

Program:	55	Registry ID:	536885
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	08-OCT-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	82	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AI276
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077385**

Program:	55	Registry ID:	536889
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	10-OCT-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	82	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AI277
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080520**

Program:	55	Registry ID:	540220
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-AUG-93	Approved:	Not Reported
Installed Date:	06-AUG-93	Well Depth (ft):	190
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	120	AMA or INA:	TUCSON
Casing Depth (ft):	140	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AE278
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036682**

DWR Number:	55-536885	DEQ Well #:	46454
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-210
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AD279
South
1/2 - 1 Mile
Higher | **AZ WELLS** | **AZDEQ3000036703**

DWR Number:	55-540222	DEQ Well #:	46475
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-231
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AG280
North
1/2 - 1 Mile
Lower | **FED USGS** | **USGS40000037086**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 24DAA	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1941
Well Depth:	800	Well Depth Units:	ft
Well Hole Depth:	800	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	31	Level reading date:	1991-12-19
Feet below surface:	144.89	Feet to sea level:	Not Reported
Note:	Not Reported		

Level reading date:	1990-12-21	Feet below surface:	140.56
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1989-01-10	Feet below surface:	134.20
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1987-12-23	Feet below surface:	131.40
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1987-12-02	Feet below surface:	129.10
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-12-31	Feet below surface:	128.50
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-01-09	Feet below surface:	132.80
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1983-12-22	Feet below surface:	149.40
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1982-12-01	Feet below surface:	149.40
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1981-12-29	Feet below surface:	144.9
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1970-02-09	Feet below surface:	131.97
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1969-02-12	Feet below surface:	126.31
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1968-02-02	Feet below surface:	121.42
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1966-02-28	Feet below surface:	121.30
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-02-03	Feet below surface:	124.41
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-01-28	Feet below surface:	121.33
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-02-04	Feet below surface:	116.64
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-01-26	Feet below surface:	112.35
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1961-01-30	Feet below surface:	109.47
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1960-02-01	Feet below surface:	107.22
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1959-01-29	Feet below surface:	105.18
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1958-01-28	Feet below surface:	103.4
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1957-02-06	Feet below surface:	99.05
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-02-13	Feet below surface:	99.98
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1955-02-07	Feet below surface:	99.05
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-02-08	Feet below surface:	97.60
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1953-02-06	Feet below surface:	97.25
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1952-02-11	Feet below surface:	93.35
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1951-02-23	Feet below surface:	91.86
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1950-02-09	Feet below surface:	88.68
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1949-02-10	Feet below surface:	84.87
Feet to sea level:	Not Reported	Note:	Not Reported

AF281
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036702**

DWR Number:	55-540221	DEQ Well #:	46474
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-230
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AF282
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036697**

DWR Number:	55-539771	DEQ Well #:	46469
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-225
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AI283
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036700**

DWR Number:	55-540220	DEQ Well #:	46472
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-228
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AF284
SSE
1/2 - 1 Mile
Higher

Site ID:	006244
Groundwater Flow:	Not Reported
Shallowest Water Table Depth:	Not Reported
Deepest Water Table Depth:	Not Reported
Average Water Table Depth:	200ft
Date:	09/30/1988

AQUIFLOW **49620**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database | EDR ID Number

285
ESE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200155488**

Program:	55	Registry ID:	622173
Owner Name:	5151 EAST, LLC	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	IRRIGATION
Basin Name:	TUCSON AMA	Driller License #:	667
Application:	14-JUN-82	Approved:	Not Reported
Installed Date:	01-JAN-46	Well Depth (ft):	90
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AJ286
North
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000049339**

DWR Number:	55-530777	DEQ Well #:	63067
Agency Well #:	Not Reported	Start Date:	12-MAR-91
End Date:	Not Reported	Station Alt Name:	D-141419BCC
well Depth:	Not Reported	Drill Depth:	228
Watershed:	Not Reported	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Well Designed To Test Aquifer Parameters.
Well Type:	Anode Is A Hole Used As An Electrical Anode, Include In This Category Wells Used Solely To Ground Pipelines Or Electronic Relays And Other Installations.		

AK287
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080900**

Program:	55	Registry ID:	541777
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-DEC-93	Approved:	Not Reported
Installed Date:	11-JAN-94	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	136	AMA or INA:	TUCSON
Casing Depth (ft):	141	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AK288
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080901**

Program:	55	Registry ID:	541778
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-DEC-93	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AK289
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200081272**

Program:	55	Registry ID:	542233
Owner Name:	CITY OF TUCSON	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	26-JAN-94	Approved:	Not Reported
Installed Date:	09-FEB-94	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	136	AMA or INA:	TUCSON
Casing Depth (ft):	141	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

290
SW
1/2 - 1 Mile
Lower

FED USGS **USGS40000036937**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-14 25CDA	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	400	Well Depth Units:	ft
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AL291
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDEQ3000036680**

DWR Number:	55-536887	DEQ Well #:	46452
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-208
well Depth:	Not Reported	Drill Depth:	Not Reported
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AJ292
North
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200070729**

Program:	55	Registry ID:	530777
Owner Name:	SW GAS CORP,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	499
Application:	01-FEB-91	Approved:	Not Reported
Installed Date:	12-MAR-91	Well Depth (ft):	228
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AL293
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077383**

Program:	55	Registry ID:	536887
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	06-OCT-92	Approved:	Not Reported
Installed Date:	23-AUG-92	Well Depth (ft):	120
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	84	AMA or INA:	TUCSON
Casing Depth (ft):	120	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AL294
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200077389**

Program:	55	Registry ID:	536893
Owner Name:	TUCSON, CITY OF, Airport Authority	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	360
Application:	01-OCT-92	Approved:	Not Reported
Installed Date:	17-NOV-92	Well Depth (ft):	194
Casing Type:	PLASTIC OR PVC	Water Level (ft):	116
AMA or INA:	TUCSON	Casing Depth (ft):	490
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

295
South
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080902**

Program:	55	Registry ID:	541779
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-DEC-93	Approved:	Not Reported
Installed Date:	08-JAN-94	Well Depth (ft):	191
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	126	AMA or INA:	TUCSON
Casing Depth (ft):	141	Casing Diameter (in):	4
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	N	Well Cancelled:	Not Reported
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

296
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200192896**

Program:	55	Registry ID:	800131
Owner Name:	KLUGE,F J	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	06-AUG-82	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AM297
NNE **AZ WELLS** **AZDEQ3000028915**
1/2 - 1 Mile
Lower

DWR Number:	55-620198	DEQ Well #:	37677
Agency Well #:	37677	Start Date:	01-JAN-30
End Date:	Not Reported	Station Alt Name:	TUCSON WATER B-34
well Depth:	Not Reported	Drill Depth:	316
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AM298
NNE **AZ WELLS** **AZDEQ3000028916**
1/2 - 1 Mile
Lower

DWR Number:	55-620197	DEQ Well #:	37678
Agency Well #:	37678	Start Date:	01-NOV-48
End Date:	Not Reported	Station Alt Name:	TUCSON WATER B-33
well Depth:	Not Reported	Drill Depth:	557
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AL299
South **AZ WELLS** **AZDEQ3000036688**
1/2 - 1 Mile
Higher

DWR Number:	55-536893	DEQ Well #:	46460
Agency Well #:	Not Reported	Start Date:	17-NOV-92
End Date:	Not Reported	Station Alt Name:	CITY OF TUCSON WR-216
well Depth:	Not Reported	Drill Depth:	490
Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Is Extracted For Analyse Of Water Quality And/Or Water Levels.		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AN300
WSW **AZ WELLS** **AZDEQ3000028699**
1/2 - 1 Mile
Lower

DWR Number:	55-620196	DEQ Well #:	37461
Agency Well #:	37461	Start Date:	01-AUG-46
End Date:	Not Reported	Station Alt Name:	D-14-13 25CBD
well Depth:	Not Reported	Drill Depth:	547

Watershed:	SANTA CRUZ	Basin:	Tucson AMA
Aquifer Type:	Not Reported	Water Use:	Site Water Use Is Unknown
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

AN301
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200153186**

Program:	55	Registry ID:	620195
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	160
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	160	Casing Diameter (in):	8
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AN302
WSW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200153187**

Program:	55	Registry ID:	620196
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	01-AUG-46	Well Depth (ft):	547
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	145	AMA or INA:	TUCSON
Casing Depth (ft):	547	Casing Diameter (in):	12
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AN303
WSW
1/2 - 1 Mile
Lower

FED USGS **USGS40000036956**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-13 25CBD	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	194608

Well Depth:	499.6	Well Depth Units:	ft
Well Hole Depth:	547	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	12	Level reading date:	1991-12-23
Feet below surface:	149.98	Feet to sea level:	Not Reported
Note:	Not Reported		
Level reading date:	1990-12-28	Feet below surface:	143.30
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1989-01-09	Feet below surface:	137.90
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1988-01-02	Feet below surface:	126.90
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1987-01-02	Feet below surface:	126.90
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-12-30	Feet below surface:	126.40
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-01-07	Feet below surface:	129.00
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1984-01-06	Feet below surface:	140.60
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1982-12-01	Feet below surface:	151.40
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1981-12-28	Feet below surface:	145.2
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-03-01	Feet below surface:	94.00
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-03	Feet below surface:	94.00
Feet to sea level:	Not Reported	Note:	Not Reported

AO304
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200203018**

Program:	55	Registry ID:	910874
Owner Name:	CITY OF TUCSON, TRANSPORTATION DEPT	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	30-JUN-09	Approved:	30-JUN-09
Installed Date:	07-JUL-09	Well Depth (ft):	110
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AO305
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200204843**

Program:	55	Registry ID:	912714
Owner Name:	CITY OF TUCSON DEPT. OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	16-NOV-10
Approved:	16-NOV-10	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AO306
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200101522**

Program:	55	Registry ID:	567586
Owner Name:	UNION PACIFIC RAILROAD COMPANY	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	10-MAR-98	Approved:	30-MAR-98
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AO307
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200199488**

Program:	55	Registry ID:	908529
Owner Name:	UNION PACIFIC RAILROAD	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	17-FEB-08	Approved:	17-FEB-08
Installed Date:	10-MAR-08	Well Depth (ft):	126
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AO308
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200199487**

Program:	55	Registry ID:	908528
Owner Name:	UNION PACIFIC RAILROAD COMPANY	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	161
Application:	17-FEB-08	Approved:	17-FEB-08
Installed Date:	06-MAR-08	Well Depth (ft):	133
Casing Type:	Not Reported	Water Level (ft):	130
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AM309
NNE
1/2 - 1 Mile
Lower

FED USGS **USGS40000037102**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-14 19BDD2	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	194811
Well Depth:	557	Well Depth Units:	ft
Well Hole Depth:	557	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	18	Level reading date:	1990-12-19
Feet below surface:	178.14	Feet to sea level:	Not Reported
Note:	Not Reported		

Level reading date:	1989-01-10	Feet below surface:	172.00
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1987-12-23	Feet below surface:	168.70
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1984-01-05	Feet below surface:	172.00
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1965-07-08	Feet below surface:	146.1
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1965-03-17	Feet below surface:	111.45
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1964-03-05	Feet below surface:	129.90
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-03-07	Feet below surface:	126.58
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-03-13	Feet below surface:	111.35
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1961-03	Feet below surface:	111.31
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1960-04-06	Feet below surface:	111.22
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1959-03-30	Feet below surface:	115.71
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1958-03-19	Feet below surface:	113.14
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1957-04-10	Feet below surface:	113.26
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-03-30	Feet below surface:	113.70
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1955-03-28	Feet below surface:	116.25
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-03-12	Feet below surface:	112.49
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1953-03-19	Feet below surface:	103.40
Feet to sea level:	Not Reported	Note:	Not Reported

310
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200080899**

Program:	55	Registry ID:	541776
Owner Name:	TUCSON, CITY OF,	Well Type:	ENV - MONITOR OR PIEZOMETER
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	09-DEC-93	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AP311
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200199358**

Program:	55	Registry ID:	906742
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	30-MAR-07	Approved:	30-MAR-07
Installed Date:	13-APR-07	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	83
AMA or INA:	TUCSON	Casing Depth (ft):	108
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP312
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200205461**

Program:	55	Registry ID:	902176
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	10-MAY-05	Approved:	10-MAY-05
Installed Date:	11-MAY-05	Well Depth (ft):	103
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	78	AMA or INA:	TUCSON
Casing Depth (ft):	100	Casing Diameter (in):	2
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	A	Well Cancelled:	Y
Driller Log:	X	Watershed:	SANTA CRUZ RIVER

AP313
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016626**

Program:	55	Registry ID:	215956
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	09-AUG-07	Well Depth (ft):	111
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP314
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016627**

Program:	55	Registry ID:	215957
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	14-AUG-07	Well Depth (ft):	412
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP315
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016628**

Program:	55	Registry ID:	215958
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	17-AUG-07	Well Depth (ft):	112
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP316
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200015989**

Program:	55	Registry ID:	214454
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	09-JAN-07	Approved:	12-JAN-07
Installed Date:	19-MAR-07	Well Depth (ft):	107
Casing Type:	PLASTIC OR PVC	Water Level (ft):	80

AMA or INA:	TUCSON	Casing Depth (ft):	105
Casing Diameter (in):	3	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP317
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200015990**

Program:	55	Registry ID:	214455
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	17-JAN-07	Approved:	18-JAN-07
Installed Date:	20-MAR-07	Well Depth (ft):	109
Casing Type:	PLASTIC OR PVC	Water Level (ft):	77
AMA or INA:	TUCSON	Casing Depth (ft):	108
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP318
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016625**

Program:	55	Registry ID:	215955
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	03-AUG-07	Well Depth (ft):	112
Casing Type:	PLASTIC OR PVC	Water Level (ft):	72
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP319
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016632**

Program:	55	Registry ID:	215962
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION

Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	08-AUG-07	Well Depth (ft):	111
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP320
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016818**

Program:	55	Registry ID:	215963
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	02-AUG-07	Well Depth (ft):	102
Casing Type:	PLASTIC OR PVC	Water Level (ft):	72
AMA or INA:	TUCSON	Casing Depth (ft):	97
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP321
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200017580**

Program:	55	Registry ID:	216187
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	23-JUL-07	Approved:	25-JUL-07
Installed Date:	22-AUG-07	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AP322
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016629**

Program:	55	Registry ID:	215959
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	21-AUG-07	Well Depth (ft):	111
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP323
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016630**

Program:	55	Registry ID:	215960
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	15-AUG-07	Well Depth (ft):	112
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP324
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200016631**

Program:	55	Registry ID:	215961
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SOIL VAPOR EXTRACTION / MONITORING
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	21-JUN-07	Approved:	25-JUN-07
Installed Date:	07-AUG-07	Well Depth (ft):	114
Casing Type:	PLASTIC OR PVC	Water Level (ft):	82
AMA or INA:	TUCSON	Casing Depth (ft):	107
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP325
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200205463**

Program:	55	Registry ID:	902178
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	10-MAY-05	Approved:	10-MAY-05
Installed Date:	13-MAY-05	Well Depth (ft):	93
Casing Type:	PLASTIC OR PVC	Water Level (ft):	57
AMA or INA:	TUCSON	Casing Depth (ft):	90
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP326
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200015988**

Program:	55	Registry ID:	214453
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)
Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	09-JAN-07	Approved:	12-JAN-07
Installed Date:	15-MAR-07	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	77
AMA or INA:	TUCSON	Casing Depth (ft):	105
Casing Diameter (in):	3	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP327
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200012261**

Program:	55	Registry ID:	210788
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	18-JAN-06	Approved:	19-JAN-06
Installed Date:	16-FEB-06	Well Depth (ft):	85
Casing Type:	PLASTIC OR PVC	Water Level (ft):	67

AMA or INA:	TUCSON	Casing Depth (ft):	85
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP328
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200012260**

Program:	55	Registry ID:	210787
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	18-JAN-06	Approved:	19-JAN-06
Installed Date:	14-FEB-06	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	67
AMA or INA:	TUCSON	Casing Depth (ft):	108
Casing Diameter (in):	5	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP329
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200205878**

Program:	55	Registry ID:	902181
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	78
Application:	10-MAY-05	Approved:	10-MAY-05
Installed Date:	18-MAY-05	Well Depth (ft):	93
Casing Type:	PLASTIC OR PVC	Water Level (ft):	61
AMA or INA:	TUCSON	Casing Depth (ft):	90
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AP330
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200205464**

Program:	55	Registry ID:	902179
Owner Name:	PHILLIPS 66 COMPANY	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING

Basin Name:	TUCSON AMA	Driller License #:	78
Application:	10-MAY-05	Approved:	10-MAY-05
Installed Date:	14-MAY-05	Well Depth (ft):	80
Casing Type:	PLASTIC OR PVC	Water Level (ft):	57
AMA or INA:	TUCSON	Casing Depth (ft):	80
Casing Diameter (in):	2	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AM331
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200193638**

Program:	55	Registry ID:	700426
Owner Name:	Not Reported	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	Not Reported
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	550
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	16	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AM332
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200153189**

Program:	55	Registry ID:	620198
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES, MONITORING
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	01-JAN-30	Well Depth (ft):	316
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	174	AMA or INA:	TUCSON
Casing Depth (ft):	316	Casing Diameter (in):	16
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

Map ID
Direction
Distance
Elevation | Database | EDR ID Number

AM333
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200153188**

Program:	55	Registry ID:	620197
Owner Name:	TUCSON, CITY OF,	Well Type:	NON-EXEMPT
Well Type Group:	NON-EXEMPT	Water Use:	MUNICIPAL USES, MONITORING
Basin Name:	TUCSON AMA	Driller License #:	0
Application:	09-JUN-82	Approved:	Not Reported
Installed Date:	01-NOV-48	Well Depth (ft):	557
Casing Type:	STEEL - PERFORATED OR SLOTTED CASING		
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	557	Casing Diameter (in):	16
RGR Pump Data:	NO	Pump Type:	NO PUMP CODE LISTED
Pump Power:	NO POWER CODE LISTED	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Not Reported
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

334
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200069830**

Program:	55	Registry ID:	529459
Owner Name:	V A MEDICAL CENTER,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	10-SEP-90	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	0
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AQ335
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200200567**

Program:	55	Registry ID:	912436
Owner Name:	CITY OF SOUTH TUCSON	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	498
Application:	16-AUG-10	Approved:	16-AUG-10
Installed Date:	Not Reported	Well Depth (ft):	65
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	63
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0

Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AQ336
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200112034**

Program:	55	Registry ID:	581826
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	20-JUN-00
Approved:	27-JUN-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AQ337
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200116857**

Program:	55	Registry ID:	581687
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	161	Application:	12-JUN-00
Approved:	27-JUN-00	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	N
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AQ338
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200193213**

Program:	55	Registry ID:	700374
Owner Name:	Not Reported	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	76
Casing Type:	Not Reported	Water Level (ft):	0

AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	6	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AQ339
NW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200099110**

Program:	55	Registry ID:	571454
Owner Name:	ARIZONA DEPARTMENT OF TRANSPORTATION		
Well Type:	SPCL - GEOTECHNICAL	Well Type Group:	OTHER
Water Use:	NO WATER USE	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	09-NOV-98
Approved:	08-JAN-99	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AM340
NNE
1/2 - 1 Mile
Lower

FED USGS **USGS40000037101**

Organization ID:	USGS-AZ	Organization Name:	USGS Arizona Water Science Center
Monitor Location:	D-14-14 19BDD1	Type:	Well
Description:	Not Reported	HUC:	15050301
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	1930
Well Depth:	316	Well Depth Units:	ft
Well Hole Depth:	316	Well Hole Depth Units:	ft

Ground water levels,Number of Measurements:	34	Level reading date:	1990-12-19
Feet below surface:	187.75	Feet to sea level:	Not Reported
Note:	Not Reported		
Level reading date:	1989-01-10	Feet below surface:	182.60
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1987-12-23	Feet below surface:	179.30
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-12-31	Feet below surface:	177.00
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1985-01-11	Feet below surface:	176.70

Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1984-01-05	Feet below surface:	176.50
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1982-12-01	Feet below surface:	177.80
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1981-12-29	Feet below surface:	174.7
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1979-03	Feet below surface:	170.35
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1978-03	Feet below surface:	169.15
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1977-03	Feet below surface:	172.10
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1976-03-30	Feet below surface:	169.25
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1975-02-18	Feet below surface:	167.75
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1974-01-16	Feet below surface:	177.85
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1973-01-24	Feet below surface:	173.82
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1972-02	Feet below surface:	170.35
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1971-03	Feet below surface:	167.60
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1969-02-25	Feet below surface:	166.20
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1968-03-20	Feet below surface:	162.60
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1965-03-15	Feet below surface:	112.43
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1964-03-05	Feet below surface:	131.96
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1963-03-07	Feet below surface:	128.06
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1962-03-13	Feet below surface:	122.96
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1959-03-30	Feet below surface:	108.87
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1958-03-19	Feet below surface:	108.70
Feet to sea level:	Not Reported	Note:	Not Reported

Level reading date:	1957-04-10	Feet below surface:	112.31
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1956-03-30	Feet below surface:	110.06
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1955-03-28	Feet below surface:	107.22
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1954-03-12	Feet below surface:	104.73
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1953-03-19	Feet below surface:	104.51
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1952-03-10	Feet below surface:	98.79
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1951-04-06	Feet below surface:	97.17
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1950-03-09	Feet below surface:	99.83
Feet to sea level:	Not Reported	Note:	Not Reported
Level reading date:	1949-06-03	Feet below surface:	100.75
Feet to sea level:	Not Reported	Note:	Not Reported

341
SSE
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200076247**

Program:	55	Registry ID:	535509
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JUN-92	Approved:	Not Reported
Installed Date:	17-JUN-92	Well Depth (ft):	185
Casing Type:	NO CASING CODE LISTED	Water Level (ft):	83
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AR342
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000049463**

DWR Number:	55-616497	DEQ Well #:	63237
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	WELL #2
well Depth:	Not Reported	Drill Depth:	300
Watershed:	Not Reported	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Used To Supply Household Needs Of Less Than Three Homes (Drinking, Cooking, Washing, Sanitary Purposes, Lawn Watering, Pet Care, One Classroom Schools, Turnpike Gates And Similar Purposes).		

Well Type: Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type

---

AR343
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDEQ3000049462**

DWR Number:	55-616496	DEQ Well #:	63236
Agency Well #:	Not Reported	Start Date:	Not Reported
End Date:	Not Reported	Station Alt Name:	WELL #1
well Depth:	Not Reported	Drill Depth:	300
Watershed:	Not Reported	Basin:	Tucson AMA
Aquifer Type:	Not Reported		
Water Use:	Water Used To Supply Household Needs Of Less Than Three Homes (Drinking, Cooking, Washing, Sanitary Purposes, Lawn Watering, Pet Care, One Classroom Schools, Turnpike Gates And Similar Purposes).		
Well Type:	Well, For Single Wells Other Than Wells Of The Collector Or Ranney Type		

344
WNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200116725**

Program:	55	Registry ID:	586591
Owner Name:	MICHAEL KATCHER C/O ENGINEER ENVIRONMENTAL CONSULTANT		
Well Type:	ENV - MONITOR	Well Type Group:	MONITOR
Water Use:	TEST, MONITORING	Basin Name:	TUCSON AMA
Driller License #:	498	Application:	16-APR-01
Approved:	27-APR-01	Installed Date:	Not Reported
Well Depth (ft):	0	Casing Type:	Not Reported
Water Level (ft):	0	AMA or INA:	TUCSON
Casing Depth (ft):	0	Casing Diameter (in):	0
RGR Pump Data:	NO	Pump Type:	Not Reported
Pump Power:	Not Reported	Pump Rate:	0
Tested Rate:	0	Draw Down:	0
Completion:	Not Reported	Well Cancelled:	Y
Driller Log:	Not Reported	Watershed:	SANTA CRUZ RIVER

AR345
NNW
1/2 - 1 Mile
Lower

AQUIFLOW **49569**

Site ID:	008837
Groundwater Flow:	NW
Shallowest Water Table Depth:	40
Deepest Water Table Depth:	145
Average Water Table Depth:	Not Reported
Date:	02/20/1997

346
SSW
1/2 - 1 Mile
Higher

AZ WELLS **AZDWR1200076249**

Program:	55	Registry ID:	535511
Owner Name:	TUCSON, CITY OF,	Well Type:	SPCL - EXPLORATION
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	473
Application:	03-JUN-92	Approved:	Not Reported
Installed Date:	20-AUG-92	Well Depth (ft):	190

Casing Type:	NO CASING CODE LISTED	Water Level (ft):	84
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	0	RGR Pump Data:	NO
Pump Type:	NO PUMP CODE LISTED	Pump Power:	NO POWER CODE LISTED
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	N
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

347
NNE
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200193203**

Program:	55	Registry ID:	700364
Owner Name:	Not Reported	Well Type:	EXEMPT
Well Type Group:	EXEMPT	Water Use:	DOMESTIC
Basin Name:	TUCSON AMA	Driller License #:	Not Reported
Application:	22-MAR-04	Approved:	Not Reported
Installed Date:	Not Reported	Well Depth (ft):	260
Casing Type:	Not Reported	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	16	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	Not Reported
Watershed:	SANTA CRUZ RIVER		

AR348
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200214488**

Program:	55	Registry ID:	921891
Owner Name:	ADEQ	Well Type:	SPCL - GEOTECHNICAL
Well Type Group:	OTHER	Water Use:	NO WATER USE
Basin Name:	TUCSON AMA	Driller License #:	855
Application:	10-JUL-18	Approved:	10-JUL-18
Installed Date:	18-JUL-18	Well Depth (ft):	110
Casing Type:	Not Reported	Water Level (ft):	87
AMA or INA:	TUCSON	Casing Depth (ft):	0
Casing Diameter (in):	8	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	A
Well Cancelled:	Y	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AR349
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200212794**

Program:	55	Registry ID:	922223
Owner Name:	ADEQ (ATTN: NATALIE ROMANOFF)	Well Type:	ENV - SPARGING (AIR, OZONE, AS/SVE)

Well Type Group:	OTHER	Water Use:	REMEDIATION
Basin Name:	TUCSON AMA	Driller License #:	855
Application:	12-OCT-18	Approved:	12-OCT-18
Installed Date:	Not Reported	Well Depth (ft):	110
Casing Type:	PLASTIC OR PVC	Water Level (ft):	87
AMA or INA:	TUCSON	Casing Depth (ft):	110
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AR350
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200216234**

Program:	55	Registry ID:	922010
Owner Name:	ADEQ (ATTN: NATALIE ROMANOFF)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	855
Application:	10-AUG-18	Approved:	10-AUG-18
Installed Date:	10-JUL-18	Well Depth (ft):	87
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	85
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

AR351
NNW
1/2 - 1 Mile
Lower

AZ WELLS **AZDWR1200216233**

Program:	55	Registry ID:	922009
Owner Name:	ADEQ (ATTN: NATALIE ROMANOFF)	Well Type:	ENV - MONITOR
Well Type Group:	MONITOR	Water Use:	MONITORING
Basin Name:	TUCSON AMA	Driller License #:	855
Application:	10-AUG-18	Approved:	10-AUG-18
Installed Date:	06-JUL-18	Well Depth (ft):	45
Casing Type:	PLASTIC OR PVC	Water Level (ft):	0
AMA or INA:	TUCSON	Casing Depth (ft):	45
Casing Diameter (in):	4	RGR Pump Data:	NO
Pump Type:	Not Reported	Pump Power:	Not Reported
Pump Rate:	0	Tested Rate:	0
Draw Down:	0	Completion:	Not Reported
Well Cancelled:	Not Reported	Driller Log:	X
Watershed:	SANTA CRUZ RIVER		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID Direction Distance Elevation			Database	EDR ID Number
1G **NNW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	008837 NW 40 145 Not Reported 02/20/1997	**AQUIFLOW**	**49569**
2G **WNW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	008100 N Not Reported Not Reported 100 f 05/1993	**AQUIFLOW**	**49669**
3G **WNW** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	009043 SW 40 ft 75 ft Not Reported 06/09/1997	**AQUIFLOW**	**49681**
4G **WNW** **1/4 - 1/2 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	007077 Not Reported Not Reported Not Reported 89 ft 03/09/1995	**AQUIFLOW**	**49572**
5G **WNW** **1/4 - 1/2 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	007039 NW Not Reported Not Reported 124ft 02/09/1990	**AQUIFLOW**	**49591**
6G **SSE** **1/2 - 1 Mile** **Lower**	Site ID: Groundwater Flow: Shallowest Water Table Depth: Deepest Water Table Depth: Average Water Table Depth: Date:	006244 Not Reported Not Reported Not Reported 200ft 09/30/1988	**AQUIFLOW**	**49620**

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS
RADON

AREA RADON INFORMATION

State Database: AZ Radon

Radon Test Results (pCi/L)

Zip	City	Result (pCi/L)
85713	TUCSON	< 0.50
85713	TUCSON	= 0.20
85713	TUCSON	= 0.40
85713	TUCSON	= 0.70
85713	TUCSON	= 0.80
85713	TUCSON	= 0.90
85713	TUCSON	= 1.00
85713	TUCSON	= 1.10
85713	TUCSON	= 1.30
85713	TUCSON	= 1.40
85713	TUCSON	= 1.50
85713	TUCSON	= 2.00
85713	TUCSON	= 2.30
85713	TUCSON	= 2.70

Federal EPA Radon Zone for PIMA County: 2

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 85713

Number of sites tested: 11

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	1.255 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)
Source: United States Geologic Survey
EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.
Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Riparian Vegetation Associated with Perennial Waters
Source: State Land Department
Telephone: 602-542-4094

HYDROGEOLOGIC INFORMATION

AQUIFLOW^{R} Information System
Source: EDR proprietary database of groundwater flow information
EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit
Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database
Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)
Telephone: 800-672-5559
SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data
Source: EPA/Office of Drinking Water
Telephone: 202-564-3750
Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)
This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Arizona Well Registration Database
Source: Department of Water Resources
Telephone: 602-771-8535
The Wells database contains all wells registered in the state.

Water Well Information
Agency: Department of Environmental Quality
Telephone: 602-771-2300

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database
Source: Arizona Geological Survey
Telephone: 520-770-3500
This database contains Oil and Gas wells in the State of Arizona. Includes all wells that have been permitted by the State Oil and Gas Conservation Commission (OGCC). Gas wells include natural gas, helium, and carbon dioxide wells.

RADON

State Database: AZ Radon
Source: Arizona Radiation Regulatory Agency
Telephone: 602-255-4845
State Indoor Radon Survey

Area Radon Information
Source: USGS
Telephone: 703-356-4020
The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones
Source: EPA
Telephone: 703-356-4020
Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Detailed Facility Report

Facility Summary

ADVANCED CERAMICS RESEARCH

841 E 47TH ST, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002604325

EPA Region: 09

Latitude: 32.1803

Longitude: -110.9574

Locational Data Source: FRS

Industries: Electrical Equipment, Appliance, and Component Manufacturing

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZR000006791)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002604325					N	32.1803	-110.9574
RCRAInfo	RCRA	AZR000006791	Other	Inactive ( )			N	32.180688	-110.957796

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002604325	ADVANCED CERAMICS RESEARCH	841 E 47TH ST, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZR000006791	ADVANCED CERAMICS RESEARCH	841 E 47TH ST, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZR000006791	335999	All Other Miscellaneous Electrical Equipment and Component Manufacturing
RCRAInfo	AZR000006791	54171	Research and Development in the Physical, Engineering, and Life Sciences

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZR000006791	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZR000006791)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	7,179
Population Density	2,300/sq.mi.
Housing Units in Area	3,007
Percent People of Color	91%
Households in Area	2,636
Households on Public Assistance	39
Persons With Low Income	3,654
Percent With Low Income	51%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.1803
Center Longitude	-110.9574
Total Area	--
Land Area	100%
Water Area	0%

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	441 (6%)
Minors 17 years and younger	1,575 (22%)
Adults 18 years and older	5,604 (78%)
Seniors 65 years and older	1,194 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,780 (39%)
African-American	87 (1%)
Hispanic-Origin	6,020 (84%)
Asian	72 (1%)
Hawaiian/Pacific Islander	22 (0%)
American Indian	586 (8%)
Other/Multiracial	2,044 (28%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	760 (16.72%)
9th through 12th Grade	651 (14.32%)
High School Diploma	1,425 (31.35%)

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	602 (22.85%)
$15,000 - $25,000	293 (11.12%)
$25,000 - $50,000	571 (21.67%)
$50,000 - $75,000	528 (20.04%)
Greater than $75,000	641 (24.33%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Some College/2-year	981 (21.58%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	378 (8.32%)

Detailed Facility Report

Facility Summary

ARCO NO 5904

3601 S PARK AVE, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002599082

EPA Region: 09

Latitude: 32.18047

Longitude: -110.95612

Locational Data Source: FRS

Industries: Gasoline Stations

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZR000000554)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002599082					N	32.18047	-110.95612
RCRAInfo	RCRA	AZR000000554	Other	Inactive ( )			N		

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002599082	ARCO NO 5904	3601 S PARK AVE, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZR000000554	ARCO NO 5904	3601 S PARK AVE, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZR000000554	4471	Gasoline Stations

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZR000000554	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZR000000554)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	6,682
Population Density	2,141/sq.mi.
Housing Units in Area	2,777
Percent People of Color	91%
Households in Area	2,443
Households on Public Assistance	37
Persons With Low Income	3,347
Percent With Low Income	51%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18047
Center Longitude	-110.95612
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	559 (22.89%)
$15,000 - $25,000	262 (10.73%)
$25,000 - $50,000	515 (21.09%)
$50,000 - $75,000	486 (19.9%)
Greater than $75,000	620 (25.39%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	401 (6%)
Minors 17 years and younger	1,452 (22%)
Adults 18 years and older	5,229 (78%)
Seniors 65 years and older	1,108 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,600 (39%)
African-American	89 (1%)
Hispanic-Origin	5,586 (84%)
Asian	66 (1%)
Hawaiian/Pacific Islander	23 (0%)
American Indian	527 (8%)
Other/Multiracial	1,891 (28%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	711 (16.79%)
9th through 12th Grade	615 (14.52%)
High School Diploma	1,317 (31.1%)
Some College/2-year	893 (21.09%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	362 (8.55%)

Detailed Facility Report

Facility Summary

ATL TUCSON FACILITY

820 E 47TH ST STE B1, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110003410924

EPA Region: 09

Latitude: 32.17995

Longitude: -110.95787

Locational Data Source: FRS

Industries: Professional, Scientific, and Technical Services

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Active VSQG, (AZ0000450098)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110003410924					N	32.17995	-110.95787
RCRAInfo	RCRA	AZ0000450098	VSQG	Active (H)			N	32.17998	-110.957783

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110003410924	ATL TUCSON FACILITY	820 E 47TH ST STE B1, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZ0000450098	ATL TUCSON FACILITY	820 E 47TH ST, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZ0000450098	54133	Engineering Services
RCRAInfo	AZ0000450098	54138	Testing Laboratories and Services

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZ0000450098	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type	QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZ0000450098)		07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation / Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	7,445
Population Density	2,385/sq.mi.
Housing Units in Area	3,118
Percent People of Color	91%
Households in Area	2,739
Households on Public Assistance	40
Persons With Low Income	3,818
Percent With Low Income	52%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.17995
Center Longitude	-110.95787
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	621 (22.71%)
$15,000 - $25,000	307 (11.22%)
$25,000 - $50,000	605 (22.12%)
$50,000 - $75,000	550 (20.11%)
Greater than $75,000	652 (23.84%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	462 (6%)
Minors 17 years and younger	1,649 (22%)
Adults 18 years and older	5,799 (78%)
Seniors 65 years and older	1,236 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,891 (39%)
African-American	85 (1%)
Hispanic-Origin	6,264 (84%)
Asian	75 (1%)
Hawaiian/Pacific Islander	21 (0%)
American Indian	605 (8%)
Other/Multiracial	2,102 (28%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	786 (16.69%)
9th through 12th Grade	675 (14.33%)
High School Diploma	1,484 (31.51%)
Some College/2-year	1,030 (21.87%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	388 (8.24%)

Detailed Facility Report

Facility Summary

BEAUDRY RV SERVICE AND DEL RV3

2626 S 4TH AVE, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002570780

EPA Region: 09

Latitude: 32.19194

Longitude: -110.9653

Locational Data Source: FRS

Industries: Motor Vehicle and Parts Dealers

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	10/02/1996
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZD982045403), Inactive Other, (AZD981414907)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002570780					N	32.19194	-110.9653
RCRAInfo	RCRA	AZD982045403	Other	Inactive ( )			N		
RCRAInfo	RCRA	AZD981414907	Other	Inactive ( )			N		

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002570780	BEAUDRY RV SERVICE AND DEL RV3	2626 S 4TH AVE, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZD982045403	BEAUDRY RV SERVICE AND DEL RV3	2626 S 4TH AVE, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZD981414907	BEAUDRY RV SERVICE & DEL RV3	2626 S 4TH AVE, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZD982045403	44111	New Car Dealers
RCRAInfo	AZD982045403	811111	General Automotive Repair
RCRAInfo	AZD982045403	811198	All Other Automotive Repair and Maintenance

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	5

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZD982045403	No	06/07/2025	0	06/06/2025
RCRA	AZD981414907	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZD981414907)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											
RCRA (Source ID: AZD982045403)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	9,552
Population Density	3,060/sq.mi.
Housing Units in Area	4,135
Percent People of Color	88%
Households in Area	3,503
Households on Public Assistance	83
Persons With Low Income	5,419
Percent With Low Income	57%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.19194
Center Longitude	-110.9653
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	873 (24.93%)
$15,000 - $25,000	520 (14.85%)
$25,000 - $50,000	709 (20.25%)
$50,000 - $75,000	574 (16.39%)
Greater than $75,000	826 (23.59%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	345 (4%)
Minors 17 years and younger	2,167 (23%)
Adults 18 years and older	7,384 (77%)
Seniors 65 years and older	1,590 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	4,092 (43%)
African-American	256 (3%)
Hispanic-Origin	7,108 (74%)
Asian	146 (2%)
Hawaiian/Pacific Islander	19 (0%)
American Indian	1,170 (12%)
Other/Multiracial	2,080 (22%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	1,022 (16.65%)
9th through 12th Grade	857 (13.96%)
High School Diploma	1,937 (31.56%)
Some College/2-year	1,217 (19.83%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	704 (11.47%)

Detailed Facility Report

Facility Summary

BUSY D PUMPING INC

1500 E 36TH ST, TUCSON, AZ 85716

FRS (Facility Registry Service) ID: 110070571642

EPA Region: 09

Latitude: 32.19239

Longitude: -110.95245

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZS000030478)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110070571642					N	32.19239	-110.95245
RCRAInfo	RCRA	AZS000030478	Other	Inactive ( )			N		

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110070571642	BUSY D PUMPING INC	1500 E 36TH ST, TUCSON, AZ 85716	Pima County
RCRAInfo	RCRA	AZS000030478	BUSY D PUMPING INC	1500 E 36TH ST, TUCSON, AZ 85716	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	5

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZS000030478	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZS000030478)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	9,135
Population Density	2,927/sq.mi.
Housing Units in Area	3,526
Percent People of Color	90%
Households in Area	3,136
Households on Public Assistance	60
Persons With Low Income	5,256
Percent With Low Income	58%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.19239
Center Longitude	-110.95245
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	622 (19.85%)
$15,000 - $25,000	389 (12.41%)
$25,000 - $50,000	591 (18.86%)
$50,000 - $75,000	612 (19.53%)
Greater than $75,000	920 (29.36%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	454 (5%)
Minors 17 years and younger	2,516 (28%)
Adults 18 years and older	6,622 (72%)
Seniors 65 years and older	1,118 (12%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	3,847 (42%)
African-American	435 (5%)
Hispanic-Origin	7,134 (78%)
Asian	326 (4%)
Hawaiian/Pacific Islander	28 (0%)
American Indian	523 (6%)
Other/Multiracial	1,961 (21%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	833 (15.61%)
9th through 12th Grade	561 (10.51%)
High School Diploma	1,742 (32.63%)
Some College/2-year	1,099 (20.59%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	745 (13.96%)

Detailed Facility Report

Facility Summary

CHEVRON #9-0965

3002 S 6TH AVE, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110003409400

EPA Region: 09

Latitude: 32.18839

Longitude: -110.96836

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZ0000012005)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110003409400					N	32.18839	-110.96836
RCRAInfo	RCRA	AZ0000012005	Other	Inactive ( )			N	32.188485	-110.968696

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110003409400	CHEVRON #9-0965	3002 S 6TH AVE, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZ0000012005	CHEVRON #9-0965	3002 S 6TH AVE, TUCSON, AZ 85713-4707	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	7
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZ0000012005	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZ0000012005)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	9,627
Population Density	3,084/sq.mi.
Housing Units in Area	4,194
Percent People of Color	90%
Households in Area	3,549
Households on Public Assistance	84
Persons With Low Income	5,357
Percent With Low Income	56%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18839
Center Longitude	-110.96836
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	879 (24.77%)
$15,000 - $25,000	539 (15.19%)
$25,000 - $50,000	759 (21.39%)
$50,000 - $75,000	609 (17.16%)
Greater than $75,000	763 (21.5%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	411 (4%)
Minors 17 years and younger	2,200 (23%)
Adults 18 years and older	7,427 (77%)
Seniors 65 years and older	1,681 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	3,930 (41%)
African-American	219 (2%)
Hispanic-Origin	7,523 (78%)
Asian	72 (1%)
Hawaiian/Pacific Islander	15 (0%)
American Indian	1,195 (12%)
Other/Multiracial	2,265 (24%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	1,047 (16.84%)
9th through 12th Grade	935 (15.04%)
High School Diploma	2,034 (32.72%)
Some College/2-year	1,259 (20.25%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	540 (8.69%)

An official website of the United States government

Property Details for Greyhound Site

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**255537**
Property Address	**2601 South 3rd Avenue TUCSON, AZ 85713**
Size	**16.7**
Parcel Numbers	
Latitude/Longitude	**32.19170581185804 / -110.96272254873193**
Congressional District	**7**
Property Contact	**Stollman, Scott** **Stollman.Scott@epa.gov** **415-972-3729**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF98T07001	AZ	Assessment	2020

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment		05/05/2022	05/26/2022	City of South Tucson	N	
Phase I Environmental Assessment		05/05/2022	05/26/2022	City of South Tucson	N	
Phase II Environmental Assessment	$17,312.24	03/10/2023	09/08/2023	City of South Tucson	Y	FY24
Phase II Environmental Assessment	$35,904.00	06/19/2023	01/08/2024	City of South Tucson		FY24

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Supplemental Assessment		03/13/2024	04/12/2024	City of South Tucson		

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$53,216.24**
Leveraged Funding: **$5,800.00**
Total Funding: **$59,016.24**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

Selected Strategy(ies)	Explanatory Text
Evaluate Reuse options that consider impacts from extreme weather events and natural disasters	Discussion of observed and forecasted natural hazard conditions and the associated site-specific risk are part of any reuse considerations. Both current and forecasted extreme weather events and natural disasters may impact the effectiveness of a remedial alternative.

Top of Pag

Contaminants and Media

Contaminant Found
Asbestos
Media Affected
Building Materials

Remediating Action for Contaminants
NOT Cleaned up
Remediating Action for Media
NOT Cleaned up

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:

Cleanup/Treatement Categories:

Addl Cleanup/Treatment info:

Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:
Actual Acreage of Greenspace Created:
Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation – Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The site is comprised of one parcel (Pima County Assessor's Parcel Number [APN] 119-01-0070), which cover approximately 10.10 acres. The site is developed with a dog-racing track (currently nonoperational) and associated structures. The reminder of the site is developed with asphalt-paved parking and access roads. The laboratory results of the soil samples submitted for analysis indicated the soil did not contain analytes concentrations above established ADEQ SRLs or Minimum GPLs. Some building materials were found to contain asbestos in concentrations greater than 1% and lead-based paint. ACM: The RBM Survey identified drywall materials as a result of laboratory analysis as containing ?1% asbestos. LBP: A summary of XRF readings are provided below: - Twenty building materials coated with LBP were identified within Building A Five building materials coated with LBP were identified within Area H. - Terracon did not identify any lead-based paints during the XRF screening of Buildings D, E, F, and G. - Painted surfaces were identified throughout the site during the XRF screening with <1.0 milligrams per centimeter squared (mg/cm2).**
Predominant Past Usage	**Commercial (10.1)**
What types of funding are being used on this property?	
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Detailed Facility Report

Facility Summary

INTERCHECKS INC

801 E 47TH ST, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002574866

EPA Region: 09

Latitude: 32.17975

Longitude: -110.95814

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZD981972987)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002574866					N	32.17975	-110.95814
RCRAInfo	RCRA	AZD981972987	Other	Inactive ( )			N	32.1799	-110.958856

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002574866	INTERCHECKS INC	801 E 47TH ST, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZD981972987	INTERCHECKS INC	801 E 47TH ST, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZD981972987	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZD981972987)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	7,597
Population Density	2,434/sq.mi.
Housing Units in Area	3,186
Percent People of Color	91%
Households in Area	2,799
Households on Public Assistance	41
Persons With Low Income	3,916
Percent With Low Income	52%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.17975
Center Longitude	-110.95814
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	632 (22.6%)
$15,000 - $25,000	316 (11.3%)
$25,000 - $50,000	626 (22.38%)
$50,000 - $75,000	562 (20.09%)
Greater than $75,000	661 (23.63%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	473 (6%)
Minors 17 years and younger	1,688 (22%)
Adults 18 years and older	5,908 (78%)
Seniors 65 years and older	1,259 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,957 (39%)
African-American	88 (1%)
Hispanic-Origin	6,404 (84%)
Asian	77 (1%)
Hawaiian/Pacific Islander	21 (0%)
American Indian	617 (8%)
Other/Multiracial	2,139 (28%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	799 (16.63%)
9th through 12th Grade	687 (14.29%)
High School Diploma	1,518 (31.59%)
Some College/2-year	1,055 (21.95%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	394 (8.2%)

Detailed Facility Report

Facility Summary

MERRY X RAY

740 E 46TH ST, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002592132

EPA Region: 09

Latitude: 32.18112

Longitude: -110.95902

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZD983473885)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002592132					N	32.18112	-110.95902
RCRAInfo	RCRA	AZD983473885	Other	Inactive ( )			N	32.180878	-110.958847

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002592132	MERRY X RAY	740 E 46TH ST, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZD983473885	MERRY X RAY	740 E 46TH ST, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZD983473885	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZD983473885)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	7,740
Population Density	2,480/sq.mi.
Housing Units in Area	3,291
Percent People of Color	91%
Households in Area	2,869
Households on Public Assistance	47
Persons With Low Income	3,998
Percent With Low Income	52%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18112
Center Longitude	-110.95902
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	673 (23.45%)
$15,000 - $25,000	338 (11.78%)
$25,000 - $50,000	627 (21.85%)
$50,000 - $75,000	562 (19.58%)
Greater than $75,000	670 (23.34%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	472 (6%)
Minors 17 years and younger	1,701 (22%)
Adults 18 years and older	6,040 (78%)
Seniors 65 years and older	1,306 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,950 (38%)
African-American	91 (1%)
Hispanic-Origin	6,457 (83%)
Asian	82 (1%)
Hawaiian/Pacific Islander	23 (0%)
American Indian	686 (9%)
Other/Multiracial	2,213 (29%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	825 (16.83%)
9th through 12th Grade	695 (14.18%)
High School Diploma	1,544 (31.5%)
Some College/2-year	1,072 (21.87%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	407 (8.3%)

Detailed Facility Report

Facility Summary

PAYLESS CASHWAYS

2901 S 4TH AVE, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110002595950

EPA Region: 09

Latitude: 32.18901

Longitude: -110.96528

Locational Data Source: FRS

Industries: Building Material and Garden Equipment and Supplies Dealers

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZD983481342)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110002595950					N	32.18901	-110.96528
RCRAInfo	RCRA	AZD983481342	Other	Inactive ( )			N	32.189028	-110.964439

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110002595950	PAYLESS CASHWAYS	2901 S 4TH AVE, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZD983481342	PAYLESS CASHWAYS INC 136	2901 S 4TH AVE, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZD983481342	44411	Home Centers

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZD983481342	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZD983481342)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	9,568
Population Density	3,065/sq.mi.
Housing Units in Area	4,181
Percent People of Color	90%
Households in Area	3,531
Households on Public Assistance	79
Persons With Low Income	5,377
Percent With Low Income	57%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18901
Center Longitude	-110.96528
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	910 (25.77%)
$15,000 - $25,000	532 (15.07%)
$25,000 - $50,000	718 (20.33%)
$50,000 - $75,000	597 (16.91%)
Greater than $75,000	774 (21.92%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	386 (4%)
Minors 17 years and younger	2,207 (23%)
Adults 18 years and older	7,360 (77%)
Seniors 65 years and older	1,654 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	3,924 (41%)
African-American	235 (2%)
Hispanic-Origin	7,422 (78%)
Asian	96 (1%)
Hawaiian/Pacific Islander	20 (0%)
American Indian	1,120 (12%)
Other/Multiracial	2,274 (24%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	1,030 (16.79%)
9th through 12th Grade	889 (14.49%)
High School Diploma	2,011 (32.77%)
Some College/2-year	1,240 (20.21%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	558 (9.09%)

An official website of the United States government

Property Details for Spanish Trails East

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**238600**
Property Address	**425 East Benson Highway TUCSON, AZ 85713**
Size	**7.81**
Parcel Numbers	**119-01-038B**
Latitude/Longitude	**32.187193 / -110.962466**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment ✗
Clean Up ✗
Institutional Controls in Place ✗
Engineering Controls in Place ✗
Ready for Anticipated Use ✓
Redevelopment Underway ✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T61301	AZ	Assessment	2017

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$5,550.00	06/28/2018	09/24/2018	City of South Tucson	Y	FY19

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$5,550.00**
Leveraged Funding:
Total Funding: **$5,550.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights **Former Use: The Site consisted of approximately 7.81 acres of land and was located at 425 East Benson Highway. A majority of the Site consisted of vacant desert land with natural vegetation. An unpaved road w present on the northern and eastern portions of the Site. The Phase I ESA did not identify any RECs in connection with the Site.**

Predominant Past Usage	
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Detailed Facility Report

Facility Summary

TUCSON IRON AND METAL

690 E 36TH ST, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110057131287

EPA Region: 09

Latitude: 32.19242

Longitude: -110.96085

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

Statute	CWA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): Non-Major, Permit Expired (AZMS80626), Non-Major, Permit Effective (AZI108850)

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZS000048090)

Safe Drinking Water Act (SDWA): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details
Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110057131287					N	32.19242	-110.96085
ICIS-NPDES	CWA	AZMS80626	Non-Major: General Permit Covered Facility	Expired		12/30/2024	N	32.19184	-110.96098
ICIS-NPDES	CWA	AZI108850	Non-Major: General Permit Covered Facility	Effective		01/15/2030	N	32.19184	-110.96098
RCRAInfo	RCRA	AZS000048090	Other	Inactive ( )			N	32.191166	-110.960836

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110057131287	TUCSON IRON AND METAL	690 E 36TH ST, TUCSON, AZ 85713	Pima County
ICIS-NPDES	CWA	AZMS80626	TUCSON IRON & METAL	690 E 36TH ST, TUCSON, AZ 85713	Pima County
ICIS-NPDES	CWA	AZI108850	TUCSON IRON & METAL	690 E 36TH ST, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZS000048090	TUCSON IRON AND METAL	690 E 36TH ST, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Industrial Effluent Guidelines

Identifier	Effluent Guideline (40 CFR Part)	Effluent Guideline Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	5

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
CWA	AZMS80626	No	12/31/2024	0	06/06/2025
CWA	AZI108850	No	12/31/2024	0	06/06/2025
RCRA	AZS000048090	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type	QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
CWA (Source ID: AZMS80626)		01/01-03/31/22	04/01-06/30/22	07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24
	Facility-Level Status	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Quarterly Noncompliance Report History											

Statute	Program/Pollutant/Violation Type	QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
CWA (Source ID: AZI108850)		01/01-03/31/22	04/01-06/30/22	07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24
	Facility-Level Status	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Quarterly Noncompliance Report History											

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZS000048090)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?
150503010906	Arroyo Chico-Santa Cruz River	--	No	No	--	Yes

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

CWA (Clean Water Act) Discharge Monitoring Report (DMR)

DMR and TRI Multi-Year Loading Report

Pollutant Loadings

NPDES ID	Description
No data records returned	

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	9,093
Population Density	2,913/sq.mi.
Housing Units in Area	3,784
Percent People of Color	88%
Households in Area	3,236
Households on Public Assistance	69
Persons With Low Income	5,185
Percent With Low Income	58%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.19242
Center Longitude	-110.96085
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	802 (24.79%)
$15,000 - $25,000	443 (13.69%)
$25,000 - $50,000	632 (19.54%)
$50,000 - $75,000	529 (16.35%)
Greater than $75,000	829 (25.63%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	357 (4%)
Minors 17 years and younger	2,112 (23%)
Adults 18 years and older	6,984 (77%)
Seniors 65 years and older	1,349 (15%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	3,925 (43%)
African-American	269 (3%)
Hispanic-Origin	6,679 (73%)
Asian	243 (3%)
Hawaiian/Pacific Islander	24 (0%)
American Indian	1,008 (11%)
Other/Multiracial	1,892 (21%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	927 (16.35%)
9th through 12th Grade	759 (13.39%)
High School Diploma	1,758 (31.01%)
Some College/2-year	1,094 (19.3%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	747 (13.18%)

Detailed Facility Report

Facility Summary

WALMART SUPERCENTER #5626

1260 E TUCSON MARKETPLACE BLVD, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110054109326

EPA Region: 09

Latitude: 32.18721

Longitude: -110.95375

Locational Data Source: FRS

Industries: General Merchandise Retailers

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	1
Date of Last Compliance Monitoring Activity	10/12/2022
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Active VSQG, (AZR000512491)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110054109326					N	32.18721	-110.95375
RCRAInfo	RCRA	AZR000512491	VSQG	Active (H)			N	32.185887	-110.953163

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110054109326	WALMART SUPERCENTER #5626	1260 E TUCSON MARKETPLACE BLVD, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZR000512491	WALMART SUPERCENTER #5626	1260 E TUCSON MARKETPLACE BLVD, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZR000512491	455211	Warehouse Clubs and Supercenters

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	5

Enforcement and Compliance

RCRA (Hazardous Waste (Resource Conservation and Recovery Act) Compliance Pipeline (Compliance Monitoring → Violations → Enforcement Actions) (10 Years)

This table shows how violations relate to compliance monitoring (CM) activities and enforcement. Currently available for CAA and RCRA only. Full CM history available below.

No data records returned

There are no relationships to display in the RCRA Compliance Pipeline table for this facility. Scroll down to view compliance monitoring history.

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)
RCRA	AZR000512491	RCRAInfo		Compliance Evaluation Inspection	State	10/12/2022	No Violations Or Compliance Issues Were Found

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZR000512491	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type		QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZR000512491)			07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status		No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation	Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date
RCRA	*RCRAInfo*	*AZR000512491*	*INSPECTION REPORT SENT NO VIOL NO RESPONSE*	*State*	*10/21/2022*

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

e-Manifest Hazardous Waste History (Public)

Hazardous Waste Shipped in Kilograms by Year (Through 3/8/2025)

Source ID	Waste Description	2022	2023	2024	2025
AZR000512491	Hazardous Waste	626 - 630	730 - 739	362 - 367	84 - 85
AZR000512491	Acute Hazardous Waste	0 - 5	0 - 5	0 - 2	0
AZR000512491	Pharmaceutical Hazardous Waste	0 - 4	0 - 9	4 - 9	0 - 1

“Pharmaceutical Hazardous Waste” refers to quantities managed under 40 CFR part 266 subpart P and thus excluded from the Hazardous and Acute Hazardous Waste quantities shown above.

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA’s spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	7,361
Population Density	2,358/sq.mi.
Housing Units in Area	2,907
Percent People of Color	91%
Households in Area	2,568

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	391 (5%)
Minors 17 years and younger	1,791 (24%)
Adults 18 years and older	5,570 (76%)
Seniors 65 years and older	1,029 (14%)

General Statistics (ACS (American Community Survey))	
Households on Public Assistance	46
Persons With Low Income	3,943
Percent With Low Income	54%
Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18721
Center Longitude	-110.95375
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	572 (22.28%)
$15,000 - $25,000	291 (11.34%)
$25,000 - $50,000	470 (18.31%)
$50,000 - $75,000	490 (19.09%)
Greater than $75,000	744 (28.98%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,909 (40%)
African-American	245 (3%)
Hispanic-Origin	5,853 (80%)
Asian	201 (3%)
Hawaiian/Pacific Islander	28 (0%)
American Indian	545 (7%)
Other/Multiracial	1,804 (25%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	762 (17.1%)
9th through 12th Grade	558 (12.52%)
High School Diploma	1,404 (31.51%)
Some College/2-year	862 (19.34%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	518 (11.62%)

Detailed Facility Report

Facility Summary

WHITE CAP CONSTRUCTION SUPPLY #HDWC0705

3680 S PARK AVE STE B, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110031340181

EPA Region: 09

Latitude: 32.18084

Longitude: -110.95634

Locational Data Source: FRS

Industries: Building Material and Garden Equipment and Supplies Dealers

Indian Country: N

Enforcement and Compliance Summary

Statute	RCRA
Compliance Monitoring Activities (5 years)	--
Date of Last Compliance Monitoring Activity	--
Compliance Status	No Violation Identified
Qtrs in Noncompliance (of 12)	0
Qtrs with Significant Violation	0
Informal Enforcement Actions (5 years)	--
Formal Enforcement Actions (5 years)	--
Penalties from Formal Enforcement Actions (5 years)	--
EPA Cases (5 years)	--
Penalties from EPA Cases (5 years)	--

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): Inactive Other, (AZR000503342)

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110031340181					N	32.18084	-110.95634
RCRAInfo	RCRA	AZR000503342	Other	Inactive ( )			N		

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110031340181	WHITE CAP CONSTRUCTION SUPPLY #HDWC0705	3680 S PARK AVE STE B, TUCSON, AZ 85713	Pima County
RCRAInfo	RCRA	AZR000503342	WHITE CAP CONSTRUCTION SUPPLY #HDWC0705	3680 S PARK AVE STE B, TUCSON, AZ 85713-5041	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description
RCRAInfo	AZR000503342	44419	Other Building Material Dealers

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	8
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>.

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed
RCRA	AZR000503342	No	06/07/2025	0	06/06/2025

Three-Year Compliance History by Quarter

Statute	Program/Pollutant/Violation Type	QTR 1	QTR 2	QTR 3	QTR 4	QTR 5	QTR 6	QTR 7	QTR 8	QTR 9	QTR 10	QTR 11
RCRA (Source ID: AZR000503342)		07/01-09/30/22	10/01-12/31/22	01/01-03/31/23	04/01-06/30/23	07/01-09/30/23	10/01-12/31/23	01/01-03/31/24	04/01-06/30/24	07/01-09/30/24	10/01-12/31/24	01/01-03/31/25
	Facility-Level Status	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified	No Violation Identified
	Violation / Agency											

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

General Statistics (ACS (American Community Survey))	
Total Persons	6,681
Population Density	2,140/sq.mi.
Housing Units in Area	2,786
Percent People of Color	91%
Households in Area	2,441
Households on Public Assistance	36
Persons With Low Income	3,346
Percent With Low Income	51%

Geography	
Radius of Selected Area	1 mi.
Center Latitude	32.18084
Center Longitude	-110.95634
Total Area	--
Land Area	100%
Water Area	0%

Income Breakdown (ACS (American Community Survey)) - Households (%)	
Less than $15,000	565 (23.15%)
$15,000 - $25,000	265 (10.86%)
$25,000 - $50,000	506 (20.73%)
$50,000 - $75,000	488 (19.99%)
Greater than $75,000	617 (25.28%)

Age Breakdown (ACS (American Community Survey)) - Persons (%)	
Children 5 years and younger	400 (6%)
Minors 17 years and younger	1,444 (22%)
Adults 18 years and older	5,237 (78%)
Seniors 65 years and older	1,114 (17%)

Race Breakdown (ACS (American Community Survey)) - Persons (%)	
White	2,572 (38%)
African-American	90 (1%)
Hispanic-Origin	5,561 (83%)
Asian	68 (1%)
Hawaiian/Pacific Islander	23 (0%)
American Indian	544 (8%)
Other/Multiracial	1,909 (29%)

Education Level (Persons 25 & older) (ACS (American Community Survey)) - Persons (%)	
Less than 9th Grade	713 (16.83%)
9th through 12th Grade	614 (14.49%)
High School Diploma	1,313 (31%)
Some College/2-year	890 (21.01%)
B.S./B.A. (Bachelor of Science/Bachelor of Arts) or More	366 (8.64%)

An official website of the United States government

Property Details for Spanish Trail Task 3

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**228295**
Property Address	**425 East Benson Highway TUCSON, AZ 85713**
Size	**8.6**
Parcel Numbers	**119-01-038B**
Latitude/Longitude	**32.187193 / -110.962466**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T23201	AZ	Assessment	2014

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$4,200.00	03/17/2015	05/03/2015	City of South Tucson	Y	FY18

Is Cleanup Necessary? **Unknown**
EPA Assessment Funding: **$4,200.00**
Leveraged Funding:
Total Funding: **$4,200.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights **COST was not provided access to the Property or allowed to interview the occupants. Therefore, our observations were made from Google Maps. The Property was vacant being used as storage. A portion of th Property was enclosed by a chain-link fence. Some large waste receptacles were in the southwest corner of the Property. Multiple soil piles were present on the southeastern portion of the Property.**

	Former Use: COST was not provided access to the Property or allowed to interview the occupants. Therefore our observations were made from Google Maps. The Property was vacant being used as storage. A portion o the Property was enclosed by a chain-link fence. Some large waste receptacles were in the southwest corne of the Property. Multiple soil piles were present on the southeastern portion of the Property.
Predominant Past Usage	**Commercial (8.6)**
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

ERR H5

An official website of the United States government

Property Details for Centro Carismatico Carismatico

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**133001**
Property Address	**NWC 4th Avenue and Benson Highway South Tucson, AZ 85713**
Size	**4.04**
Parcel Numbers	**119-01-0260, -0270, -0280, -0320, -0330, and -0340**
Latitude/Longitude	**32.187836 / -110.965935**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment	☑
Clean Up	✗
Institutional Controls in Place	✗
Engineering Controls in Place	✗
Ready for Anticipated Use	✗
Redevelopment Underway	✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
South Tucson, City of	2B00T18701	AZ	Assessment	2009

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase II Environmental Assessment	$5,528.00	03/30/2011	05/11/2011	South Tucson, City of	Y	FY12

Is Cleanup Necessary? **No**

EPA Assessment Funding: **$5,528.00**
Leveraged Funding:
Total Funding: **$5,528.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**U**
Categories of Controls	
Additional Institutional Controls Information	
Address of Data Source (URL if available)	
Are Institutional Controls in Place	
Date Institutional Controls were put in place	
Indicate whether Engineering Controls are required	
Categories of Controls	
Additional Engineering controls information	
Address of Data Source (URL if available)	
Indicate whether Engineering Controls are in place	
Date Engineering Controls were put in place	

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The purpose of the Phase II ESA was to further investigate two recognized environmental conditions RECs a the site as documented in the Phase I ESA report. Subsequently, a Phase II field investigation on May 2, 201 The following information was obtained from the analytical report: • Sample SS-1, collected in the vicinity of the waste street sweepings revealed the following constituents at levels above the applicable analytical laboratory method detection limits MDLs but below the applicable State of Arizona non-residential or residential SRLs: - Anthracene, Acenaphtene, Benzoa anthracene, Benzobfluoranthene, Benzog,h,iperylene Benzokfluoranthene, Chrysene, Dibenza,hanthracene, Fluoranthene, Fluorene, Indeno1,2,3-cdpyrene, Phenanthrene, and Pyrene. - Arsenic, Barium, Chromium, Lead, and Silver. Benzoapyrene was present in SS 0.21 milligrams per kilogram mg/kg at a concentrations above the applicable State of Arizona residential SR for the 1x10-6 cancer risk of 0.069 mg/kg, but below the applicable State of Arizona non-residential SRL for the 1x10-5 cancer risk of 0.69 mg/kg. • Sample SS-2, collected in the vicinity of the waste street sweepings revealed the following constituents at levels above the applicable analytical laboratory MDLs but below the applicable State of Arizona non-residential or residential SRLs: - Arsenic, Barium, Chromium, and Lead. • Sample SS-3, collected in the vicinity of the construction and demolition debris revealed the following constituents at levels above the applicable analytical laboratory MDLs but below the applicable State of Arizona non-residential or residential SRLs: - Barium, Chromium, and Lead. • Sample SS-4, collected in the vicinity of the construction and demolition debris revealed the following constituents at levels above the applicable analytical laboratory MDLs but below the applicable State of Arizona non-residential or residenti SRLs: - Barium, Chromium, and Lead. A Supplemental Phase II ESA was to further investigate the horizontal concentration of semi-volatile organic compounds SVOCS, particularly Benzoapyrene in the vicinity of SS-1. The soil samples collected did not reveal the presence of SVOCs above the applicable analytical laboratory method detection limits MDLs. Based on the results of the Supplemental Phase II ESA, the results of the Phase II ESA, and the results and conclusions in the Phase I ESA, the horizontal extent of SVOCs has been delineated in the vicinity of SS-1. Therefore, no additional soil sampling is required and no recognized environmental conditions RECs exist at the site.** **Former Use: In 1958, the subject property consisted of native desert. No significant changes have occurred a the subject property since that time.**
Predominant Past Usage	**Greenspace (4.04)**
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Ask.

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

Follow.

Release 3.0.2

An official website of the United States government

Property Details for Former Chile Rellenos Restaurant

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**227761**
Property Address	**2433 S. 4th Ave. South Tucson, AZ 85713**
Size	**.15**
Parcel Numbers	**118-25-2410**
Latitude/Longitude	**32.193629 / -110.96499499999999**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T23201	AZ	Assessment	2014

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$8,900.00	08/17/2016	09/23/2016	City of South Tucson	Y	FY18

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$8,900.00**

Leveraged Funding:
Total Funding: **$8,900.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Asbestos
Lead
Media Affected
Building Materials

Remediating Action for Contaminants
NOT Cleaned up
NOT Cleaned up
Remediating Action for Media
NOT Cleaned up

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**
Categories of Controls	
Additional Institutional Controls Information	
Address of Data Source (URL if available)	
Are Institutional Controls in Place	
Date Institutional Controls were put in place	
Indicate whether Engineering Controls are required	
Categories of Controls	
Additional Engineering controls information	
Address of Data Source (URL if available)	
Indicate whether Engineering Controls are in place	
Date Engineering Controls were put in place	

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The Property covered approximately 0.15 acres and contained one single-story, 3,350-square foot structure located in the eastern portion of the Property. The Property was last used as the Chile Relleno restaurant ar apparent single-family residence. The front, westernmost rooms appeared to be used for the kitchen, dinin area, and restrooms of the restaurant. The back rooms appeared to be used for residential living rooms, bedrooms, and bathrooms. The Property was vacant and the structure was significantly vandalized and demolished. Large sections of walls, ceiling, and flooring were missing from the building interior. Building materials were strewn across the Property and it was not possible for the environmental contractor to observe extensive sections of the ground underlying the materials. There was an asphalt pavement-covere parking lot in the western portion of the Property, that was enclosed with a chain link fence that was locke to prevent unlawful entry into the structure.** **Former Use: The Property covered approximately 0.15 acres and contained one single-story, 3,350-square foot structure located in the eastern portion of the Property. The Property was last used as the Chile Rellen restaurant and apparent single-family residence. The front, westernmost rooms appeared to be used for th kitchen, dining area, and restrooms of the restaurant. The back rooms appeared to be used for residential living rooms, bedrooms, and bathrooms. The Property was vacant and the structure was significantly vandalized and demolished. Large sections of walls, ceiling, and flooring were missing from the building interior. Building materials were strewn across the Property and it was not possible for the environmental contractor to observe extensive sections of the ground underlying the materials. There was an asphalt pavement-covered parking lot in the western portion of the Property, that was enclosed with a chain link fence that was locked to prevent unlawful entry into the structure. Historical records were not reasonable available to COST to identify the Property use prior to 1940, but it is likely that the Property was undevelop desert land prior to residential and commercial development on the Property and the surrounding area. Th Property was graded and not further developed since at least 1940. The structure was built on the Property 1973, and appears to have been used as a meat market from 1973 until the early 1980s. No other documentation of other uses on the Property was reasonable available to COST; however, based on COST's knowledge and a sign on the building, the Property was used as restaurant called Chile Rellenos. We did not identify any past uses on the Property that we would consider to represent a REC for the Property. COST reviewed online Pima County Assessor's records available for the Property. Based on our review, the Kaneen & Khalil 401K Plan was identified as the current owner of the Property.**
Predominant Past Usage	**Commercial (.15)**
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Ask.

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Newsroom
<https://www.epa.gov/newsroom>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

Follow.

An official website of the United States government

Property Details for Greyhound Site

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**255537**
Property Address	**2601 South 3rd Avenue TUCSON, AZ 85713**
Size	**16.7**
Parcel Numbers	
Latitude/Longitude	**32.19170581185804 / -110.96272254873193**
Congressional District	**7**
Property Contact	**Stollman, Scott** **Stollman.Scott@epa.gov** **415-972-3729**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF98T07001	AZ	Assessment	2020

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment		05/05/2022	05/26/2022	City of South Tucson	N	
Phase I Environmental Assessment		05/05/2022	05/26/2022	City of South Tucson	N	
Phase II Environmental Assessment	$17,312.24	03/10/2023	09/08/2023	City of South Tucson	Y	FY24
Phase II Environmental Assessment	$35,904.00	06/19/2023	01/08/2024	City of South Tucson		FY24

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Supplemental Assessment		03/13/2024	04/12/2024	City of South Tucson		

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$53,216.24**
Leveraged Funding: **$5,800.00**
Total Funding: **$59,016.24**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

Selected Strategy(ies)	Explanatory Text
Evaluate Reuse options that consider impacts from extreme weather events and natural disasters	Discussion of observed and forecasted natural hazard conditions and the associated site-specific risk are part of any reuse considerations. Both current and forecasted extreme weather events and natural disasters may impact the effectiveness of a remedial alternative.

Top of Pag

Contaminants and Media

Contaminant Found
Asbestos
Media Affected
Building Materials

Remediating Action for Contaminants
NOT Cleaned up
Remediating Action for Media
NOT Cleaned up

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:

Cleanup/Treatement Categories:

Addl Cleanup/Treatment info:

Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:
Actual Acreage of Greenspace Created:
Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation – Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The site is comprised of one parcel (Pima County Assessor's Parcel Number [APN] 119-01-0070), which cover approximately 10.10 acres. The site is developed with a dog-racing track (currently nonoperational) and associated structures. The reminder of the site is developed with asphalt-paved parking and access roads. The laboratory results of the soil samples submitted for analysis indicated the soil did not contain analytes concentrations above established ADEQ SRLs or Minimum GPLs. Some building materials were found to contain asbestos in concentrations greater than 1% and lead-based paint. ACM: The RBM Survey identified drywall materials as a result of laboratory analysis as containing ?1% asbestos. LBP: A summary of XRF readings are provided below: - Twenty building materials coated with LBP were identified within Building A Five building materials coated with LBP were identified within Area H. - Terracon did not identify any lead-based paints during the XRF screening of Buildings D, E, F, and G. - Painted surfaces were identified throughout the site during the XRF screening with <1.0 milligrams per centimeter squared (mg/cm2).**
Predominant Past Usage	**Commercial (10.1)**
What types of funding are being used on this property?	
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Contracting
<https://www.epa.gov/contracts>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

Follow.

An official website of the United States government

Property Details for Hedlund 310

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	**2501 South 4th Avenue**
Property Owner	**Private**
ACRES Property ID	**238603**
Property Address	**310 East 35th Street TUCSON, AZ 85713**
Size	**.15**
Parcel Numbers	**118-25-3010**
Latitude/Longitude	**32.193312329330155 / -110.9647390669979**
Congressional District	**7**
Property Contact	**Stollman, Scott** **Stollman.Scott@epa.gov** **415-972-3729**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T61301	AZ	Assessment	2017
City of South Tucson	BF98T07001	AZ	Assessment	2020

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$4,300.00	03/09/2022	05/18/2022	City of South Tucson		
Phase I Environmental Assessment	$4,800.00	08/03/2018	11/14/2018	City of South Tucson	Y	FY19
Phase II Environmental Assessment	$20,390.75	07/15/2022	02/24/2023	City of South Tucson		

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Supplemental Assessment	$7,200.00	05/05/2023	06/06/2023	City of South Tucson		

Is Cleanup Necessary? **Yes**
EPA Assessment Funding: **$36,690.75**
Leveraged Funding:
Total Funding: **$36,690.75**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

Selected Strategy(ies)	Explanatory Text
N/A	This property does not incorporate planning or assessment activities to address impacts from extreme weather events and natural disasters. If no activities were incorporated, select this option.

Top of Pag

Contaminants and Media

Contaminant Found
Lead
Media Affected
Soil

Remediating Action for Contaminants
NOT Cleaned up
Remediating Action for Media
NOT Cleaned up

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:

Cleanup/Treatement Categories:

Addl Cleanup/Treatment info: **Based on the results of this investigation, the presence of lead contamination detected in the soil ha been delineated to an approximately 108-square foot area spanning approximately 12 feet north to south and nine feet east to west, and approximately 0.5 feet bgs. Terracon recommends the top 0.5 feet of soil be excavated and disposed of at an appropriately licensed landfill in accordance with local, state, and federal regulations. Terracon recommends approximately two cubic yards of soil be removed from the site. Prior to disposal an additional sample may need to be collected from the excavated soil and analyzed based on selected landfill requirements.**

Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

Selected Strategy(ies)	Explanatory Text
N/A	This property does not incorporate demolition or cleanup activities to address impacts from extreme weather events and natural disasters. If no activities were incorporated, select this option.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**
Categories of Controls	
Additional Institutional Controls Information	
Address of Data Source (URL if available)	
Are Institutional Controls in Place	
Date Institutional Controls were put in place	
Indicate whether Engineering Controls are required	**Yes**
Categories of Controls	**Security (e.g., Guard, Fences)**
Additional Engineering controls information	**Fences at the site.**
Address of Data Source (URL if available)	
Indicate whether Engineering Controls are in place	
Date Engineering Controls were put in place	

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:
Actual Acreage of Greenspace Created:
Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**Former Use: The Site consisted of approximately 0.6 acres of land and was located at 310 East 35th Street. The Site was generally flat, and rocks were placed throughout the Site. A circular outline was observed in th southern portion along the western boundary of the Site. Mr. Brian Hedlund, the Site Owner, indicated the outline represented the location of a former cesspool. Along the eastern boundary, Mr. Hedlund also indicated he had observed paint and stucco material runoff from the eastern adjoining property, a single-family residence. Two former fence poles were observed along the eastern boundary. Three pole mounted transformers were located in the alley near the southeastern corner of the Site. Former Use: The Site was approximately 0.46 acres of vacant land. The Site was generally flat, and rocks were placed to outline an unpaved driveway in the western portion and were placed throughout the Site. An electrical meter, electric box, and concrete-lined utilities vault were located in the southwest corner of the Site. A concrete debris pil was located along the southern portion of the western boundary of the Site. An irrigation pipe was observe in a planter box located in the northwestern portion of the Site. Multiple shapes were drawn in the soil in th northeast portion of the Site, which, according to Mr. Brian Hedlund, the Site owner, represented the forme locations of the apartment building and basement stairs, the wash house, and two cesspools. Three pole-mounted transformers were located in the alley near the southeast corner of the Site. Two electrical boxes and a pad-mounted transformer was located near the southwest corner of the Site along South 4th Avenue.**
Predominant Past Usage	**Commercial (.6) Residential (.6)**
What types of funding are being used on this property?	
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Ask.

Top of Pag

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

Follow.

An official website of the United States government

Property Details for Kunz South Property

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**131261**
Property Address	**2413 S. 4th Avenue South Tucson, AZ 85713**
Size	**.6**
Parcel Numbers	**18-25-2350**
Latitude/Longitude	**32.194225 / -110.964908**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment	☑
Clean Up	✗
Institutional Controls in Place	✗
Engineering Controls in Place	✗
Ready for Anticipated Use	✗
Redevelopment Underway	✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
South Tucson, City of	2B00T18701	AZ	Assessment	2009

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$3,200.00	03/28/2011	04/25/2011	South Tucson, City of	Y	FY11

Is Cleanup Necessary? **Unknown**
EPA Assessment Funding: **$3,200.00**
Leveraged Funding:

Total Funding: **$3,200.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected
Unknown

Remediating Action for Contaminants
Remediating Action for Media
NOT Cleaned up

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**U**
Categories of Controls	
Additional Institutional Controls Information	
Address of Data Source (URL if available)	
Are Institutional Controls in Place	
Date Institutional Controls were put in place	
Indicate whether Engineering Controls are required	
Categories of Controls	
Additional Engineering controls information	
Address of Data Source (URL if available)	
Indicate whether Engineering Controls are in place	
Date Engineering Controls were put in place	

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The City of South Tucson completed a Phase I Environmental Site Assessment at the subject property. This assessment has revealed evidence of the following recognized environmental conditions in connection with the property: • Four discreet areas were observed of approximately 20 square feet each in which the soil is at a level lower than the general site topography indicating the potential presence of former pits, tanks, or materials disposal areas. Additional assessment of these areas should be conducted by excavating the soil t identify whether these features are present and, if these features are encountered, soil samples should be collected and analyzed for constituents appropriate for the feature identified. • A cast iron pipe was observed that was partially buried in the west-central portion of the subject property, potentially indicatin the presence of a septic system, wastewater disposal system, gasoline service station, or other use. A geophysical survey and/or excavation should be conducted to evaluate the extent of buried features and additional assessment should be conducted based on the results of this additional investigation.** **Former Use: In 1958, the subject property was being used for residential purposes and several mobile home occupied the subject property. Prior to 1996, the mobile homes were removed from the subject property an it began to be used to store equipment, materials, and a small number of vehicles. The items being stored o the property were removed in 2011. Currently, the subject property is undeveloped and used to store plumbing supplies and for vehicle parking.**
Predominant Past Usage	**Commercial (.6)**
What types of funding are being used on this property?	**Petroleum**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Ask.

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Follow.

Release 3.0.2

An official website of the United States government

Property Details for Orion Leasing Realty & Investment

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**228265**
Property Address	**101 E. 40th Street TUCSON, AZ 85713**
Size	**.89**
Parcel Numbers	**119-02-1700, 119-02-1710, 119-02-1720, 119-02-1730 and 119-02-1770**
Latitude/Longitude	**32.1890 / -110.9679**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment
Clean Up
Institutional Controls in Place
Engineering Controls in Place
Ready for Anticipated Use
Redevelopment Underway

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T23201	AZ	Assessment	2014

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$3,600.00	03/07/2016	07/28/2016	City of South Tucson	Y	FY18
Phase II Environmental Assessment	$33,088.00	08/01/2016	09/25/2016	City of South Tucson	N	

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$36,688.00**
Leveraged Funding:
Total Funding: **$36,688.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found	Remediating Action for Contaminants
Media Affected	Remediating Action for Media
Ground Water	**NOT Cleaned up**
Soil	**NOT Cleaned up**

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**
Categories of Controls	
Additional Institutional Controls Information	
Address of Data Source (URL if available)	
Are Institutional Controls in Place	
Date Institutional Controls were put in place	
Indicate whether Engineering Controls are required	
Categories of Controls	
Additional Engineering controls information	
Address of Data Source (URL if available)	
Indicate whether Engineering Controls are in place	
Date Engineering Controls were put in place	

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**The Property was vacant graded land that is partially enclosed by a temporary chain link fence on a portion of the northern boundaries and there are residential cinder block fences bordering the entirety of the easte portion of the Property. We observed scattered litter and trash on the Property including beverage containers, plastic bags, and clothing articles. There were also remnants of asphalt on the western boundar of the Property and a large billboard in the southwest corner. We did not observe stained soil, chemical containers, indication of buried materials, or other potential indications of disposed hazardous substances petroleum products on the property. Based on our review of historical documents, a gas station operated o APN 119-02-1720 from the 1940s to the 1960s. In 1958, there were four residences and a gas station occupyi the Property. Between 1958 and 1967, a portion of the Property began to be utilized for the storage of tract trailers and/or mobile homes. Between 1967 and 1972, the western central portion of the property was use for equipment storage. Between 1972 and 1980, both the residence occupying the southwestern portion of the Property and the equipment being stored in the west central portion of the property had been removed Between 1980 and 1991, the central, west central and southwest portions of the Property began to be utiliz for equipment storage. Between 1991 and 2002, the entire length of the subject property on the western boundary had been paved for parking. A new rectangular structure, used by a tire shop, was constructed an tires were stored on both the east and west sides of the structure, in the southern portion of the Property ju east of the parking area. The western portion of the subject has been graded and cleared. Between 2002 an 2005, a new structure was constructed in the central portion of the Property and an enclosed area for tire storage was constructed east of the tire shop. The eastern portion of the subject property began to be used for storing vehicles and equipment. At the time of this report, the subject property is vacant land.** **Former Use: The Property was vacant graded land that is partially enclosed by a temporary chain link fence on a portion of the northern boundaries and there are residential cinder block fences bordering the entiret of the eastern portion of the Property. We observed scattered litter and trash on the Property including beverage containers, plastic bags, and clothing articles. There were also remnants of asphalt on the weste boundary of the Property and a large billboard in the southwest corner. We did not observe stained soil, chemical containers, indication of buried materials, or other potential indications of disposed hazardous substances or petroleum products on the property.**
Predominant Past Usage	
What types of funding are being used on this property?	**Petroleum**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Ask.

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

Follow.

Release 3.0.2

Detailed Facility Report

Facility Summary

PRIMAVERA PROPERTY

2901 S. SIXTH AVENUE, TUCSON, AZ 85713

FRS (Facility Registry Service) ID: 110070247582

EPA Region: 09

Latitude: 32.1892

Longitude: -110.96836

Locational Data Source: FRS

Industries: --

Indian Country: N

Enforcement and Compliance Summary

No data records returned

Regulatory Information

Clean Air Act (CAA): No Information

Clean Water Act (CWA): No Information

Resource Conservation and Recovery Act (RCRA): No Information

Safe Drinking Water Act (SDWA): No Information

Other Regulatory Reports

Air Emissions Inventory (EIS): No Information

Greenhouse Gas Emissions (eGGRT): No Information

Toxic Releases (TRI): No Information

Compliance and Emissions Data Reporting Interface (CEDRI): No Information

Go To Enforcement/Compliance Details

Known Data Problems <https://epa.gov/resources/echo-data/known-data-problems>

Facility/System Characteristics

Facility/System Characteristics

System	Statute	Identifier	Universe	Status	Areas	Permit Expiration Date	Indian Country	Latitude	Longitude
FRS		110070247582					N	32.1892	-110.96836

Facility Address

System	Statute	Identifier	Facility Name	Facility Address	Facility County
FRS		110070247582	PRIMAVERA PROPERTY	2901 S. SIXTH AVENUE, TUCSON, AZ 85713	Pima County

Facility SIC (Standard Industrial Classification) Codes

System	Identifier	SIC Code	SIC Description

No data records returned

Facility NAICS (North American Industry Classification System) Codes

System	Identifier	NAICS Code	NAICS Description

No data records returned

Facility Tribe Information

Reservation Name	Tribe Name	EPA Tribal ID	Distance to Tribe (miles)
Pascua Pueblo Yaqui Reservation	Pascua Yaqui Tribe of Arizona	100000193	7
Tohono O'odham Nation Reservation	Tohono O'odham Nation of Arizona	100000302	4

Enforcement and Compliance

Compliance Monitoring History

Last 5 Years

Statute	Source ID	System	Activity Type	Compliance Monitoring Type	Lead Agency	Date	Finding (if applicable)

No data records returned

Entries in italics are not included in ECHO's Compliance Monitoring Activity counts because they are not compliance monitoring strategy <https://www.epa.gov/compliance/compliance-monitoring-programs> *activities or because they are not counted as inspections within EPA's Annual Results* <https://www.epa.gov/enforcement/enforcement-data-and-results>*.*

Compliance Summary Data

Statute	Source ID	Current SNC (Significant Noncompliance)/HPV (High Priority Violation)	Current As Of	Qtrs with NC (Noncompliance) (of 12)	Data Last Refreshed

No data records returned

Three-Year Compliance History by Quarter

Informal Enforcement Actions

Last 5 Years

Statute	System	Source ID	Type of Action	Lead Agency	Date

No data records returned

Entries in italics are not counted as "informal enforcement actions" in EPA policies pertaining to enforcement response tools.

Formal Enforcement Actions

Last 5 Years

Statute	System	Law/ Section	Source ID	Type of Action	Case No.	Lead Agency	Case Name	Issued/ Filed Date	Settlements/ Actions	Settlement/ Action Date	Federal Penalty Assessed	State/ Local Penalty Assessed	Penalty Amount Collected	SEP Value	Comp Action Cost

No data records returned

Environmental Conditions

Watersheds

12-Digit WBD (Watershed Boundary Dataset) HUC (RAD (Reach Address Database))	WBD (Watershed Boundary Dataset) Subwatershed Name (RAD (Reach Address Database))	State Water Body Name (ICIS (Integrated Compliance Information System))	Beach Closures Within Last Year	Beach Closures Within Last Two Years	Pollutants Potentially Related to Impairment	Watershed with ESA (Endangered Species Act)-listed Aquatic Species?

No data records returned

Assessed Waters From Latest State Submission (ATTAINS)

State	Report Cycle	Assessment Unit ID	Assessment Unit Name	Water Condition	Cause Groups Impaired	Drinking Water Use	Ecological Use	Fish Consumption Use	Recreation Use	Other Use

No data records returned

Air Quality Nonattainment Areas

Pollutant	Within Nonattainment Status Area?	Nonattainment Status Applicable Standard(s)	Within Maintenance Status Area?	Maintenance Status Applicable Standard(s)
Ozone	No	--	No	--
Lead	No	--	No	--
Particulate Matter	No	--	No	--
Carbon Monoxide	No	--	Yes	Carbon Monoxide (1971)
Sulfur Dioxide	No	--	No	--

Pollutants

Toxics Release Inventory History of Reported Chemicals Released or Transferred in Pounds per Year at Site

TRI Facility ID	Year	Air Emissions	Surface Water Discharges	Off-Site Transfers to POTWs (Publicly Owned Treatment Works)	Underground Injections	Disposal to Land	Total On-Site Releases	Total Off-Site Transfers

No data records returned

Toxics Release Inventory Total Releases and Transfers in Pounds by Chemical and Year

Chemical Name

No data records returned

Community

Demographic Profile of Surrounding Area (1-Mile Radius)

This section provides demographic information regarding the community surrounding the facility. ECHO compliance data alone are not sufficient to determine whether violations at a particular facility had negative impacts on public health or the environment. Statistics are based upon the 2022 American Community Survey (ACS) 5-year Summary and are accurate to the extent that the facility latitude and longitude listed below are correct. Census boundaries and demographic data for U.S. Territories are based on the "2020 Island Areas Demographic Profiles" from the U.S. Census Bureau. EPA's spatial processing methodology considers the overlap between the selected radii and ACS census block groups in determining the demographics surrounding the facility. For more detail about this methodology, see the DFR Data Dictionary <https://epa.gov/help/reports/dfr-data-dictionary#demographic>.

No demographic profile information available for this facility.

An official website of the United States government

Property Details for Spanish Trail Task 2

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**228292**
Property Address	**305 East Benson Highway TUCSON, AZ 85713**
Size	**7.07**
Parcel Numbers	**119-01-020C and 119-01-037D**
Latitude/Longitude	**32.1870918 / -110.9638996**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment ✗
Clean Up ✗
Institutional Controls in Place ✗
Engineering Controls in Place ✗
Ready for Anticipated Use ✓
Redevelopment Underway ✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T23201	AZ	Assessment	2014

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$6,400.00	03/17/2015	04/22/2015	City of South Tucson	Y	FY18

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$6,400.00**
Leveraged Funding:
Total Funding: **$6,400.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights **COST was not provided access to the Property or allowed to interview the occupants. Therefore, our observations were made from Google Maps. The building had a sign indicating the Spanish Trail Motel and Apartments, occupied the Property. The Motel side, eastern side, of the Property appeared to be decommissioned, the roof on the northeastern buildings had been removed or degraded significantly. Multiple abandoned vehicles were present in this area. An empty pool and courtyard area were located in th**

	center of the southeastern motels. The motels were various sizes, approximately between 1,100 and 2,700 square feet in size. Multiple storage trailers were present in the southeastern corner of the Property. The apartments on the western portion of the Property were apparently still in use. Multiple vehicles were parked in between the two apartment buildings. The two apartment structures were approximately 12,900 square feet in size. An aboveground storage tank (AST) was observed near the northern portion of the Property. Based on our observations during the reconnaissance, we believe that the lack of access and occupant interviews represents a REC for the Property. **Former Use: COST was not provided access to the Property or allowed to interview the occupants. Therefore our observations were made from Google Maps. The building had a sign indicating the Spanish Trail Motel a Apartments, occupied the Property. The Motel side, eastern side, of the Property appeared to be decommissioned, the roof on the northeastern buildings had been removed or degraded significantly. Multiple abandoned vehicles were present in this area. An empty pool and courtyard area were located in th center of the southeastern motels. The motels were various sizes, approximately between 1,100 and 2,700 square feet in size. Multiple storage trailers were present in the southeastern corner of the Property. The apartments on the western portion of the Property were apparently still in use. Multiple vehicles were parked in between the two apartment buildings. The two apartment structures were approximately 12,900 square feet in size. An aboveground storage tank (AST) was observed near the northern portion of the Property. Based on our observations during the reconnaissance, we believe that the lack of access and occupant interviews represents a REC for the Property.**
Predominant Past Usage	**Commercial (7.07)**
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

Discover.

Accessibility
<https://www.epa.gov/accessibility>

Budget & Performance
<https://www.epa.gov/planandbudget>

Contracting
<https://www.epa.gov/contracts>

EPA www Web Snapshots
<https://www.epa.gov/home/wwwepagov-snapshots>

Grants
<https://www.epa.gov/grants>

Connect.

Data.gov
<https://www.data.gov/>

Inspector General
<https://www.epa.gov/office-inspector-general/about-epas-office-inspector-general>

Jobs
<https://www.epa.gov/careers>

Newsroom
<https://www.epa.gov/newsroom>

Open Government
<https://www.epa.gov/data>

Regulations.gov
<https://www.regulations.gov/>

Ask.

Contact EPA
<https://www.epa.gov/aboutepa/forms/contact-epa>

EPA Disclaimers
<https://www.epa.gov/web-policies-and-procedures/epa-disclaimers>

Hotlines
<https://www.epa.gov/aboutepa/epa-hotlines>

FOIA Requests
<https://www.epa.gov/foia>

Frequent Questions
<https://www.epa.gov/aboutepa/frequent-questions-specific-epa-programstopics>

No FEAR Act Data
<https://www.epa.gov/ocr/whistleblower-protections-epa-and-how-they-relate-non-disclosure-agreements-signed-epa-employees>

Privacy
<https://www.epa.gov/privacy>

Privacy and Security Notice
<https://www.epa.gov/privacy/privacy-and-security-notice>

Subscribe
<https://www.epa.gov/newsroom/email-subscriptions-epa-news-releases>

USA.gov
<https://www.usa.gov/>

White House
<https://www.whitehouse.gov/>

Follow.

Release 3.0.2

An official website of the United States government

Property Details for Spanish Trails East

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	**Private**
ACRES Property ID	**238600**
Property Address	**425 East Benson Highway TUCSON, AZ 85713**
Size	**7.81**
Parcel Numbers	**119-01-038B**
Latitude/Longitude	**32.187193 / -110.962466**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment ✗
Clean Up ✗
Institutional Controls in Place ✗
Engineering Controls in Place ✗
Ready for Anticipated Use ✓
Redevelopment Underway ✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T61301	AZ	Assessment	2017

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$5,550.00	06/28/2018	09/24/2018	City of South Tucson	Y	FY19

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$5,550.00**
Leveraged Funding:
Total Funding: **$5,550.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights **Former Use: The Site consisted of approximately 7.81 acres of land and was located at 425 East Benson Highway. A majority of the Site consisted of vacant desert land with natural vegetation. An unpaved road w present on the northern and eastern portions of the Site. The Phase I ESA did not identify any RECs in connection with the Site.**

Predominant Past Usage	
What types of funding are being used on this property?	**Hazardous**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

An official website of the United States government

Property Details for Spanish Trails North

On this page:

- Profile Information
- Property Location
- Property Progress
- CAs Associated with this Property
- Assessment Activities at this Property
- Climate Adaption and Mitigation - Planning or Assessment
- Contaminants and Media
- Cleanup Activities
- Climate Adaption and Mitigation - Demolition or Cleanup
- Institutional & Engineering Controls
- Redevelopment and Other Leveraged Accomplishments
- Climate Adaption and Mitigation - Redevelopment
- Additional Property Attributes

Legal Notices <https://www.epa.gov/cleanups/cimc-legal-notices>

Profile Information

Property Alias	
Property Owner	
ACRES Property ID	**238602**
Property Address	**NE of 4th Avenue and Benson Highway TUCSON, AZ 85713**
Size	**2.35**
Parcel Numbers	**119-01-020C and 119-01-025C**
Latitude/Longitude	**32.1866447 / -110.9653687**
Congressional District	**7**
Property Contact	**Garcia, Jose** **Garcia.Jose@epa.gov** **213-244-1811**

Top of Pag

Property Location

Top of Pag

Property Progress

Assessment ✗
Clean Up ✗
Institutional Controls in Place ✗
Engineering Controls in Place ✗
Ready for Anticipated Use ✓
Redevelopment Underway ✗

Top of Pag

CAs Associated with this Property

CA Name	CA #	State	Type	Announcement Year
City of South Tucson	BF99T61301	AZ	Assessment	2017

Top of Pag

Assessment Activities at this Property

Activity	EPA Funding	Start Date	Completion Date	CA	Accomplishment Counted?	Counted When?
Phase I Environmental Assessment	$5,550.00	06/28/2018	09/18/2018	City of South Tucson	Y	FY19

Is Cleanup Necessary? **No**
EPA Assessment Funding: **$5,550.00**
Leveraged Funding:
Total Funding: **$5,550.00**

Top of Pag

Climate Adaption and Mitigation - Planning or Assessment

There is no data for Climate Adaption and Mitigation - Planning or Assessment.

Top of Pag

Contaminants and Media

Contaminant Found
Media Affected

Remediating Action for Contaminants
Remediating Action for Media

Top of Pag

Cleanup Activities

There are no current cleanup activities.

Cleanup/Treatment Implemented:
Cleanup/Treatement Categories:
Addl Cleanup/Treatment info:
Address of Data Source:

Top of Pag

Climate Adaption and Mitigation - Demolition or Cleanup

There is no data for Climate Adaption and Mitigation - Demolition or Cleanup.

Top of Pag

Institutional and Engineering Controls

Indicate whether Institutional Controls are required	**No**

Categories of Controls

Additional Institutional Controls Information

Address of Data Source (URL if available)

Are Institutional Controls in Place

Date Institutional Controls were put in place

Indicate whether Engineering Controls are required

Categories of Controls

Additional Engineering controls information

Address of Data Source (URL if available)

Indicate whether Engineering Controls are in place

Date Engineering Controls were put in place

Top of Pag

Redevelopment and Other Leveraged Accomplishments

There are no current redevelopment activities.

Number of Redevelopment Jobs Leveraged:

Actual Acreage of Greenspace Created:

Leveraged Funding:

Top of Pag

Climate Adaption and Mitigation - Redevelopment

There is no data for Climate Adaption and Mitigation – Redevelopment

Top of Pag

Additional Property Attributes

Property Highlights	**Former Use: The Site consisted of 2.35 acres of vacant, undeveloped land with natural vegetation. An unpaved road was present on the Site and trended east-west along the northern boundary. The northern ar southern borders of the Site were bounded by chain-link fences**
Predominant Past Usage	

What types of funding are being used on this property?	**Petroleum**
State and Tribal Program Information	
Date No Further Action Letter Received	
Date Letter/Signed Report Received from a Qualified Professional	
Other Cleanup Documentation	

Top of Pag

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.70	Ajo	85321
< 0.50	Ajo	85321
< 0.50	Ajo	85321
= 2.70	Tucson	85570
= 5.60	Green Valley	85614
= 4.70	Green Valley	85614
= 3.10	Green Valley	85614
= 2.40	Green Valley	85614
= 2.10	Green Valley	85614
= 2.00	Green Valley	85614
= 2.00	Green Valley	85614
= 1.90	Green Valley	85614
= 1.80	Green Valley	85614
= 1.80	Green Valley	85614
= 1.60	Green Valley	85614
= 1.50	Green Valley	85614
= 1.30	Green Valley	85614
= 1.30	Green Valley	85614
= 1.20	Green Valley	85614
= 1.40	Green Valley	85614+
= 1.00	Green Valley	85614+
= 1.20	Green Valley	85614
= 1.10	Green Valley	85614
= 1.00	Green Valley	85614
= 0.80	Green Valley	85614
= 0.80	Green Valley	85614
= 0.80	Green Valley	85614
= 0.50	Green Valley	85614
= 1.00	Green Valley	85614+
= 0.80	Green Valley	85614+
= 0.90	Green Valley	85614+
= 0.70	Green Valley	85614+
= 4.70	Tucson	85629
= 3.70	Sahuarita	85629

=	2.90	Tucson	85629

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 2.60	Tucson	85629
= 2.30	Tucson	85629
= 2.30	Tucson	85629
= 2.30	Tucson	85629
= 2.20	Tucson	85629
= 1.90	Tucson	85629
= 1.90	Tucson	85629
= 1.80	Tucson	85629
= 1.70	Tucson	85629
= 1.70	Tucson	85629
= 1.50	Tucson	85629
= 1.50	Tucson	85629
= 1.50	Tucson	85629
= 1.40	Tucson	85629
= 1.30	Tucson	85629
= 1.30	Tucson	85629
= 1.10	Tucson	85629
= 1.00	Tucson	85629
< 0.50	Sahuarita	85629
= 2.60	Tucson	85641
= 2.00	Tucson	85641
= 1.60	Tucson	85641
= 1.60	Tucson	85641
= 1.50	Tucson	85641
= 0.90	Tucson	85641
< 0.50	Tucson	85641
< 0.50	Tucson	85641
= 1.00	Marana	85653
= 0.70	Marana	85653+
= 0.50	Marana	85653+
= 2.50	Tucson	85701
= 2.30	Tucson	85704
= 2.20	Tucson	85704

=	1.90	Tucson	85704
=	1.80	Tucson	85704

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 1.30	Tucson	85704+
= 0.60	Tucson	85704+
= 1.80	Tucson	85704
= 1.40	Tucson	85704
= 1.30	Tucson	85704
= 1.00	Tucson	85704
= 1.00	Tucson	85704
= 0.90	Tucson	85704
= 0.70	Tucson	85704
= 0.70	Tucson	85704
= 0.90	Tucson	85704+
= 0.80	Tucson	85704+
= 0.60	Tucson	85704
= 0.60	Tucson	85704
= 0.60	Tucson	85704
< 0.50	Tucson	85704
= 0.50	Tucson	85704+
= 0.20	Tucson	85704+
< 0.50	Tucson	85704
= 15.70	Tucson	85705
= 3.90	Tucson	85705
= 3.10	Tucson	85705
= 2.80	Tucson	85705
= 2.60	Tucson	85705
= 2.00	Tucson	85705
= 1.90	Tucson	85705
= 1.90	Tucson	85705
= 1.70	Tucson	85705
= 1.40	Tucson	85705
= 1.40	Tucson	85705
= 1.40	Tucson	85705
= 1.40	Tucson	85705
= 1.20	Tucson	85705
= 1.10	Tucson	85705
= 1.00	Tucson	85705
= 1.00	Tucson	85705

=	0.90	Tucson	85705
=	0.80	Tucson	85705

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.80	Tucson	85705
= 0.80	Tucson	85705
= 0.70	Tucson	85705
= 0.70	Tucson	85705
= 0.60	Tucson	85705
= 0.60	Tucson	85705
= 0.60	Tucson	85705
= 0.60	Tucson	85705
= 0.60	Tucson	85705
= 0.50	Tucson	85705
= 2.20	Tucson	85705
< 0.50	Tucson	85705
< 0.50	Tucson	85705
< 0.50	Tucson	85705
< 0.50	Tucson	85705
< 0.50	Tucson	85705
< 0.50	Tucson	85705
= 0.80	Tucson	85705+
= 0.20	Tucson	85705+
< LLD	Tucson	85705+
= 0.80	Tucson	85705+
= 0.70	Tucson	85705+
= 1.60	Tucson	85706
= 1.10	Tucson	85706
= 1.00	Tucson	85706
= 0.90	Tucson	85706
= 0.80	Tucson	85706
= 0.70	Tucson	85706
< 0.50	Tucson	85706
< 0.50	Tucson	85706
< 0.50	Tucson	85706
= 5.20	Tucson	85710
= 3.50	Tucson	85710
= 3.50	Tucson	85710
= 2.10	Tucson	85710

=	1.70	Tucson	85710
=	0.70	Tucson	85710+

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.60	Tucson	85710+
= 1.30	Tucson	85710
= 1.20	Tucson	85710
= 1.10	Tucson	85710
= 0.90	Tucson	85710
= 0.80	Tucson	85710
= 0.70	Tucson	85710
= 0.70	Tucson	85710
= 0.60	Tucson	85710
= 0.50	Tucson	85710
= 0.40	Tucson	85710+
< 0.50	Tucson	85710
< 0.50	Tucson	85710
= 0.40	Tucson	85710+
= 0.40	Tucson	85710
< 0.50	Tucson	85710+
= 3.40	Tucson	85710+
= 0.80	Tucson	85710+
< 0.50	Tucson	85710
< 0.50	Tucson	85710
= 4.10	Tucson	85711
= 4.10	Tucson	85711
= 3.30	Tucson	85711
= 2.40	Tucson	85711
= 2.40	Tucson	85711
= 2.10	Tucson	85711
= 1.90	Tucson	85711
= 1.70	Tucson	85711
= 1.50	Tucson	85711
= 1.40	Tucson	85711
= 1.20	Tucson	85711
= 1.10	Tucson	85711
= 1.10	Tucson	85711
= 1.10	Tucson	85711
= 1.00	Tucson	85711
= 0.90	Tucson	85711

=	0.80	Tucson	85711
=	0.80	Tucson	85711

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.80	Tucson	85711
= 0.70	Tucson	85711
= 0.60	Tucson	85711
< 0.50	Tucson	85711
< 0.50	Tucson	85711
< 0.50	Tucson	85711
< 0.50	Tucson	85711
= 6.10	Tucson	85712
= 4.40	Tucson	85712
= 1.80	Tucson	85712
= 1.60	Tucson	85712
= 1.50	Tucson	85712
= 0.80	Tucson	85712
= 0.60	Tucson	85712
< 0.50	Tucson	85712
< 0.50	Tucson	85712
= 2.70	Tucson	85713
= 2.30	Tucson	85713
= 1.50	Tucson	85713
= 1.40	Tucson	85713
= 1.30	Tucson	85713
= 1.00	Tucson	85713
= 1.00	Tucson	85713
= 1.00	Tucson	85713
= 1.00	Tucson	85713+
= 0.90	Tucson	85713+
= 0.80	Tucson	85713
= 0.80	Tucson	85713
= 0.70	Tucson	85713
= 1.30	Tucson	85713+
= 0.20	Tucson	85713+
< 0.50	Tucson	85713
< 0.50	Tucson	85713
= 0.70	Tucson	85713+
= 0.40	Tucson	85713+

<	0.50	Tucson	85713
<	0.50	Tucson	85713

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 3.30	Tucson	85714
= 1.30	Tucson	85714
= 0.60	Tucson	85714
= 1.90	Tucson	85715
= 1.80	Tucson	85715
= 1.80	Tucson	85715
= 1.60	Tucson	85715
= 1.60	Tucson	85715
= 1.60	Tucson	85715
= 1.30	Tucson	85715
= 1.30	Tucson	85715
= 1.20	Tucson	85715
= 0.90	Tucson	85715
= 0.90	Tucson	85715
= 0.60	Tucson	85715
< 0.50	Tucson	85715
< 0.50	Tucson	85715
< 0.50	Tucson	85715
< 0.50	Tucson	85715
< 0.50	Tucson	85715
< 0.50	Tucson	85715
= 4.80	Tucson	85716
= 3.80	Tucson	85716
= 3.20	Tucson	85716
= 2.30	Tucson	85716
= 2.10	Tucson	85716
= 1.30	Tucson	85716
= 1.10	Tucson	85716
= 1.10	Tucson	85716
= 1.00	Tucson	85716
= 0.90	Tucson	85716
= 1.20	Tucson	85716+
= 0.30	Tucson	85716+
= 0.70	Tucson	85716
= 0.70	Tucson	85716

=	0.70	Tucson	85716
<	0.50	Tucson	85716

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.20	Tucson	85716+
= 0.10	Tucson	85716+
< 0.50	Tucson	85716
= 1.10	Tucson	85716+
= 1.00	Tucson	85716+
< 0.50	Tucson	85716
< 0.50	Tucson	85716
< 0.50	Tucson	85716
= 0.50	Tucson	85716+
= 0.30	Tucson	85716+
= 0.30	Tucson	85716+
= 6.00	Tucson	85718
= 4.30	Tucson	85718
= 2.30	Tucson	85718
= 2.20	Tucson	85718
= 2.00	Tucson	85718
= 2.00	Tucson	85718
= 2.00	Tucson	85718
= 1.90	Tucson	85718
= 1.30	Tucson	85718
= 1.20	Tucson	85718
= 1.10	Tucson	85718
= 1.10	Tucson	85718
= 1.50	Tucson	85718+
= 1.50	Tucson	85718+
= 1.00	Tucson	85718
= 1.00	Tucson	85718
= 0.90	Tucson	85718
= 0.80	Tucson	85718
= 0.60	Tucson	85718
< 0.50	Tucson	85718
< 0.50	Tucson	85718
= 6.70	Tucson	85719
= 0.90	Tucson	85719+
= 0.80	Tucson	85719+

=	2.50	Tucson	85719
=	2.10	Tucson	85719

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 1.80	Tucson	85719
= 1.00	Tucson	85719
= 0.80	Tucson	85719
= 0.80	Tucson	85719
= 0.70	Tucson	85719
= 0.60	Tucson	85719
= 0.50	Tucson	85719
< 0.50	Tucson	85719
< 0.50	Tucson	85719
= 0.50	Tucson	85719+
= 0.30	Tucson	85719+
< 0.50	Tucson	85719
< 0.50	Tucson	85719
< 0.50	Tucson	85719
< 0.50	Tucson	85719
< 0.50	Tucson	85719
= 4.50	Tucson	85730
= 1.40	Tucson	85730
= 1.20	Tucson	85730
= 1.00	Tucson	85730
= 0.50	Tucson	85730+
= 0.20	Tucson	85730+
= 1.00	Tucson	85730
= 0.80	Tucson	85730
< 0.50	Tucson	85730
< 0.50	Tucson	85730
= 0.30	Tucson	85730+
= 0.10	Tucson	85730+
< 0.50	Tucson	85730
< 0.50	Tucson	85730
< 0.50	Tucson	85730
< 0.50	Tucson	85730
= 0.60	Tucson	85732

=	5.20	Tucson	85737
=	2.10	Tucson	85737

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.90	Tucson	85737+
= 0.60	Tucson	85737+
= 2.10	Tucson	85737
= 1.30	Tucson	85737
= 1.20	Tucson	85737
= 1.00	Tucson	85737
= 0.80	Tucson	85737
= 0.70	Tucson	85737
= 0.60	Tucson	85737
< 0.50	Tucson	85737
< 0.50	Tucson	85737
= 1.90	Tucson	85741
= 1.50	Tucson	85741
= 1.40	Tucson	85741
= 1.30	Tucson	85741
= 1.30	Tucson	85741
= 1.10	Tucson	85741
= 0.80	Tucson	85741
= 0.70	Tucson	85741
= 0.60	Tucson	85741
= 0.60	Tucson	85741
< 0.50	Tucson	85741
< 0.50	Tucson	85741
< 0.50	Tucson	85741
< 0.50	Tucson	85741
= 0.60	Tucson	85741+
= 0.30	Tucson	85741+
< 0.50	Tucson	85741
= 0.10	Tucson	85741+
= 0.20	Tucson	85741+
< 0.50	Tucson	85741
= 0.50	Tucson	85741+
= 0.40	Tucson	85741+
< 0.50	Tucson	85741
< 0.50	Tucson	85741
< 0.50	Tucson	85741

```
=  3.00        Tucson          85743
```

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 3.00	Tucson	85743
= 1.80	Tucson	85743
< 0.50	Tucson	85743
= 1.50	Tucson	85745
= 1.00	Tucson	85745+
= 0.80	Tucson	85745
= 1.40	Tucson	85745
= 1.20	Tucson	85745
= 1.20	Tucson	85745
= 0.90	Tucson	85745
= 0.80	Tucson	85745
< 0.50	Tucson	85745
= 0.90	Tucson	85745+
= 0.80	Tucson	85745+
< 0.50	Tucson	85745
< 0.50	Tucson	85745
= 4.50	Tucson	85746
= 2.70	Tucson	85746
= 2.40	Tucson	85746
= 2.10	Tucson	85746
= 2.00	Tucson	85746
= 1.80	Tucson	85746
= 1.80	Tucson	85746
= 1.70	Tucson	85746
= 1.70	Tucson	85746
= 1.60	Tucson	85746
= 1.50	Tucson	85746
= 1.50	Tucson	85746
= 1.40	Tucson	85746
= 1.20	Tucson	85746
= 1.10	Tucson	85746
= 1.10	Tucson	85746
= 1.00	Tucson	85746
= 0.90	Tucson	85746
= 0.90	Tucson	85746

=	1.60	Tucson	85746+
=	0.90	Tucson	85746+
=	0.90	Tucson	85746

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 0.80	Tucson	85746
< 0.50	Tucson	85746
= 0.30	Tucson	85746+
= 0.10	Tucson	85746+
< 0.50	Tucson	85746
< 0.50	Tucson	85747
= 1.40	Tucson	85747+
= 1.20	Tucson	85747+
< 0.50	Tucson	85747
< 0.50	Tucson	85747
= 2.40	Tucson	85748
= 1.30	Tucson	85748
= 0.70	Tucson	85748
< 0.50	Tucson	85748
= 5.20	Tucson	85749
= 4.80	Tucson	85749
= 3.50	Tucson	85749
= 2.20	Tucson	85749
= 2.10	Tucson	85749
= 1.90	Tucson	85749
= 1.20	Tucson	85749
= 0.70	Tucson	85749
= 0.60	Tucson	85749
= 0.60	Tucson	85749
= 0.60	Tucson	85749
= 0.60	Tucson	85749
< 0.50	Tucson	85749
< 0.50	Tucson	85749
< 0.50	Tucson	85749
< 0.50	Tucson	85749
= 0.90	Tucson	85749+
= 0.30	Tucson	85749+
= 1.10	Tucson	85770

EPA/ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE ONE COUNTY RADON RESULTS 1987/1988

RESULTS	CITY NAME	ZIP
= 3.20	Tucson	88571

+ ATD Results

All results in units of picoCuries/Liter (pCi/L)

ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE TWO COUNTY RADON RESULTS 1988/1989

RESULTS	CITY NAME	ZIP
= 1.30	Green Valley	85614
= 3.00	Tucson	85701
= 1.20	Tucson	85704
= 1.00	Tucson	85704
= 1.00	Tucson	85704
= 0.60	Tucson	85704
= 0.50	Tucson	85706

=	1.00	Tucson	85710
=	1.00	Tucson	85710
=	1.00	Tucson	85710
=	0.90	Tucson	85710
=	6.80	Tucson	85711
=	1.20	Tucson	85711
=	2.00	Tucson	85713
=	1.10	Tucson	85713
=	0.70	Tucson	85713
=	1.70	Tucson	85714
=	1.00	Tucson	85714
=	1.70	Tucson	85715
=	1.50	Tucson	85715
=	1.00	Tucson	85715
=	0.90	Tucson	85716
=	1.50	Tucson	85717
=	6.00	Tucson	85718
=	3.70	Tucson	85718
=	3.60	Tucson	85718

ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE TWO COUNTY RADON RESULTS 1988/1989

RESULTS	CITY NAME	ZIP
= 3.50	Tucson	85718
= 3.50	Tucson	85718
= 3.30	Tucson	85718
= 3.30	Tucson	85718
= 2.80	Tucson	85718
= 2.50	Tucson	85718
= 2.50	Tucson	85718
= 2.40	Tucson	85718
= 2.40	Tucson	85718
= 2.20	Tucson	85718
= 2.10	Tucson	85718
= 2.00	Tucson	85718
= 1.60	Tucson	85718
= 1.40	Tucson	85718
= 1.40	Tucson	85718
= 1.40	Tucson	85718
= 1.00	Tucson	85718
= 1.00	Tucson	85718
= 0.70	Tucson	85718
= 0.70	Tucson	85718
< 0.00	Tucson	85718*
< 0.50	Tucson	85718
< 0.50	Tucson	85718
= 4.80	Tucson	85719
= 1.40	Tucson	85719
= 1.40	Tucson	85719
< 0.50	Tucson	85719
= 1.20	Tucson	85730
= 1.00	Tucson	85736
= 1.60	Tucson	85737
= 1.40	Tucson	85737

=	1.70	Tucson	85743
=	1.10	Tucson	85743

ARIZONA RADIATION REGULATORY AGENCY

PIMA COUNTY

PHASE TWO COUNTY RADON RESULTS 1988/1989

RESULTS	CITY NAME	ZIP
< 0.50	Tucson	85743
= 0.90	Tucson	85746
= 0.70	Tucson	85746
= 1.60	Tucson	85747
= 3.40	Tucson	85749
= 1.20	Tucson	85749
= 1.00	Tucson	85749
= 0.80	Tucson	85749
< 0.50	Tucson	85749

* Invalid Sample

All results in units of picoCuries/liter (pCi/L)

ARIZONA - EPA Map of Radon Zones

http://www.epa.gov/radon/zonemap.html

The Map of Radon Zones was developed in 1993 to identify areas of the U.S. with the potential for elevated indoor radon levels. The map is intended to help governments and other organizations target risk reduction activities and resources. The Map of Radon Zones should not be used to determine if individual homes need to be tested. No matter where you live, test your home for radon—it's easy and inexpensive Fix your home if your radon level is 4 picocuries per liter (pCi/L) (150 becquerels per meter cubed (Bq/m3)) or higher. Consider fixing if your level is between 2 and 4 pCi/L (75 - 150 Bq/m3).

The Map of Radon Zones was developed using data on indoor radon measurements, geology, aerial radioactivity, soil parameters, and foundation types. The EPA recommends that this map be supplemented with any available local data to further understand and predict the radon potential for a specific area.

All homes should be tested, regardless of zone designation.

IMPORTANT: Consult the publication entitled "Preliminary Geologic Radon Potential Assessment of Arizona" (USGS Open-file Report 93-292-I) before using this map. See https://doi.org/10.3133/ofr93292I. This document contains information on radon potential variations within counties. EPA also recommends that this map be supplemented with any available local data in order to further understand and predict the radon potential of a specific area.

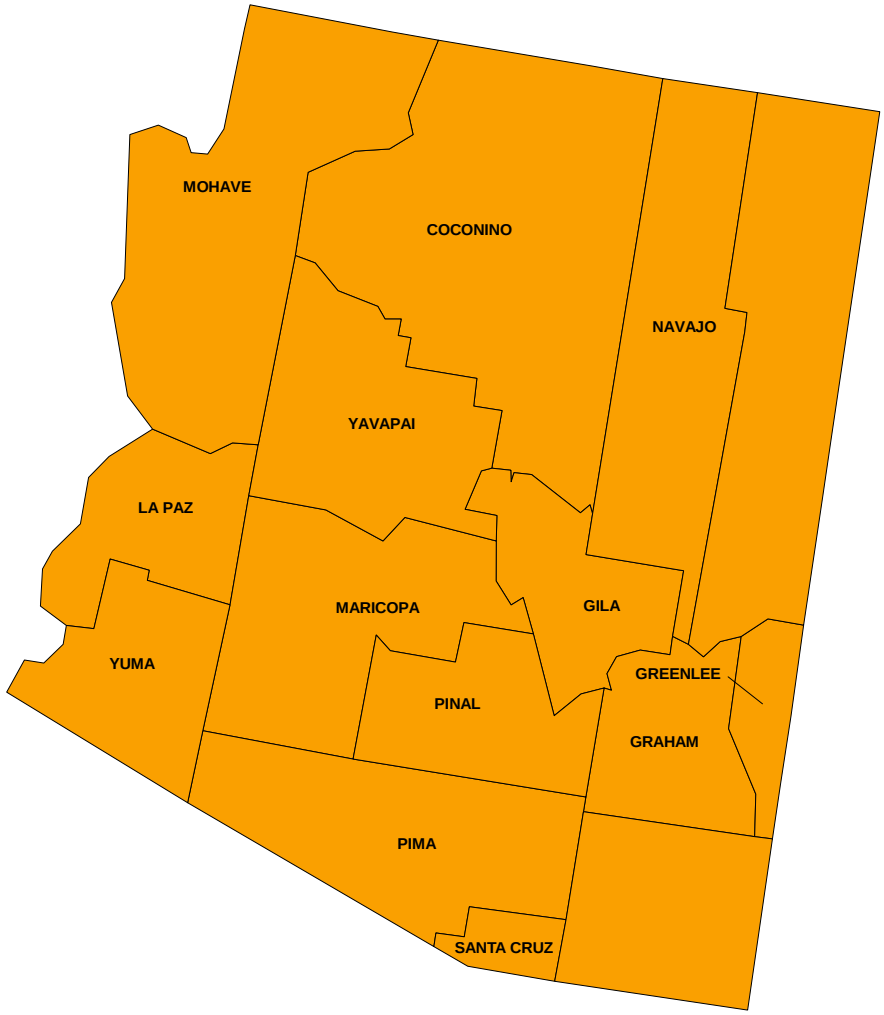

What the colors mean?

Color	Zone	Description
	Zone 1 (red zones)	Highest potential Counties have a predicted average indoor screening level > (Greater) than 4 pCi/L (picocuries per liter) (150 Bq/m3 (becquerels per meter cubed))
	Zone 2 (orange zones)	Moderate potential Counties have a predicted average screening level ≥ (Greater than and equal to) 2 pCi/L (75 Bq/m3) and ≤ (less than and equal to) 4 pCi/L (150 Bq/m3)
	Zone 3 (yellow zones)	Low potential Counties have a predicted average indoor screening level < (Less than) 2 pCi/L (75 Bq/m3)

United States Department of the Interior

FISH AND WILDLIFE SERVICE
Arizona Ecological Services Field Office
9828 North 31st Ave
#c3
Phoenix, AZ 85051-2517
Phone: (602) 242-0210 Fax: (602) 242-2513

In Reply Refer To: 11/24/2025 23:11:42 UTC
Project Code: 2025-0152911
Project Name: JTED Urban Workforce Development Via Career and Technical Education

Subject: List of threatened and endangered species that may occur in your proposed project location or may be affected by your proposed project

To Whom It May Concern:

The Fish and Wildlife Service (Service) is providing this list under section 7(c) of the Endangered Species Act (Act) of 1973, as amended (16 U.S.C. 1531 *et seq.*). The list you have generated identifies threatened, endangered, proposed, and candidate species, and designated and proposed critical habitat, that *may* occur within the One-Range that has been delineated for the species (candidate, proposed, or listed) and it's critical habitat (designated or proposed) with which your project polygon intersects. These range delineations are based on biological metrics, and do not necessarily represent exactly where the species is located. Please refer to the species information found on ECOS to determine if suitable habitat for the species on your list occurs in your project area.

The purpose of the Act is to provide a means whereby threatened and endangered species and the habitats upon which they depend may be conserved. Under sections 7(a)(1) and 7(a)(2) of the Act and its implementing regulations (50 CFR 402 *et seq.*), Federal agencies are required to utilize their authorities to carry out programs for the conservation of Federal trust resources and to determine whether projects may affect federally listed species and/or designated critical habitat. A Biological Assessment is required for construction projects (or other undertakings having similar physical impacts) that are major Federal actions significantly affecting the quality of the human environment as defined in the National Environmental Policy Act (42 U.S.C. 4332(2)(c)). For projects other than major construction activities, the Service suggests that a biological evaluation similar to a Biological Assessment be prepared to determine whether the project may affect listed or proposed species and/or designated or proposed critical habitat. Recommended contents of a Biological Assessment are described at 50 CFR 402.12.
If the Federal action agency determines that listed species or critical habitat *may be affected* by a federally funded, permitted or authorized activity, the agency must consult with us pursuant to 50 CFR 402. Note that a "may affect" determination includes effects that may not be adverse and that may be beneficial, insignificant, or discountable. An effect exists even if only one individual

or habitat segment may be affected. The effects analysis should include the entire action area, which often extends well outside the project boundary or "footprint." For example, projects that involve streams and river systems should consider downstream affects. If the Federal action agency determines that the action may jeopardize a *proposed* species or may adversely modify *proposed* critical habitat, the agency must enter into a section 7 conference. The agency may choose to confer with us on an action that may affect proposed species or critical habitat.

Candidate species are those for which there is sufficient information to support a proposal for listing. Although candidate species have no legal protection under the Act, we recommend that they be considered in the planning process in the event they become proposed or listed prior to project completion. More information on the regulations (50 CFR 402) and procedures for section 7 consultation, including the role of permit or license applicants, can be found in our Endangered Species Consultation Handbook at: https://www.fws.gov/sites/default/files/documents/endangered-species-consultation-handbook.pdf.

We also advise you to consider species protected under the Migratory Bird Treaty Act (MBTA) (16 U.S.C. 703-712) and the Bald and Golden Eagle Protection Act (Eagle Act) (16 U.S.C. 668 *et seq.*). The MBTA prohibits the taking, killing, possession, transportation, and importation of migratory birds, their eggs, parts, and nests, except when authorized by the Service. The Eagle Act prohibits anyone, without a permit, from taking (including disturbing) eagles, and their parts, nests, or eggs. Currently 1,026 species of birds are protected by the MBTA, including the western burrowing owl (*Athene cunicularia hypugaea*). Protected western burrowing owls can be found in urban areas and may use their nest/burrows year-round; destruction of the burrow may result in the unpermitted take of the owl or their eggs.

If a bald eagle or golden eagle nest occurs in or near the proposed project area, our office should be contacted for Technical Assistance. An evaluation must be performed to determine whether the project is likely to disturb or harm eagles. The National Bald Eagle Management Guidelines provide recommendations to minimize potential project impacts to bald eagles (see https://www.fws.gov/law/bald-and-golden-eagle-protection-act and https://www.fws.gov/program/eagle-management).

The Division of Migratory Birds (505/248-7882) administers and issues permits under the MBTA and Eagle Act, while our office can provide guidance and Technical Assistance. For more information regarding the MBTA, BGEPA, and permitting processes, please visit the following web site: https://www.fws.gov/program/migratory-bird-permit. Guidance for minimizing impacts to migratory birds for communication tower projects (e.g. cellular, digital television, radio, and emergency broadcast) can be found at https://www.fws.gov/media/recommended-best-practices-communication-tower-design-siting-construction-operation.

The U.S. Army Corps of Engineers (Corps) may regulate activities that involve streams (including some intermittent streams) and/or wetlands. We recommend that you contact the Corps to determine their interest in proposed projects in these areas. For activities within a National Wildlife Refuge, we recommend that you contact refuge staff for specific information about refuge resources, please visit this link or visit https://www.fws.gov/program/national-

wildlife-refuge-system to locate the refuge you would be working in or around.

If your action is on tribal land or has implications for off-reservation tribal interests, we encourage you to contact the tribe(s) and the Bureau of Indian Affairs (BIA) to discuss potential tribal concerns, and to invite any affected tribe and the BIA to participate in the section 7 consultation. In keeping with our tribal trust responsibility, we will notify tribes that may be affected by proposed actions when section 7 consultation is initiated. For more information, please contact our Tribal Coordinator, John Nystedt, at 928/556-2160 or John_Nystedt@fws.gov.

We also recommend you seek additional information and coordinate your project with the Arizona Game and Fish Department. Information on known species detections, special status species, and Arizona species of greatest conservation need, such as the western burrowing owl and the Sonoran desert tortoise (*Gopherus morafkai*) can be found by using their Online Environmental Review Tool, administered through the Heritage Data Management System and Project Evaluation Program (https://www.azgfd.com/wildlife-conservation/planning-for-wildlife/project-evaluation-program/).

We appreciate your concern for threatened and endangered species. Please include the Consultation Code in the header of this letter with any request for consultation or correspondence about your project that you submit to our office. If we may be of further assistance, please contact our Flagstaff office at 928/556-2118 for projects in northern Arizona, our general Phoenix number 602/242-0210 for central Arizona, or 520/670-6144 for projects in southern Arizona.

Sincerely,
/s/

Heather Whitlaw
Field Supervisor
Attachment

Attachment(s):

- Official Species List
- USFWS National Wildlife Refuges and Fish Hatcheries
- Bald & Golden Eagles
- Migratory Birds
- Wetlands

OFFICIAL SPECIES LIST

This list is provided pursuant to Section 7 of the Endangered Species Act, and fulfills the requirement for Federal agencies to "request of the Secretary of the Interior information whether any species which is listed or proposed to be listed may be present in the area of a proposed action".

This species list is provided by:

Arizona Ecological Services Field Office
9828 North 31st Ave
#c3
Phoenix, AZ 85051-2517
(602) 242-0210

PROJECT SUMMARY

Project Code: 2025-0152911

Project Name: JTED Urban Workforce Development Via Career and Technical Education

Project Type: Mixed-Use Construction

Project Description: The Urban Workforce Development via Career and Technical Education Project will increase access to Career and Technical Education (CTE) programs in inner city Tucson and throughout Southern Arizona by purchasing 4.5 acres of land adjacent to an existing campus currently operating at capacity. The property will become the future site of Building 3 of Bridges at JTED.

Project Location:

The approximate location of the project can be viewed in Google Maps: https://www.google.com/maps/@32.18794375,-110.95998561325898,14z

Counties: Pima County, Arizona

ENDANGERED SPECIES ACT SPECIES

There is a total of 12 threatened, endangered, or candidate species on this species list.

Species on this list should be considered in an effects analysis for your project and could include species that exist in another geographic area. For example, certain fish may appear on the species list because a project could affect downstream species.

IPaC does not display listed species or critical habitats under the sole jurisdiction of NOAA Fisheries[1], as USFWS does not have the authority to speak on behalf of NOAA and the Department of Commerce.

See the "Critical habitats" section below for those critical habitats that lie wholly or partially within your project area under this office's jurisdiction. Please contact the designated FWS office if you have questions.

---

1. NOAA Fisheries, also known as the National Marine Fisheries Service (NMFS), is an office of the National Oceanic and Atmospheric Administration within the Department of Commerce.

MAMMALS

NAME	STATUS
Jaguar *Panthera onca* There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/3944	Endangered
Ocelot *Leopardus (=Felis) pardalis* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/4474	Endangered

BIRDS

NAME	STATUS
Cactus Ferruginous Pygmy-owl *Glaucidium brasilianum cactorum* There is **final** critical habitat for this species. Species profile: https://ecos.fws.gov/ecp/species/1225	Threatened
California Least Tern *Sternula antillarum browni* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/8104	Endangered
Yellow-billed Cuckoo *Coccyzus americanus* Population: Western U.S. DPS There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/3911	Threatened

FISHES

NAME	STATUS
Desert Pupfish *Cyprinodon macularius* There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/7003	Endangered
Gila Chub *Gila intermedia* There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/51	Endangered
Gila Topminnow (incl. Yaqui) *Poeciliopsis occidentalis* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/1116	Endangered

INSECTS

NAME	STATUS
Monarch Butterfly *Danaus plexippus* There is **proposed** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/9743	Proposed Threatened

FLOWERING PLANTS

NAME	STATUS
Arizona Eryngo *Eryngium sparganophyllum* Population: There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/10705	Endangered
Huachuca Water-umbel *Lilaeopsis schaffneriana var. recurva* There is **final** critical habitat for this species. Your location does not overlap the critical habitat. Species profile: https://ecos.fws.gov/ecp/species/1201	Endangered
Pima Pineapple Cactus *Coryphantha scheeri var. robustispina* No critical habitat has been designated for this species. Species profile: https://ecos.fws.gov/ecp/species/4919	Endangered

CRITICAL HABITATS

THERE ARE NO CRITICAL HABITATS WITHIN YOUR PROJECT AREA UNDER THIS OFFICE'S JURISDICTION.

YOU ARE STILL REQUIRED TO DETERMINE IF YOUR PROJECT(S) MAY HAVE EFFECTS ON ALL ABOVE LISTED SPECIES.

USFWS NATIONAL WILDLIFE REFUGE LANDS AND FISH HATCHERIES

Any activity proposed on lands managed by the National Wildlife Refuge system must undergo a 'Compatibility Determination' conducted by the Refuge. Please contact the individual Refuges to discuss any questions or concerns.

THERE ARE NO REFUGE LANDS OR FISH HATCHERIES WITHIN YOUR PROJECT AREA.

BALD & GOLDEN EAGLES

Bald and Golden Eagles are protected under the Bald and Golden Eagle Protection Act [2] and the Migratory Bird Treaty Act (MBTA) [1]. Any person or organization who plans or conducts activities that may result in impacts to Bald or Golden Eagles, or their habitats, should follow appropriate regulations and consider implementing appropriate avoidance and minimization measures, as described in the various links on this page.

---

1. The Bald and Golden Eagle Protection Act of 1940.
2. The Migratory Birds Treaty Act of 1918.
3. 50 C.F.R. Sec. 10.12 and 16 U.S.C. Sec. 668(a)

There are Bald Eagles and/or Golden Eagles in your project area.

Measures for Proactively Minimizing Eagle Impacts
For information on how to best avoid and minimize disturbance to nesting bald eagles, please review the National Bald Eagle Management Guidelines. You may employ the timing and activity-specific distance recommendations in this document when designing your project/ activity to avoid and minimize eagle impacts. For bald eagle information specific to Alaska, please refer to Bald Eagle Nesting and Sensitivity to Human Activity.

The FWS does not currently have guidelines for avoiding and minimizing disturbance to nesting Golden Eagles. For site-specific recommendations regarding nesting Golden Eagles, please consult with the appropriate Regional Migratory Bird Office or Ecological Services Field Office.

If disturbance or take of eagles cannot be avoided, an incidental take permit may be available to authorize any take that results from, but is not the purpose of, an otherwise lawful activity. For assistance making this determination for Bald Eagles, visit the Do I Need A Permit Tool. For assistance making this determination for golden eagles, please consult with the appropriate Regional Migratory Bird Office or Ecological Services Field Office.

Ensure Your Eagle List is Accurate and Complete
If your project area is in a poorly surveyed area in IPaC, your list may not be complete and you may need to rely on other resources to determine what species may be present (e.g. your local FWS field office, state surveys, your own surveys). Please review the Supplemental Information on Migratory Birds and Eagles, to help you properly interpret the report for your specified location, including determining if there is sufficient data to ensure your list is accurate.

For guidance on when to schedule activities or implement avoidance and minimization measures to reduce impacts to bald or golden eagles on your list, see the "Probability of Presence Summary" below to see when these bald or golden eagles are most likely to be present and breeding in your project area.

NAME	BREEDING SEASON
Bald Eagle *Haliaeetus leucocephalus* This is not a Bird of Conservation Concern (BCC) in this area, but warrants attention because of the Eagle Act or for potential susceptibilities in offshore areas from certain types of development or activities. https://ecos.fws.gov/ecp/species/1626	Breeds Oct 15 to Aug 31

PROBABILITY OF PRESENCE SUMMARY

The graphs below provide our best understanding of when birds of concern are most likely to be present in your project area. This information can be used to tailor and schedule your project activities to avoid or minimize impacts to birds. Please make sure you read "Supplemental Information on Migratory Birds and Eagles", specifically the FAQ section titled "Proper Interpretation and Use of Your Migratory Bird Report" before using or attempting to interpret this report.

Probability of Presence (■)

Green bars; the bird's relative probability of presence in the 10km grid cell(s) your project overlaps during that week of the year.

Breeding Season (▪)
Yellow bars; liberal estimate of the timeframe inside which the bird breeds across its entire range.

Survey Effort (|)
Vertical black lines; the number of surveys performed for that species in the 10km grid cell(s) your project area overlaps.

No Data (–)
A week is marked as having no data if there were no survey events for that week.

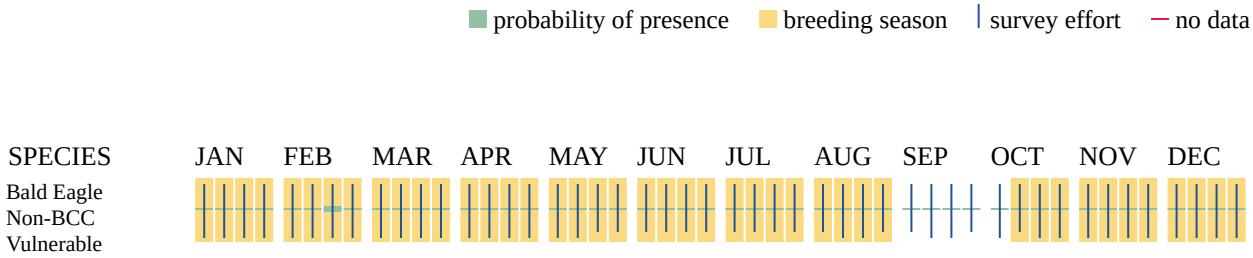

Additional information can be found using the following links:

- Eagle Management https://www.fws.gov/program/eagle-management
- Measures for avoiding and minimizing impacts to birds https://www.fws.gov/library/collections/avoiding-and-minimizing-incidental-take-migratory-birds
- Nationwide avoidance and minimization measures for birds https://www.fws.gov/sites/default/files/documents/nationwide-standard-conservation-measures.pdf
- Supplemental Information for Migratory Birds and Eagles in IPaC https://www.fws.gov/media/supplemental-information-migratory-birds-and-bald-and-golden-eagles-may-occur-project-action

MIGRATORY BIRDS

The Migratory Bird Treaty Act (MBTA) [1] prohibits the take (including killing, capturing, selling, trading, and transport) of protected migratory bird species without prior authorization by the Department of Interior U.S. Fish and Wildlife Service (Service).

---

1. The Migratory Birds Treaty Act of 1918.
2. The Bald and Golden Eagle Protection Act of 1940.
3. 50 C.F.R. Sec. 10.12 and 16 U.S.C. Sec. 668(a)

For guidance on when to schedule activities or implement avoidance and minimization measures to reduce impacts to migratory birds on your list, see the "Probability of Presence Summary" below to see when these birds are most likely to be present and breeding in your project area.

NAME	BREEDING SEASON
American Avocet *Recurvirostra americana* This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA https://ecos.fws.gov/ecp/species/11927	Breeds Apr 21 to Aug 10
Bald Eagle *Haliaeetus leucocephalus* This is not a Bird of Conservation Concern (BCC) in this area, but warrants attention because of the Eagle Act or for potential susceptibilities in offshore areas from certain types of development or activities. https://ecos.fws.gov/ecp/species/1626	Breeds Oct 15 to Aug 31
Black-chinned Sparrow *Spizella atrogularis* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/9447	Breeds Apr 15 to Jul 31
Costa's Hummingbird *Calypte costae* This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA https://ecos.fws.gov/ecp/species/9470	Breeds Jan 15 to Jun 10
Gila Woodpecker *Melanerpes uropygialis* This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA https://ecos.fws.gov/ecp/species/5960	Breeds Apr 1 to Aug 31
Grace's Warbler *Setophaga graciae* This is a Bird of Conservation Concern (BCC) only in particular Bird Conservation Regions (BCRs) in the continental USA https://ecos.fws.gov/ecp/species/9514	Breeds May 20 to Jul 20
Lawrence's Goldfinch *Spinus lawrencei* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/9464	Breeds Mar 20 to Sep 20
Western Grebe *aechmophorus occidentalis* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/6743	Breeds Jun 1 to Aug 31
Willet *Tringa semipalmata* This is a Bird of Conservation Concern (BCC) throughout its range in the continental USA and Alaska. https://ecos.fws.gov/ecp/species/10669	Breeds elsewhere

PROBABILITY OF PRESENCE SUMMARY

The graphs below provide our best understanding of when birds of concern are most likely to be present in your project area. This information can be used to tailor and schedule your project activities to avoid or minimize impacts to birds. Please make sure you read "Supplemental Information on Migratory Birds and Eagles", specifically the FAQ section titled "Proper Interpretation and Use of Your Migratory Bird Report" before using or attempting to interpret this report.

Probability of Presence (■)

Green bars; the bird's relative probability of presence in the 10km grid cell(s) your project overlaps during that week of the year.

Breeding Season (■)
Yellow bars; liberal estimate of the timeframe inside which the bird breeds across its entire range.

Survey Effort (|)
Vertical black lines; the number of surveys performed for that species in the 10km grid cell(s) your project area overlaps.

No Data (–)
A week is marked as having no data if there were no survey events for that week.

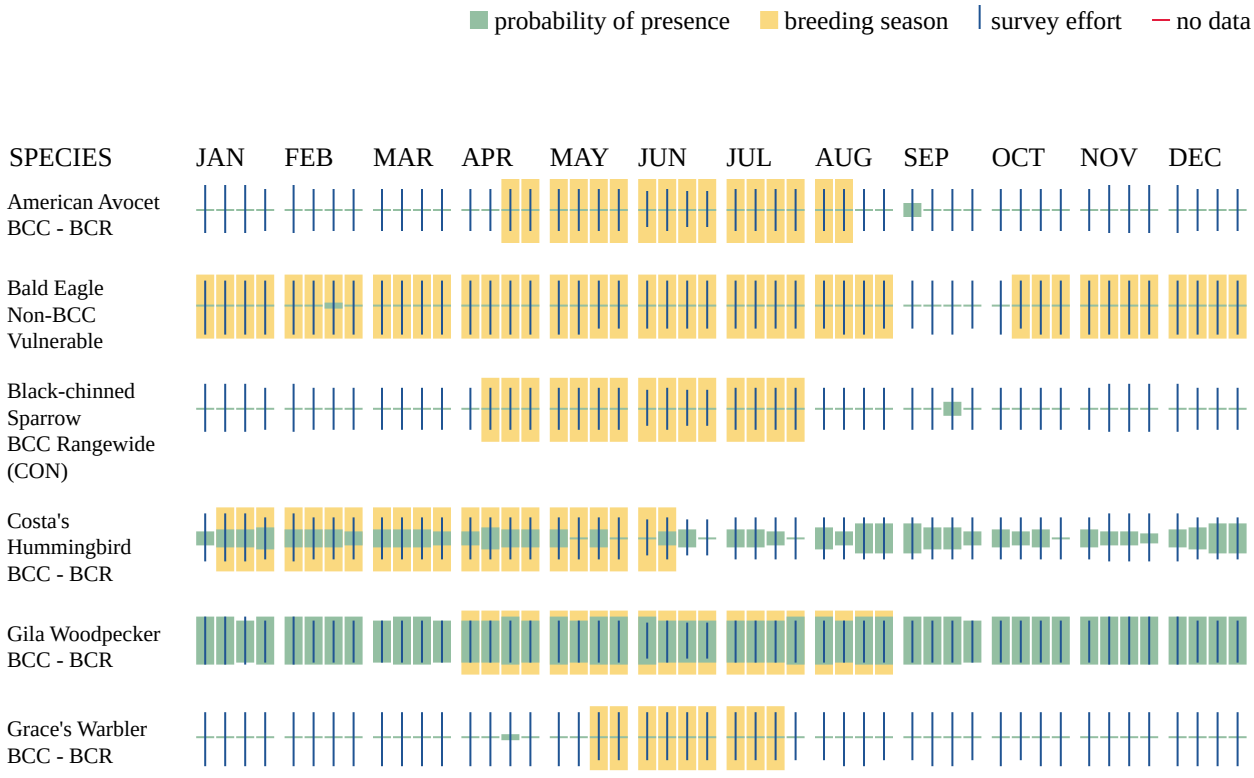

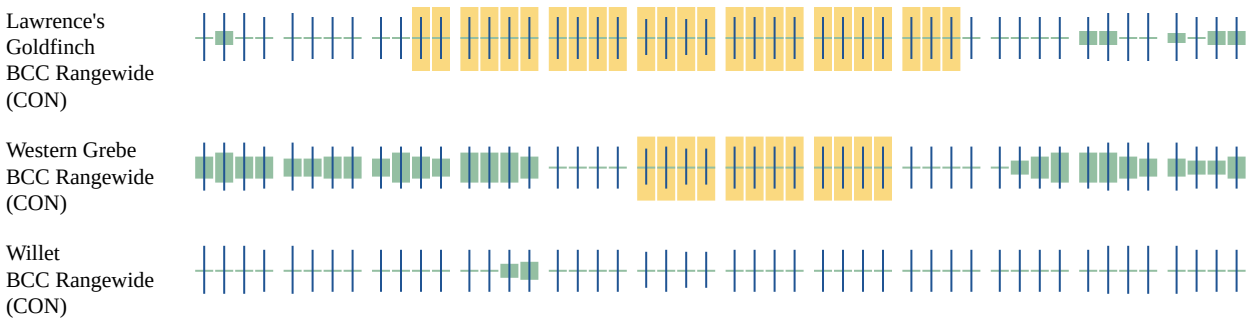

Additional information can be found using the following links:

- Eagle Management https://www.fws.gov/program/eagle-management
- Measures for avoiding and minimizing impacts to birds https://www.fws.gov/library/collections/avoiding-and-minimizing-incidental-take-migratory-birds
- Nationwide avoidance and minimization measures for birds
- Supplemental Information for Migratory Birds and Eagles in IPaC https://www.fws.gov/media/supplemental-information-migratory-birds-and-bald-and-golden-eagles-may-occur-project-action

WETLANDS

Impacts to NWI wetlands and other aquatic habitats may be subject to regulation under Section 404 of the Clean Water Act, or other State/Federal statutes.

For more information please contact the Regulatory Program of the local U.S. Army Corps of Engineers District.

Please note that the NWI data being shown may be out of date. We are currently working to update our NWI data set. We recommend you verify these results with a site visit to determine the actual extent of wetlands on site.

THERE ARE NO WETLANDS WITHIN YOUR PROJECT AREA.

IPAC USER CONTACT INFORMATION

Agency: Private Entity
Name: Daja Burley
Address: 1805 West Drake Drive
City: Tempe
State: AZ
Zip: 85283
Email dburley@rma-western.com
Phone: 6232120049

LEAD AGENCY CONTACT INFORMATION

Lead Agency: Department of Housing and Urban Development

Prime and other Important Farmlands

This table lists the map units in the survey area that are considered important farmlands. Important farmlands consist of prime farmland, unique farmland, and farmland of statewide or local importance. This list does not constitute a recommendation for a particular land use.

In an effort to identify the extent and location of important farmlands, the Natural Resources Conservation Service, in cooperation with other interested Federal, State, and local government organizations, has inventoried land that can be used for the production of the Nation's food supply.

Prime farmland is of major importance in meeting the Nation's short- and long-range needs for food and fiber. Because the supply of high-quality farmland is limited, the U.S. Department of Agriculture recognizes that responsible levels of government, as well as individuals, should encourage and facilitate the wise use of our Nation's prime farmland.

Prime farmland, as defined by the U.S. Department of Agriculture, is land that has the best combination of physical and chemical characteristics for producing food, feed, forage, fiber, and oilseed crops and is available for these uses. It could be cultivated land, pastureland, forestland, or other land, but it is not urban or built-up land or water areas. The soil quality, growing season, and moisture supply are those needed for the soil to economically produce sustained high yields of crops when proper management, including water management, and acceptable farming methods are applied. In general, prime farmland has an adequate and dependable supply of moisture from precipitation or irrigation, a favorable temperature and growing season, acceptable acidity or alkalinity, an acceptable salt and sodium content, and few or no rocks. The water supply is dependable and of adequate quality. Prime farmland is permeable to water and air. It is not excessively erodible or saturated with water for long periods, and it either is not frequently flooded during the growing season or is protected from flooding. Slope ranges mainly from 0 to 6 percent. More detailed information about the criteria for prime farmland is available at the local office of the Natural Resources Conservation Service.

For some of the soils identified in the table as prime farmland, measures that overcome a hazard or limitation, such as flooding, wetness, and droughtiness, are needed. Onsite evaluation is needed to determine whether or not the hazard or limitation has been overcome by corrective measures.

A recent trend in land use in some areas has been the loss of some prime farmland to industrial and urban uses. The loss of prime farmland to other uses puts pressure on marginal lands, which generally are more erodible, droughty, and less productive and cannot be easily cultivated.

Unique farmland is land other than prime farmland that is used for the production of specific high-value food and fiber crops, such as citrus, tree nuts, olives, cranberries, and other fruits and vegetables. It has the special combination of soil quality, growing season, moisture supply, temperature, humidity, air drainage, elevation, and aspect needed for the soil to economically produce sustainable high yields of these crops when properly managed. The water supply is dependable and of adequate quality. Nearness to markets is an additional consideration. Unique farmland is not based on national criteria. It commonly is in areas where there is a special microclimate, such as the wine country in California.

In some areas, land that does not meet the criteria for prime or unique farmland is considered to be *farmland of statewide importance* for the production of food, feed, fiber, forage, and oilseed crops. The criteria for defining and delineating farmland of statewide importance are determined by the appropriate State agencies. Generally, this land includes areas of soils that nearly meet the requirements for prime farmland and that economically produce high yields of crops when treated and managed according to acceptable farming methods. Some areas may produce as high a yield as prime farmland if conditions are favorable. Farmland of statewide importance may include tracts of land that have been designated for agriculture by State law.

In some areas that are not identified as having national or statewide importance, land is considered to be *farmland of local importance* for the production of food, feed, fiber, forage, and oilseed crops. This farmland is identified by the appropriate local agencies. Farmland of local importance may include tracts of land that have been designated for agriculture by local ordinance.

Report—Prime and other Important Farmlands

Prime and other Important Farmlands–Pima County, Arizona, Eastern Part		
Map Symbol	**Map Unit Name**	**Farmland Classification**
11	Cave soils and urban land, 0 to 8 percent slopes	Not prime farmland
47	Mohave soils and urban land, 1 to 8 percent slopes	Not prime farmland

Data Source Information

Soil Survey Area: Pima County, Arizona, Eastern Part
Survey Area Data: Version 23, Aug 30, 2024

JTED

751 East Marketplace Boulevard

Tucson, AZ 85713

Inquiry Number: 7970166.8

April 25, 2025

The EDR Aerial Photo Decade Package

6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

04/25/25

Site Name:

JTED
751 East Marketplace Boulevar
Tucson, AZ 85713
EDR Inquiry # 7970166.8

Client Name:

Western Technologies, Inc.
3480 South Dodge Boulevard
Tucson, AZ 85713
Contact: Kenna Karjala

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

Year	*Scale*	*Details*	*Source*
2019	1"=500'	Flight Year: 2019	USDA/NAIP
2015	1"=500'	Flight Year: 2015	USDA/NAIP
2010	1"=500'	Flight Year: 2010	USDA/NAIP
2007	1"=500'	Flight Year: 2007	USDA/NAIP
2003	1"=500'	Acquisition Date: January 01, 2003	USGS/DOQQ
1996	1"=500'	Acquisition Date: June 02, 1996	USGS/DOQQ
1992	1"=500'	Acquisition Date: January 01, 1992	USGS/DOQQ
1984	1"=500'	Flight Date: June 07, 1984	USDA
1976	1"=500'	Flight Date: April 23, 1976	USDA
1972	1"=500'	Flight Date: January 06, 1972	USGS
1967	1"=500'	Flight Date: April 10, 1967	USGS
1958	1"=500'	Flight Date: February 06, 1958	USGS
1954	1"=500'	Flight Date: February 17, 1954	USDA
1949	1"=500'	Flight Date: February 23, 1949	USDA
1936	1"=500'	Flight Date: February 22, 1936	SCS

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.

Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2025 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

INQUIRY #: 7970166.8
YEAR: 2019
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 2015
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 2010
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 2007
= 500'
N
EDR

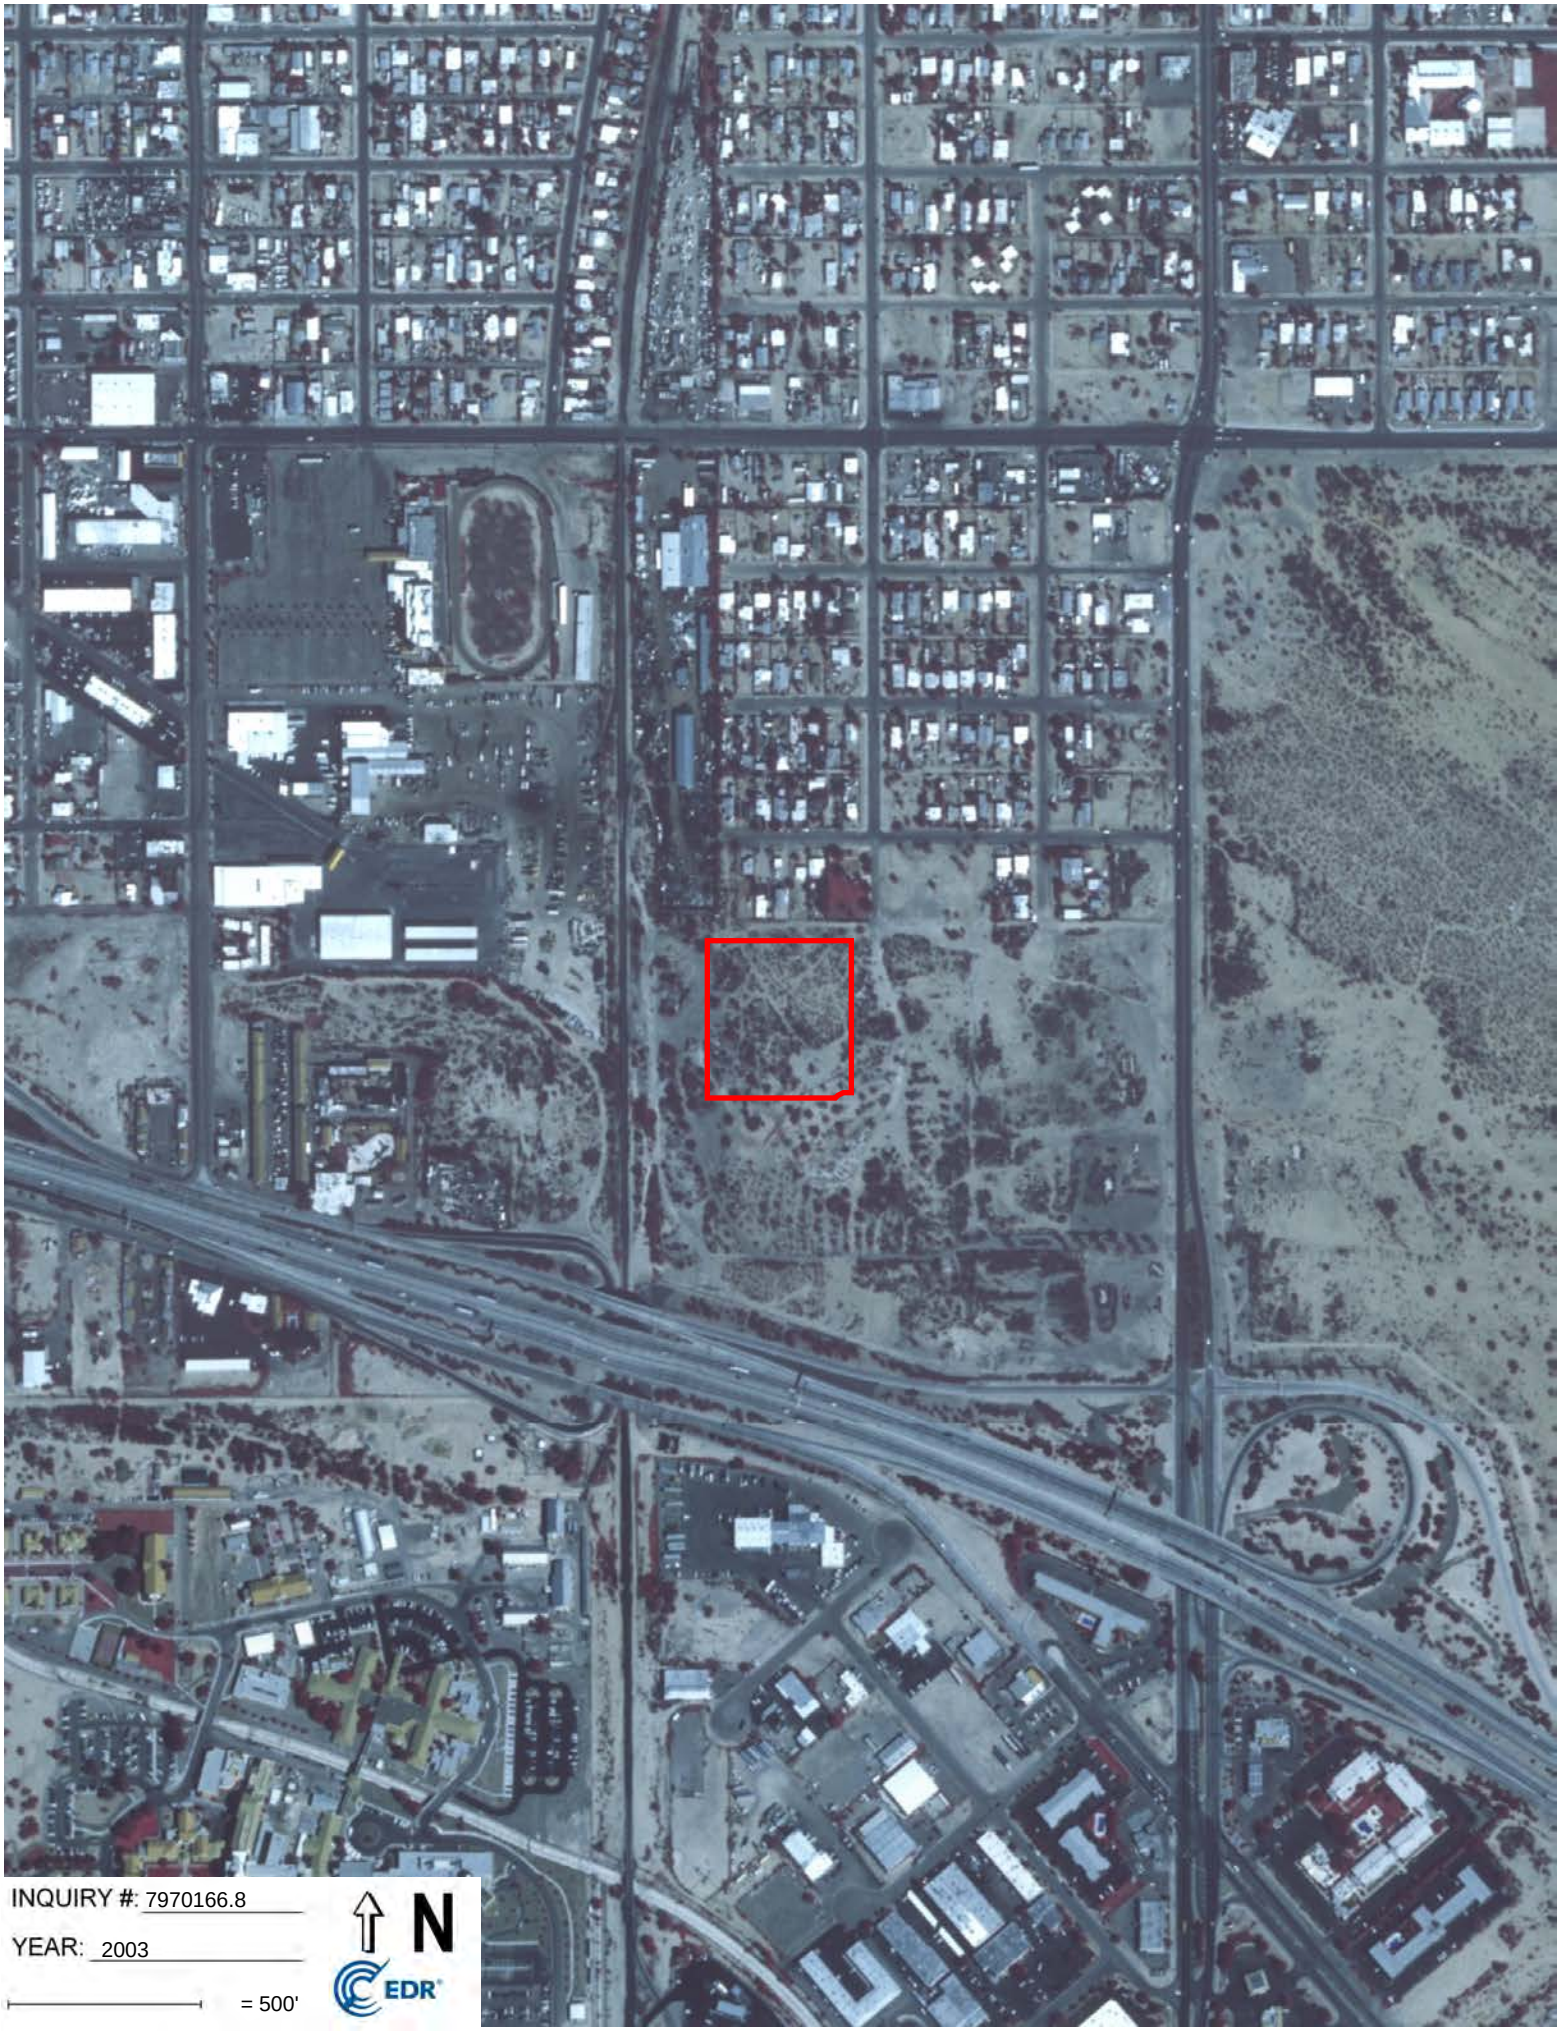
INQUIRY #: 7970166.8
YEAR: 2003
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1996
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1992
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1984
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1976
= 500'
N
EDR

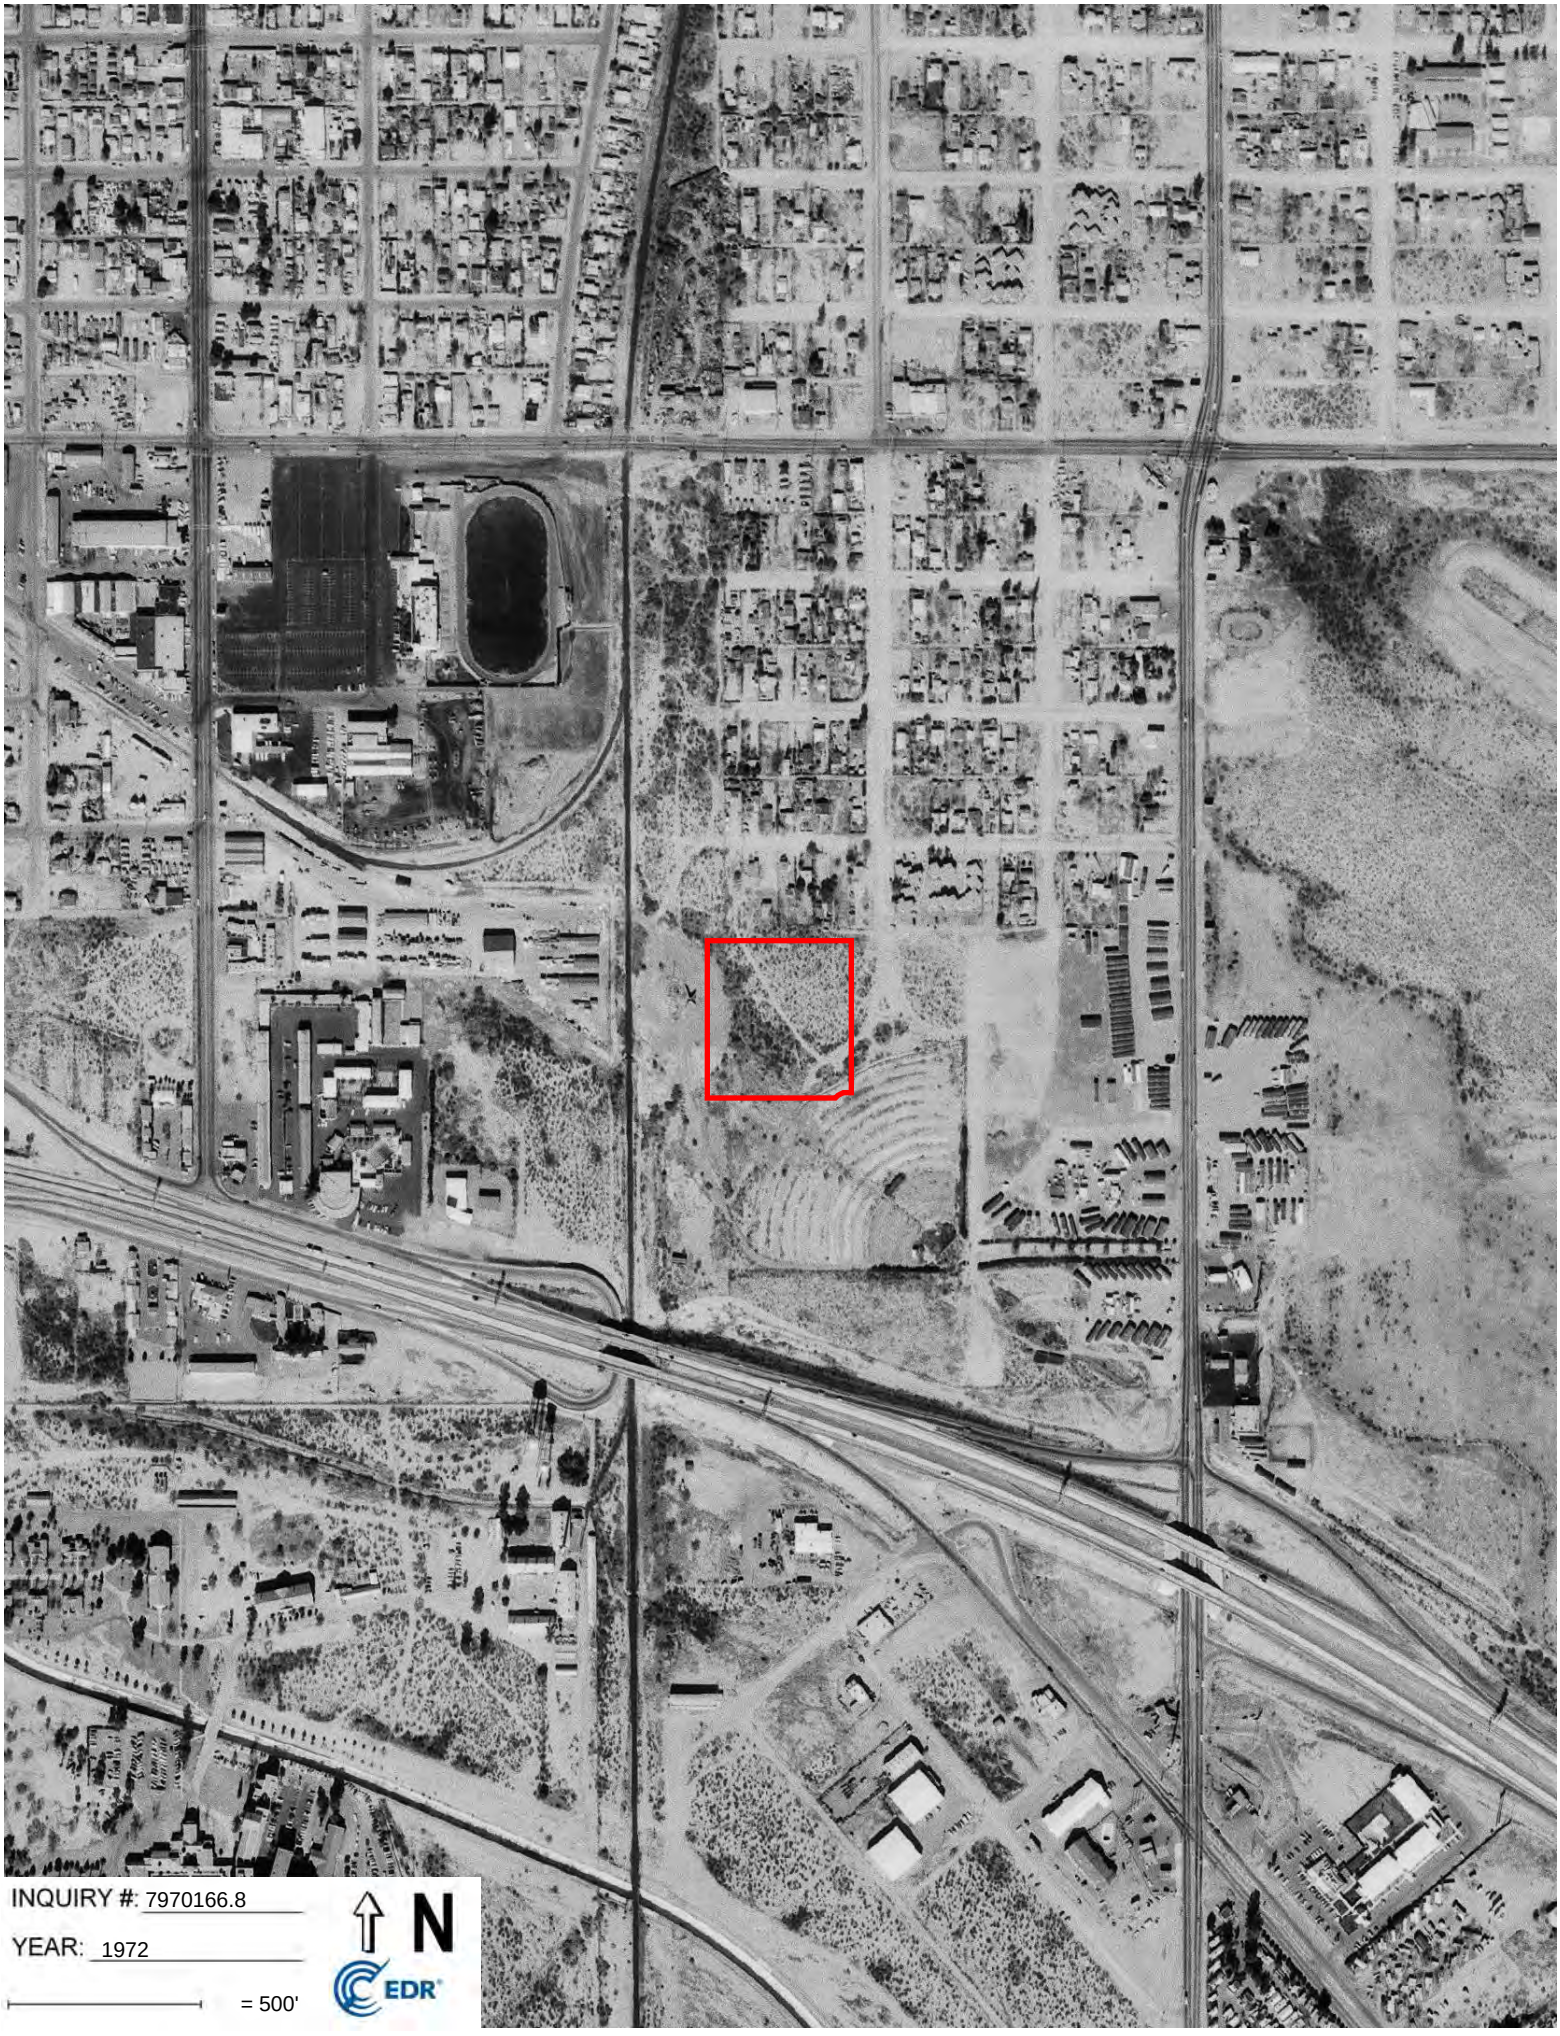
INQUIRY #: 7970166.8
YEAR: 1972
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1967
= 500'
N
EDR

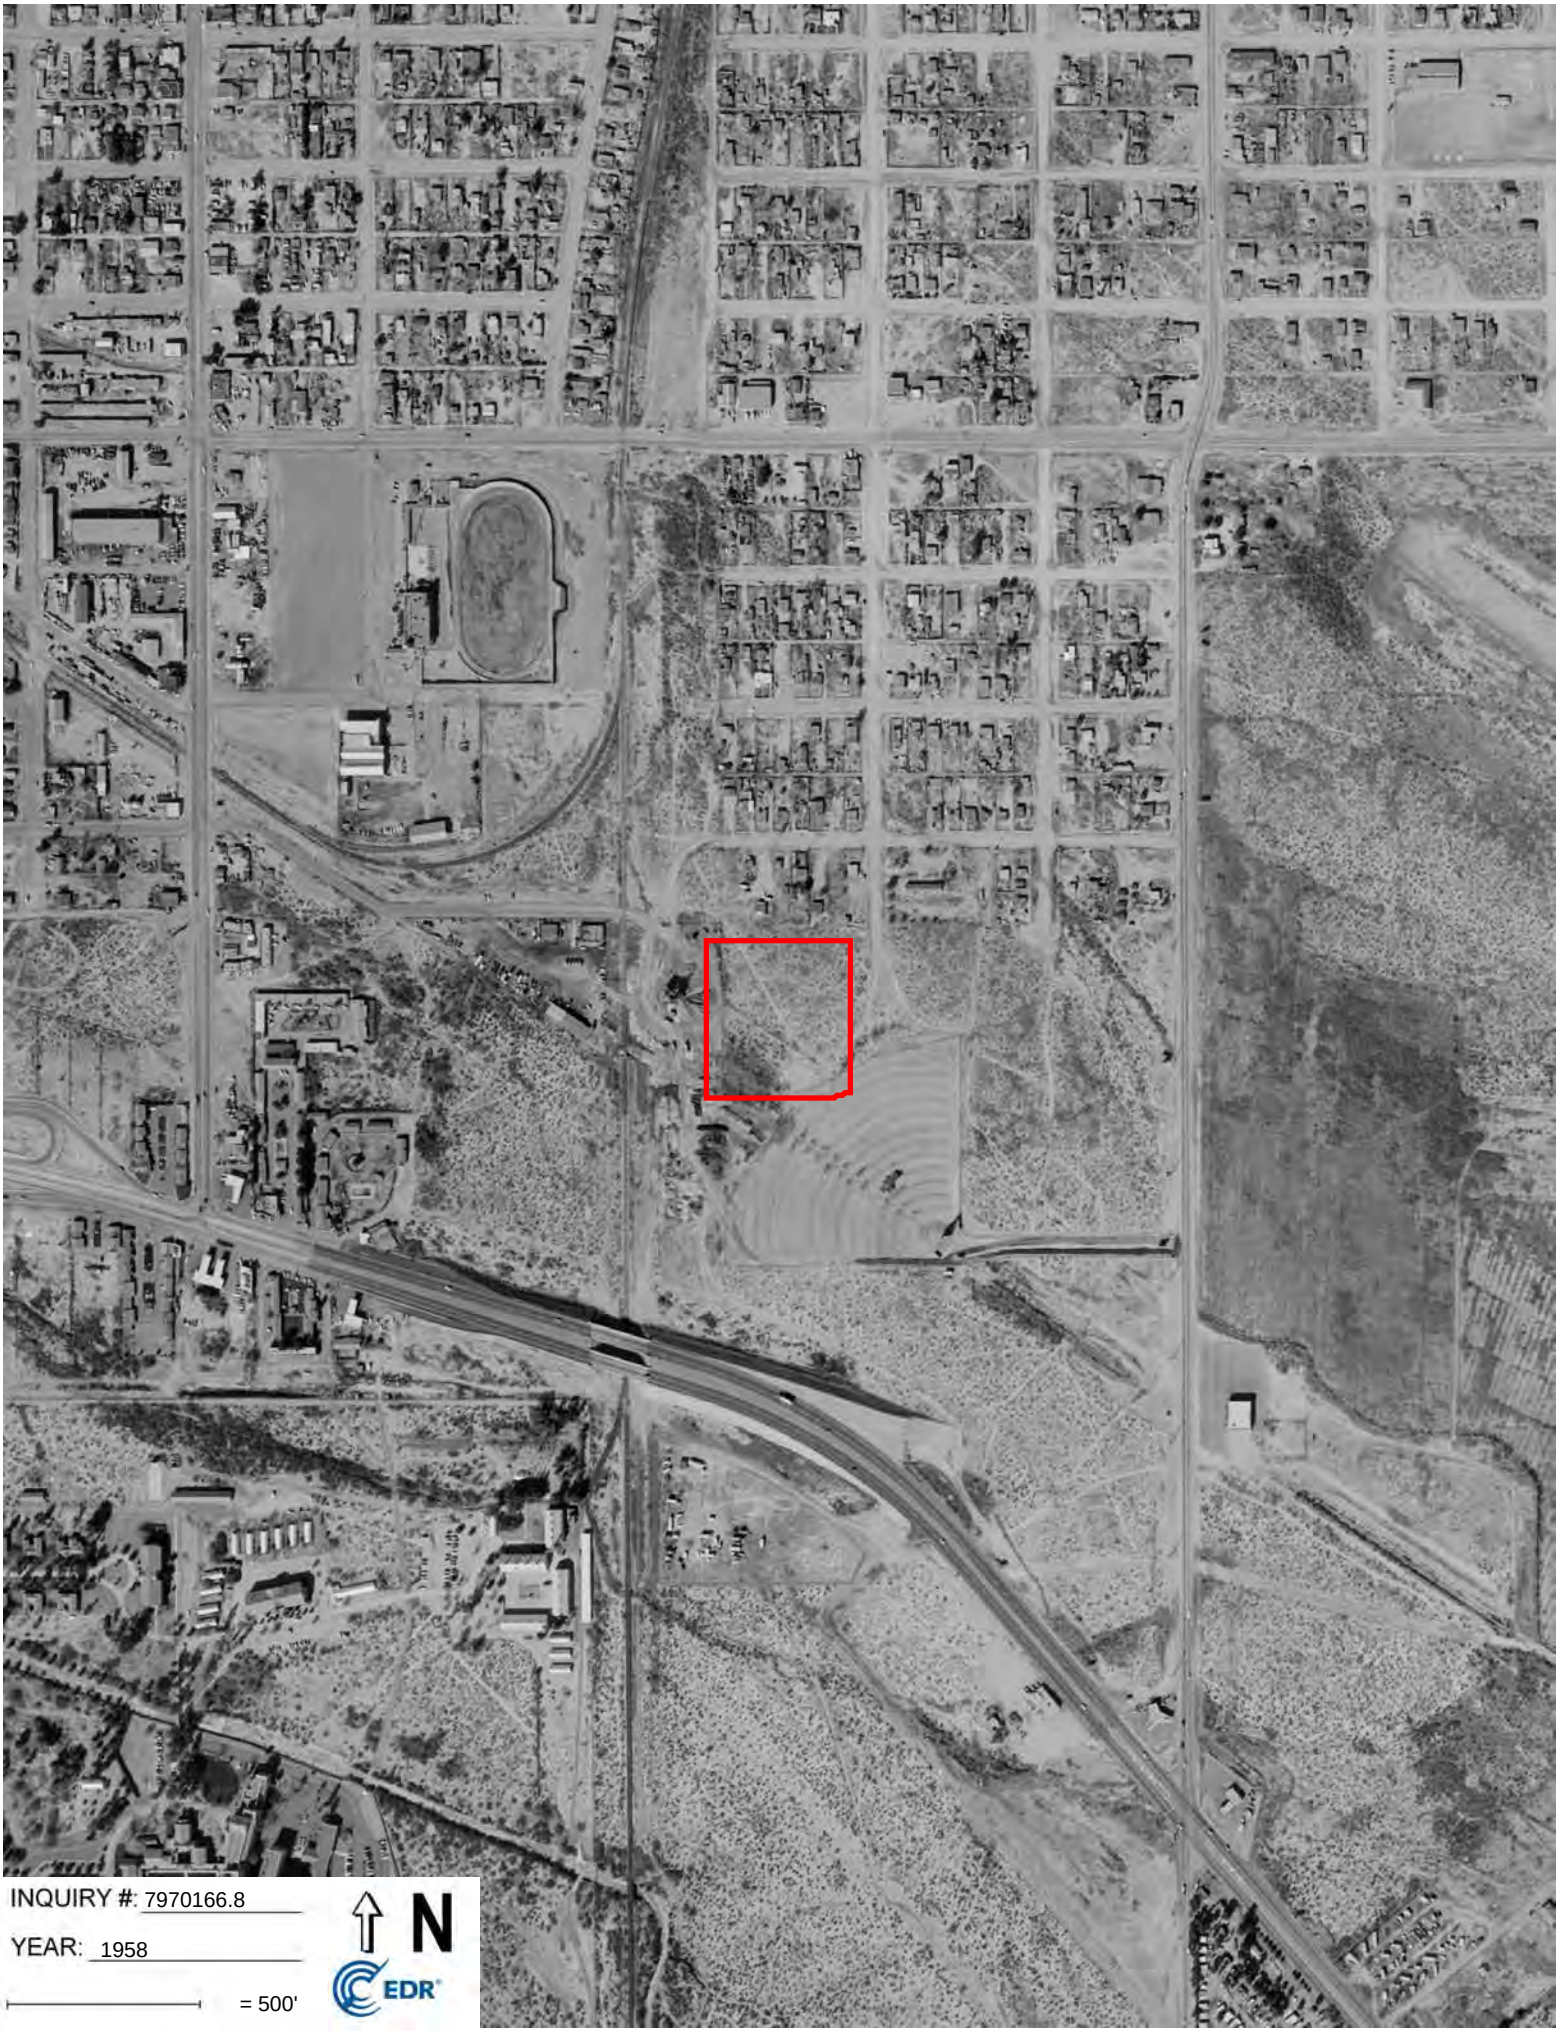
INQUIRY #: 7970166.8
YEAR: 1958
= 500'
N
EDR

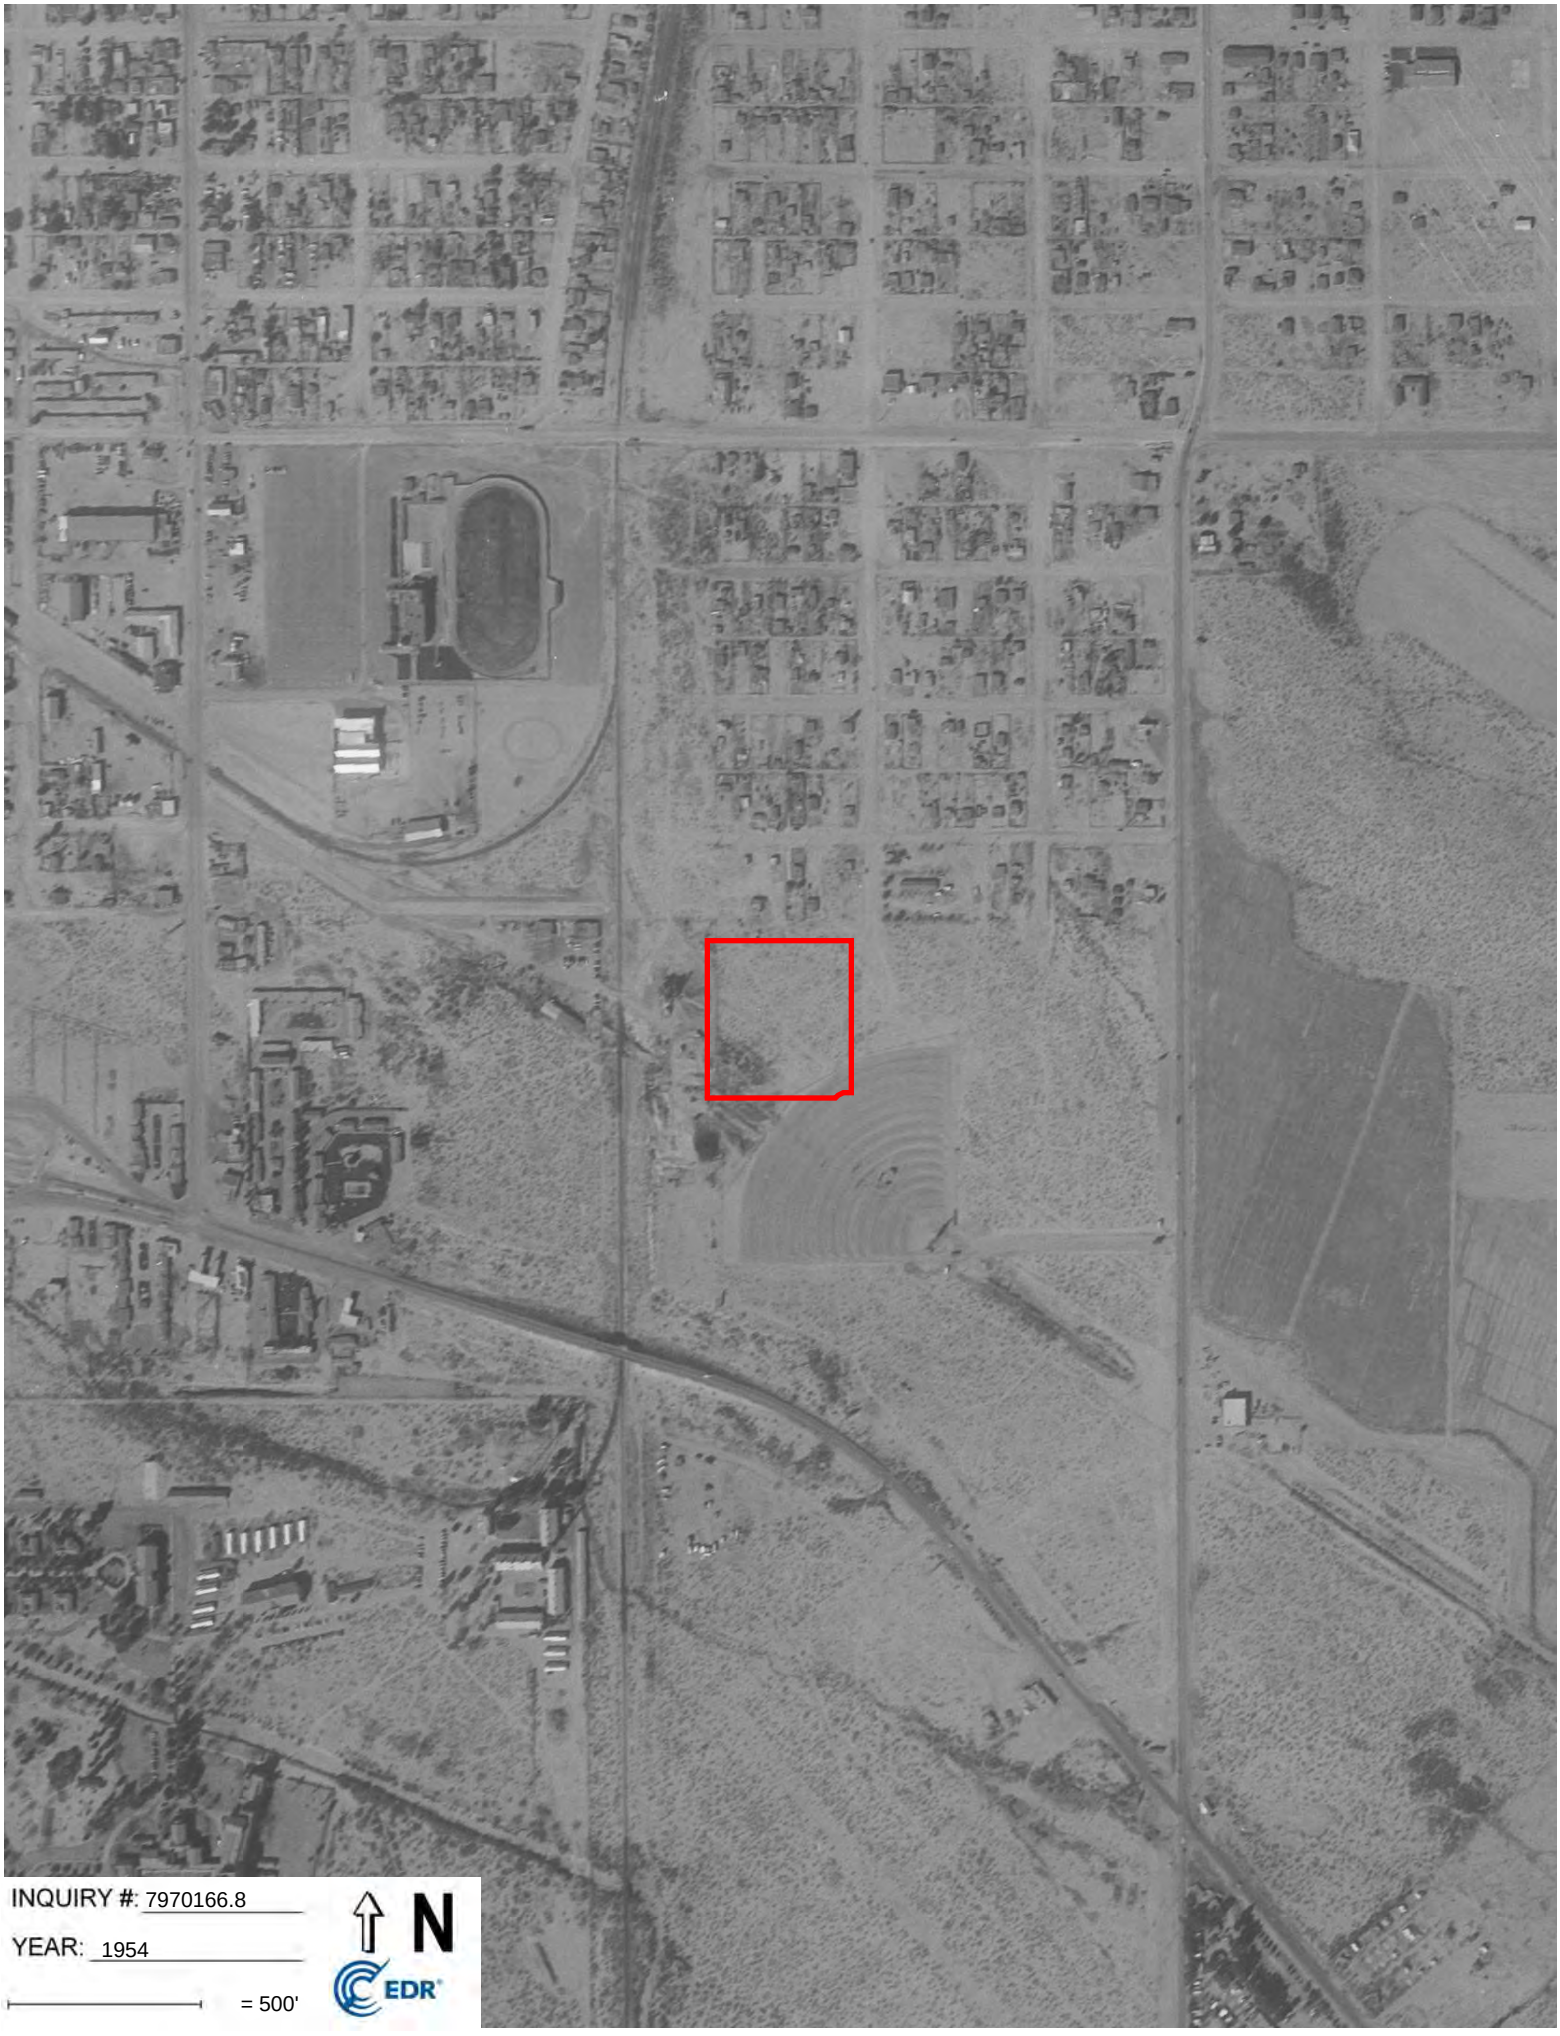
INQUIRY #: 7970166.8
YEAR: 1954
= 500'
N
EDR

INQUIRY #: 7970166.8
YEAR: 1949
= 500'
N
EDR

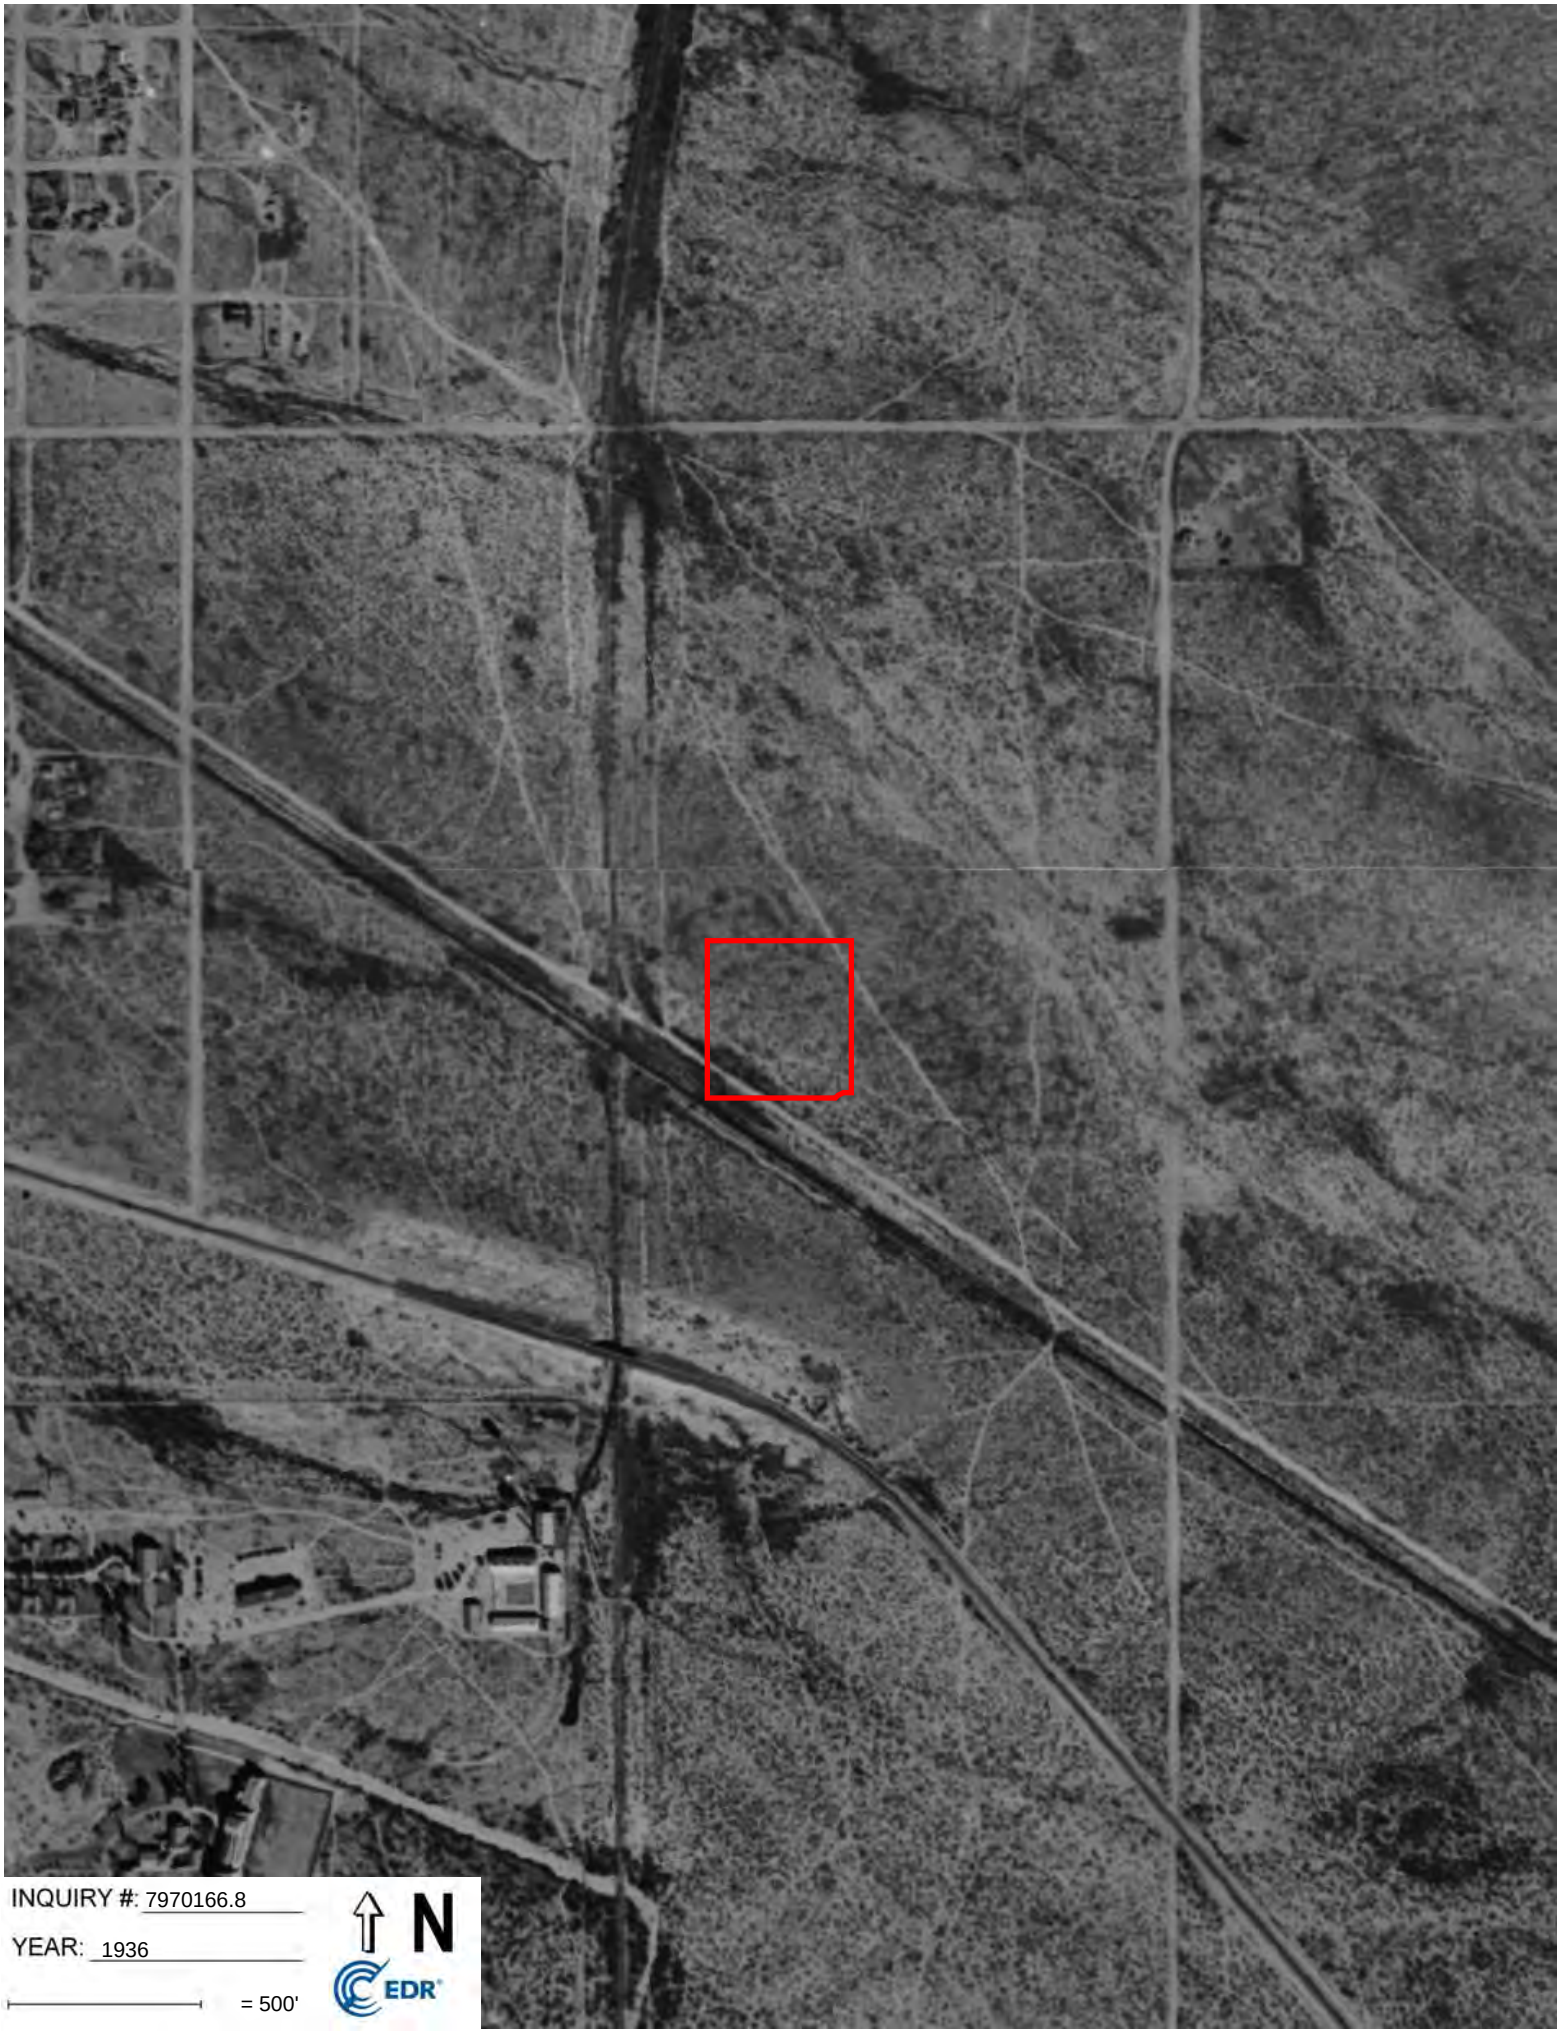
INQUIRY #: 7970166.8
YEAR: 1936
= 500'
N
EDR

ERR L

City of Tucson Planning and Zoning Map

Legend

- Parcel Labels
- Parcels

Notes

752.3 0 376.17 752.3 Feet

WGS_1984_Web_Mercator_Auxiliary_Sphere

© City of Tucson

This map is a user generated static output from an Internet mapping site and is for reference only. Data layers that appear on this map may or may not be accurate, current, or otherwise reliable.

THIS MAP IS NOT TO BE USED FOR NAVIGATION

ERR M1

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
Jennifer.heminokeky@fortsillapache-nsn.gov
Micheal.darrow@fortsillapache-nsn.gov

Fort Sill Apache Tribe of Oklahoma
Chairwoman Jennifer Heminokeky
43187 US Highway 281
Apache, Oklahoma 73006

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairwoman Jennifer Hemionkeky,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
Skoyiyumptewa@hopi.nsn.us
Tnuvangyaoma@hopi.nsn.us

Hopi Tribe of Arizona
Chairman Timothy Nuvangyaoma
123 Main Street
Kykotsmovi Village, Arizona 86039

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairman Timothy Nuvangyaoma,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
jhernandez1@pascuayaqui-nsn.gov
khoerig@pascuayaqui-nsn.gov

Pascua Yaqui Tribe of Arizona
Chairman Julian Hernandez
7777 South Camino Huivisim, Building C
Tucson, Arizona 85757

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairman Julian Hernandez,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
Trambler@scatui.net
Apachevern@yahoo.com

San Carlos Apache Tribe
Chairman Terry Rambler
San Carlos Avenue
San Carlos, Arizona 85550

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairman Terry Rambler

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
Verlon.jose@tonation-nsn.gov
Peter.steere@tonation-nsn.gov

Tohono O'odham Nation
Chairman Verlon Jose
Tohono O'odham Nation Main Tribal Business Loop
Sells, Arizona 85634

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairman Verlon Jose,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

May 16, 2025

SENT VIA EMAIL
Kaseyvelasquez@wmat.us
markaltaha@wmat.us

White Mountain Apache Tribe
Chairman Kasey Velasquez
201 East Walnut Street,
Whiteriver Arizona, 85941

Re: ***Request for Tribal Comments for Proposed HUD-Funded Undertaking***
751 East Tucson Marketplace Boulevard
Tucson, Arizona 85713

Dear Chairman Kasey Velasquez,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. We respectfully request you to review this undertaking's potential

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

impacts and effects upon historic properties and provide written comments within thirty (30) calendar days of receipt of this letter.

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

Kage Anderson
Environmental Scientist I ***Western Technologies***
*An **RMA** Company*
3480 South Dodge Boulevard, Tucson, AZ 85713-5435
O (520) 748-2262
C (520) 444-8639

We are thrilled that Western Technologies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com. During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.

From: Karl Hoerig <khoerig@pascuayaqui-nsn.gov>
Sent: Friday, May 23, 2025 2:55 PM
To: Kage Anderson <kanderson@rma-western.com>
Cc: Dajahnique Burley <dburley@rma-western.com>; Julian Hernandez <jhernandez1@pascuayaqui-nsn.gov>
Subject: Re: Request for Tribal Comments for Proposed HUD-Funded Undertaking - JTED Career and Technology Education Building

Dear Kage,

Thank you for requesting consultation with the Pascua Yaqui Tribe regarding the planned application of Pima JTED to HUD for funding to purchase 4.09 acres at 751 E. Tucson Marketplace, and to construct new buildings and parking for Innovation Tech High School. The PYT THPO has no information that would suggest this project will have any effect on heritage resources of importance to the Tribe.

With warmest wishes,
Karl

Karl A. Hoerig, Ph.D.
Tribal Historic Preservation Officer
Pascua Yaqui Tribe
5100 W. Calle Tetakusim, Room 130
Tucson, AZ 85757
(520) 883-5116
karl.hoerig@pascuayaqui-nsn.gov

From: Dajahnique Burley <dburley@rma-western.com>
Sent: Friday, May 16, 2025 9:27 AM
To: Julian Hernandez <jhernandez1@pascuayaqui-nsn.gov>
Cc: Karl Hoerig <khoerig@pascuayaqui-nsn.gov>; Kage Anderson <kanderson@rma-western.com>
Subject: Request for Tribal Comments for Proposed HUD-Funded Undertaking - JTED Career and Technology Education Building

CAUTION - Beware External Email - Think Before You Act.

WARNING - This email originated from outside of the organization! Do not click links, open attachments or reply, unless you recognize the sender's email address and know the content is safe!

Good morning,

Please find the attached request for tribal comments for the proposed HUD-funded undertaking by JTED for a new 50,000-square-foot Career and Technology Education building on approximately 4 acres of vacant land. The Project Site is located at 751 East Tucson Marketplace Boulevard in Tucson, Arizona.

Thank you!

Dajahnique Burley
Environmental Scientist

She/her
c: (623) 212-0049
1805 West Drake Drive
Tempe, Arizona 85283
dburley@rma-western.com | https://www.certerra.com/

We are thrilled that RMA Companies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com. During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.

Caution: This email originated from outside of the organization. DO NOT click on links or open attachments unless you were expecting the email, recognize the sender, and know the content is safe.

Outlook

RE: Request for Tribal Comments for Proposed HUD-Funded Undertaking - JTED Career and Technology Education Building

From Peter Steere <Peter.Steere@tonation-nsn.gov>
Date Fri 5/16/2025 9:55 AM
To Dajahnique Burley <dburley@rma-western.com>

Dajahnique Burley
Environmental Scientist
Western Technologies

Thank you for consulting with the Tohono O'odham Nation regarding the HUD ITED Career and Technology Education Building

The Tohono O'odham Nation concurs that "no historic properties" will be affected by this proposed construction project

You mention that if buried cultural deposits including burials are encountered during construction you will contact the Arizona State Museum

That is fine

Please note that you will also need to contact the Tribal Historic Preservation Office of the Tohono O'odham Nation also

Peter L. Steere
Tribal Historic Preservation Officer
Tohono O'odham Nation

520-383-3622

Cell 520-471-34358

From: Dajahnique Burley <dburley@rma-western.com>
Sent: Friday, May 16, 2025 9:23 AM
To: Verlon M. Jose <Verlon.Jose@tonation-nsn.gov>
Cc: Peter Steere <Peter.Steere@tonation-nsn.gov>; Kage Anderson <kanderson@rma-western.com>
Subject: Request for Tribal Comments for Proposed HUD-Funded Undertaking - JTED Career and Technology Education Building

Some people who received this message don't often get email from dburley@rma-western.com. Learn why this is important
CAUTION: This email originated from outside your organization. Exercise caution when opening attachments or clicking links, especially from unknown senders.
Good morning,

Please find the attached request for tribal comments for the proposed HUD-funded undertaking by JTED for a new 50,000-square-foot Career and Technology Education building on approximately 4 acres of vacant land. The

Project Site is located at 751 East Tucson Marketplace Boulevard in Tucson, Arizona.

Thank you!

Dajahnique Burley
Environmental Scientist

She/her
c: (623) 212-0049
1805 West Drake Drive
Tempe, Arizona 85283
dburley@rma-western.com | https://www.certerra.com/

We are thrilled that RMA Companies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.

Caution: This email originated from outside of the organization. DO NOT click on links or open attachments unless you were expecting the email, recognize the sender, and know the content is safe.

White Mountain Apache Tribe

Office of Historic Preservation
PO Box 1032
Fort Apache, AZ 85926
Ph: (928) 338-3033 Fax: (928) 338-6055

To: Tina Norton – Pima County JTED District 11

Date: May 21, 2025

Re: *Acquisition of land for the expansion of the Innovation Tech High School*

……

The White Mountain Apache Tribe Historic Preservation Office appreciates receiving information on the project dated; *May 16, 2025.* In regard to this, please refer to the following statement(s) below;

Thank you for allowing the White Mountain Apache tribe the opportunity to review and respond to the above proposed acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School, located at 751 East Tucson Market Place Boulevard, Tucson, Pima County, Arizona.

Please be advised, we have reviewed the information provided, and we have determined the proposed land acquisition project will have a ***"No Adverse Effect"*** on the tribe's cultural heritage resources and/or historic properties.

Thank you for the continued tribal engagement and consultation, and collaborations in protecting and preserving places of cultural and historical importance.

Sincerely,

Mark Altaha

White Mountain Apache Tribe – THPO
Historic Preservation Office

ERR M3

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

April 30, 2025

Kathryn Leonard, Arizona State Historic Preservation Officer
AZSHPO@stateparks.com
State Historic Preservation Office (SHPO)
1110 West Washington Street #100
Phoenix Arizona 85007

Re: Proposed HUD-Funded Undertaking at 751 East Tucson Marketplace Boulevard in Tucson, Arizona

Dear Kathryn Leonard,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. Please review this undertaking's potential impacts and effects upon

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

historic properties and provide concurrence within thirty (30) calendar days of receipt of this letter. Your assistance is valued, and we look forward to consulting further if there are historic properties of significance affected by this project. Any written responses should be sent to the following address:

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

LEGEND

APPROXIMATE AREA OF POTENTIAL EFFECTS (APE)

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	1
WT Job No. 29-824105-0	
Area of Potential Effects (APE) Map	

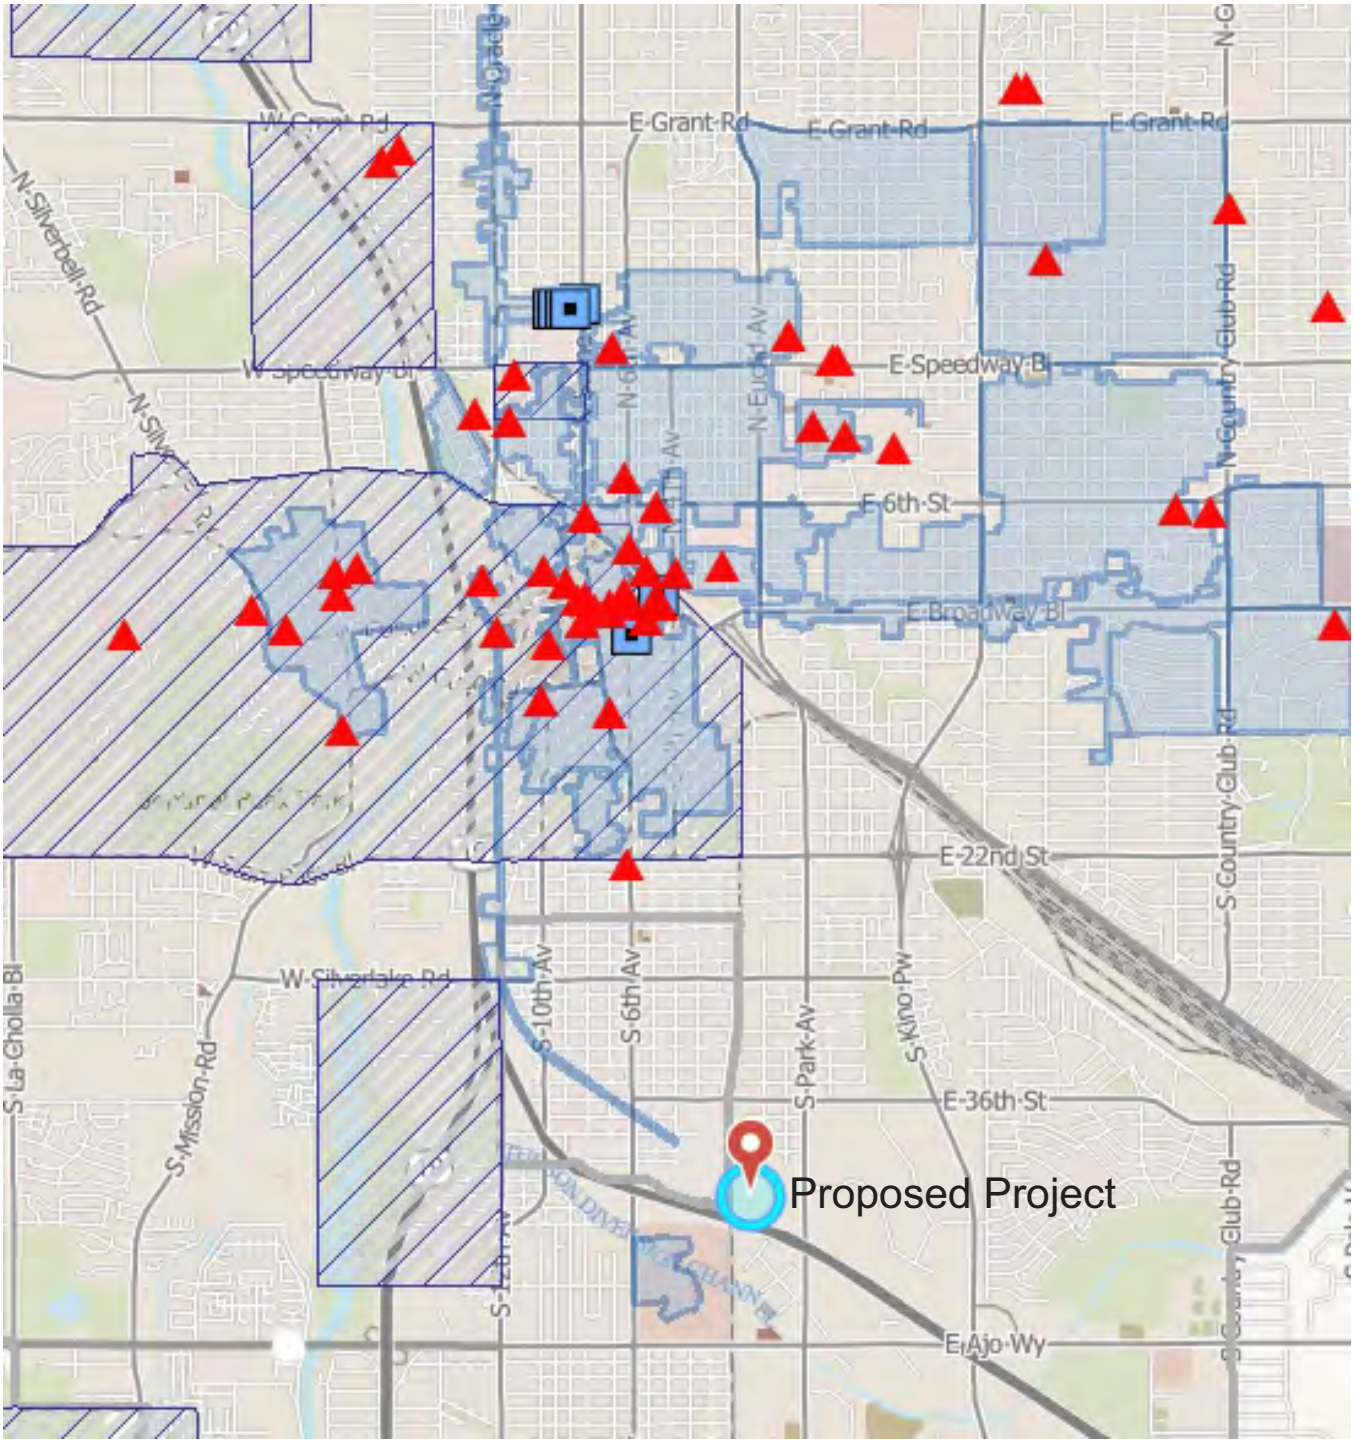

LEGEND

Historic District Boundaries

NRHP Listed Historic Property

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	2
WT Job No. 29-824105-0	
NRHPMap	

Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

Prepared for:
Pima County Joint Technical Education District #11
2855 West Master Pieces Drive
Tucson, AZ 85741

Prepared by:
Sarah Wolfram and Drew Sangerman

Submitted by:
Harris Environmental Group, Inc.
650 N 6th Ave, Tucson, AZ 85705

February 2025

1. REPORT TITLE

1a. Report Title: Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

1b. Report Author(s): Sarah Wolfram and Drew Sangerman

1c. Date: February 2025

2. PROJECT REGISTRATION/PERMITS

2a. AAA Permit Number: 2025-034bl

3. ORGANIZATION/CONSULTING FIRM

3a. Name: Harris Environmental Group, Inc.

3b. Internal Project Number: 25-003

3c. Internal Project Name: Tucson Marketplace Class I

3d. Contact Name: Sarah Wolfram

3e. Contact Address: 650 North 6th Ave, Tucson, AZ 85705

3f. Contact Phone: 520-628-7648

3g. Contact Email: swolfram@heg-inc.com

4. SPONSOR/LEAD AGENCY

4a. Sponsor: Pima County Joint Technical Education District #11

4b. Lead Agency: Pima County Joint Technical Education District #11

4c. Funding Source(s): Private

4d. Other Involved Agencies: Western Technologies

4e. **Applicable Regulations:** Arizona Antiquities Act (AAA), Arizona Revised Statutes (ARS; Title 41 § 841-844), the Arizona State Historic Preservation Act (SHPA; ARS Title 41 § 861-865), and Section 106 of the National Historic Preservation Act. A Class III pedestrian survey was necessary to identify, document, and evaluate cultural resources that could be affected by the proposed project. This process requires consultation with the SHPO and ASM to review the findings of this study regarding the undertaking's potential effects on cultural resources. This report was prepared per guidelines specified by the SHPO (2009, 2016).

5. DESCRIPTION OF PROJECT OR UNDERTAKING: Class I Cultural Resources Survey, associated with a 4.09-acre parcel located in Tucson, Arizona.

6. PROJECT AREA/AREA OF POTENTIAL EFFECTS: The area of potential effects (APE) is 4.09 acres located in Tucson, Arizona. The surrounding environment is built with modern buildings and roads in use. The southern end of the parcel has standing structures that are in use.

7. PROJECT LOCATION

7a. Address: 751 East Tucson Marketplace Boulevard

7b. Nearest City/Town: Tucson

7c. County: Pima

7d. Project Locator UTM: 503756 Easting, 3561169 Northing

7e. NAD 83

7f. Zone: 12N

7g. Baseline & Meridian: Gila & Salt River

7h. USGS Quadrangle(s): Tucson

7i. Legal Description(s): Township 14 S, Range 14 E, Section 30

8. SURVEY AREA

8a. Total Acres: 4.09

8b. Survey Area.

1. Land Jurisdiction	2. Total Acres Surveyed	3. Total Acres Not Surveyed	4. Justification for Areas Not Surveyed
Private	4.09	0	N/A

9. ENVIRONMENTAL CONTEXTS

9a. Landform: The project area is on a southeast facing gradual slope.

9b. Elevation: 2,462 ft amsl

9c. Surrounding Topographic Features: Characterized by broad sweeping alluvial plains. Sentinel Peak is located 2.43 miles to the northwest.

9d. Nearest Drainage: The Santa Cruz River is 1.68 miles to the west.

9e. Local Geology: The geology of this region consists of Quaternary Surficial deposits. Quaternary Surficial deposits are associated with strongly consolidated alluvial and eolian deposits. The geologic make up consists of course poorly sorted alluvial fan and terrace deposits

on middle to upper piedmonts and along large drainages. Sand, silt, and clay are present on alluvial plains, with wind-blown sand deposits (Arizona Geologic Survey, 2025).

9f. Vegetation: Common vegetation of this region is dominated by creosote (*Larrea tridentata*), ocotillo (*Fouquieria*), saguaro cactus (*Carnegiea gigantea*), ironwood (*Olneya tesota*), and mesquite (*Prosopis glandulosa*) (Griffith et al, 2014).

9g. Soils/Deposition: Soils across the project area are primarily composed of cave soils and urban land. This soil is typical of the surrounding fan terraces. A typical profile consists of zero to seven inches of gravelly fine sandy loam, seven to twenty inches of cemented material, and twenty to sixty inches of gravelly loamy sand (NRCS, 2024).

9h. Buried Deposits: Buried cultural deposits are not likely within the project area.

9i. Justification: The known cultural sites in the immediate vicinity of the project area are all historic affiliation, with very little potential for subsurface artifacts.

I0. BUILT ENVIRONMENT: The project area is located just north of the Pima JTED Innovative Learning Center in Tucson, Arizona. The surrounding area is built as an urban setting across all cardinal directions. No historical standing architecture is present in the project area.

11. INVENTORY CLASS COMPLETED

11a. Class I Inventory: ☒

11b. Researcher(s): Jonathan Damp Ph.D. and Sarah Wolfram

11c. Class II Survey: ☐

11d Sampling Strategy:

11e. Class III Inventory: ☐

12. BACKGROUND RESEARCH SOURCES

12a. AZSITE: ☒

12b. ASM Archaeological Records Office: ☒

12c. SHPO Inventories and/or SHPO Library: ☐

12d. NRHP Database: ☐

12e. ADOT Portal: ☐

12f. GLO Maps: #204095, 1872; #204097, 1872; #210345, 1876; #210347, 1876

12g. Land- Managing Agency Files: N/A

12h. Tribal Cultural Resources Files: N/A

12i. Local Government Websites: N/A

12j. Other: USGS Topographic Maps: Tucson, AZ 1:125,000 1904; Tucson, AZ 1:125,000 1905; Tucson, AZ 1:62,500 1948; Tucson, AZ 1:250,000 1956; Tucson, AZ 1:24,000 1957; Tucson, AZ

1:250,000 1958; Tucson, AZ 1:250,000 1959; Tucson, AZ 1:250,000 1962; Tucson, AZ 1:250,000 1964

13. BACKGROUND RESEARCH RESULTS

Harris Environmental personnel conducted a site file search on AZSITE to identify previous projects and sites within one half-mile of the project area. AZSITE records noted 31 previous projects within the project area and or buffer. An ASM Archaeological Records Office (ARO) search was also conducted as part of that project, which do not provide a differing information that what was shown on AZSITE. Nine previously recorded site are located within one half-mile of the project area, with three of these previously recorded cultural resources identified within the project area.

The sites located within the project area are: AZ BB:13:738(ASM), AZ BB:13:744(ASM), and AZ BB:13:798(ASM).

AZ BB:13:738(ASM) is a concrete foundation of the Fiesta Drive-In Theatre, that was located at 3230 South Park Avenue. The business first opened in 1953 and was torn down in 1966. The remaining foundation consists of a cluster of seven concrete pads, each measuring approximately 6 ft long and 1 ft high. The concession building was bulldozed into a rubble pile, which remains on site (ASM, 2012).

AZ BB:13:744(ASM) is the Tucson-Bisbee Highway, which once ran through the area but now remains as an arbitrary line. The section through the project area, noted as "Section 1, Number 18" ran parallel alongside the EP&SW train track, from South 6th Avenue. This highway was built between 1909 and 1914, and abandoned in 1928, but was re-established as a county road in 1931, renamed as "Old Vail Road." Today, no portions of the original road survive (ASM, 2021).

AZ BB:13:798(ASM) is a historic house foundation that consists of four "wing walls" extending out from a square center. The foundation measures 106 ft by 84 ft, standing 10 ft tall. These walls are sloping downward, outside from the center. There is a small concrete pad to the west of the foundation. The property is present in 1954 aerial photographs of the area, but not in the 1946 aerial images. The purpose of the structure is unknown (ASM, 2012).

13a. Previous Projects Within Study Area and Half-Mile Buffer.

1. Project Reference Number	2. Project Name	3. Author(s)	4. Year
1980-155	Santa Cruz SW Interceptor Project	Brew	1980
1983-134	SE Interceptor Route	Brew	1983
1993-213	Julian/Rodeo Wash Survey	Slawson	1993
1996-286	Water Main Alignments in the Vicinity of Park Avenue and 33rd Street, Tucson	Sliva	1996
1997-28	Kino Community Center Reclaimed Water Main Project	Eppley	1997
1997-33	Kino Silverlake Main Replacement Project Survey	Eppley	1997

1998-43	6th Ave. I-10 to Ajo Way Survey	Castalia	1998
1998-44	S. Park (19th to 36th) Survey	Castalia	1998
1998-266	6th Ave- 18th St. to I-10 Survey	Diehl	1998
2000-116	Jct. I-19 - Craycroft Rd.	Montero	2000
2000-166	Pipeline Anomaly Digs	Rogge	2000
2000-284	Moratorium Streets Survey	Diehl	2000
2000-882	N/A	N/A	N/A
2001-399	South Park Survey	Diehl	2001
2001-769	B-10 Survey	Wright	2001
2002-316	South Park Back to Basics Survey	Diehl	2002
2003-505	Hope VI South Park 35th Street Survey	Diehl	2003
2003-1217	Hope VI 35th Street Purchase Survey	Diehl	2003
2003-1218	Habitat - 36th and Mountain Survey	Diehl	2003
2003-1514	N/A	N/A	N/A
2004-541	I-10/6th Avenue Bridge, Artistic Fencing and Sidewalk Improvements	Touchin	2004
2004-1748	902 East 35th Street Survey	Diehl	2004
2005-877	MUSD Transportation Facility	DeJongh & Dart	2005
2007-681	Sinclair Data Recovery	Jones et al.	2009
2012-73	Proposed Fiber Optic Corridor-Cultural Resource Survey	Knoblock	2001
2012-76	Cultural Resources Inventory of a Portion of The Loop	Smith, Wygant, & McKee	2012
2012-146	Sinclair Survey	Doak	2007
2012-147	Sinclair Survey -- Fiesta Drive-In	Doak	2006
2015-6	Southeast Interceptor Class III	King & Prasciunas	2015
2016-397	Old Nogales Interceptor	Stone	2017
SHPO-2001-548	Request for Evaluation - Telecommunication Facilities - UTILITY INTERNATIONAL Solomon Industrial P	SHPO	2001

13b. Previously Recorded Cultural Resources Within Study Area and Half-Mile Buffer.

1. Site Number/Name	2. Affiliation	3. Site Type	4. Eligibility Status	5. Associated Reference(s)
AZ BB:13:679(ASM)	Euro-American	Railroad	Eligible	Tucker, 2000 Ruble, 2001 Smith & Wheeler, 2001 Estes et al, 2005 Twilling, 2006

				Twilling, Luchetta, & Shaw 2007 Luchetta & Shaw, 2007 Goldstein, 2008 Hesse, 2010 Howell, 2011 Lindeman, Diel, & Gilma 2012 Peters, 2013 Heilman, 2013 Hesse & Hesse, 2014 Rawson, 2015 King & Prasciunas, 2015
AZ BB:13:738(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2006 Doak, 2007
AZ BB:13:739(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2007
AZ BB:13:744(ASM)	Euro-American	Road-trail	Unevaluated	Doak, 2006 Doak, 2007 Copperstone, 2014
AZ BB:13:748(ASM)	Euro-American	Historic structure and artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:763(ASM)	Euro-American	Historic artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:798(ASM)	Euro-American	House Foundation	Eligible	Doak, 2007
AZ EE:1:300(ASM)	Euro-American	Railroad	Eligible	Wright, 2000 Luchetta & Shaw, 2007 Hesse, Levstik, & Barr, 2009 Tucker, 2009 Hess & Barr, 2009 Lindeman, Diel, & Gilman, 2012 Smith, Wygant, & McKee, 2012 Heilman, 2013 Hesse & Hesse, 2014 Jerla & King, 2014
AZ FF:9:17(ASM)	Euro-American	Road-trail	Eligible	Champe, 1936 Davis, 2001 Knoblock, 2001

				Davis & Ogren, 2002 Davis, 2002 Touchin & Brodbeck, 2002 Rogge, 2002 Chapin-Pyritz & Hill, 2002 McDermott, 2002 Touchin, Palmer, & Brodbeck, 2002 Shepard & Turner, 2002 Moses & Doak, 2003 Doak, 2003 Klune & Moses, 2003 Touchin & Brodbeck, 2003 Lindly, 2004 Moses & Montgomery, 2004 Jones, 2004 Stephen, 2004 Moses, 2004 Jolly & Fangmeier, 2004 Twilling, Fahrni, & DeJongh, 2004 Terhune, 2004 Compton-Gore & Rogge, 2005 Klune & Doak, 2005 Petersen, 2005 Webb, 2005 Schroeder, 2005 Hesse, 2005 Allan, Price, Arrigoni, & Kearney, 2005 Strohmayer, McDermott, & Ramsey, 2005 Estes, 2005 Fahrni, 2005 Vanderpot, 2005

				Rossi & Garcia, 2005 Courtright, 2005 Ekstrom, 2006 Goldstein & Bassett, 2006 Barr, 2006 Stahman, 2006 Brodbeck, Touchin, Belvin, & Silverman, 2006 Davis, Davis, Lincoln-Babb, Montero, & Turner, 2006 Davis, Turner, & Davis, 2006 Gordon, 2006 Shilling & Fangmeier, 2006 Rawson, Rieder, & Boley, 2006 Cook, 2006 Rieder, Rawson, & Epperson, 2006 Jones, Gegory, Bockhorst, & Stokes, 2006 Petersen, 2006 Florie & Luhnow, 2007 West & Ezzo, 2007 Compton-Gore, Cox, & Rogge, 2007 Goldstein, 2007 Newsome, 2007 Huebechen, Garcia, & Bruden, 2008 Davis, 2008 Vance, 2008 Caldwell, 2008 Goldstein, 2008 Davis, 2008 Williams, 2008 Wright, 2008 Lascaux & Klucas, 2008

				Hesse & Barr, 2009 Tucker, 2009 Jones & Fangmeier, 2009 Langan & Rehar, 2009 Tucker, 2010 Rodgers, 2010 Barr 2010 Jones & Vargas 2010, Alexandra & Vaughn, 2010 Schilz, 2011 Rayle, 2011 Jones, 2011 Watkins, Davis, & Courtright, 2011 Leonard, Greata, Ryden D., & Ryden E., 2011 Rawson, 2011 Howard, Moore, & Jacoby, 2011 Watkins, 2011 Peterson & Hesse, 2011 Hesse & West, 2011 Bowler, 2012 Steely, 2012 Rodgers, 2012 Langan & Solliday, 2012 Lindeman, Diehl, & Gilman, 2012 Hesse J., Ferland, &Hesse I., 2012 Hart & Barnes, 2012 Rawson, 2012 Melanie, Jones, & Stokes, 2012 Punzmann, 2012 Fahrni & Foster, 2012 Tinseth, 2013 Tucker & Hesse, 2013

				Tactikos, Jones, & Gregory, 2013 Graces, Natoli, & Huber, 2013 Lundin, Solliday, & Langan, 2013 Tactikos, 2013 Jones, 2014 Stevens, 2014 Rawson, 2014 Jessica, 2014 Bastin, 2014 Tactikos & Jones, 2014 Rucker, 2015 Hart, 2015 Lonardo & Vorsanger, 2015 Brodbeck, 2015 King & Prasciunas, 2015 Rucker, 2016 Klebacha, 2016 Stone, 2017 Schilling, 2018 Schilling, 2018 Chamorro, 2019 Brodbeck, Faer, Garnett, Mueller, & Thomas, 2021

13c. Historic Buildings/Districts/Neighborhoods.

1. Property Name or Address	2. Year	3. Eligibility Status
N/A		

14. CULTURAL CONTEXTS

14a. Prehistoric Culture: Hohokam

14b. Protohistoric Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14c. Indigenous Historic Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14d. Euro-American Culture: 1540s to present.

15. PERSONNEL

15a. Principal Investigator: Jonathan Damp Ph. D.

15b. Supervisor: Sarah Wolfram

15C. Date(s): February 4, 2025

16. COMMENTS:

Harris Environmental performed a literature review Class I cultural resource survey of the project area. Four previously recorded cultural resource sites were observed during the survey within the project area.

Background research revealed 31 previous surveys for cultural resources, and 9 previously recorded cultural sites within the project area and half-mile buffer, with 3 of these sites being in the project area.

Ground visibility within the APE ranges from 0-100% depending on disturbance. The landform has been altered substantially due to the construction of the surrounding urban area.

There is little potential for the inadvertent discovery of significant archaeological remains within the project area. If previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency. If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

SECTION 19. ATTACHMENTS
19a. Project Location Map: ☒
19b. Land Jurisdiction Map: ☒
19c. Background Research Map(s): ☒
19d. GLO Map(s): ☐
19e. References: ☒

SECTION 20. CONSULTANT CERTIFICATION

I certify the information provided herein has been reviewed for content and accuracy and all work meets applicable agency standards.

_____
Signature

President

_____
Title

SECTION 21. DISCOVERY CLAUSE

In the event that previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency.

If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

Appendix A: Project Area Maps

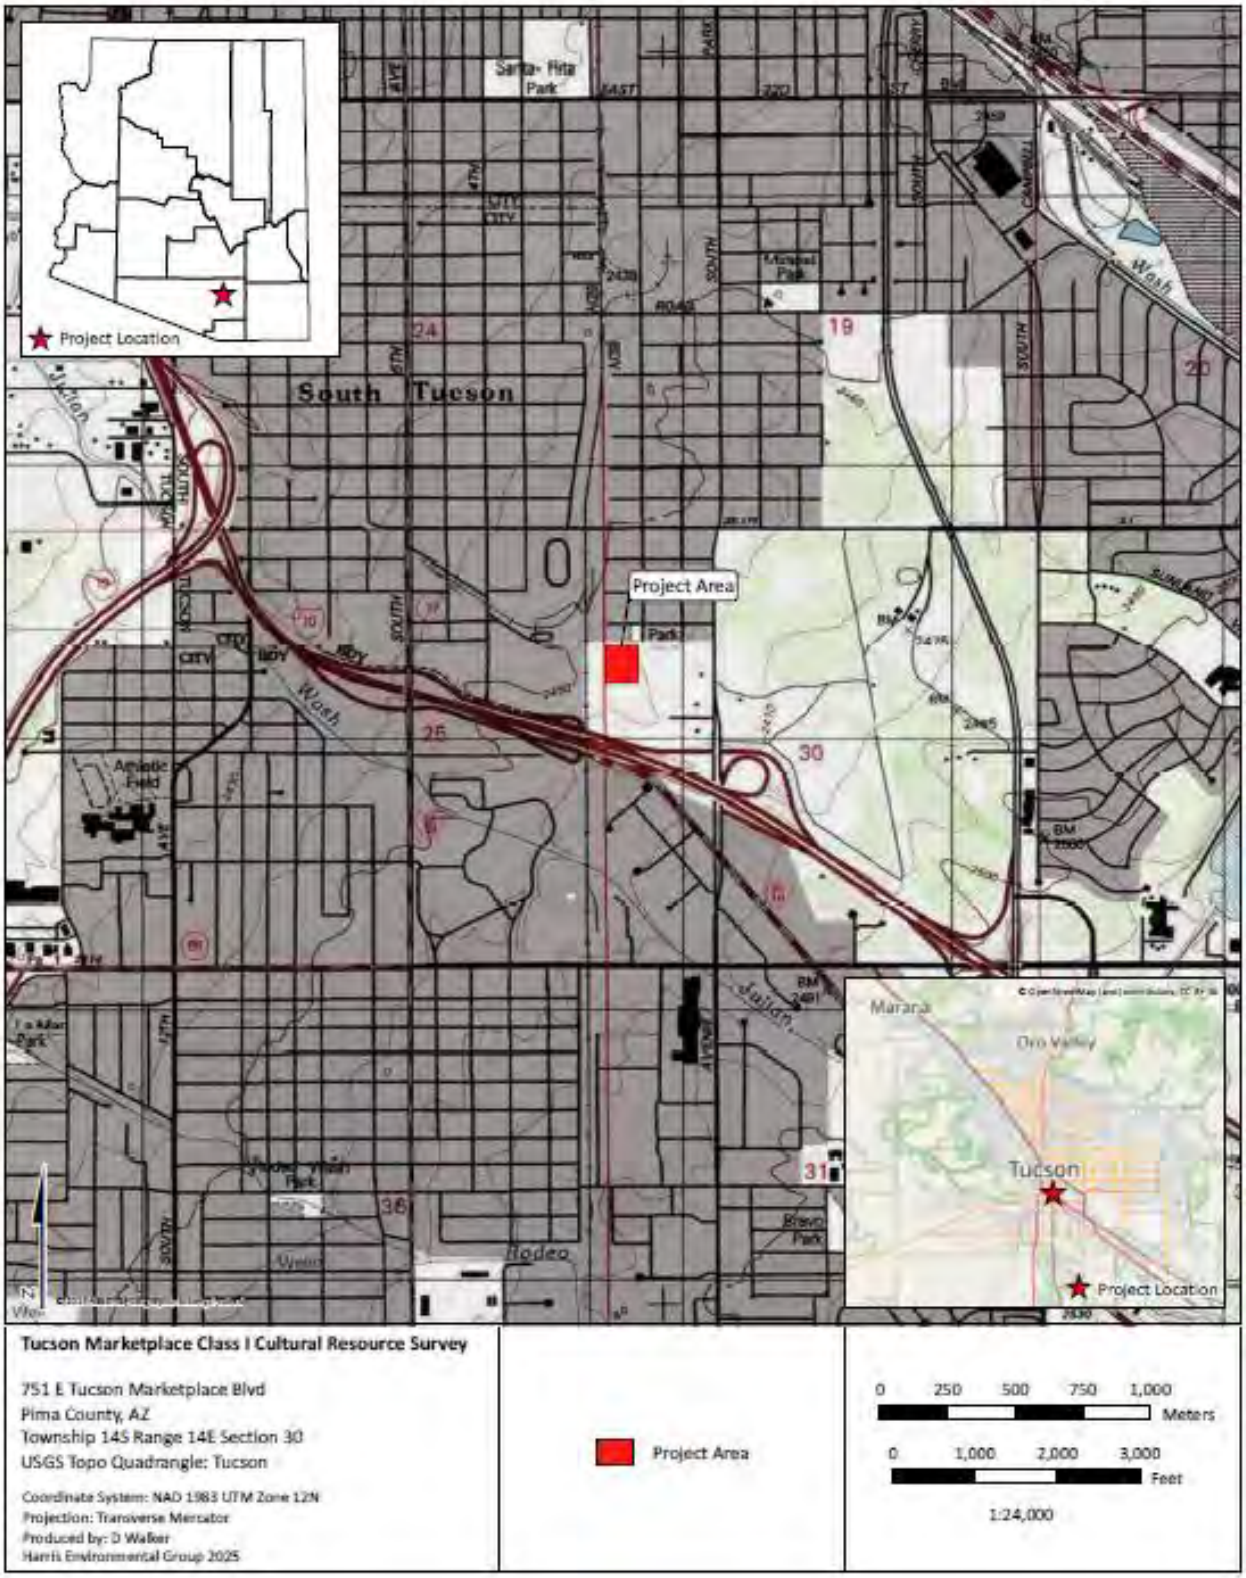

Figure 1. Project area map, topographic.

Figure 2. Project area map, aerial.

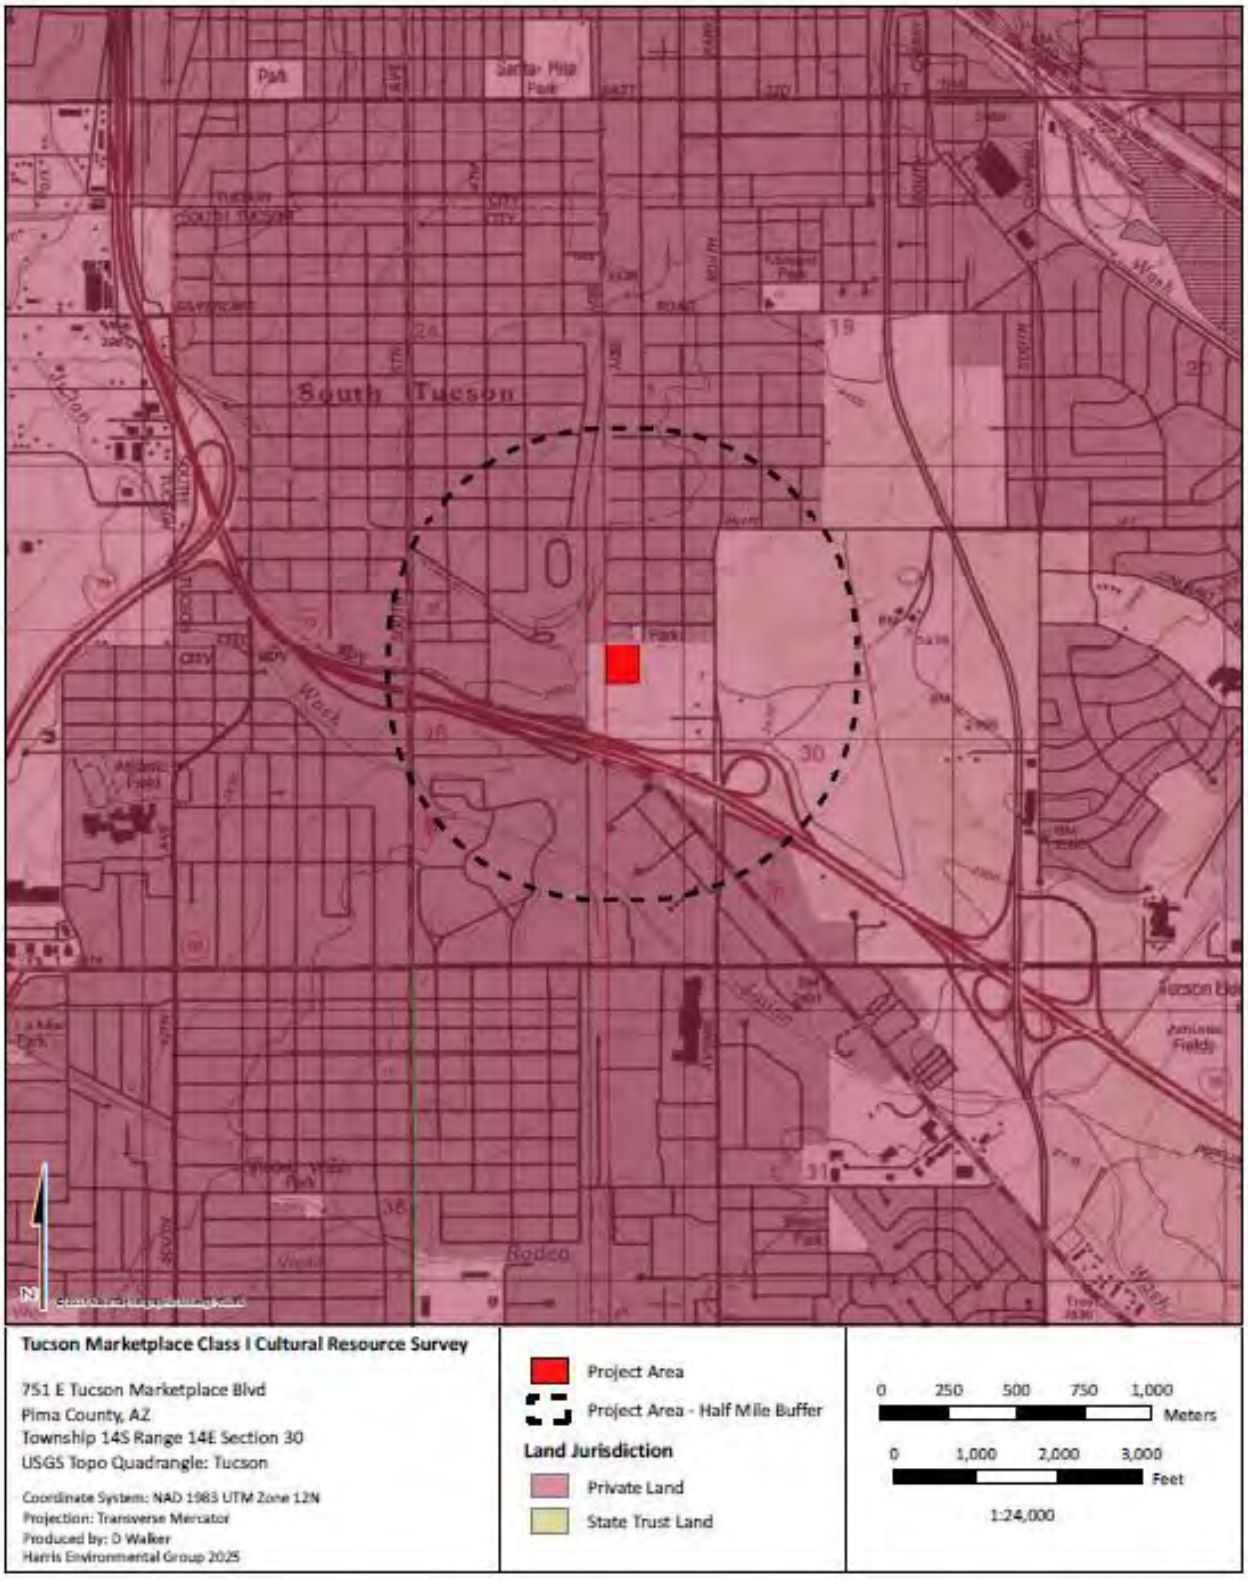

Figure 3. Project area map, land jurisdiction.

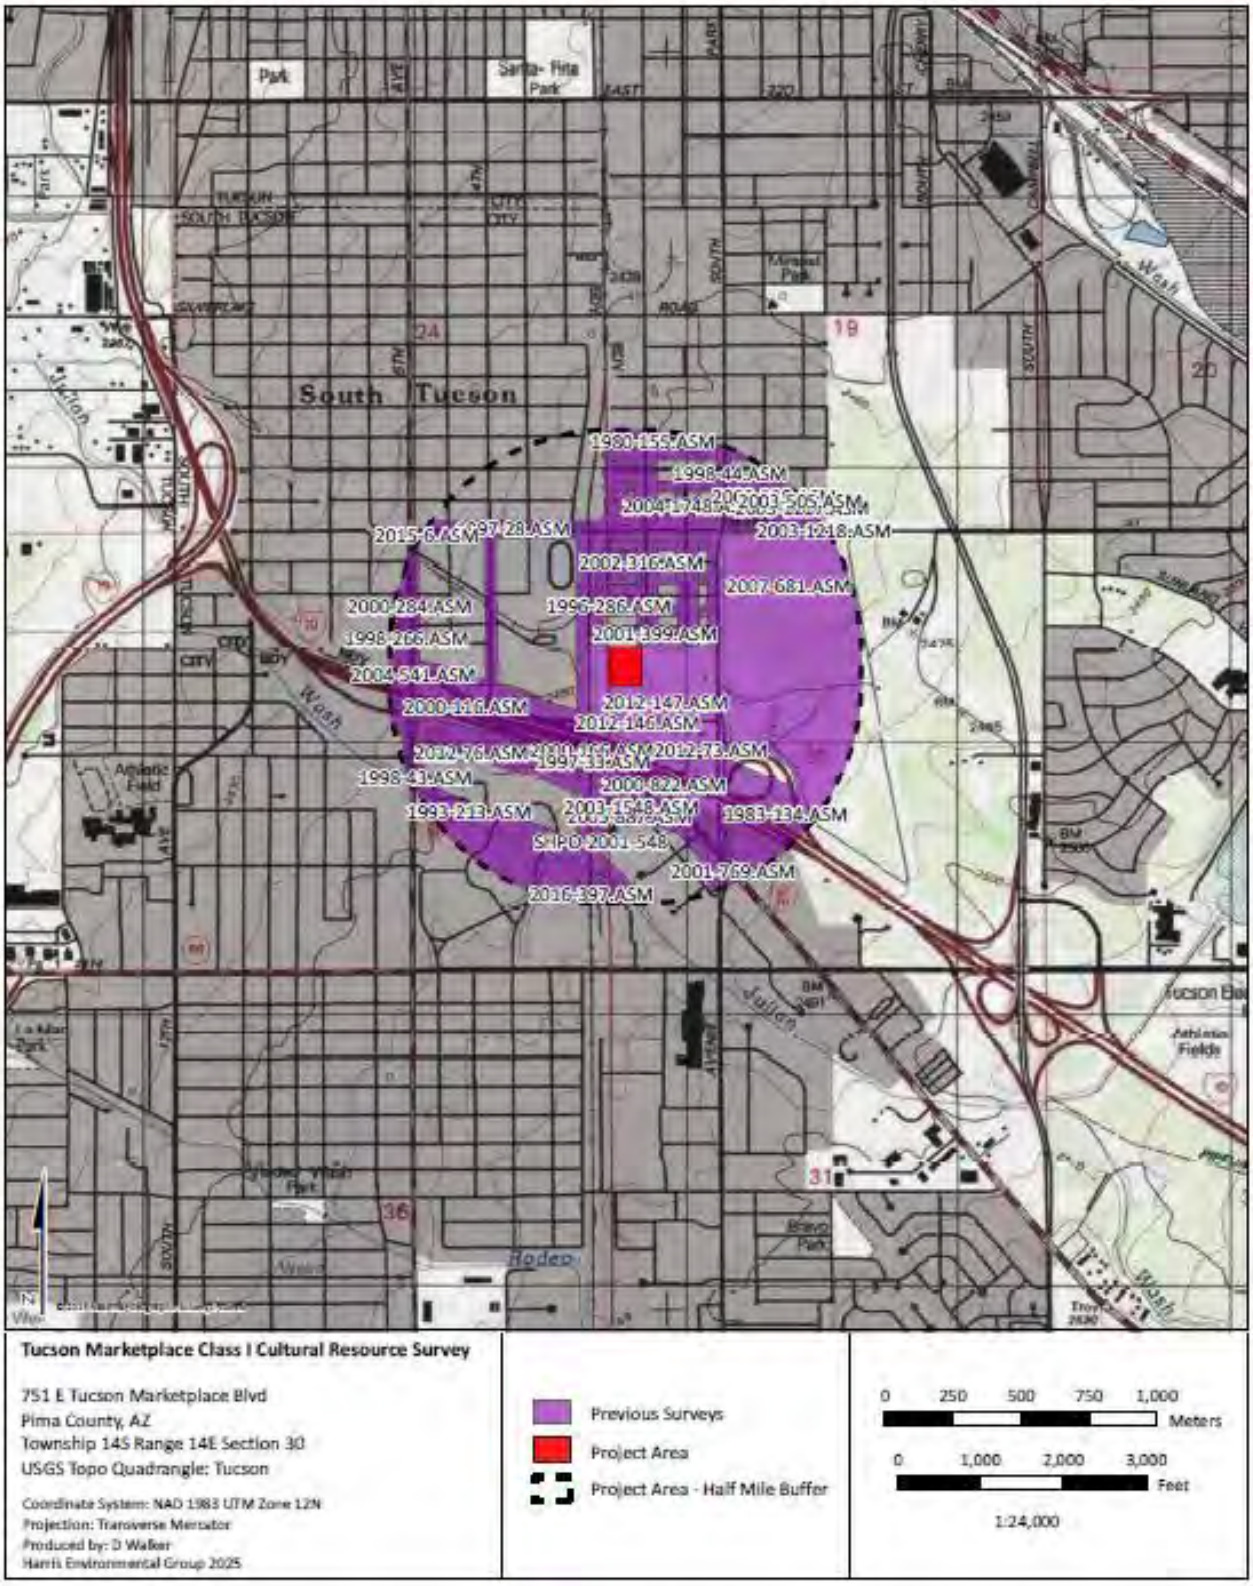

Figure 4. Project area map, previous cultural resource surveys.

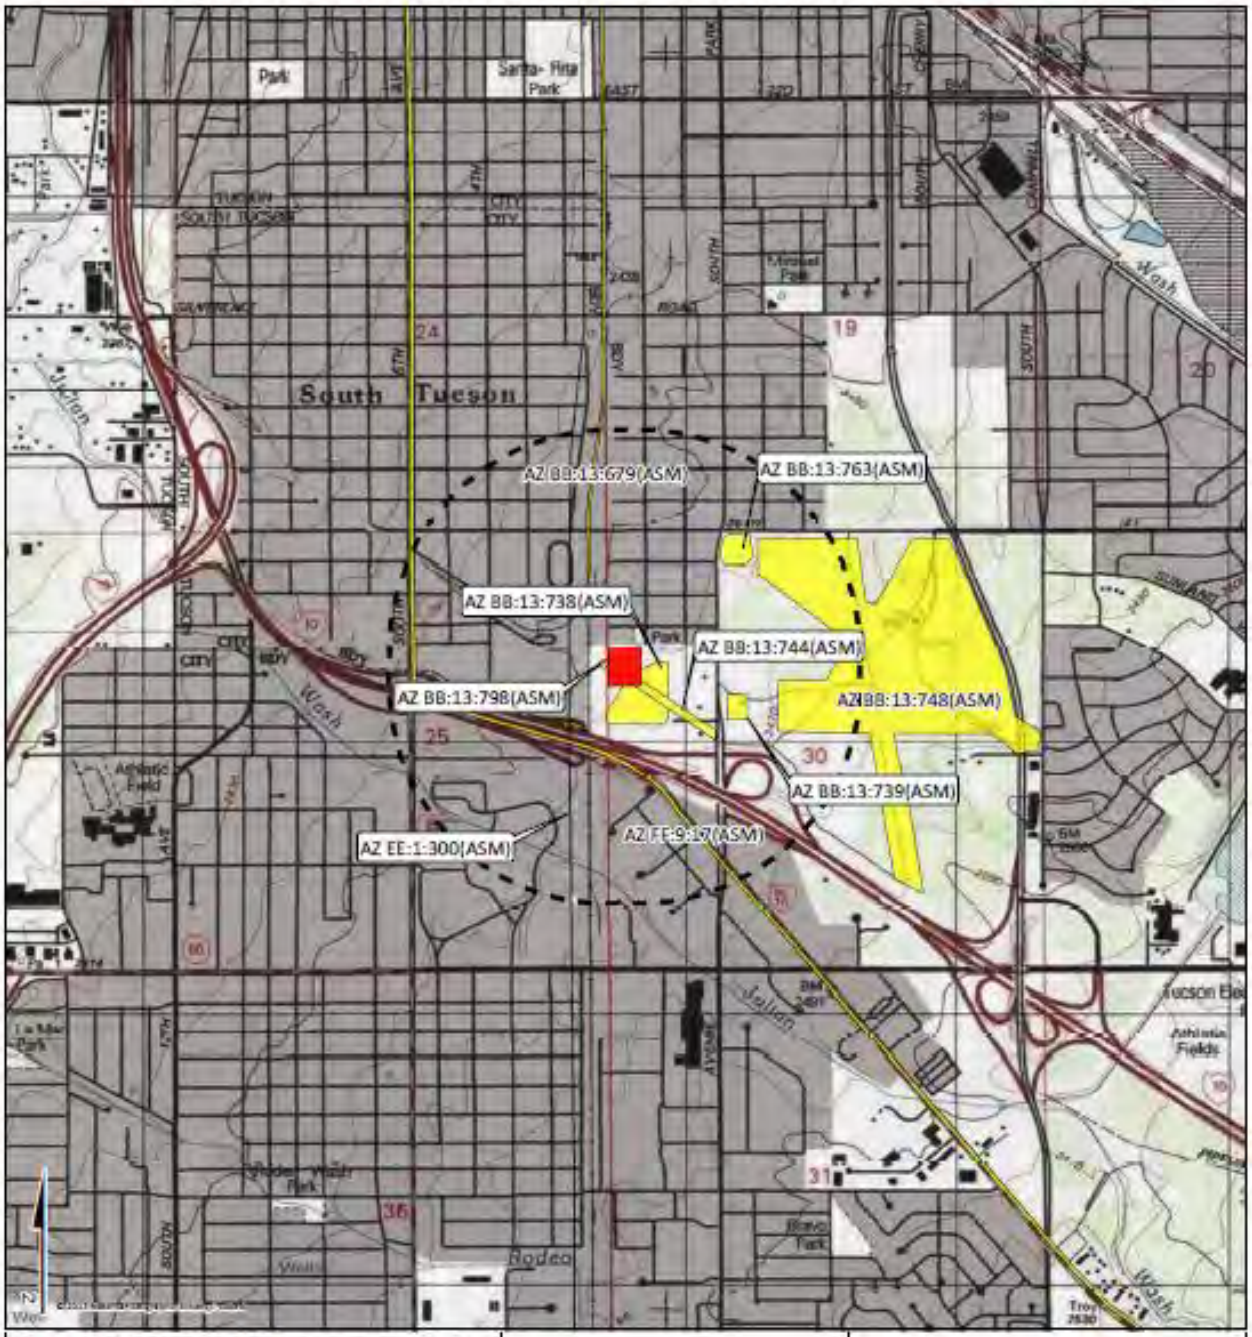

Figure 5. Project area map, previously recorded cultural resource sites.

References:

Allan, James M. et al.
2005 Cultural Resource Survey Report KMEP Line Section 53/54 SCC Digs Project Maricopa and Pinal Counties, Arizona. William Self Associates, Inc. Orinda, California.

Arizona State Historic Preservation Office (SHPO)
2016 Arizona Reporting Standards for Cultural Resources. Developed by the AZSHPO, the ASM, and the ASLD. Adopted by the Arizona State Parks Board in 2002, with minor edits, revisions, and updates in 2009; 2016.

Arizona State Historic Preservation Office (SHPO) and Salt River Pima-Maricopa Indian Community (SRP-MIC)
2024 *Government to Government Consultation Toolkit*. https://sites.google.com/view/az-consultation-toolkit/home.

Arizona State Museum (ASM)
1993 *Archaeological Site Recording Manual*. Arizona State Museum, University of

Arizona, Tucson.
1995 *Revised Site Definition Policy*. Arizona State Museum, University of Arizona, Tucson.

Arizona Geological Survey
2025 *Geologic Map of Arizona*. https://geomapaz.azgs.arizona.edu/. Accessed online January 30, 2025.

Barr, David M. R.
2006 A Cultural Resources Survey of a 3.5-mile-long Corridor as Part of the Bachmann Springs Electrical Routing Project, Cochise County, Arizona. Cultural Resources Report No. 06-39. SWCA Environmental Consultants, Tucson.

2010 Cultural resources inventory for 7210 north Oracle Road (parcel 225-51-2350), Pima County, Arizona. Report 2 of 2. Cultural Resource Report no. 10-347. SWCA Environmental Consultants, Tucson, Arizona.

Bastin, Kerri A.
2014 A class I literature review addendum report for the MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Buckles, Avi et al.

2012 A Cultural Resources Inventory of the Magma Arizona Railroad Right-of-way, Pinal County, Arizona. Westland Project No. 807.44 C 500. WestLand Resources, Inc, Tucson, Arizona.

Bowler, Maggie R.
2012 Cultural Resources Survey of 38.42 Acres Outside ADOT Right-of-way along State Route 77 between milepost 81.91 and 88.12, Oro Valley and Catalina, Pima and Pinal Counties, Arizona. Report no. AZG0907-030. AZTEC Engineering, Phoenix, Arizona.

Brodbeck, Mark.
2015 A Final Class III Survey of the W59 and E1 Alignments for the South Mountain Freeway, Maricopa County, Arizona. Cultural Resources Report 15-2. HDR, Inc., Phoenix, Arizona.

Brodbeck, Mark et al.
2006 A Class III Cultural Resources Survey of Proposed Corridors for the State Route (SR) 801 Freeway, SR 303L to SR 202L, Maricopa County, Arizona. Report 07-08. HDR Engineering, Inc., Phoenix, Arizona.

2021 Archaeological Monitoring and Data Recovery Excavations for the Tempe Streetcar Project, Tempe Maricopa County, Arizona. Report No. 21-13. HDR Engineering, Inc., Phoenix, Arizona.

Brown, David E. (editor)
1994 *Biotic Communities: Southwestern United States and Northwestern Mexico*. University of Utah Press, Salt Lake City.

Caldwell, Bryana.
2008 Determination of No Adverse Effect: Cactus Forest/State Route 79 Rehabilitation. SCIP Project No. R-048-050. Bureau of Indian Affairs: San Carlos Irrigation Project, Coolidge, Arizona.

Chamorro, Sebastian.
2019 Cultural Resources Inventory of 9.5 Linear Miles for a Portion of the Irvington to Sonoran to Vail Reconductor Project in Pima County, Arizona. Report 2019-34. WestLand Resources, Inc., Tucson, Arizona.

Champe, John L.
1936 The Sweetwater Culture Complex. Chapters in Nebraska Archaeology 1(3): 249-299. Lincoln: University of Nebraska.

Chapin-Pyritz, Regina L., and Matthew E. Hill
2002 A Cultural Resources Survey of the Proposed Hassayampa to Jojoba 500kV Transmission Line, Maricopa County, Arizona. Environmental Planning Group. Cultural Resource Services Technical Paper No.10. Tucson, Arizona.

Code of Federal Regulation
2010 National Archive and Records Administration. http://www.gpoaccess.gov/cfr/.

Compton-Gore et al.
2005 Cultural Resource Survey for the Mission View Wash Drainage Improvements Project in Tucson, Pima County, Arizona. URS Cultural Resource Report 2005-24(AZ). URS Corporation, Phoenix, Arizona.

2007 Cultural Resource Survey of Turner Road (Maricopa County Route 85 Extension to Hazen Road) and 24 intersections along Maricopa County Route 85 (75th Avenue to State Route 85), Maricopa County, Arizona. URS Cultural Resource Report 2007-46(AZ). URS Corporation, Phoenix, Arizona

Cook, Michael D.
2006 A Class III Cultural Resources Survey of 10.65 Acres Within ADOT Right-of-Way along State Route 79 for the Willow Springs Development. Cultural Resources Report 2005-67. Westland Resources, Inc., Tucson, Arizona.

Copperstone, Chance
2014 A class III cultural resources survey for the proposed installation of a telecommunications line along East Valencia Road for Cox Communications in Pima County, Arizona. Tierra Right of Way Services, Tucson, Arizona.

Courtright, J. Scott
2005 A cultural resources survey for 611.7 acres of proposed new right-of-way for the SR 85 and I-8 Interchange and the evaluation of eight previously recorded sites between SR 85 mileposts 120.24 and 123.00 and I-8 mileposts 117.40 and 119.25, Gila Bend, Maricopa County, Arizona. Logan Simpson Design, Inc. Technical Report No. 035051. Tempe, Arizona.

Dart, Allen
1989 *Prehistoric Irrigation in Arizona: A Component of the Arizona Historic Preservation Plan*. Center for Desert Archeology. Arizona State Historic Preservation Office.

Davis, Erin
2001 A Cultural Resource Survey of 18.60 Miles (605 Acres) along Interstate 10 between Mileposts 296.20 and 301.10, and between Mileposts 302.20 and 316.00, near the City of Benson, Safford Maintenance District, Cochise County, Arizona. Entranco Project Report 2001-012. Phoenix, Arizona.

2002 A Cultural Resource Survey of 22.06 Miles (660.08 Acres) along Interstate 8 between Mileposts 65.94 and 88.00, near the Towns of Dateland and Sentinel, Yuma Maintenance District, Yuma and Maricopa Counties, Arizona. Entranco Project Report No. 2001-046. Phoenix, Arizona.

Davis, Erin, and Kari Ogren
2002 A Cultural Resource Survey of 23.47 Miles (1,270.82 Acres) along Both Sides of Interstate 8 between Mileposts 3.00 and 19.00 and the Westbound Right-of-Way between Mileposts 19.00 and 20.40 in the Vicinity of Yuma, and Both Sides of Interstate 8 between Mileposts 29.00 and 34.80, near the Town of Wellton, ADOT Yuma Maintenance District, Yuma County, Arizona. Entranco Project Report 2001-045. Phoenix, Arizona.

Davis, Erin et al.
2002 A Cultural Resource Survey of 20.48 Moles (595.72 Acres) Along Interstate 8 Between Mileposts 106.07 and 119.40, and Mileposts 121.00 and 125.00, and Along Business Route 8 Between Mileposts 117.15 and 120.30 in the Vicinity of Gila Bend, Yuma Maintenance District, Maricopa County, Arizona. Entranco Project Report 2001-047. Phoenix, Arizona.

2008 A class III cultural resources survey of approximately 4,451 acres of Arizona State Trust Land for the proposed Lost Duchman Hights Project, Apache Junction, Pinal County, Arizona. Report No. 2007-018. Carter & Burgess, Inc., Phoenix.

Davis, Linda.
2008 Archaeological Monitoring for the 15th Avenue Sewer Main Replacement, Phoenix, Maricopa County, Arizona. Project Report No. 2006-030. Carter Burgess, Phoenix, Arizona.

Davis, Linda et al.
2006 A Class III Cultural Resources Survey of Approximately 8,875 Acres of Private Land Within the Proposed Paloma Ranch Development West of Gila Bend, Maricopa County, Arizona. Report No. 2006-011, Carter & Burgess, Inc., Phoenix.

2006 A cultural resources survey of 15 traffic interchanges totaling approximately 97.3 acres along Interstate 10, between mileposts 268 and 350, between Tucson and Willcox, Pima and Cochise Counties, Arizona. Report No. Project Report (Carter & Burgess); no. 2006-021. Carter & Burgess: Phoenix, Arizona.

DeJongh, Jennifer and Allen Dart.

2005 Cultural Resources Survey of 15.0 acres for Proposed School District Transportation Facility Southeast of the Intersection of Avra Valley Road and Interstate 10 in Marana, Arizona. Letter Report No. 20042005.023. Old Pueblo Archaeology Center. Tucson, Arizona.

Diehl, Allison Cohen.
2002 Cultural Resources Survey for the Proposed South Park Back to Basics Project, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 02-160. Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

2016 Cultural Resources Survey on Oracle Road (State Route 77) near Los Lomitas Road, Pima County, Arizona. DAI Project Report 16-104. Desert Archaeology, Inc., Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

Doak, David P.

2003 A Cultural Resource Survey of a 7.5-Mile-Long Stretch of Deep Well Ranch Road, South of Florence, Pinal County, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2002-100A. Tucson, Arizona.

2006 The Sinclair Property Survey: A Class III Cultural Resource Survey of a 32-acre Parcel in Tucson, Arizona, the Former Site of the Fiesta Drive-In Theater. Report no. 2004-93. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2007 A Class III Cultural Resources Survey of Two Parcels Constituting Part of the Sinclair Property, Tucson, Arizona. Report no. 2007-1. Tierra Right of Way Services, Tucson, Arizona.

2007 A class III cultural resource survey of a 2.10-acre parcel at the junction of Ajo Way and Interstate 10, in Tucson, Pima County, Arizona. Tierra Archaeological Report No. 2007-131. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2008 A class III cultural resource survey/assessment of a 6-mile-long communications line corridor running along Arizona Highway 80, near Tombstone, Cochise County, Arizona. Report No. 2008-58. Tierra Right of Way Services, Tucson, Arizona.

2010 A Class III Cultural Resource Survey of a 6.25-Mile-Long Corridor in the Eastern Tucson Basin: the TEP Cienega Power Line Maintenance Corridor Survey. Archaeological Report No. 2009-76. Tierra Right of Way Services, Ltd.: A Land Services Company, Tucson, Arizona.

Ekstrom, Saskia M.
2006 A cultural resource survey of 26 temporary construction easement parcels along Interstate 8 between mileposts 29.18 to 36.86, near the town of Wellton, Yuma County, Arizona. Carter & Burgess: Phoenix, Arizona.

Estes, Allen et al.
2005 Final data recovery and monitoring report, KMEP Tucson pipeline replacement project, phases III and IV, Pima County, Arizona. William Self Associates, Orinda, California.

Fahrni, Grant
2005 A class III cultural resources survey of approximately five acres near the intersection of East Hardy Road and North Oracle Road, Oro Valley, Pima County, Arizona. Harris Environmental Group, Tucson, Arizona.

Fahrni, Grant and Foster Michael S.
2012 A cultural resources survey of two alternatives for the extension of SR 195 from I-8 to US 95: the South Avenue 3E and Araby Road Alignments, Yuma County, Arizona. Logan Simpson Design, Tempe, Arizona.

Florie, Paige and Glennda Luhnow.
2007 Cultural Resources Survey of State Route 80 between Mileposts 295.00 and 295.50 for the United Civil Group Turn Lanes Project, Benson, Cochise County, Arizona. ACS Internal Report No. 07-206-02. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Florie, Paige B. et al.
2009 A Cultural Resource Survey and Inventory for the Gila to Wellton-Mohawk 161-kV Transmission Line, Yuma County, Arizona: Background, Fieldwork Results, and Eligibility and Management Recommendations. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Goldstein, Beau J.
2007 Class III Cultural Resources Survey Report Vail Area 138kV System Project, Pima County, Arizona. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 1 of 2. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 2 of 2. Transcon Environmental, Inc., Mesa, Arizona.

Goldstein, Beau J., and Everett Bassett.
2006 Cultural III resources survey report, Ajo to Gila Bend Telecommunications Project, Pima and Maricopa Counties, Arizona. Transcon Environmental, Mesa, Arizona.

Gordon, Carl J.
2006 Cultural resources survey of Arizona Public Service Company right-of-way on Mule Mountain near Bisbee, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Graves, William M. et al.
2013 A Class I Overview and Class III Cultural Resource Inventory of the Proposed San Luis Rio Colorado Project Transmission Line Corridor, Yuma County, Arizona. Report no. 07-11. Statistical Research, Inc., Tucson, Arizona.

Griffith, G.E., Omernik, J.M., Johnson, C.B., and Turner, D.S.,
2014 Ecoregions of Arizona (poster): U.S. Geological Survey Open-File Report 2014-1141, with map, scale 1:1,325,000, http://dx.doi.org/10.3133/ofr20141141.

Hart, David R.

2015 Addendum Report: cultural resources survey of proposed integrated fixed towers and remote video surveillance systems on Arizona State Trust Land in support of right of way application no 14-116685, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Hart, David R., and Dean A. Barnes.
2012 Revised Final: cultural resources survey in support of integrated fixed towers in Douglas Station's area of responsibility, US Border Patrol, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Heilman, Jill.
2013 Cultural Resource Survey in Support of Improvements along Old Vail Connection Road and Nogales Highway within Unincorporated Pima County, Arizona. Report no. 13-442. EcoPlan Associates, Inc., Tucson, Arizona.

Hesse, India S.
2005 RE: TRICO Willow Springs Oracle Substation to Proposed Saddlebrook Ranch Substation Reroute Survey: An Addendum to a Cultural Resources Survey of the Proposed 69kV Transmission Line Between the Oracle Substation and the Proposed Willow Springs Substation, Pinal County, Arizona (TRICO W.O. No. 33808). SWCA Environmental Consultants, Tucson.

Hesse, S. Jerome.
2010 Cultural resources survey for the Palo Parado Road- Road, Bridge, Rail Improvements Project, Santa Cruz, Arizona. Resources Report No. 10-102. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and David M. R. Barr.
2009 Historic Properties Inventory for the EPNG Line No. 1007 MAOP Uprate project, Tucson Metropolitan Area, Pima County, Arizona. Cultural Resources Report No. 08-497. SWCA Environmental Consultants, Tucson, Arizona

Hesse, S. Jerome, and Heather West.
2011 Valencia Road improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona. Report 1 of 2. Report No. 10-404. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and India S. Hesse.

2014 Archaeological survey of a 7.0-mile-long water pipeline corridor for the proposed Sahuarita supply line slip liner project in Pima County, Arizona (City of Tucson Project 14-09). SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome et al.
2009 Historic Properties Inventory for the EPNG line 1007 Make-Piggable Project Between EPNG Mileposts 89 and 99 in Metropolitan Tucson, Pima County, Arizona. Cultural Resources Report No. 08-547. SWCA Environmental Consultants, Tucson, Arizona.

2012. Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona: supplemental survey of road crossings. SWCA Cultural Resources Report No. 12-140. SWCA Environmental Consultants, Tucson, Arizona.

Historic Aerials
2025 https://www.historicaerials.com/viewer

Howard, Alexandra, and Catherine S. Vaughn.
2010 Class III Cultural Resources Survey Oracle Junction Substation to Catalina to Oracle 12.5kV Power Lines Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howard, Alexandra et al.
2011 Customer service project and trouble reports Pima and Pinal Counties, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howell, Joseph.
2011 A class III cultural resource survey of a proposed high-pressure natural gas line reinforcement route in Green Valley, Pima County, Arizona. Report No. 2011-174. Tierra Right of Way Services, Tucson, Arizona.

Huebchen, Karl R. et al.
2008 A Cultural Resource Overview and Survey for the SR 303 Loop, SR 801/MC 85 to I-10, Maricopa County, Arizona. Environmental Planning Group Report Number STP-303-A(ASO). EcoPlan Associates, Inc.

Inter-Tribal Council of Arizona.
2011 Salt River Pima-Maricopa Indian Community. https://itcaonline.com/member-tribes/salt-river-pima-maricopa-indian-community/ Accessed electronically March 8, 2024.

Jerla, Christine A. and Anna King.
2014 A cultural resources inventory of 783.3 acres for the SWTC Bicknell to Vail transmission line upgrade, Pima County, Arizona. WestLand Resources, Tucson, Arizona.

Jolly, Donald W. and Kristin L. Fangmeier
2004 Cultural Resources Survey of Red Mountain Freeway Right-of-Way Between University Drive and Southern Avenue, Mesa, Maricopa County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-029-02. Tempe, Arizona.

Jones, Jeffrey T.
2010 A Class III Cultural Resource Survey of 5.83 Km (3.62 Miles) of 20-M-Wide (66-Foot-Wide) Areas of Potential Effect Proposed for the Construction of Two Segments of the Arizona Trail within and Near Cienega Creek Natural Preserve in Pima County, Arizona. Tierra Archaeological Report Number 2010-166, Tierra Right of Way Services, Ltd., Tucson, Arizona.

2012 A class III cultural resource survey of a portion of The Loop, a pedestrian and non-motorized vehicle trail, in Tucson and Pima County, Arizona. EcoPlan Associates, Inc., Mesa, Arizona.

Jones, Jeffrey T. et al.
2009 Archaeological data recovery investigations at AZ BB:13:742(ASM), AZ BB:13:748(ASM), and AZ BB:13:763(ASM) in Tucson, Arizona. Report No. 2007-146. Tierra Right of Way Services, Tucson, Arizona.

Jones, Thomas E.
2004 Cultural Resources Survey for Arizona Public Service Company's McVay 69kV Transmission Line Right-of-Way Renewal, La Paz County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-056-02. Tempe, Arizona.

2008 Cultural Resource Survey of a 350-Acres Parcel for the Proposed Painted Rock Grain Handling Facility West of Gila Bend, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2011 Documentation of Old US 80 and Associated Features at Gillespie Dam Bridge, South of Arlington, Maricopa County, Arizona for documentation of its Information Potential Associated with the Historic State Highway System. Report no. 11-120-csur. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2014 A class III cultural resource survey of State Route 79 between mileposts 144.4 and 145.1 for the Silver Bar Mine regional landfill access road project, North of Florence, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas, and Kristin L. Fangmeier.

2009 A class I cultural resource literature review and class III pedestrian survey for a Crown Castle International Wireless telecommunications facility (Site #1123-3285) near State Route 79 and Deep Well Ranch Road southeast of Florence, Pinal County, Arizona. Archaeological Consulting Services, Ltd., Tempe.

Jones, Thomas E., and Victoria D. Vargas.
2010 Archaeological monitoring at Old US Highway 80 (AZ FF:9:17[ASM]) for Maricopa County Department of Transportation (MCDOT) Maricopa Highway 85 and Baseline Road Intersection Improvements Project, Buckeye, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas E. et al.
2006 CULTURAL RESOURCES SURVEY AND HISTORICAL CONTEXT OF THE GILLESPIE DAM BRIDGE POTENTIAL IMPACT AREA, MARICOPA COUNTY DEPARTMENT OF TRANSPORTATION, MARICOPA COUNTY, ARIZONA. Manuscript on file, Archaeological Consulting Services, Tempe.

King, Anna Martin, and Mary M Prasciunas.
2015 A Cultural Resources Inventory Of 22.4 Acres for The Southeast Interceptor Sewer Augmentation Project in The Cities of Tucson and South Tucson, Pima County, Arizona. Cultural Resources Report 2015-10. Westland Resources, Tucson, Arizona.

Klebacha, Caroline.
2016 Cultural Resource Survey, Glance Creek Bridge, ADOT Structure #237, Cochise County, Arizona. Technical Report No. 13-467016. EcoPlan Associates, Inc., Mesa, Arizona.

Klune, Ingrid and David P. Doak
2005 A class III cultural resources survey of 2.5 linear miles of Arizona Department of Transportation Right of-Way alongside portions of Interstate 10 and State Highways 80 and 90 near Benson, Cochise County, Arizona. Tierra Archaeological Report No. 2005-28. Tierra Right of Way Services, Tucson, Arizona.

Klune, Ingrid and James Moses
2003 A Cultural Resources Assessment Survey of Approximately 2530 Linear Feet along State Highway 77 and Edwin Road, Pima and Pinal Counties, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2003-54. Tucson, Arizona.

Knoblock, Keith
2001 A Cultural Resource Survey for a Proposed Fiber Optic Corridor Spanning Southeastern Arizona in Pima, Santa Cruz, and Cochise Counties. Lone Mountain Report No. 421/423. Lone Mountain Archaeological Services, Inc., Tucson, Arizona.

Langan, John S. and Courtney C. Rehar.
2009 Cultural Resources Survey of 1.0 Mile of ADOT Right-of-way along State Route 77, Between Mileposts 88.0 and 89.0, near Catalina, Pinal County, Arizona. Report No. AZG0907-008, AZTEC Engineering, Phoenix, Arizona.

Langan, John S. and Scott Solliday.
2012 Cultural Resource Survey for Widening and Improvement of Maricopa County Route 85 in Avondale, Phoenix, and Tollston, Maricopa County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Larsen, David N.
2009 A Cultural Resources Survey Report of Four Pavement Preservation Projects, Town of Buckeye, Maricopa County, Arizona. AMEC Internal Report No. 04009005, AMEC Earth & Environmental, Inc., Tempe, Arizona.

Lascaux, Annick and Eric Klucas.
2008 A cultural resources inventory of the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #1 plant substation 34.5-KV and Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #3 pumping plant substation 34.5-KV transmission lines, and the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk pumping plant #2 4.16-KV distribution line rebuild project, Yuma County, Arizona. Tierra Archaeological Report 2007-16. Tierra Right of Way Services, Ltd., Tucson, Arizona.

Leonard, Kathryn et al.
2011 Historic streetscape assessment report for a roadway transportation enhancement project on SR 80, Fremont Street in the Schieffelin Historic District, Tombstone, Cochise County, Arizona. Logan Simpson Design, Tempe, Arizona.

Lindeman, Michael W. et al. 2012 A Plan for Monitoring, Discovery, and Limited Data Recovery within City of Tucson right-of-way in Eleven Archaeological Sensitivity Zones in the City of Tucson. Report No. 2011-06. Desert Archaeology, Inc., Tucson, Arizona.

Lindly, John M.
2004 An Archaeological Survey of the Proposed Loop 303 Expressway (Cotton Lane) South of Interstate 10 to the Gila River in Southwest Maricopa County, Arizona. SWCA Environmental Consultants. SWCA Cultural Resources Report No. 04-248. Phoenix, Arizona.

Lonardo, Cara, and Andrew Vorsanger.
2015 A Class III Cultural Resources Survey for the Western Area Power Administration Levee-Salinity Power Systems Project, Yuma County, Arizona. EPG Cultural Resource Services Technical Paper No. 2015-22. Environmental Planning Group, LLC, Phoenix, Arizona.

Luchetta, Sarah, and Chester Shaw.
2007 A class III cultural resources survey of approximately 2.3 miles along Sahuarita Road between La Villita Road and County Club Road in Sahuarita and Unincorporated Pima County, Arizona. HEG project 06-190. Harris Environmental Group, Inc., Tucson, Arizona.

Lundin, Deil R. et al.
2013 A cultural resources survey for the Chino Road extension project in Douglas, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

McDermott, Matt
2002 A Cultural Resource Survey of 15.5-Miles of ADOT Right-of-Way Along State Route 80, Between Silver Creek and Bernardino, Northeast of Douglas, Cochise County, Arizona. EcoPlan Associates, Inc. EcoPlan Associates, Inc. Report #00-469:44. Mesa, Arizona.

Morgan, Rieder et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-08. Williams Self Associates, Inc., Tucson, Arizona.

Moses, James J.
2004 A Class III Cultural Resources Survey of Approximately 480 Acres West of State Route 79 south of Bogard Wash, 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Report no. 2003-48. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and David P. Doak
2003 A Class III Cultural Resources Survey of a Proposed Temporary Access Road for a Materials Source Pit West of State Route 79 and 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Arizona State Land Department Right of Entry Permit Reference No. 29.109254. Report no. 2003-56. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and Barbara Montgomery
2004 A Cultural Resources Assessment of a Cellular Tower Site located at 7900 East Main Street in Mesa, Maricopa County, Arizona. Tierra Archaeological Report No. 2004-72. Tierra Right of Way Services, Tucson, Arizona.

Newsome, Daniel K.
2007 Cultural resources inventory of 4.57 miles for a 69/12kV transmission line rebuild across Arizona State Trust Land near Arlington, Maricopa County, Arizona. Report (EnviroSystems Management (Flagstaff, Ariz.)); no. 1259-06. EnviroSystems Management: Flagstaff, Arizona.

National Resources and Conservation Service (NRCS)

2024 Web Soil Survey. Natural Resources and Conservation Service, US Department of Agriculture. Electronic document, http://websoilsurvey.nrcs.usda.gov/app/WebSoilSurvey.aspx.

Petersen, Eric S.
2004 A cultural resources survey for a proposed 69-kV Transmission line between the Oracle Substation and the proposed Willow Springs Substation near Oracle Junction, Pinal County, Arizona. Project Report No. 8886-067. SWCA Environmental Consultants. Tucson, Arizona.

Petersen, Eric S., and S. Jerome Hesse.
2011 Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona. SWCA Cultural Resource Report No. 11-369. SWCA Environmental Consultants, Tucson, Arizona.

Peters, Matthew D.
2013 Class III cultural resources survey report: ‡b Vail to Valencia 115kV to 138kV transmission line upgrade project, private lands, and previously authorized right-of-way south of Kantor substation, Santa Cruz County, Arizona. Transcon Environmental, Mesa, Arizona.

Punzmann, Walter R.
2012 A Class III Cultural Resource Survey of Four Proposed Bus Pullouts Along State Route 77/Oracle Road, Tucson, Pima County, Arizona. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2006 Trico Willow Springs 69-kV line reroute survey: an addendum to a cultural resources survey of the proposed 69-kV transmission line between the Oracle Substation and the proposed Willow Springs Substation, Pinal County, Arizona. SWCA Environmental Consultants: Tucson, Arizona

Rawson, Paul M.
2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2015 Cultural resources survey for the Elephant Head Road Bridge Superstructure Replacement Project, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rawson, Paul M. et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion: Addendum, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-12. William Self Associates, Inc., Tucson, Arizona.

Rayle, Greta J.
2011 A class III cultural resources survey and a reconnaissance-level architectural survey along State Route 80, Patton Street between Miller Lane and milepost 300.64, St. David, Cochise County, Arizona. Report No. 095451. Logan Simpson Design, Inc., Tempe, Arizona.

Rawson, Paul M.
2011 A cultural resource survey of the Ina and Oracle Road intersection improvements project, Pima County, Arizona. Report 1 of 2. Cultural Resources Report no. 11-407. SWCA Environmental Consultants, Tucson, Arizona.

2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2014 Archaeological records search and pedestrian survey for the City of Tucson 14-03 ADA sidewalk improvements project, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rodgers, James B.
2010 An archaeological inventory of the Loop 303 Outfall Project Area in Goodyear and West-Central Maricopa County, Arizona. Contract Archaeology Series 10-1, Scientific Archeological Services, Phoenix, Arizona.

Rogge et al.
2002 Cultural Resource Survey for the Phase 3 PM-10 Roads Project Number 16214, Maricopa County, Arizona. URS Cultural Resource Report 2002-36(AZ). URS Corporation, Phoenix, Arizona.

Rossi, Erica, and Daniel Garcia
2005 A Cultural Resource Survey of State Route 280 (Ave 3E) from Interstate 8 to Business 8, Yuma, Yuma County, Arizona. EcoPlan Cultural Resource Survey Report No. 04-712:09. Mesa, Arizona.

Ruble, Ellen C.
2004 Cultural resources monitoring results for the Kinder Morgan gasoline pipeline within the Arizona Department of Transportation right-of-way, Pima County, Arizona. Project report no. 03-193. Desert Archaeology, Inc., Tucson, Arizona.

Rucker, Daniel.
2015 Class III cultural resources survey: Cross Hill Quarry, Pima County, Arizona. Transcon Environmental, Mesa, Arizona.

2016 Class III Cultural Resources Survey: Cross Hill Quarry Access Road, Pima County, Arizona. Transcon Report No. M06-22. Transcon Environmental, Inc., Mesa, Arizona.

Ryan, E. Melanie et al.
2012 Final Report of Class III Cultural Resource Survey for the SCIDD-Florence Canal, Phase I: Station 45+00 to 1224+00, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Schilz, Allan J.
2011 Tracks Through Time: Urban Archaeology Along the METRO Light Rail Corridor. Report no. 147. Archaeological Consulting Services, Tempe, Arizona.

Schroeder, K.J.
2005 A class III (intensive field inventory) cultural resources survey of approximately five miles of waterline right-of-way on state trust land along Baseline Road, Apache Junction, Pinal County, Arizona. Archaeological Research Services, Inc.

Shepard, Kristopher S., and Korri Dee Turner
2002 A Cultural Resource Survey of 27.63 Miles (226.96 Acres) along Five Segments of State Route 80 between Mileposts 295.62 and 383.00, and along a 1.90-Mile-Long Segment (2.30 Acres) of Business State Route 80 between Mileposts 366.20 and 368.10, within Cochise County, Arizona. Entranco Project Report 2001-026. Phoenix, Arizona.

Schilling, Linda M.
2013 Class III cultural resource survey of 35.8 acres for the I-8 South Frontage Road, Avenue 8.5E to Fortuna Road project, Yuma County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2018 A Class III Cultural Resources Survey for Drainage Improvements at Rainbow Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-002. Jacobs Engineering Group, Inc., Phoenix, Arizona.

2018 A Class III Cultural Resource Survey for Drainage Improvements at Butterfield Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-003. Jacobs Engineering Group, Inc., Phoenix, Arizona.

Shilling, Linda M., and Kristin L. Fangmeier.
2006 Cultural Resources Survey for the AZTech SMART Corridors Phase 3 Project, Maricopa County, Arizona. ACS Project No. 05-110-02. Archaeological Consulting Services, Ltd. Tempe, Arizona.

SHPO A Cultural Resources Inventory for a Proposed Telecommunications Site (PH30822C) at Solomon Industrial Park Lot 3 in Tucson, Arizona

Slawson, Laurie V.

1993 A Class III Archaeological Survey for the Julian and Rodeo Wash Linear Parks in Tucson, Arizona. Tucson, Arizona: Cultural & Environmental Systems, Inc.

Smith, Alexa M. et al.
2012 A Cultural Resources Inventory for a Portion of The Loop Between South Park and South 6th Avenues, Tucson, Arizona. Report no. 2012-06. William Self Associates, Inc., Tucson, Arizona.

Smith, Matthew B., and Charles W. Wheeler.
2001 An Archaeological Survey of the Proposed South of Tucson Reroute Addendum 5 to An Archaeological Survey of the Arizona Portion of Link Two of the AT&T NexGen/Core Project. Western Cultural Resource Management, Inc Report No. WCRM(F)228. Farmington, New Mexico.

Stahman, Andrea R.
2006 Cultural Resources Survey of 26 Linear Miles Along County Road 85/Buckeye Road between 75th Avenue and Turner Road, Maricopa County, Arizona. Report no. 06-12. Northland Research, Tempe, Arizona.

Steely, James Wright et al.
2012 Cultural Resources Evaluation of the Tucson Downtown Links Project, Tucson, Arizona. Report no. 12-232. SWCA Environmental Consultants, Tucson, Arizona.

Stephen, David V.M.
2004 Cultural resources survey of the Landin Park Access Project near Tombstone, Cochise County, Arizona. P.A.S.T. Cultural Resources Report No. 041620. Professional Archaeological Services of Tucson, Tucson, Arizona

Stevens, Michelle.
2014 Prehistoric and historic land use in Cienega Valley, southeastern Arizona: results of the Cienega Valley Survey Project. Project Report No. 2013-104. Desert Archaeology, Inc., Tucson, Arizona.

Stone, Bradford W.
2017 A Cultural Resources Inventory for the old Nogales Interceptor/Aerospace Corridor/Park Avenue Sewer Project, Pima County, Arizona. Cultural Resources Report 2016-50. Westland Resources, Tucson, Arizona.

2017 A Cultural Resources Inventory for the Proposed Benson Highway at Drexel Road Intersection Improvements Project. Cultural Resources Report 2017-0240. Westland Resources Inc., Tucson, Arizona.

Strohmayer, Jodi et al
2005 A Cultural Resource Survey and the Final Results of a Feasibility Study for the Relocation of the Marsh Station Traffic Interchange along I-10, Pima County, Arizona. EcoPlan Cultural Resource Report No. 00-469:115. EcoPlan Associates, Inc., Mesa, Arizona.

Tactikos, Joanne C.
2013 A class III cultural resource survey for a proposed improvements to the Avondale Boulevard and MC 85 intersection in Avondale, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Tactikos, Joanne C. and Thomas Jones.
2014 A class III cultural resource survey for the proposed improvements to MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Tactikos, Joanne C. et al.
2013 Addendum report to the class III survey along reaches 1 and 2 of the San Carlos Irrigation Project rehabilitation. ACS Project No. 13-107. Archaeology Consulting Services, Tempe, Arizona.

Terhune, Claire E.
2004 A Cultural Resources Survey for a Pavement Preservation and Culvert Extension Project on State Route 80, St. David, Cochise County, Arizona. EcoPlan Associates, Inc. Cultural Resources Report 02-599, Task 5. Mesa, Arizona.

Tinseth, George.
2013 A cultural resources inventory of approximately 5.6 acres for a Tucson Electronic Power Company distribution line installation along Oracle Road, Pima County, Arizona. Report no. 2013-39. Westland Resources, Inc., Tucson, Arizona.

Touchin, Jewel.

2004 A Cultural Resources Survey of a Proposed New Right-of-Way and Temporary Construction Easement at the Sixth Avenue and Westbound Frontage Road Intersection in South Tucson, Pima County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-29. Phoenix, Arizona.

Touchin, Jewel et al.

2002 A cultural resources survey of State Route 79, from milepost 135.00 to milepost 150.28, Florence to Florence Junction, Pinal County, Arizona. HDR Engineering, Inc. Cultural Resources Report 02-14. Phoenix, Arizona.

Touchin, Jewel and Mark Brodbeck
2002 A Cultural Resources Survey of State Route 80, from Milepost 302.0 to Milepost 309.0, South of St. David, Cochise County, Arizona. Cultural Resource Report 01-12. HDR Engineering, Inc., Phoenix, Arizona.

2003 A Cultural Resources Survey of State Route 80, between Mileposts 356.3 and 357.0, Between Bisbee and Douglas, Cochise County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-14. Phoenix, Arizona.

Tucker, David B.
2000 Report 3 of 4 The El Paso to Los Angeles Fiber Optic Cable Project: A Cultural Resources Survey of the Arizona Segment of a Linear Right-of-Way Across Cochise, Pima, Pinal, Maricopa, and La Paz Counties, Arizona. SWCA, Inc., Tucson, AZ.

2009 Archaeological Records Search and Survey for Amphi Neighborhood Light Project, Phase 2, Navajo Road, Oracle Road to Stone Avenue, Tucson, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

2009 An archaeological survey for the TRICO circuit 76 rebuild project, Pima County, Arizona: TRICO work order No. 40543. Cultural Resources Report No. 08-483. SWCA Environmental Consultants, Tucson, Arizona.

2010 Archaeological Records Search and Survey for Grant Road and Oracle Road Intersection Improvements, Tucson, Arizona, and Building Assessments for 225 and 201 West Grant Road. SWCA, Environmental Consultants, Tucson, Arizona.

Tucker, David B., and India S. Hesse.
2013 A cultural resources survey for the five points combined transportation enhancement and pedestrian improvements, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Twilling, Shannon D.
2006 A class III cultural resources survey of 2.75 acres along Nogales Highway at Franco Wash in Pima County, Arizona. Harris Environmental Group: Tucson, Arizona.

2007 A Class III Cultural Resources Investigation of 704 Acres at the Tucson International Airport in Support of Proposed Runway 11R/29L Relocation. Project no. 05-052. Harris Environmental Group, Inc., Tucson, Arizona.

Twilling, Shannon et al.
2004 A Cultural Resources Survey and Treatment Plan in Support of a Proposed Perimeter Fence Line Installation Around the Florence Military Reservation Perimeter, Pinal County, Arizona. Harris Environmental Group. Harris Project No. 04-106. Tucson, Arizona.

Vance, Meghann M.
2008 Class III Cultural Resources Survey: Oracle to Oracle Junction Transmission Line, Pinal County, Arizona.

Vanderpot, Rein et al.
2005 Archaeological Investigations for the Transfer of Title to Facilities, Works, and Lands of Gila Project, Wellton-Mohawk Division, to the Wellton-Mohawk Irrigation and Drainage District, Yuma County, Arizona. Report 04-64. Statistical Research, Inc., Tucson, Arizona.

Vaughn, Catherine S.
2009 Distribution line along State Route 79 milepost 106 to Iron Valley, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

2009 Distribution line from Oracle Junction to milepost 103.5 along State Route 79, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Watkins, Christopher N.
2011 A cultural resources survey on State and Federal lands of 8.20 miles (49.69 acres) of the SE-12 (Mural-Fairview) 69-kV and 2.04 miles (12.36 acres) of the SE-13 (McNeal-San Pedro) 69kV-transmission lines in Cochise County, Arizona. Logan Simpson Design, Temple, Arizona.

Watkins, Christopher N. et al.
2011 A cultural resources survey on Federal and State land of 58.06 miles (351.87 acres) of the Arizona Public Service M-108 (Bunyan-Aztec) 69-kV transmission line, 2.92 miles (17.69 acres) of the M-110 (Gila Bend-Bunyan) 69-kV transmission line, and 20.76 miles (125.81 acres) of the M-111 (Gillespie-Gila Bend) 69-kV transmission line in Maricopa and Yuma Counties, Arizona. Logan Simpson Design, Tempe, Arizona.

Webb, David
2005 Cultural resources survey of new right-of-way and drainage easement parcels located between State Route 80 mileposts 294.96 and 296.45, Benson, Cochise County, Arizona. Project Number AZ02103, Task 43, AZTEC Engineering, Phoenix, Arizona.

West, Heather M., and Joseph A. Ezzo
2007 Cultural Resources Survey of 159 Washes Along the Union Pacific Railroad form Estrella to Stockham-Milepost No. 876 in Maricopa County to Milepost No. 980 in Tucson, Pima County, Arizona. SWCA Cultural Resources Report 07-205, SWCA Environmental Consultants, Tucson.

Williams, CaraMia
2008 A class III cultural resources survey of 4.39 linear miles within the Arizona Department of Transportation (ADOT) right-of-way on both sides of State Route 80, beginning at milepost 298.94 and ending at 2nd Avenue (milepost 303.3), and within utility easements along Dragoon Vista Road and Lee Street, in the town of St. David, Cochise County, Arizona. Report No. 2007-67. Tierra Right of Way Services, Tucson, Arizona.

Wright, Thomas E.
2000 A Cultural Resources Survey along Business Interstate 19 (Mileposts 44.20-57.42 and 62.48-63.48), between Interstate 19 and Interstate 10, Pima County, Arizona. Project Report No. 99:35. Archaeological Research Services, Inc., Tempe, Arizona.

2001 A Cultural Resources Survey of 5.2 Miles of Business Interstate 10 Right-of-Way, Mileposts 248.0 - 253.2, Tucson, Pima County, Arizona. Archaeological Research Services, Inc. Report No. 2001:085. Tempe, Arizona.

2008 An archaeological survey of a proposed water line right-of-way on Arizona State Trust Land near Florence Junction, Pinal County, Arizona. Cultural Resources Report No. 08-258. SWCA Environmental Consultants, Phoenix, Arizona.

Young, Jessica.
2014 Class III cultural resources surveys and monitoring. Customer service projects and trouble reports, Gila and Pinal counties, Arizona: 2014 second quarter report. San Carlos Irrigation Project, Coolidge, Arizona.

SHPO-2025-0571 (180642) REC'D 04/30/2025
ERR M4

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

April 30, 2025

Kathryn Leonard, Arizona State Historic Preservation Officer
AZSHPO@stateparks.com
State Historic Preservation Office (SHPO)
1110 West Washington Street #100
Phoenix Arizona 85007

Re: Proposed HUD-Funded Undertaking at 751 East Tucson Marketplace Boulevard in Tucson, Arizona

Dear Kathryn Leonard,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NRHP Eligibility

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) and AZ BB:13:798(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) ~~and AZ BB:13:577(ASM)~~ 798 eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. Please review this undertaking's potential impacts and effects upon

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

historic properties and provide concurrence within thirty (30) calendar days of receipt of this letter. Your assistance is valued, and we look forward to consulting further if there are historic properties of significance affected by this project. Any written responses should be sent to the following address:

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

AZ BB:13:738(ASM) and AZ BB:13:798(ASM) have both been previously determined ineligible for inclusion in the National Register of Historic Places. AZ BB:13:744(ASM) has been determined eligible, but the alignment within the APE is no longer extant. SHPO recommends that a finding of No Adverse Effect is appropriate for this undertaking, and no additional archaeological work is recommended.

Erin Davis
Archaeological Compliance Specialist
Arizona State Historic Preservation Office
May 28, 2025

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

April 30, 2025

Jodie Brown, City of Tucson Historic Preservation Officer
201 North Stone Avenue, 3rd Floor
Tucson, Arizona 85701

Re: Proposed HUD-Funded Undertaking at 751 East Tucson Marketplace Boulevard in Tucson, Arizona

Dear Jodie Brown,

The Pima County JTED District 11 ("JTED") is seeking financial assistance from the Department of Housing and Urban Development (HUD) for the acquisition of 4.09 acres of land for the future expansion of the Innovation Tech High School. In accordance with 36 CFR Part 800, "Protection of Historic Properties," regulations that implement Section 106 of the National Historic Preservation Act of 1966, as amended (16 USC 470f), JTED is contacting you on behalf of HUD to request comments on historic properties affected by the proposed project.

The project involves the acquisition and future new construction of a building on a poured foundation as well as increased parking space on asphalt-paved surface (see Attachment 1) on previously undeveloped land at 751 East Tucson Marketplace in Tucson, Arizona. According to the Pima County Assessor's Office, the Arizona Parcel Numbers (APN) for this project is 132-13-104A. Assumed ground disturbance will occur on approximately 4 acres of land. The project will be used to provide an educational facility to underserved and at-risk students.

The land for the project is owned by BP Bridges Partners.

Area of Potential Effects

The Area of Potential Effects (APE) is defined as the "…geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties. The area of potential effects is influenced by the scale and nature of the undertaking…" (36 CFR § 800.9[a]). The APE includes the entirety of parcel 132-13-104A. Surrounding buildings and man-made features were taken into account when developing its limits, and it encompasses an area of approximately 4.09 acres (see Figure 1).

NRHP Eligibility

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

Western Technologies searched for aboveground resources within the APE that are at least 50 years of age. The project is not located within or adjoining a historical district, nor is the property or adjoining sites listed in the National Register of Historic Places (see figure 2).

The property appeared to have been cropland from the 1940's through the 1970's, whereupon the land was vacated. No structures were identified on the parcel from 1940 to 2023.

Class I Cultural Resources Survey

JTED contracted Harris Environmental Group, Inc. ("Harris") to perform a Class I Cultural Resources Assessment for the proposed project area, defined as the 4.09-acre parcel, plus a 0.5-mile study buffer. Harris's archaeologist evaluated previous survey coverage and known archaeological site density in the project area by reviewing existing archaeological survey and site information available in the AZSITE archaeological database and at the ASM Archaeological Records Office and historical maps of the project area to assess the potential for additional prehistoric and historical sites. Based on the review of previous survey coverage and mitigation efforts, Harris recommends that the entire project area has been surveyed to modern standards. Three sites have been identified within the project area: AZ BB:13:738(ASM), the Fiesta Drive-In Theater; AZ BB:13:744(ASM), the Tucson– Bisbee Highway; and AZ BB:13:798(ASM), a historic house foundation. The Arizona SHPO has determined AZ BB:13:738(ASM) ineligible for listing in the A/NRHP (2005-1887), and no further archaeological work is recommended for this site. The Arizona SHPO has determined sites AZ BB:13:744(ASM) and AZ BB:13:577(ASM) eligible for listing in the A/NRHP, but the portions of these sites within the project area have been obliterated and are recommended non-contributing. Further, the project area is not located in a floodplain or other depositional area where buried cultural deposits would be expected.

Harris found that there is little potential for the inadvertent discovery of significant archeological remains within the project area. However, Harris provides the general recommendation that all ground-disturbing activities have the potential to inadvertently disturb human remains and other cultural items. Pursuant to Arizona Revised Statutes §41-844 and §41-865, if previously unreported cultural resources including Native American human remains or funerary objects or human remains are encountered during ground disturbing activities, all work within 100 feet must cease and the Director of the ASM shall be immediately notified.

Effect Finding

Based on this information and the recommendations from Harris, WT has determined that no property within the APE is eligible for listing in the NRHP and that a finding of no historic properties affected is appropriate for the undertaking. Please review this undertaking's potential impacts and effects upon historic properties and provide concurrence within thirty (30) calendar days of receipt of this letter. Your

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

assistance is valued, and we look forward to consulting further if there are historic properties of significance affected by this project. Any written responses should be sent to the following address:

Western Technologies
3480 South Dodge Boulevard
Tucson, Arizona 85713
Attn: Kage Anderson

Alternately, responses can be sent via e-mail to kanderson@rma-western.com. We appreciate your continued efforts and patience in responding to this request. Should you have any questions please contact our office at 520.748.2262.

Sincerely,

Tina Norton

Enclosures

LEGEND

APPROXIMATE AREA OF POTENTIAL EFFECTS (APE)

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	1
WT Job No. 29-824105-0	
Area of Potential Effects (APE) Map	

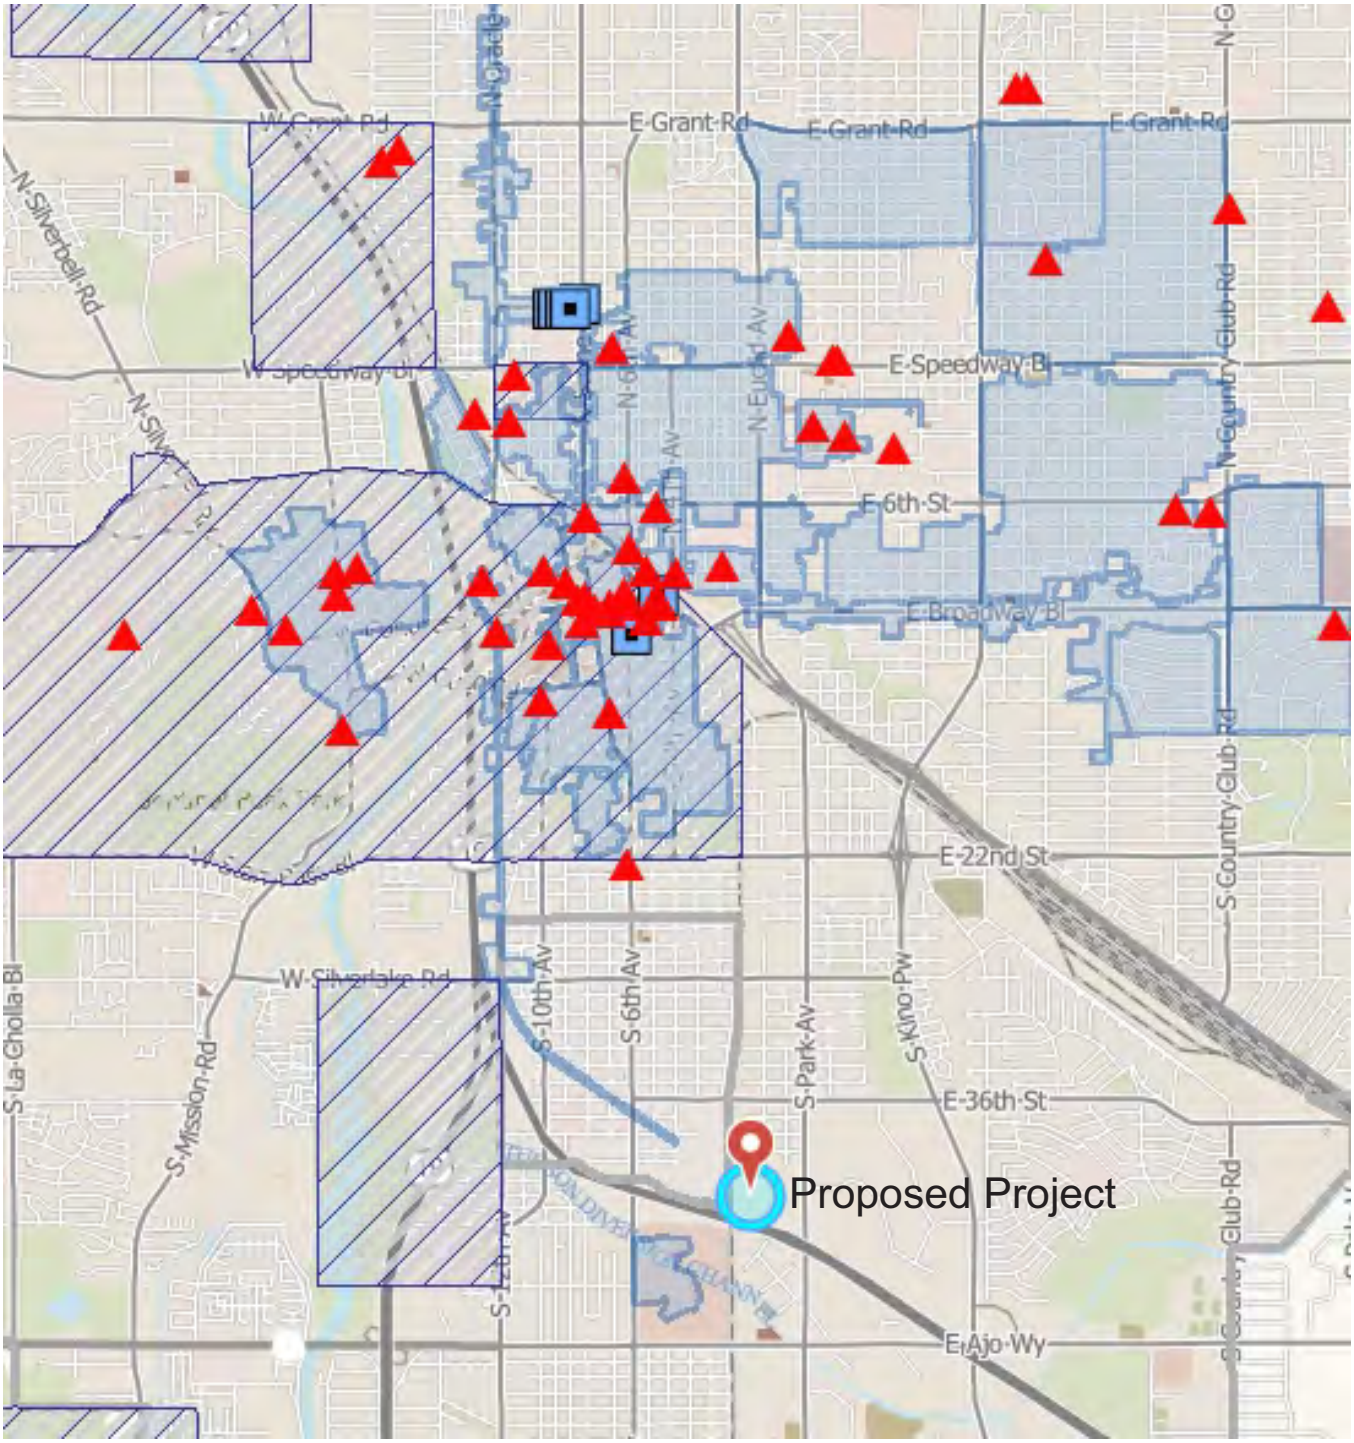

LEGEND

Historic District Boundaries

NRHP Listed Historic Property

NOT TO SCALE, FOR REFERENCE ONLY

NORTH

CERTERRA
WESTERN TECHNOLOGIES

Environmental Assessment	FIGURE
751 East Tucson Marketplace Boulevard, Tucson, Arizona	2
WT Job No. 29-824105-0	
NRHPMap	

Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

Prepared for:
Pima County Joint Technical Education District #11
2855 West Master Pieces Drive
Tucson, AZ 85741

Prepared by:
Sarah Wolfram and Drew Sangerman

Submitted by:
Harris Environmental Group, Inc.
650 N 6th Ave, Tucson, AZ 85705

February 2025

1. REPORT TITLE

1a. Report Title: Tucson Marketplace Cultural Resources Class I Survey, Tucson, Pima County, Arizona Report

1b. Report Author(s): Sarah Wolfram and Drew Sangerman

1c. Date: February 2025

2. PROJECT REGISTRATION/PERMITS

2a. AAA Permit Number: 2025-034bl

3. ORGANIZATION/CONSULTING FIRM

3a. Name: Harris Environmental Group, Inc.

3b. Internal Project Number: 25-003

3c. Internal Project Name: Tucson Marketplace Class I

3d. Contact Name: Sarah Wolfram

3e. Contact Address: 650 North 6th Ave, Tucson, AZ 85705

3f. Contact Phone: 520-628-7648

3g. Contact Email: swolfram@heg-inc.com

4. SPONSOR/LEAD AGENCY

4a. Sponsor: Pima County Joint Technical Education District #11

4b. Lead Agency: Pima County Joint Technical Education District #11

4c. Funding Source(s): Private

4d. Other Involved Agencies: Western Technologies

4e. **Applicable Regulations:** Arizona Antiquities Act (AAA), Arizona Revised Statutes (ARS; Title 41 § 841-844), the Arizona State Historic Preservation Act (SHPA; ARS Title 41 § 861-865), and Section 106 of the National Historic Preservation Act. A Class III pedestrian survey was necessary to identify, document, and evaluate cultural resources that could be affected by the proposed project. This process requires consultation with the SHPO and ASM to review the findings of this study regarding the undertaking's potential effects on cultural resources. This report was prepared per guidelines specified by the SHPO (2009, 2016).

5. DESCRIPTION OF PROJECT OR UNDERTAKING: Class I Cultural Resources Survey, associated with a 4.09-acre parcel located in Tucson, Arizona.

6. PROJECT AREA/AREA OF POTENTIAL EFFECTS: The area of potential effects (APE) is 4.09 acres located in Tucson, Arizona. The surrounding environment is built with modern buildings and roads in use. The southern end of the parcel has standing structures that are in use.

7. PROJECT LOCATION

7a. Address: 751 East Tucson Marketplace Boulevard

7b. Nearest City/Town: Tucson

7c. County: Pima

7d. Project Locator UTM: 503756 Easting, 3561169 Northing

7e. NAD 83

7f. Zone: 12N

7g. Baseline & Meridian: Gila & Salt River

7h. USGS Quadrangle(s): Tucson

7i. Legal Description(s): Township 14 S, Range 14 E, Section 30

8. SURVEY AREA

8a. Total Acres: 4.09

8b. Survey Area.

1. Land Jurisdiction	2. Total Acres Surveyed	3. Total Acres Not Surveyed	4. Justification for Areas Not Surveyed
Private	4.09	0	N/A

9. ENVIRONMENTAL CONTEXTS

9a. Landform: The project area is on a southeast facing gradual slope.

9b. Elevation: 2,462 ft amsl

9c. Surrounding Topographic Features: Characterized by broad sweeping alluvial plains. Sentinel Peak is located 2.43 miles to the northwest.

9d. Nearest Drainage: The Santa Cruz River is 1.68 miles to the west.

9e. Local Geology: The geology of this region consists of Quaternary Surficial deposits. Quaternary Surficial deposits are associated with strongly consolidated alluvial and eolian deposits. The geologic make up consists of course poorly sorted alluvial fan and terrace deposits

on middle to upper piedmonts and along large drainages. Sand, silt, and clay are present on alluvial plains, with wind-blown sand deposits (Arizona Geologic Survey, 2025).

9f. Vegetation: Common vegetation of this region is dominated by creosote (*Larrea tridentata*), ocotillo (*Fouquieria*), saguaro cactus (*Carnegiea gigantea*), ironwood (*Olneya tesota*), and mesquite (*Prosopis glandulosa*) (Griffith et al, 2014).

9g. Soils/Deposition: Soils across the project area are primarily composed of cave soils and urban land. This soil is typical of the surrounding fan terraces. A typical profile consists of zero to seven inches of gravelly fine sandy loam, seven to twenty inches of cemented material, and twenty to sixty inches of gravelly loamy sand (NRCS, 2024).

9h. Buried Deposits: Buried cultural deposits are not likely within the project area.

9i. Justification: The known cultural sites in the immediate vicinity of the project area are all historic affiliation, with very little potential for subsurface artifacts.

I0. BUILT ENVIRONMENT: The project area is located just north of the Pima JTED Innovative Learning Center in Tucson, Arizona. The surrounding area is built as an urban setting across all cardinal directions. No historical standing architecture is present in the project area.

11. INVENTORY CLASS COMPLETED

11a. Class I Inventory: ☒

11b. Researcher(s): Jonathan Damp Ph.D. and Sarah Wolfram

11c. Class II Survey: ☐

11d Sampling Strategy:

11e. Class III Inventory: ☐

12. BACKGROUND RESEARCH SOURCES

12a. AZSITE: ☒

12b. ASM Archaeological Records Office: ☒

12c. SHPO Inventories and/or SHPO Library: ☐

12d. NRHP Database: ☐

12e. ADOT Portal: ☐

12f. GLO Maps: #204095, 1872; #204097, 1872; #210345, 1876; #210347, 1876

12g. Land- Managing Agency Files: N/A

12h. Tribal Cultural Resources Files: N/A

12i. Local Government Websites: N/A

12j. Other: USGS Topographic Maps: Tucson, AZ 1:125,000 1904; Tucson, AZ 1:125,000 1905; Tucson, AZ 1:62,500 1948; Tucson, AZ 1:250,000 1956; Tucson, AZ 1:24,000 1957; Tucson, AZ

1:250,000 1958; Tucson, AZ 1:250,000 1959; Tucson, AZ 1:250,000 1962; Tucson, AZ 1:250,000 1964

13. BACKGROUND RESEARCH RESULTS

Harris Environmental personnel conducted a site file search on AZSITE to identify previous projects and sites within one half-mile of the project area. AZSITE records noted 31 previous projects within the project area and or buffer. An ASM Archaeological Records Office (ARO) search was also conducted as part of that project, which do not provide a differing information that what was shown on AZSITE. Nine previously recorded site are located within one half-mile of the project area, with three of these previously recorded cultural resources identified within the project area.

The sites located within the project area are: AZ BB:13:738(ASM), AZ BB:13:744(ASM), and AZ BB:13:798(ASM).

AZ BB:13:738(ASM) is a concrete foundation of the Fiesta Drive-In Theatre, that was located at 3230 South Park Avenue. The business first opened in 1953 and was torn down in 1966. The remaining foundation consists of a cluster of seven concrete pads, each measuring approximately 6 ft long and 1 ft high. The concession building was bulldozed into a rubble pile, which remains on site (ASM, 2012).

AZ BB:13:744(ASM) is the Tucson-Bisbee Highway, which once ran through the area but now remains as an arbitrary line. The section through the project area, noted as "Section 1, Number 18" ran parallel alongside the EP&SW train track, from South 6th Avenue. This highway was built between 1909 and 1914, and abandoned in 1928, but was re-established as a county road in 1931, renamed as "Old Vail Road." Today, no portions of the original road survive (ASM, 2021).

AZ BB:13:798(ASM) is a historic house foundation that consists of four "wing walls" extending out from a square center. The foundation measures 106 ft by 84 ft, standing 10 ft tall. These walls are sloping downward, outside from the center. There is a small concrete pad to the west of the foundation. The property is present in 1954 aerial photographs of the area, but not in the 1946 aerial images. The purpose of the structure is unknown (ASM, 2012).

13a. Previous Projects Within Study Area and Half-Mile Buffer.

1. Project Reference Number	2. Project Name	3. Author(s)	4. Year
1980-155	Santa Cruz SW Interceptor Project	Brew	1980
1983-134	SE Interceptor Route	Brew	1983
1993-213	Julian/Rodeo Wash Survey	Slawson	1993
1996-286	Water Main Alignments in the Vicinity of Park Avenue and 33rd Street, Tucson	Sliva	1996
1997-28	Kino Community Center Reclaimed Water Main Project	Eppley	1997
1997-33	Kino Silverlake Main Replacement Project Survey	Eppley	1997

1998-43	6th Ave. I-10 to Ajo Way Survey	Castalia	1998
1998-44	S. Park (19th to 36th) Survey	Castalia	1998
1998-266	6th Ave- 18th St. to I-10 Survey	Diehl	1998
2000-116	Jct. I-19 - Craycroft Rd.	Montero	2000
2000-166	Pipeline Anomaly Digs	Rogge	2000
2000-284	Moratorium Streets Survey	Diehl	2000
2000-882	N/A	N/A	N/A
2001-399	South Park Survey	Diehl	2001
2001-769	B-10 Survey	Wright	2001
2002-316	South Park Back to Basics Survey	Diehl	2002
2003-505	Hope VI South Park 35th Street Survey	Diehl	2003
2003-1217	Hope VI 35th Street Purchase Survey	Diehl	2003
2003-1218	Habitat - 36th and Mountain Survey	Diehl	2003
2003-1514	N/A	N/A	N/A
2004-541	I-10/6th Avenue Bridge, Artistic Fencing and Sidewalk Improvements	Touchin	2004
2004-1748	902 East 35th Street Survey	Diehl	2004
2005-877	MUSD Transportation Facility	DeJongh & Dart	2005
2007-681	Sinclair Data Recovery	Jones et al.	2009
2012-73	Proposed Fiber Optic Corridor-Cultural Resource Survey	Knoblock	2001
2012-76	Cultural Resources Inventory of a Portion of The Loop	Smith, Wygant, & McKee	2012
2012-146	Sinclair Survey	Doak	2007
2012-147	Sinclair Survey -- Fiesta Drive-In	Doak	2006
2015-6	Southeast Interceptor Class III	King & Prasciunas	2015
2016-397	Old Nogales Interceptor	Stone	2017
SHPO-2001-548	Request for Evaluation - Telecommunication Facilities - UTILITY INTERNATIONAL Solomon Industrial P	SHPO	2001

13b. Previously Recorded Cultural Resources Within Study Area and Half-Mile Buffer.

1. Site Number/Name	2. Affiliation	3. Site Type	4. Eligibility Status	5. Associated Reference(s)
AZ BB:13:679(ASM)	Euro-American	Railroad	Eligible	Tucker, 2000 Ruble, 2001 Smith & Wheeler, 2001 Estes et al, 2005 Twilling, 2006

				Twilling, Luchetta, & Shaw 2007 Luchetta & Shaw, 2007 Goldstein, 2008 Hesse, 2010 Howell, 2011 Lindeman, Diel, & Gilma 2012 Peters, 2013 Heilman, 2013 Hesse & Hesse, 2014 Rawson, 2015 King & Prasciunas, 2015
AZ BB:13:738(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2006 Doak, 2007
AZ BB:13:739(ASM)	Euro-American	Concrete foundation	Not Eligible	Doak, 2007
AZ BB:13:744(ASM)	Euro-American	Road-trail	Unevaluated	Doak, 2006 Doak, 2007 Copperstone, 2014
AZ BB:13:748(ASM)	Euro-American	Historic structure and artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:763(ASM)	Euro-American	Historic artifact scatter	Eligible	Doak, 2007 Jones, 2009
AZ BB:13:798(ASM)	Euro-American	House Foundation	Eligible	Doak, 2007
AZ EE:1:300(ASM)	Euro-American	Railroad	Eligible	Wright, 2000 Luchetta & Shaw, 2007 Hesse, Levstik, & Barr, 2009 Tucker, 2009 Hess & Barr, 2009 Lindeman, Diel, & Gilman, 2012 Smith, Wygant, & McKee, 2012 Heilman, 2013 Hesse & Hesse, 2014 Jerla & King, 2014
AZ FF:9:17(ASM)	Euro-American	Road-trail	Eligible	Champe, 1936 Davis, 2001 Knoblock, 2001

				Davis & Ogren, 2002 Davis, 2002 Touchin & Brodbeck, 2002 Rogge, 2002 Chapin-Pyritz & Hill, 2002 McDermott, 2002 Touchin, Palmer, & Brodbeck, 2002 Shepard & Turner, 2002 Moses & Doak, 2003 Doak, 2003 Klune & Moses, 2003 Touchin & Brodbeck, 2003 Lindly, 2004 Moses & Montgomery, 2004 Jones, 2004 Stephen, 2004 Moses, 2004 Jolly & Fangmeier, 2004 Twilling, Fahrni, & DeJongh, 2004 Terhune, 2004 Compton-Gore & Rogge, 2005 Klune & Doak, 2005 Petersen, 2005 Webb, 2005 Schroeder, 2005 Hesse, 2005 Allan, Price, Arrigoni, & Kearney, 2005 Strohmayer, McDermott, & Ramsey, 2005 Estes, 2005 Fahrni, 2005 Vanderpot, 2005

				Rossi & Garcia, 2005 Courtright, 2005 Ekstrom, 2006 Goldstein & Bassett, 2006 Barr, 2006 Stahman, 2006 Brodbeck, Touchin, Belvin, & Silverman, 2006 Davis, Davis, Lincoln-Babb, Montero, & Turner, 2006 Davis, Turner, & Davis, 2006 Gordon, 2006 Shilling & Fangmeier, 2006 Rawson, Rieder, & Boley, 2006 Cook, 2006 Rieder, Rawson, & Epperson, 2006 Jones, Gegory, Bockhorst, & Stokes, 2006 Petersen, 2006 Florie & Luhnow, 2007 West & Ezzo, 2007 Compton-Gore, Cox, & Rogge, 2007 Goldstein, 2007 Newsome, 2007 Huebechen, Garcia, & Bruden, 2008 Davis, 2008 Vance, 2008 Caldwell, 2008 Goldstein, 2008 Davis, 2008 Williams, 2008 Wright, 2008 Lascaux & Klucas, 2008

				Hesse & Barr, 2009 Tucker, 2009 Jones & Fangmeier, 2009 Langan & Rehar, 2009 Tucker, 2010 Rodgers, 2010 Barr 2010 Jones & Vargas 2010, Alexandra & Vaughn, 2010 Schilz, 2011 Rayle, 2011 Jones, 2011 Watkins, Davis, & Courtright, 2011 Leonard, Greata, Ryden D., & Ryden E., 2011 Rawson, 2011 Howard, Moore, & Jacoby, 2011 Watkins, 2011 Peterson & Hesse, 2011 Hesse & West, 2011 Bowler, 2012 Steely, 2012 Rodgers, 2012 Langan & Solliday, 2012 Lindeman, Diehl, & Gilman, 2012 Hesse J., Ferland, &Hesse I., 2012 Hart & Barnes, 2012 Rawson, 2012 Melanie, Jones, & Stokes, 2012 Punzmann, 2012 Fahrni & Foster, 2012 Tinseth, 2013 Tucker & Hesse, 2013

				Tactikos, Jones, & Gregory, 2013 Graces, Natoli, & Huber, 2013 Lundin, Solliday, & Langan, 2013 Tactikos, 2013 Jones, 2014 Stevens, 2014 Rawson, 2014 Jessica, 2014 Bastin, 2014 Tactikos & Jones, 2014 Rucker, 2015 Hart, 2015 Lonardo & Vorsanger, 2015 Brodbeck, 2015 King & Prasciunas, 2015 Rucker, 2016 Klebacha, 2016 Stone, 2017 Schilling, 2018 Schilling, 2018 Chamorro, 2019 Brodbeck, Faer, Garnett, Mueller, & Thomas, 2021

13c. Historic Buildings/Districts/Neighborhoods.

1. Property Name or Address	2. Year	3. Eligibility Status
N/A		

14. CULTURAL CONTEXTS

14a. Prehistoric Culture: Hohokam

14b. Protohistoric Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14c. Indigenous Historic Culture: Pueblo of Zuni, Tonto Apache Tribe, Tohono O'Odham Nation, Yavapai-Apache Nation, White Mountain Apache, Pascua Yaqui Tribe, Hopi Tribe, and Mescalero Apache Tribe

14d. Euro-American Culture: 1540s to present.

15. PERSONNEL

15a. Principal Investigator: Jonathan Damp Ph. D.

15b. Supervisor: Sarah Wolfram

15C. Date(s): February 4, 2025

16. COMMENTS:

Harris Environmental performed a literature review Class I cultural resource survey of the project area. Four previously recorded cultural resource sites were observed during the survey within the project area.

Background research revealed 31 previous surveys for cultural resources, and 9 previously recorded cultural sites within the project area and half-mile buffer, with 3 of these sites being in the project area.

Ground visibility within the APE ranges from 0-100% depending on disturbance. The landform has been altered substantially due to the construction of the surrounding urban area.

There is little potential for the inadvertent discovery of significant archaeological remains within the project area. If previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency. If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

SECTION 19. ATTACHMENTS
19a. Project Location Map: ☒
19b. Land Jurisdiction Map: ☒
19c. Background Research Map(s): ☒
19d. GLO Map(s): ☐
19e. References: ☒

SECTION 20. CONSULTANT CERTIFICATION

I certify the information provided herein has been reviewed for content and accuracy and all work meets applicable agency standards.

_____
Signature

President

_____
Title

SECTION 21. DISCOVERY CLAUSE

In the event that previously unreported cultural resources are encountered during ground disturbing activities, all work must immediately cease within 30 meters (100 feet) until a qualified archaeologist has documented the discovery and evaluated its eligibility for the Arizona or National Register of Historic Places in consultation with the lead agency, the SHPO, and Tribes, as appropriate. Work must not resume in this area without approval of the lead agency.

If human remains are encountered during ground-disturbing activities, all work must immediately cease within 30 meters (100 feet) of the discovery and the area must be secured. The Arizona State Museum, lead agency, SHPO, and appropriate Tribes must be notified of the discovery. All discoveries will be treated in accordance with NAGPRA (Public Law 101-601; 25 U.S.C. 3001-3013) or Arizona Revised Statutes (A.R.S. § 41-844 and A.R.S. § 41-865), as appropriate, and work must not resume in this area without authorization from ASM and the lead agency.

Appendix A: Project Area Maps

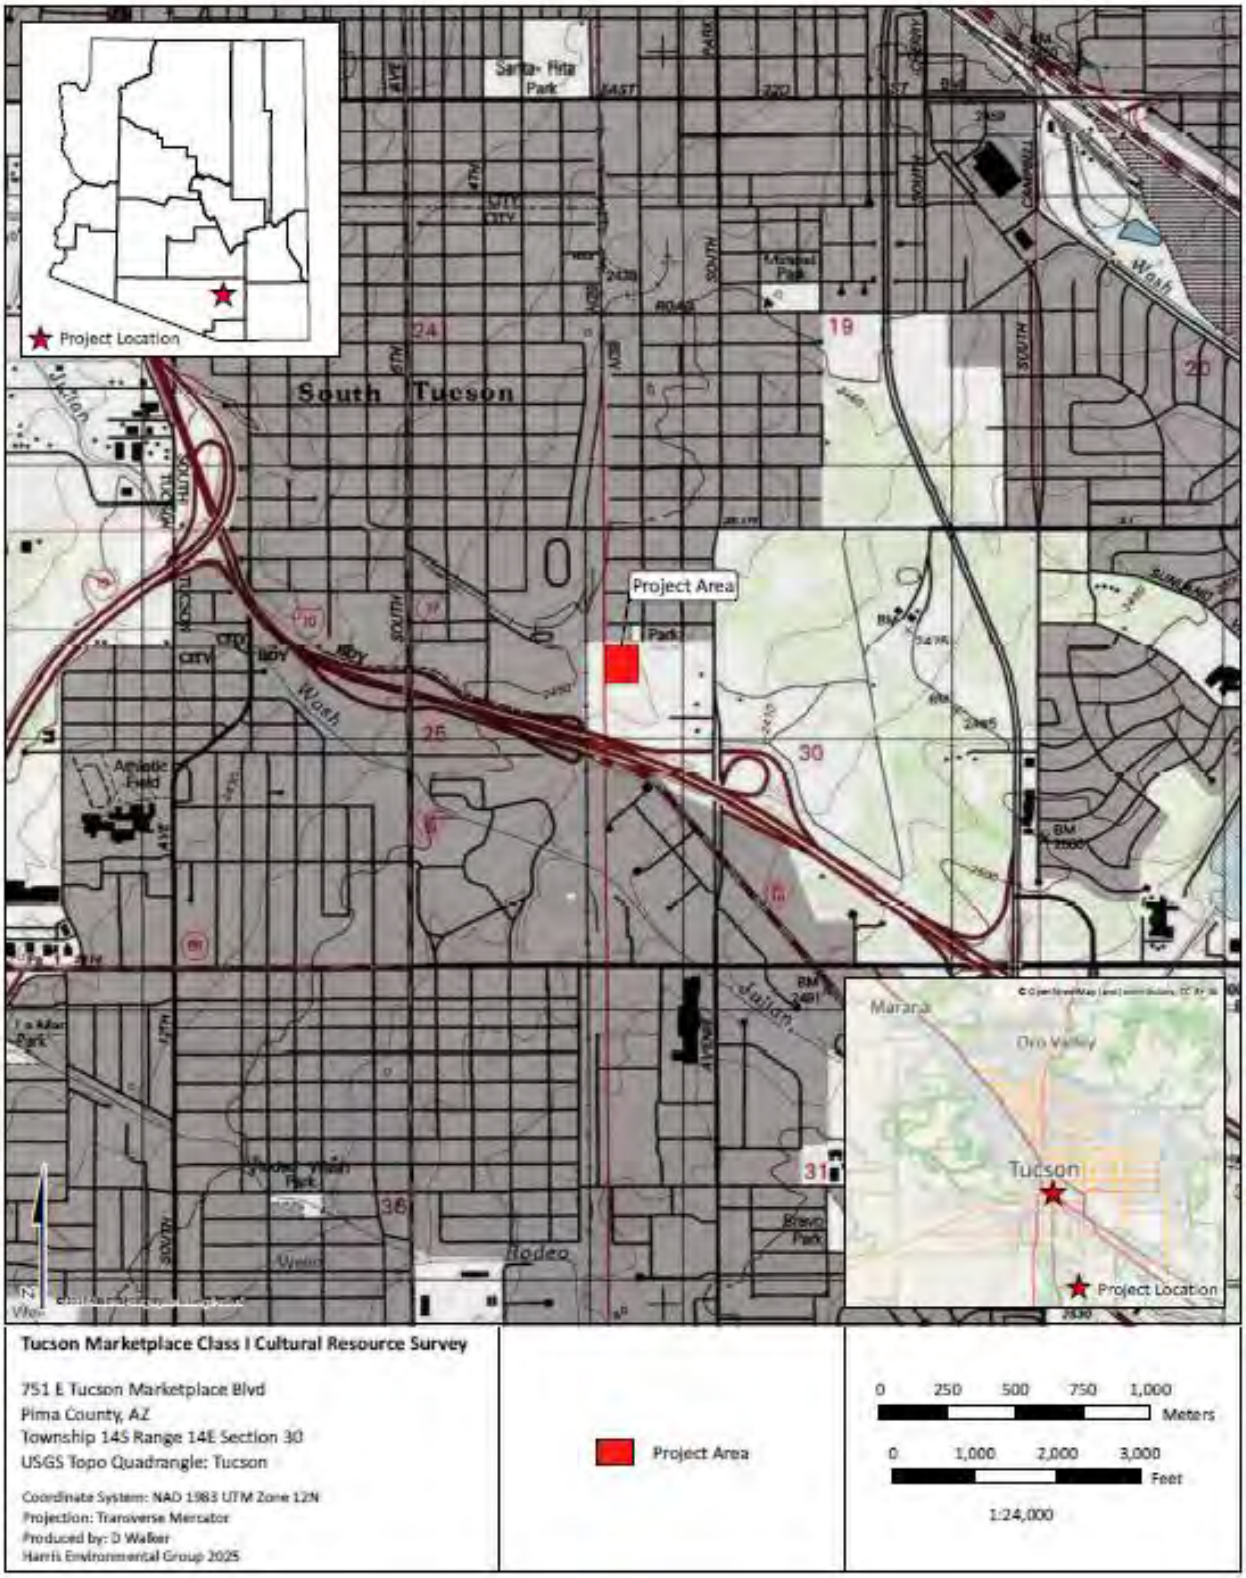

Figure 1. Project area map, topographic.

Figure 2. Project area map, aerial.

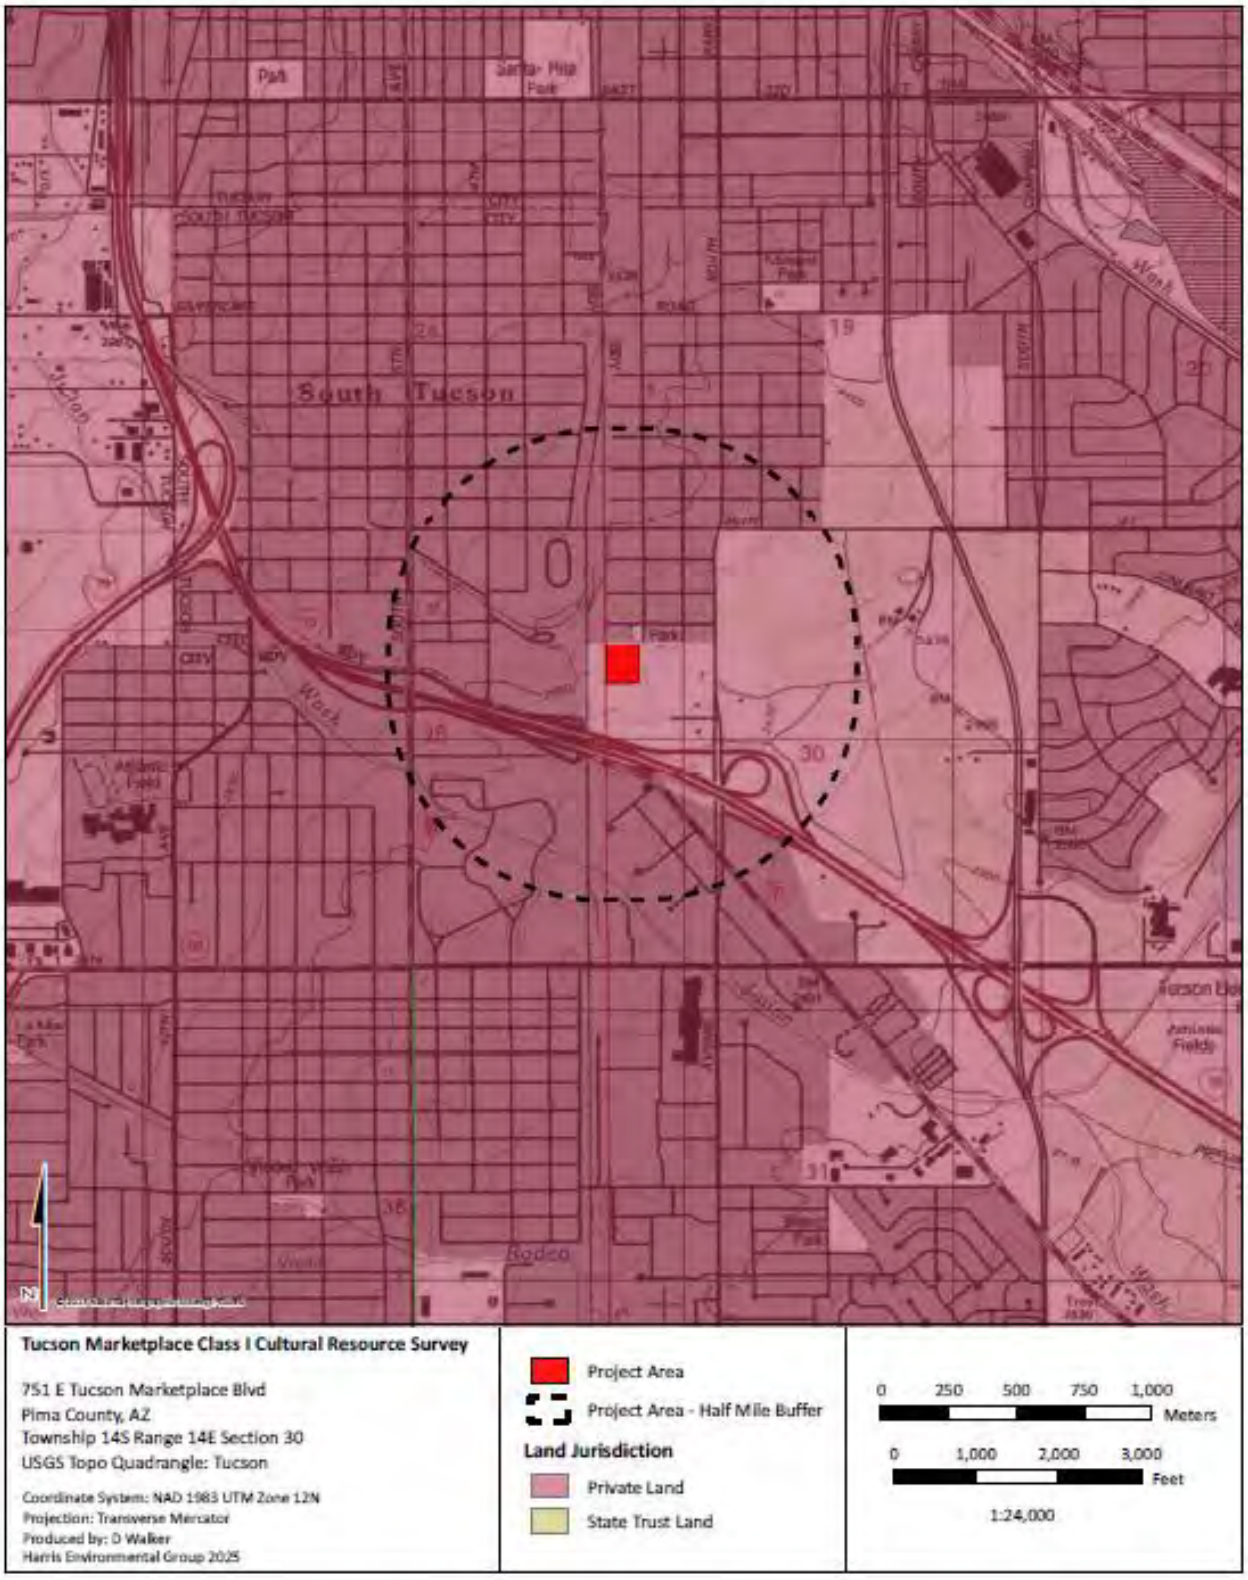

Figure 3. Project area map, land jurisdiction.

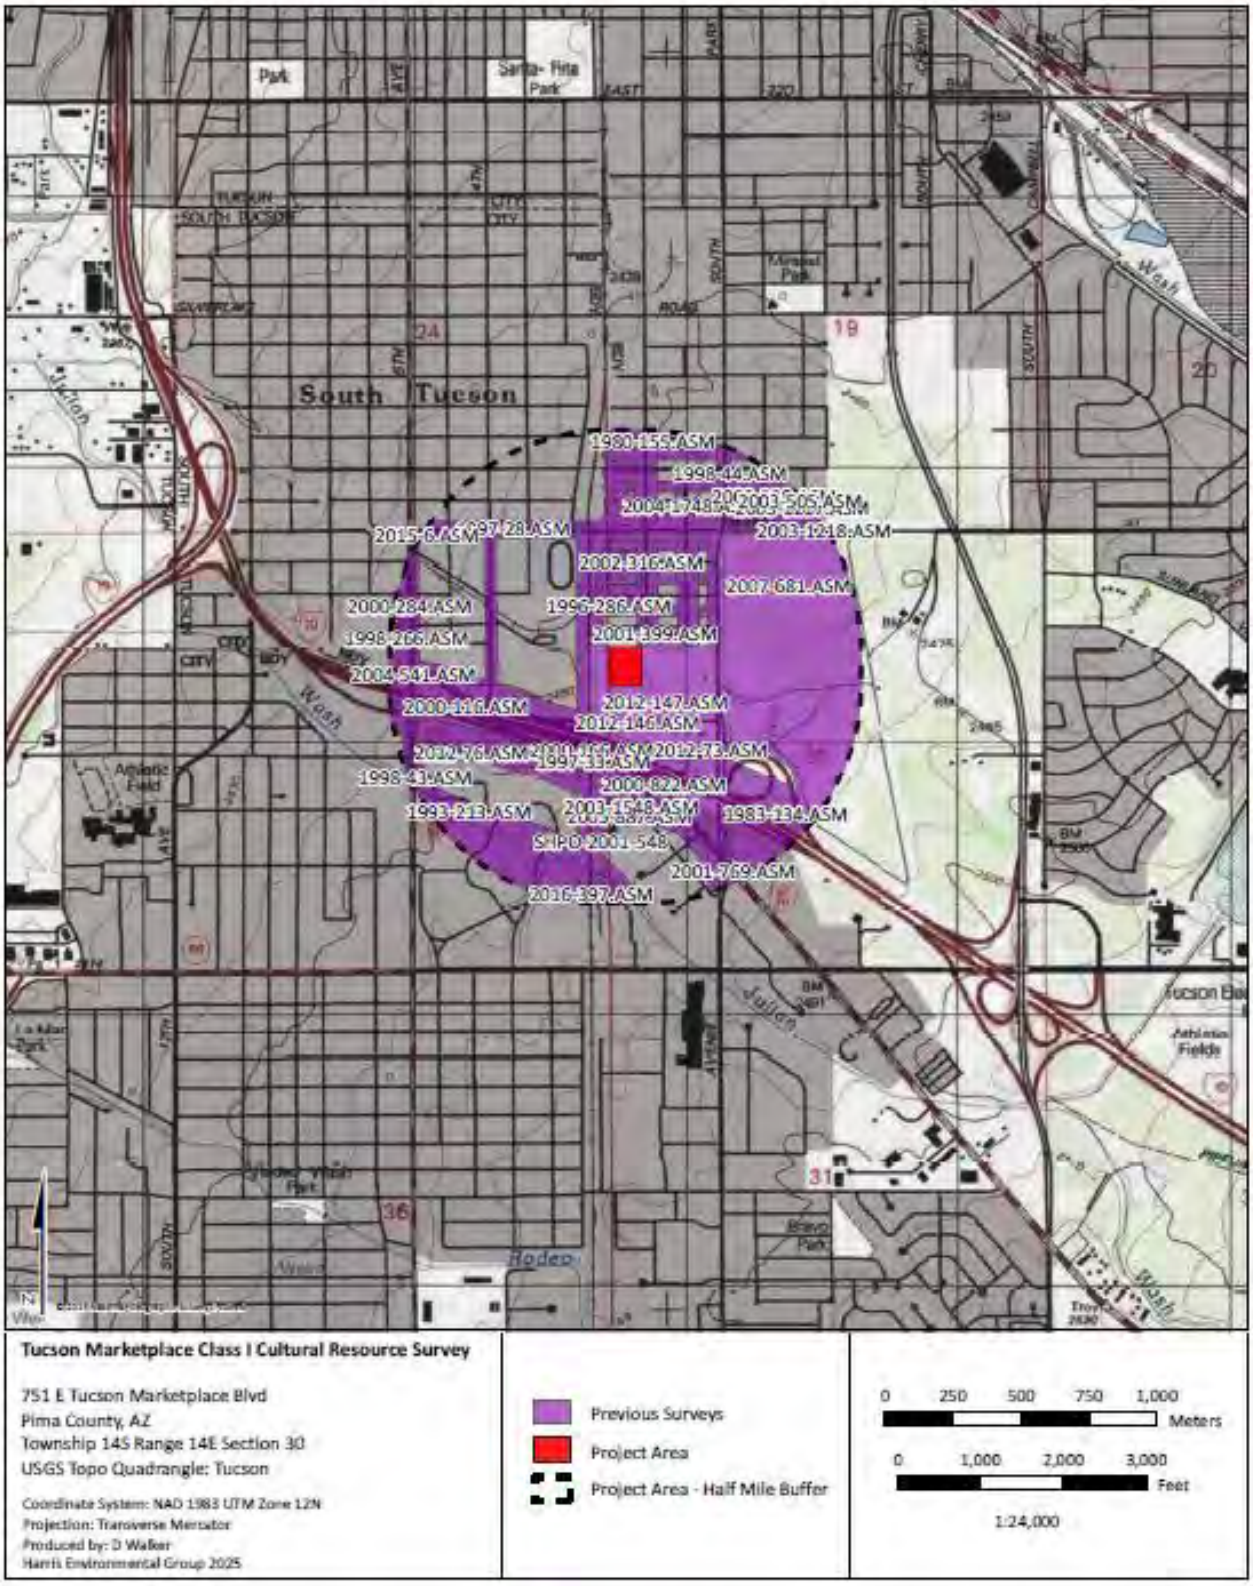

Figure 4. Project area map, previous cultural resource surveys.

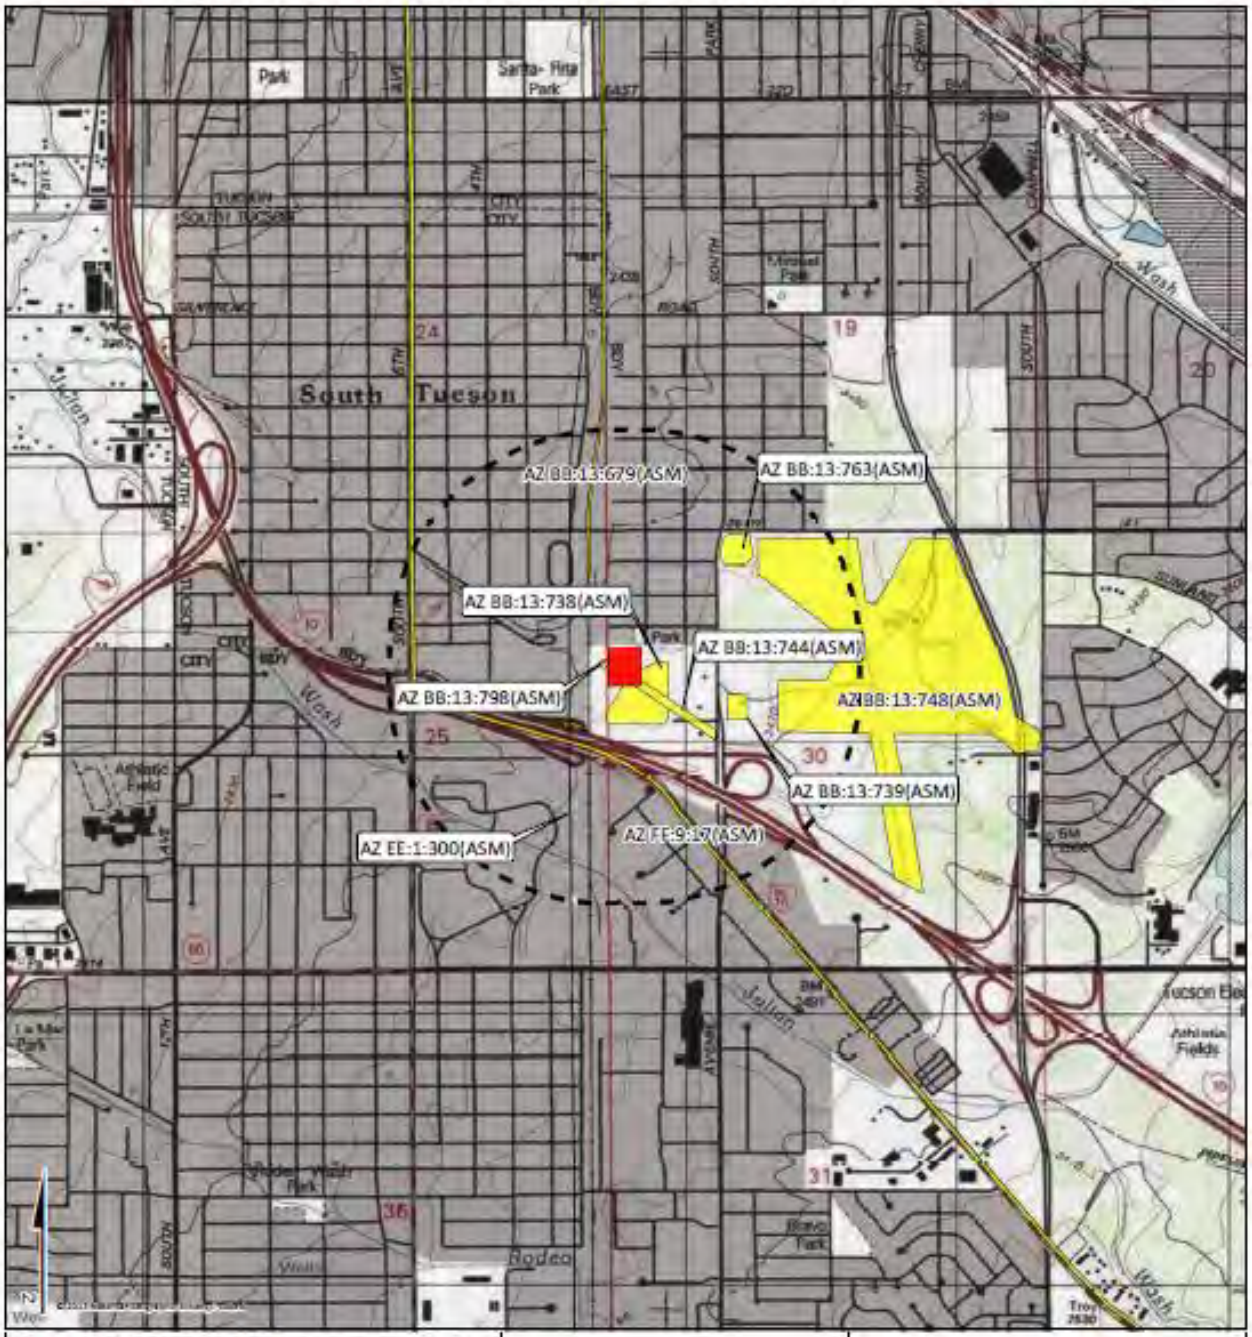

Figure 5. Project area map, previously recorded cultural resource sites.

References:

Allan, James M. et al.
2005 Cultural Resource Survey Report KMEP Line Section 53/54 SCC Digs Project Maricopa and Pinal Counties, Arizona. William Self Associates, Inc. Orinda, California.

Arizona State Historic Preservation Office (SHPO)
2016 Arizona Reporting Standards for Cultural Resources. Developed by the AZSHPO, the ASM, and the ASLD. Adopted by the Arizona State Parks Board in 2002, with minor edits, revisions, and updates in 2009; 2016.

Arizona State Historic Preservation Office (SHPO) and Salt River Pima-Maricopa Indian Community (SRP-MIC)
2024 *Government to Government Consultation Toolkit*. https://sites.google.com/view/az-consultation-toolkit/home.

Arizona State Museum (ASM)
1993 *Archaeological Site Recording Manual*. Arizona State Museum, University of

Arizona, Tucson.
1995 *Revised Site Definition Policy*. Arizona State Museum, University of Arizona, Tucson.

Arizona Geological Survey
2025 *Geologic Map of Arizona*. https://geomapaz.azgs.arizona.edu/. Accessed online January 30, 2025.

Barr, David M. R.
2006 A Cultural Resources Survey of a 3.5-mile-long Corridor as Part of the Bachmann Springs Electrical Routing Project, Cochise County, Arizona. Cultural Resources Report No. 06-39. SWCA Environmental Consultants, Tucson.

2010 Cultural resources inventory for 7210 north Oracle Road (parcel 225-51-2350), Pima County, Arizona. Report 2 of 2. Cultural Resource Report no. 10-347. SWCA Environmental Consultants, Tucson, Arizona.

Bastin, Kerri A.
2014 A class I literature review addendum report for the MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Buckles, Avi et al.

2012 A Cultural Resources Inventory of the Magma Arizona Railroad Right-of-way, Pinal County, Arizona. Westland Project No. 807.44 C 500. WestLand Resources, Inc, Tucson, Arizona.

Bowler, Maggie R.
2012 Cultural Resources Survey of 38.42 Acres Outside ADOT Right-of-way along State Route 77 between milepost 81.91 and 88.12, Oro Valley and Catalina, Pima and Pinal Counties, Arizona. Report no. AZG0907-030. AZTEC Engineering, Phoenix, Arizona.

Brodbeck, Mark.
2015 A Final Class III Survey of the W59 and E1 Alignments for the South Mountain Freeway, Maricopa County, Arizona. Cultural Resources Report 15-2. HDR, Inc., Phoenix, Arizona.

Brodbeck, Mark et al.
2006 A Class III Cultural Resources Survey of Proposed Corridors for the State Route (SR) 801 Freeway, SR 303L to SR 202L, Maricopa County, Arizona. Report 07-08. HDR Engineering, Inc., Phoenix, Arizona.

2021 Archaeological Monitoring and Data Recovery Excavations for the Tempe Streetcar Project, Tempe Maricopa County, Arizona. Report No. 21-13. HDR Engineering, Inc., Phoenix, Arizona.

Brown, David E. (editor)
1994 *Biotic Communities: Southwestern United States and Northwestern Mexico*. University of Utah Press, Salt Lake City.

Caldwell, Bryana.
2008 Determination of No Adverse Effect: Cactus Forest/State Route 79 Rehabilitation. SCIP Project No. R-048-050. Bureau of Indian Affairs: San Carlos Irrigation Project, Coolidge, Arizona.

Chamorro, Sebastian.
2019 Cultural Resources Inventory of 9.5 Linear Miles for a Portion of the Irvington to Sonoran to Vail Reconductor Project in Pima County, Arizona. Report 2019-34. WestLand Resources, Inc., Tucson, Arizona.

Champe, John L.
1936 The Sweetwater Culture Complex. Chapters in Nebraska Archaeology 1(3): 249-299. Lincoln: University of Nebraska.

Chapin-Pyritz, Regina L., and Matthew E. Hill
2002 A Cultural Resources Survey of the Proposed Hassayampa to Jojoba 500kV Transmission Line, Maricopa County, Arizona. Environmental Planning Group. Cultural Resource Services Technical Paper No.10. Tucson, Arizona.

Code of Federal Regulation
2010 National Archive and Records Administration. http://www.gpoaccess.gov/cfr/.

Compton-Gore et al.
2005 Cultural Resource Survey for the Mission View Wash Drainage Improvements Project in Tucson, Pima County, Arizona. URS Cultural Resource Report 2005-24(AZ). URS Corporation, Phoenix, Arizona.

2007 Cultural Resource Survey of Turner Road (Maricopa County Route 85 Extension to Hazen Road) and 24 intersections along Maricopa County Route 85 (75th Avenue to State Route 85), Maricopa County, Arizona. URS Cultural Resource Report 2007-46(AZ). URS Corporation, Phoenix, Arizona

Cook, Michael D.
2006 A Class III Cultural Resources Survey of 10.65 Acres Within ADOT Right-of-Way along State Route 79 for the Willow Springs Development. Cultural Resources Report 2005-67. Westland Resources, Inc., Tucson, Arizona.

Copperstone, Chance
2014 A class III cultural resources survey for the proposed installation of a telecommunications line along East Valencia Road for Cox Communications in Pima County, Arizona. Tierra Right of Way Services, Tucson, Arizona.

Courtright, J. Scott
2005 A cultural resources survey for 611.7 acres of proposed new right-of-way for the SR 85 and I-8 Interchange and the evaluation of eight previously recorded sites between SR 85 mileposts 120.24 and 123.00 and I-8 mileposts 117.40 and 119.25, Gila Bend, Maricopa County, Arizona. Logan Simpson Design, Inc. Technical Report No. 035051. Tempe, Arizona.

Dart, Allen
1989 *Prehistoric Irrigation in Arizona: A Component of the Arizona Historic Preservation Plan*. Center for Desert Archeology. Arizona State Historic Preservation Office.

Davis, Erin
2001 A Cultural Resource Survey of 18.60 Miles (605 Acres) along Interstate 10 between Mileposts 296.20 and 301.10, and between Mileposts 302.20 and 316.00, near the City of Benson, Safford Maintenance District, Cochise County, Arizona. Entranco Project Report 2001-012. Phoenix, Arizona.

2002 A Cultural Resource Survey of 22.06 Miles (660.08 Acres) along Interstate 8 between Mileposts 65.94 and 88.00, near the Towns of Dateland and Sentinel, Yuma Maintenance District, Yuma and Maricopa Counties, Arizona. Entranco Project Report No. 2001-046. Phoenix, Arizona.

Davis, Erin, and Kari Ogren
2002 A Cultural Resource Survey of 23.47 Miles (1,270.82 Acres) along Both Sides of Interstate 8 between Mileposts 3.00 and 19.00 and the Westbound Right-of-Way between Mileposts 19.00 and 20.40 in the Vicinity of Yuma, and Both Sides of Interstate 8 between Mileposts 29.00 and 34.80, near the Town of Wellton, ADOT Yuma Maintenance District, Yuma County, Arizona. Entranco Project Report 2001-045. Phoenix, Arizona.

Davis, Erin et al.
2002 A Cultural Resource Survey of 20.48 Moles (595.72 Acres) Along Interstate 8 Between Mileposts 106.07 and 119.40, and Mileposts 121.00 and 125.00, and Along Business Route 8 Between Mileposts 117.15 and 120.30 in the Vicinity of Gila Bend, Yuma Maintenance District, Maricopa County, Arizona. Entranco Project Report 2001-047. Phoenix, Arizona.

2008 A class III cultural resources survey of approximately 4,451 acres of Arizona State Trust Land for the proposed Lost Duchman Hights Project, Apache Junction, Pinal County, Arizona. Report No. 2007-018. Carter & Burgess, Inc., Phoenix.

Davis, Linda.
2008 Archaeological Monitoring for the 15th Avenue Sewer Main Replacement, Phoenix, Maricopa County, Arizona. Project Report No. 2006-030. Carter Burgess, Phoenix, Arizona.

Davis, Linda et al.
2006 A Class III Cultural Resources Survey of Approximately 8,875 Acres of Private Land Within the Proposed Paloma Ranch Development West of Gila Bend, Maricopa County, Arizona. Report No. 2006-011, Carter & Burgess, Inc., Phoenix.

2006 A cultural resources survey of 15 traffic interchanges totaling approximately 97.3 acres along Interstate 10, between mileposts 268 and 350, between Tucson and Willcox, Pima and Cochise Counties, Arizona. Report No. Project Report (Carter & Burgess); no. 2006-021. Carter & Burgess: Phoenix, Arizona.

DeJongh, Jennifer and Allen Dart.

2005 Cultural Resources Survey of 15.0 acres for Proposed School District Transportation Facility Southeast of the Intersection of Avra Valley Road and Interstate 10 in Marana, Arizona. Letter Report No. 20042005.023. Old Pueblo Archaeology Center. Tucson, Arizona.

Diehl, Allison Cohen.
2002 Cultural Resources Survey for the Proposed South Park Back to Basics Project, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 02-160. Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

2016 Cultural Resources Survey on Oracle Road (State Route 77) near Los Lomitas Road, Pima County, Arizona. DAI Project Report 16-104. Desert Archaeology, Inc., Tucson, Arizona.

2003 Cultural Resources Survey of a Vacant Lot at 1159 E. 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-135. Tucson, Arizona.

2003 Cultural Resources Survey of Parcels at 1226 East 32nd Street and 1200 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-167. Tucson, Arizona.

2003 Cultural Resources Survey of Two Lots on East 36th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 03-166. Tucson, Arizona.

2004 Cultural Resources Survey of a Parcel at 902 East 35th Street, Tucson, Pima County, Arizona. Desert Archaeology, Inc. Project Report No. 04-175. Tucson, Arizona.

Doak, David P.

2003 A Cultural Resource Survey of a 7.5-Mile-Long Stretch of Deep Well Ranch Road, South of Florence, Pinal County, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2002-100A. Tucson, Arizona.

2006 The Sinclair Property Survey: A Class III Cultural Resource Survey of a 32-acre Parcel in Tucson, Arizona, the Former Site of the Fiesta Drive-In Theater. Report no. 2004-93. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2007 A Class III Cultural Resources Survey of Two Parcels Constituting Part of the Sinclair Property, Tucson, Arizona. Report no. 2007-1. Tierra Right of Way Services, Tucson, Arizona.

2007 A class III cultural resource survey of a 2.10-acre parcel at the junction of Ajo Way and Interstate 10, in Tucson, Pima County, Arizona. Tierra Archaeological Report No. 2007-131. Tierra Right of Way Services, Ltd., Tucson, Arizona.

2008 A class III cultural resource survey/assessment of a 6-mile-long communications line corridor running along Arizona Highway 80, near Tombstone, Cochise County, Arizona. Report No. 2008-58. Tierra Right of Way Services, Tucson, Arizona.

2010 A Class III Cultural Resource Survey of a 6.25-Mile-Long Corridor in the Eastern Tucson Basin: the TEP Cienega Power Line Maintenance Corridor Survey. Archaeological Report No. 2009-76. Tierra Right of Way Services, Ltd.: A Land Services Company, Tucson, Arizona.

Ekstrom, Saskia M.
2006 A cultural resource survey of 26 temporary construction easement parcels along Interstate 8 between mileposts 29.18 to 36.86, near the town of Wellton, Yuma County, Arizona. Carter & Burgess: Phoenix, Arizona.

Estes, Allen et al.
2005 Final data recovery and monitoring report, KMEP Tucson pipeline replacement project, phases III and IV, Pima County, Arizona. William Self Associates, Orinda, California.

Fahrni, Grant
2005 A class III cultural resources survey of approximately five acres near the intersection of East Hardy Road and North Oracle Road, Oro Valley, Pima County, Arizona. Harris Environmental Group, Tucson, Arizona.

Fahrni, Grant and Foster Michael S.
2012 A cultural resources survey of two alternatives for the extension of SR 195 from I-8 to US 95: the South Avenue 3E and Araby Road Alignments, Yuma County, Arizona. Logan Simpson Design, Tempe, Arizona.

Florie, Paige and Glennda Luhnow.
2007 Cultural Resources Survey of State Route 80 between Mileposts 295.00 and 295.50 for the United Civil Group Turn Lanes Project, Benson, Cochise County, Arizona. ACS Internal Report No. 07-206-02. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Florie, Paige B. et al.
2009 A Cultural Resource Survey and Inventory for the Gila to Wellton-Mohawk 161-kV Transmission Line, Yuma County, Arizona: Background, Fieldwork Results, and Eligibility and Management Recommendations. Archaeological Consulting Services, Ltd., Tempe, Arizona.

Goldstein, Beau J.
2007 Class III Cultural Resources Survey Report Vail Area 138kV System Project, Pima County, Arizona. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 1 of 2. Transcon Environmental, Inc., Mesa, Arizona.

2008 Class III Cultural Resources Survey Report Tucson-Apache 115-kV Transmission Line Project Pima and Cochise Counties, Arizona. Report 2 of 2. Transcon Environmental, Inc., Mesa, Arizona.

Goldstein, Beau J., and Everett Bassett.
2006 Cultural III resources survey report, Ajo to Gila Bend Telecommunications Project, Pima and Maricopa Counties, Arizona. Transcon Environmental, Mesa, Arizona.

Gordon, Carl J.
2006 Cultural resources survey of Arizona Public Service Company right-of-way on Mule Mountain near Bisbee, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Graves, William M. et al.
2013 A Class I Overview and Class III Cultural Resource Inventory of the Proposed San Luis Rio Colorado Project Transmission Line Corridor, Yuma County, Arizona. Report no. 07-11. Statistical Research, Inc., Tucson, Arizona.

Griffith, G.E., Omernik, J.M., Johnson, C.B., and Turner, D.S.,
2014 Ecoregions of Arizona (poster): U.S. Geological Survey Open-File Report 2014-1141, with map, scale 1:1,325,000, http://dx.doi.org/10.3133/ofr20141141.

Hart, David R.

2015 Addendum Report: cultural resources survey of proposed integrated fixed towers and remote video surveillance systems on Arizona State Trust Land in support of right of way application no 14-116685, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Hart, David R., and Dean A. Barnes.
2012 Revised Final: cultural resources survey in support of integrated fixed towers in Douglas Station's area of responsibility, US Border Patrol, Tucson Sector, Arizona, US Customs and Border Protection, Department of Homeland Security, Washington DC. Gulf South Research Corporation, Tucson, Arizona.

Heilman, Jill.
2013 Cultural Resource Survey in Support of Improvements along Old Vail Connection Road and Nogales Highway within Unincorporated Pima County, Arizona. Report no. 13-442. EcoPlan Associates, Inc., Tucson, Arizona.

Hesse, India S.
2005 RE: TRICO Willow Springs Oracle Substation to Proposed Saddlebrook Ranch Substation Reroute Survey: An Addendum to a Cultural Resources Survey of the Proposed 69kV Transmission Line Between the Oracle Substation and the Proposed Willow Springs Substation, Pinal County, Arizona (TRICO W.O. No. 33808). SWCA Environmental Consultants, Tucson.

Hesse, S. Jerome.
2010 Cultural resources survey for the Palo Parado Road- Road, Bridge, Rail Improvements Project, Santa Cruz, Arizona. Resources Report No. 10-102. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and David M. R. Barr.
2009 Historic Properties Inventory for the EPNG Line No. 1007 MAOP Uprate project, Tucson Metropolitan Area, Pima County, Arizona. Cultural Resources Report No. 08-497. SWCA Environmental Consultants, Tucson, Arizona

Hesse, S. Jerome, and Heather West.
2011 Valencia Road improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona. Report 1 of 2. Report No. 10-404. SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome, and India S. Hesse.

2014 Archaeological survey of a 7.0-mile-long water pipeline corridor for the proposed Sahuarita supply line slip liner project in Pima County, Arizona (City of Tucson Project 14-09). SWCA Environmental Consultants, Tucson, Arizona.

Hesse, S. Jerome et al.
2009 Historic Properties Inventory for the EPNG line 1007 Make-Piggable Project Between EPNG Mileposts 89 and 99 in Metropolitan Tucson, Pima County, Arizona. Cultural Resources Report No. 08-547. SWCA Environmental Consultants, Tucson, Arizona.

2012. Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona: supplemental survey of road crossings. SWCA Cultural Resources Report No. 12-140. SWCA Environmental Consultants, Tucson, Arizona.

Historic Aerials
2025 https://www.historicaerials.com/viewer

Howard, Alexandra, and Catherine S. Vaughn.
2010 Class III Cultural Resources Survey Oracle Junction Substation to Catalina to Oracle 12.5kV Power Lines Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howard, Alexandra et al.
2011 Customer service project and trouble reports Pima and Pinal Counties, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Howell, Joseph.
2011 A class III cultural resource survey of a proposed high-pressure natural gas line reinforcement route in Green Valley, Pima County, Arizona. Report No. 2011-174. Tierra Right of Way Services, Tucson, Arizona.

Huebchen, Karl R. et al.
2008 A Cultural Resource Overview and Survey for the SR 303 Loop, SR 801/MC 85 to I-10, Maricopa County, Arizona. Environmental Planning Group Report Number STP-303-A(ASO). EcoPlan Associates, Inc.

Inter-Tribal Council of Arizona.
2011 Salt River Pima-Maricopa Indian Community. https://itcaonline.com/member-tribes/salt-river-pima-maricopa-indian-community/ Accessed electronically March 8, 2024.

Jerla, Christine A. and Anna King.
2014 A cultural resources inventory of 783.3 acres for the SWTC Bicknell to Vail transmission line upgrade, Pima County, Arizona. WestLand Resources, Tucson, Arizona.

Jolly, Donald W. and Kristin L. Fangmeier
2004 Cultural Resources Survey of Red Mountain Freeway Right-of-Way Between University Drive and Southern Avenue, Mesa, Maricopa County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-029-02. Tempe, Arizona.

Jones, Jeffrey T.
2010 A Class III Cultural Resource Survey of 5.83 Km (3.62 Miles) of 20-M-Wide (66-Foot-Wide) Areas of Potential Effect Proposed for the Construction of Two Segments of the Arizona Trail within and Near Cienega Creek Natural Preserve in Pima County, Arizona. Tierra Archaeological Report Number 2010-166, Tierra Right of Way Services, Ltd., Tucson, Arizona.

2012 A class III cultural resource survey of a portion of The Loop, a pedestrian and non-motorized vehicle trail, in Tucson and Pima County, Arizona. EcoPlan Associates, Inc., Mesa, Arizona.

Jones, Jeffrey T. et al.
2009 Archaeological data recovery investigations at AZ BB:13:742(ASM), AZ BB:13:748(ASM), and AZ BB:13:763(ASM) in Tucson, Arizona. Report No. 2007-146. Tierra Right of Way Services, Tucson, Arizona.

Jones, Thomas E.
2004 Cultural Resources Survey for Arizona Public Service Company's McVay 69kV Transmission Line Right-of-Way Renewal, La Paz County, Arizona. Archaeological Consulting Services, Ltd. ACS Project No. 04-056-02. Tempe, Arizona.

2008 Cultural Resource Survey of a 350-Acres Parcel for the Proposed Painted Rock Grain Handling Facility West of Gila Bend, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2011 Documentation of Old US 80 and Associated Features at Gillespie Dam Bridge, South of Arlington, Maricopa County, Arizona for documentation of its Information Potential Associated with the Historic State Highway System. Report no. 11-120-csur. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2014 A class III cultural resource survey of State Route 79 between mileposts 144.4 and 145.1 for the Silver Bar Mine regional landfill access road project, North of Florence, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas, and Kristin L. Fangmeier.

2009 A class I cultural resource literature review and class III pedestrian survey for a Crown Castle International Wireless telecommunications facility (Site #1123-3285) near State Route 79 and Deep Well Ranch Road southeast of Florence, Pinal County, Arizona. Archaeological Consulting Services, Ltd., Tempe.

Jones, Thomas E., and Victoria D. Vargas.
2010 Archaeological monitoring at Old US Highway 80 (AZ FF:9:17[ASM]) for Maricopa County Department of Transportation (MCDOT) Maricopa Highway 85 and Baseline Road Intersection Improvements Project, Buckeye, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Jones, Thomas E. et al.
2006 CULTURAL RESOURCES SURVEY AND HISTORICAL CONTEXT OF THE GILLESPIE DAM BRIDGE POTENTIAL IMPACT AREA, MARICOPA COUNTY DEPARTMENT OF TRANSPORTATION, MARICOPA COUNTY, ARIZONA. Manuscript on file, Archaeological Consulting Services, Tempe.

King, Anna Martin, and Mary M Prasciunas.
2015 A Cultural Resources Inventory Of 22.4 Acres for The Southeast Interceptor Sewer Augmentation Project in The Cities of Tucson and South Tucson, Pima County, Arizona. Cultural Resources Report 2015-10. Westland Resources, Tucson, Arizona.

Klebacha, Caroline.
2016 Cultural Resource Survey, Glance Creek Bridge, ADOT Structure #237, Cochise County, Arizona. Technical Report No. 13-467016. EcoPlan Associates, Inc., Mesa, Arizona.

Klune, Ingrid and David P. Doak
2005 A class III cultural resources survey of 2.5 linear miles of Arizona Department of Transportation Right of-Way alongside portions of Interstate 10 and State Highways 80 and 90 near Benson, Cochise County, Arizona. Tierra Archaeological Report No. 2005-28. Tierra Right of Way Services, Tucson, Arizona.

Klune, Ingrid and James Moses
2003 A Cultural Resources Assessment Survey of Approximately 2530 Linear Feet along State Highway 77 and Edwin Road, Pima and Pinal Counties, Arizona. Tierra Right of Way Services, Ltd. Archaeological Report No. 2003-54. Tucson, Arizona.

Knoblock, Keith
2001 A Cultural Resource Survey for a Proposed Fiber Optic Corridor Spanning Southeastern Arizona in Pima, Santa Cruz, and Cochise Counties. Lone Mountain Report No. 421/423. Lone Mountain Archaeological Services, Inc., Tucson, Arizona.

Langan, John S. and Courtney C. Rehar.
2009 Cultural Resources Survey of 1.0 Mile of ADOT Right-of-way along State Route 77, Between Mileposts 88.0 and 89.0, near Catalina, Pinal County, Arizona. Report No. AZG0907-008, AZTEC Engineering, Phoenix, Arizona.

Langan, John S. and Scott Solliday.
2012 Cultural Resource Survey for Widening and Improvement of Maricopa County Route 85 in Avondale, Phoenix, and Tollston, Maricopa County, Arizona. AZTEC Engineering, Phoenix, Arizona.

Larsen, David N.
2009 A Cultural Resources Survey Report of Four Pavement Preservation Projects, Town of Buckeye, Maricopa County, Arizona. AMEC Internal Report No. 04009005, AMEC Earth & Environmental, Inc., Tempe, Arizona.

Lascaux, Annick and Eric Klucas.
2008 A cultural resources inventory of the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #1 plant substation 34.5-KV and Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk #3 pumping plant substation 34.5-KV transmission lines, and the Wellton-Mohawk #2 pumping plant substation to Wellton-Mohawk pumping plant #2 4.16-KV distribution line rebuild project, Yuma County, Arizona. Tierra Archaeological Report 2007-16. Tierra Right of Way Services, Ltd., Tucson, Arizona.

Leonard, Kathryn et al.
2011 Historic streetscape assessment report for a roadway transportation enhancement project on SR 80, Fremont Street in the Schieffelin Historic District, Tombstone, Cochise County, Arizona. Logan Simpson Design, Tempe, Arizona.

Lindeman, Michael W. et al. 2012 A Plan for Monitoring, Discovery, and Limited Data Recovery within City of Tucson right-of-way in Eleven Archaeological Sensitivity Zones in the City of Tucson. Report No. 2011-06. Desert Archaeology, Inc., Tucson, Arizona.

Lindly, John M.
2004 An Archaeological Survey of the Proposed Loop 303 Expressway (Cotton Lane) South of Interstate 10 to the Gila River in Southwest Maricopa County, Arizona. SWCA Environmental Consultants. SWCA Cultural Resources Report No. 04-248. Phoenix, Arizona.

Lonardo, Cara, and Andrew Vorsanger.
2015 A Class III Cultural Resources Survey for the Western Area Power Administration Levee-Salinity Power Systems Project, Yuma County, Arizona. EPG Cultural Resource Services Technical Paper No. 2015-22. Environmental Planning Group, LLC, Phoenix, Arizona.

Luchetta, Sarah, and Chester Shaw.
2007 A class III cultural resources survey of approximately 2.3 miles along Sahuarita Road between La Villita Road and County Club Road in Sahuarita and Unincorporated Pima County, Arizona. HEG project 06-190. Harris Environmental Group, Inc., Tucson, Arizona.

Lundin, Deil R. et al.
2013 A cultural resources survey for the Chino Road extension project in Douglas, Cochise County, Arizona. AZTEC Engineering, Phoenix, Arizona.

McDermott, Matt
2002 A Cultural Resource Survey of 15.5-Miles of ADOT Right-of-Way Along State Route 80, Between Silver Creek and Bernardino, Northeast of Douglas, Cochise County, Arizona. EcoPlan Associates, Inc. EcoPlan Associates, Inc. Report #00-469:44. Mesa, Arizona.

Morgan, Rieder et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-08. Williams Self Associates, Inc., Tucson, Arizona.

Moses, James J.
2004 A Class III Cultural Resources Survey of Approximately 480 Acres West of State Route 79 south of Bogard Wash, 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Report no. 2003-48. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and David P. Doak
2003 A Class III Cultural Resources Survey of a Proposed Temporary Access Road for a Materials Source Pit West of State Route 79 and 17 Miles Northwest of Oracle Junction, Pinal County, Arizona. Arizona State Land Department Right of Entry Permit Reference No. 29.109254. Report no. 2003-56. Tierra Right of Way Services, Tucson, Arizona.

Moses, James, and Barbara Montgomery
2004 A Cultural Resources Assessment of a Cellular Tower Site located at 7900 East Main Street in Mesa, Maricopa County, Arizona. Tierra Archaeological Report No. 2004-72. Tierra Right of Way Services, Tucson, Arizona.

Newsome, Daniel K.
2007 Cultural resources inventory of 4.57 miles for a 69/12kV transmission line rebuild across Arizona State Trust Land near Arlington, Maricopa County, Arizona. Report (EnviroSystems Management (Flagstaff, Ariz.)); no. 1259-06. EnviroSystems Management: Flagstaff, Arizona.

National Resources and Conservation Service (NRCS)

2024 Web Soil Survey. Natural Resources and Conservation Service, US Department of Agriculture. Electronic document, http://websoilsurvey.nrcs.usda.gov/app/WebSoilSurvey.aspx.

Petersen, Eric S.
2004 A cultural resources survey for a proposed 69-kV Transmission line between the Oracle Substation and the proposed Willow Springs Substation near Oracle Junction, Pinal County, Arizona. Project Report No. 8886-067. SWCA Environmental Consultants. Tucson, Arizona.

Petersen, Eric S., and S. Jerome Hesse.
2011 Archaeological survey for the proposed El Paso Natural Gas Willcox Lateral Expansion Project, Cochise County, Arizona. SWCA Cultural Resource Report No. 11-369. SWCA Environmental Consultants, Tucson, Arizona.

Peters, Matthew D.
2013 Class III cultural resources survey report: ‡b Vail to Valencia 115kV to 138kV transmission line upgrade project, private lands, and previously authorized right-of-way south of Kantor substation, Santa Cruz County, Arizona. Transcon Environmental, Mesa, Arizona.

Punzmann, Walter R.
2012 A Class III Cultural Resource Survey of Four Proposed Bus Pullouts Along State Route 77/Oracle Road, Tucson, Pima County, Arizona. Archaeological Consulting Services, Ltd., Tempe, Arizona.

2006 Trico Willow Springs 69-kV line reroute survey: an addendum to a cultural resources survey of the proposed 69-kV transmission line between the Oracle Substation and the proposed Willow Springs Substation, Pinal County, Arizona. SWCA Environmental Consultants: Tucson, Arizona

Rawson, Paul M.
2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2015 Cultural resources survey for the Elephant Head Road Bridge Superstructure Replacement Project, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rawson, Paul M. et al.
2006 Class III cultural resources survey, SFPP, LP, El Paso to Phoenix Expansion Project, Arizona portion: Addendum, Cochise and Pima Counties, Arizona. WSA Technical Report No. 2006-12. William Self Associates, Inc., Tucson, Arizona.

Rayle, Greta J.
2011 A class III cultural resources survey and a reconnaissance-level architectural survey along State Route 80, Patton Street between Miller Lane and milepost 300.64, St. David, Cochise County, Arizona. Report No. 095451. Logan Simpson Design, Inc., Tempe, Arizona.

Rawson, Paul M.
2011 A cultural resource survey of the Ina and Oracle Road intersection improvements project, Pima County, Arizona. Report 1 of 2. Cultural Resources Report no. 11-407. SWCA Environmental Consultants, Tucson, Arizona.

2012 Valencia Road Improvements, Alvernon Way to Wilmot Road: Cultural Resources Inventory, Tucson, Pima County, Arizona: Addendum 2 -- Additional Survey from Valencia Road to Antrim Loop. Report no. 12-117. SWCA Environmental Consultants, Tucson, Arizona.

2014 Archaeological records search and pedestrian survey for the City of Tucson 14-03 ADA sidewalk improvements project, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Rodgers, James B.
2010 An archaeological inventory of the Loop 303 Outfall Project Area in Goodyear and West-Central Maricopa County, Arizona. Contract Archaeology Series 10-1, Scientific Archeological Services, Phoenix, Arizona.

Rogge et al.
2002 Cultural Resource Survey for the Phase 3 PM-10 Roads Project Number 16214, Maricopa County, Arizona. URS Cultural Resource Report 2002-36(AZ). URS Corporation, Phoenix, Arizona.

Rossi, Erica, and Daniel Garcia
2005 A Cultural Resource Survey of State Route 280 (Ave 3E) from Interstate 8 to Business 8, Yuma, Yuma County, Arizona. EcoPlan Cultural Resource Survey Report No. 04-712:09. Mesa, Arizona.

Ruble, Ellen C.
2004 Cultural resources monitoring results for the Kinder Morgan gasoline pipeline within the Arizona Department of Transportation right-of-way, Pima County, Arizona. Project report no. 03-193. Desert Archaeology, Inc., Tucson, Arizona.

Rucker, Daniel.
2015 Class III cultural resources survey: Cross Hill Quarry, Pima County, Arizona. Transcon Environmental, Mesa, Arizona.

2016 Class III Cultural Resources Survey: Cross Hill Quarry Access Road, Pima County, Arizona. Transcon Report No. M06-22. Transcon Environmental, Inc., Mesa, Arizona.

Ryan, E. Melanie et al.
2012 Final Report of Class III Cultural Resource Survey for the SCIDD-Florence Canal, Phase I: Station 45+00 to 1224+00, Pinal County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Schilz, Allan J.
2011 Tracks Through Time: Urban Archaeology Along the METRO Light Rail Corridor. Report no. 147. Archaeological Consulting Services, Tempe, Arizona.

Schroeder, K.J.
2005 A class III (intensive field inventory) cultural resources survey of approximately five miles of waterline right-of-way on state trust land along Baseline Road, Apache Junction, Pinal County, Arizona. Archaeological Research Services, Inc.

Shepard, Kristopher S., and Korri Dee Turner
2002 A Cultural Resource Survey of 27.63 Miles (226.96 Acres) along Five Segments of State Route 80 between Mileposts 295.62 and 383.00, and along a 1.90-Mile-Long Segment (2.30 Acres) of Business State Route 80 between Mileposts 366.20 and 368.10, within Cochise County, Arizona. Entranco Project Report 2001-026. Phoenix, Arizona.

Schilling, Linda M.
2013 Class III cultural resource survey of 35.8 acres for the I-8 South Frontage Road, Avenue 8.5E to Fortuna Road project, Yuma County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

2018 A Class III Cultural Resources Survey for Drainage Improvements at Rainbow Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-002. Jacobs Engineering Group, Inc., Phoenix, Arizona.

2018 A Class III Cultural Resource Survey for Drainage Improvements at Butterfield Wash along Old U.S. Highway 80, Maricopa County, Arizona. Report No. 2018-003. Jacobs Engineering Group, Inc., Phoenix, Arizona.

Shilling, Linda M., and Kristin L. Fangmeier.
2006 Cultural Resources Survey for the AZTech SMART Corridors Phase 3 Project, Maricopa County, Arizona. ACS Project No. 05-110-02. Archaeological Consulting Services, Ltd. Tempe, Arizona.

SHPO A Cultural Resources Inventory for a Proposed Telecommunications Site (PH30822C) at Solomon Industrial Park Lot 3 in Tucson, Arizona

Slawson, Laurie V.

1993 A Class III Archaeological Survey for the Julian and Rodeo Wash Linear Parks in Tucson, Arizona. Tucson, Arizona: Cultural & Environmental Systems, Inc.

Smith, Alexa M. et al.
2012 A Cultural Resources Inventory for a Portion of The Loop Between South Park and South 6th Avenues, Tucson, Arizona. Report no. 2012-06. William Self Associates, Inc., Tucson, Arizona.

Smith, Matthew B., and Charles W. Wheeler.
2001 An Archaeological Survey of the Proposed South of Tucson Reroute Addendum 5 to An Archaeological Survey of the Arizona Portion of Link Two of the AT&T NexGen/Core Project. Western Cultural Resource Management, Inc Report No. WCRM(F)228. Farmington, New Mexico.

Stahman, Andrea R.
2006 Cultural Resources Survey of 26 Linear Miles Along County Road 85/Buckeye Road between 75th Avenue and Turner Road, Maricopa County, Arizona. Report no. 06-12. Northland Research, Tempe, Arizona.

Steely, James Wright et al.
2012 Cultural Resources Evaluation of the Tucson Downtown Links Project, Tucson, Arizona. Report no. 12-232. SWCA Environmental Consultants, Tucson, Arizona.

Stephen, David V.M.
2004 Cultural resources survey of the Landin Park Access Project near Tombstone, Cochise County, Arizona. P.A.S.T. Cultural Resources Report No. 041620. Professional Archaeological Services of Tucson, Tucson, Arizona

Stevens, Michelle.
2014 Prehistoric and historic land use in Cienega Valley, southeastern Arizona: results of the Cienega Valley Survey Project. Project Report No. 2013-104. Desert Archaeology, Inc., Tucson, Arizona.

Stone, Bradford W.
2017 A Cultural Resources Inventory for the old Nogales Interceptor/Aerospace Corridor/Park Avenue Sewer Project, Pima County, Arizona. Cultural Resources Report 2016-50. Westland Resources, Tucson, Arizona.

2017 A Cultural Resources Inventory for the Proposed Benson Highway at Drexel Road Intersection Improvements Project. Cultural Resources Report 2017-0240. Westland Resources Inc., Tucson, Arizona.

Strohmayer, Jodi et al
2005 A Cultural Resource Survey and the Final Results of a Feasibility Study for the Relocation of the Marsh Station Traffic Interchange along I-10, Pima County, Arizona. EcoPlan Cultural Resource Report No. 00-469:115. EcoPlan Associates, Inc., Mesa, Arizona.

Tactikos, Joanne C.
2013 A class III cultural resource survey for a proposed improvements to the Avondale Boulevard and MC 85 intersection in Avondale, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona.

Tactikos, Joanne C. and Thomas Jones.
2014 A class III cultural resource survey for the proposed improvements to MC 85: Buckeye Road-Agua Fria River to 75th Avenue ITS project, Maricopa County, Arizona. Archaeological Consulting Services, Tempe, Arizona

Tactikos, Joanne C. et al.
2013 Addendum report to the class III survey along reaches 1 and 2 of the San Carlos Irrigation Project rehabilitation. ACS Project No. 13-107. Archaeology Consulting Services, Tempe, Arizona.

Terhune, Claire E.
2004 A Cultural Resources Survey for a Pavement Preservation and Culvert Extension Project on State Route 80, St. David, Cochise County, Arizona. EcoPlan Associates, Inc. Cultural Resources Report 02-599, Task 5. Mesa, Arizona.

Tinseth, George.
2013 A cultural resources inventory of approximately 5.6 acres for a Tucson Electronic Power Company distribution line installation along Oracle Road, Pima County, Arizona. Report no. 2013-39. Westland Resources, Inc., Tucson, Arizona.

Touchin, Jewel.

2004 A Cultural Resources Survey of a Proposed New Right-of-Way and Temporary Construction Easement at the Sixth Avenue and Westbound Frontage Road Intersection in South Tucson, Pima County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-29. Phoenix, Arizona.

Touchin, Jewel et al.

2002 A cultural resources survey of State Route 79, from milepost 135.00 to milepost 150.28, Florence to Florence Junction, Pinal County, Arizona. HDR Engineering, Inc. Cultural Resources Report 02-14. Phoenix, Arizona.

Touchin, Jewel and Mark Brodbeck
2002 A Cultural Resources Survey of State Route 80, from Milepost 302.0 to Milepost 309.0, South of St. David, Cochise County, Arizona. Cultural Resource Report 01-12. HDR Engineering, Inc., Phoenix, Arizona.

2003 A Cultural Resources Survey of State Route 80, between Mileposts 356.3 and 357.0, Between Bisbee and Douglas, Cochise County, Arizona. HDR Engineering, Inc. Cultural Resource Report 03-14. Phoenix, Arizona.

Tucker, David B.
2000 Report 3 of 4 The El Paso to Los Angeles Fiber Optic Cable Project: A Cultural Resources Survey of the Arizona Segment of a Linear Right-of-Way Across Cochise, Pima, Pinal, Maricopa, and La Paz Counties, Arizona. SWCA, Inc., Tucson, AZ.

2009 Archaeological Records Search and Survey for Amphi Neighborhood Light Project, Phase 2, Navajo Road, Oracle Road to Stone Avenue, Tucson, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

2009 An archaeological survey for the TRICO circuit 76 rebuild project, Pima County, Arizona: TRICO work order No. 40543. Cultural Resources Report No. 08-483. SWCA Environmental Consultants, Tucson, Arizona.

2010 Archaeological Records Search and Survey for Grant Road and Oracle Road Intersection Improvements, Tucson, Arizona, and Building Assessments for 225 and 201 West Grant Road. SWCA, Environmental Consultants, Tucson, Arizona.

Tucker, David B., and India S. Hesse.
2013 A cultural resources survey for the five points combined transportation enhancement and pedestrian improvements, Tucson, Pima County, Arizona. SWCA Environmental Consultants, Tucson, Arizona.

Twilling, Shannon D.
2006 A class III cultural resources survey of 2.75 acres along Nogales Highway at Franco Wash in Pima County, Arizona. Harris Environmental Group: Tucson, Arizona.

2007 A Class III Cultural Resources Investigation of 704 Acres at the Tucson International Airport in Support of Proposed Runway 11R/29L Relocation. Project no. 05-052. Harris Environmental Group, Inc., Tucson, Arizona.

Twilling, Shannon et al.
2004 A Cultural Resources Survey and Treatment Plan in Support of a Proposed Perimeter Fence Line Installation Around the Florence Military Reservation Perimeter, Pinal County, Arizona. Harris Environmental Group. Harris Project No. 04-106. Tucson, Arizona.

Vance, Meghann M.
2008 Class III Cultural Resources Survey: Oracle to Oracle Junction Transmission Line, Pinal County, Arizona.

Vanderpot, Rein et al.
2005 Archaeological Investigations for the Transfer of Title to Facilities, Works, and Lands of Gila Project, Wellton-Mohawk Division, to the Wellton-Mohawk Irrigation and Drainage District, Yuma County, Arizona. Report 04-64. Statistical Research, Inc., Tucson, Arizona.

Vaughn, Catherine S.
2009 Distribution line along State Route 79 milepost 106 to Iron Valley, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

2009 Distribution line from Oracle Junction to milepost 103.5 along State Route 79, Pinal County, Arizona. San Carlos Irrigation Project, Coolidge, Arizona.

Watkins, Christopher N.
2011 A cultural resources survey on State and Federal lands of 8.20 miles (49.69 acres) of the SE-12 (Mural-Fairview) 69-kV and 2.04 miles (12.36 acres) of the SE-13 (McNeal-San Pedro) 69kV-transmission lines in Cochise County, Arizona. Logan Simpson Design, Temple, Arizona.

Watkins, Christopher N. et al.
2011 A cultural resources survey on Federal and State land of 58.06 miles (351.87 acres) of the Arizona Public Service M-108 (Bunyan-Aztec) 69-kV transmission line, 2.92 miles (17.69 acres) of the M-110 (Gila Bend-Bunyan) 69-kV transmission line, and 20.76 miles (125.81 acres) of the M-111 (Gillespie-Gila Bend) 69-kV transmission line in Maricopa and Yuma Counties, Arizona. Logan Simpson Design, Tempe, Arizona.

Webb, David
2005 Cultural resources survey of new right-of-way and drainage easement parcels located between State Route 80 mileposts 294.96 and 296.45, Benson, Cochise County, Arizona. Project Number AZ02103, Task 43, AZTEC Engineering, Phoenix, Arizona.

West, Heather M., and Joseph A. Ezzo
2007 Cultural Resources Survey of 159 Washes Along the Union Pacific Railroad form Estrella to Stockham-Milepost No. 876 in Maricopa County to Milepost No. 980 in Tucson, Pima County, Arizona. SWCA Cultural Resources Report 07-205, SWCA Environmental Consultants, Tucson.

Williams, CaraMia
2008 A class III cultural resources survey of 4.39 linear miles within the Arizona Department of Transportation (ADOT) right-of-way on both sides of State Route 80, beginning at milepost 298.94 and ending at 2nd Avenue (milepost 303.3), and within utility easements along Dragoon Vista Road and Lee Street, in the town of St. David, Cochise County, Arizona. Report No. 2007-67. Tierra Right of Way Services, Tucson, Arizona.

Wright, Thomas E.
2000 A Cultural Resources Survey along Business Interstate 19 (Mileposts 44.20-57.42 and 62.48-63.48), between Interstate 19 and Interstate 10, Pima County, Arizona. Project Report No. 99:35. Archaeological Research Services, Inc., Tempe, Arizona.

2001 A Cultural Resources Survey of 5.2 Miles of Business Interstate 10 Right-of-Way, Mileposts 248.0 - 253.2, Tucson, Pima County, Arizona. Archaeological Research Services, Inc. Report No. 2001:085. Tempe, Arizona.

2008 An archaeological survey of a proposed water line right-of-way on Arizona State Trust Land near Florence Junction, Pinal County, Arizona. Cultural Resources Report No. 08-258. SWCA Environmental Consultants, Phoenix, Arizona.

Young, Jessica.
2014 Class III cultural resources surveys and monitoring. Customer service projects and trouble reports, Gila and Pinal counties, Arizona: 2014 second quarter report. San Carlos Irrigation Project, Coolidge, Arizona.

1805 West Drake Drive, Tempe, Arizona 85283

o: (602) 437-3737

c: (623) 212-0049

certerra.com [certerra.com]

From: Jonathan Knighton-Wisor <Jonathan.Knighton-Wisor@tucsonaz.gov>
Sent: Tuesday, September 2, 2025 12:47 PM
To: Dajahnique Burley <dburley@rma-western.com>
Cc: Kage Anderson <kanderson@rma-western.com>; Jason Lilienthal <Jason.Lilienthal@tucsonaz.gov>; Desiree Aranda <Desiree.Aranda@tucsonaz.gov>
Subject: RE: 751 E Tucson Marketplace Blvd

Daja-

Thanks for your patience on this response. Given that the project uses federal funding, the project is subject to 36 CFR Part 800 (Section 106). There are no applicable City of Tucson cultural resources compliance regulations. Since the project is on private land and it is not a City Capital Improvement Project, the City of Tucson will not be the lead agency for Section 106 consultation. I believe that HUD will be the lead agency.

Also, while the project is on private land, A.R.S. § 41-865 (treatment of human/funerary remains on private land) will still be applicable.

Let me know if I can be of any additional help.

Best,

Jonnie

Jonathan Knighton-Wisor
Cultural Resource Compliance Project Manager
Historic Perservation Office
Planning & Development Services Department
City of Tucson

From: Dajahnique Burley <dburley@rma-western.com>
Sent: Wednesday, August 27, 2025 9:15 AM
To: Jonathan Knighton-Wisor <Jonathan.Knighton-Wisor@tucsonaz.gov>
Cc: Kage Anderson <kanderson@rma-western.com>; Jason Lilienthal <Jason.Lilienthal@tucsonaz.gov>; Desiree Aranda <Desiree.Aranda@tucsonaz.gov>
Subject: [EXTERNAL] Re: 751 E Tucson Marketplace Blvd

Good morning Jonathan, I appreciate your help with this!

1. From what we understand about the project, it will be on privately owned land, but that there is HUD funding involved, correct?

- Yes, the Client will be utilizing funds provided from the Economic Development Initiative (EDI) - Community Project Funding (CPF) grant administrated by HUD.

2. Is there any funding from the City of Tucson or involvement from other City of Tucson departments, like the Housing and Community Development department?

    - No additional funding will come from the City. As for involvement, a rep from Tucson's Housing and Community Development may act as the Certfying Officer for the final report but this needs to be confirmed.

3. Are there any other involved agencies on the Federal, State, or municipal level?

    - No other agencies are involved.

4. Do you know if there has been recent Class I or Class III cultural resources survey conducted for the parcel APN 132-13-104A? I am somewhat familiar with this parcel, and it may have been recently inventoried. No worries if you do not know.

    - Yes, a Class 1 Survey was conducted February this year - I've attached the report to the email.

5. Can you provide details about the nature and extent of the proposed construction activities? Nothing complicated, but a few sentences would be helpful.

    - A new building will be constructed on approximately 4 acres of developed land and will be 50,000 sqft when completed - The property will become the future site of Building 3 of Bridges at JTED. If additional info is needed, I can look into more details and get back to you.

Western Technologies
An RMA Company

Daja Burley
Environmental Scientist

1805 West Drake Drive, Tempe, Arizona 85283
o: (602) 437-3737
c: (623) 212-0049
dburley@rma-western.com | certerra.com [certerra.com]

We are thrilled that RMA Companies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com. During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.

From: Jonathan Knighton-Wisor <Jonathan.Knighton-Wisor@tucsonaz.gov>
Sent: Wednesday, August 27, 2025 8:13 AM
To: Dajahnique Burley <dburley@rma-western.com>
Cc: Desiree Aranda <Desiree.Aranda@tucsonaz.gov>; Kage Anderson <kanderson@rma-western.com>;

Jason Lilienthal <Jason.Lilienthal@tucsonaz.gov>
Subject: Re: 751 E Tucson Marketplace Blvd

Daja-

Thanks for reaching out to us. I help take care of the City of Tucson's compliance obligations regarding cultural resources and archaeology. I have a few questions to help us better understand the level of involvement the City of Tucson's Historic Preservation Office will have.

1. From what we understand about the project, it will be on privately owned land, but that there is HUD funding involved, correct?

2. Is there any funding from the City of Tucson or involvement from other City of Tucson departments, like the Housing and Community Development department?

3. Are there any other involved agencies on the Federal, State, or municipal level?

4. Do you know if there has been recent Class I or Class III cultural resources survey conducted for the parcel APN 132-13-104A? I am somewhat familiar with this parcel, and it may have been recently inventoried. No worries if you do not know.

5. Can you provide details about the nature and extent of the proposed construction activities? Nothing complicated, but a few sentences would be helpful.

Thank you!

Jonathan Knighton-Wisor
Cultural Resource Compliance Project Manager
City of Tucson

From: Dajahnique Burley <dburley@rma-western.com>
Sent: Wednesday, August 20, 2025 10:02 AM
To: Jason Lilienthal <Jason.Lilienthal@tucsonaz.gov>
Cc: Desiree Aranda <Desiree.Aranda@tucsonaz.gov>; Jonathan Knighton-Wisor <Jonathan.Knighton-Wisor@tucsonaz.gov>; Kage Anderson <kanderson@rma-western.com>
Subject: [EXTERNAL] Re: 751 E Tucson Marketplace Blvd

Hi Jason,
Thanks for helping me with this. If need be, I can resend my initial package of information we have thus far regarding this project. During our call, you asked who the current owner of the property is - the property is associated with APN 132-13-104A and is owned by BP Bridges Partners. The JTED building that is present is located at 3300 S Park Ave, Tucson, AZ 85713 - the undertaking will be taking place just north of this building. This can also be seen in the figures that was sent in the initial email as well as the email I sent to the PDSDHistoric email on 8/6/25

I've also cc'd Kage Anderson who is the PM/project manager for this project here at Certerra (formerly Western Technologies)

Thank you!

Daja Burley
Environmental Scientist

1805 West Drake Drive, Tempe, Arizona 85283
o: (602) 437-3737
c: (623) 212-0049
dburley@rma-western.com | certerra.com [certerra.com]

We are thrilled that RMA Companies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com. During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.

From: Jason Lilienthal <Jason.Lilienthal@tucsonaz.gov>
Sent: Wednesday, August 20, 2025 9:41 AM
To: dburley@certerra.com <dburley@certerra.com>
Cc: Desiree Aranda <Desiree.Aranda@tucsonaz.gov>; Jonathan Knighton-Wisor <Jonathan.Knighton-Wisor@tucsonaz.gov>
Subject: 751 E Tucson Marketplace Blvd

You don't often get email from jason.lilienthal@tucsonaz.gov. Learn why this is important [aka.ms]

Hello Daja,

Glad to finally talk to you and find out more what you are looking into regarding the project.

I brought this up with our HPO - Desiree Aranda - who is cc'ed on this email. Our Cultural Resources Manager - Jonathon - is also cc'ed on this email.

I informed Desiree that the project you reference is funded by HUD and the academic institution is looking into building onto adjacent vacant lands.

Best regards,

Jason Lilienthal y Trujillo
Lead Historic Preservation Planner
City of Tucson - Planning Department
201 N. Stone Ave

Caution: This email originated from outside of the organization. DO NOT click on links or open attachments unless you were expecting the email, recognize the sender, and know the content is safe.

Caution: This email originated from outside of the organization. DO NOT click on links or open attachments unless you were expecting the email, recognize the sender, and know the content is safe.

Caution: This email originated from outside of the organization. DO NOT click on links or open attachments unless you were expecting the email, recognize the sender, and know the

Day/Night Noise Level (DNL) Calculator

The Day/Night Noise Level Calculator is an electronic assessment tool that calculates the Day/Night Noise Level (DNL) from roadway and railway traffic. For more information on using the DNL calculator, view the **Day/Night Noise Level Calculator Electronic Assessment Tool Overview (/programs/environmental-review/daynight-noise-level-electronic-assessment-tool/)**.

Guidelines

- To display the Road and/or Rail DNL calculator(s), click on the "Add Road Source" and/or "Add Rail Source" button(s) below.
- All Road and Rail input values must be positive non-decimal numbers.
- All Road and/or Rail DNL value(s) must be calculated separately before calculating the Site DNL.
- All checkboxes that apply must be checked for vehicles and trains in the tables' headers.
- **Note #1:** Tooltips, containing field specific information, have been added in this tool and may be accessed by hovering over all the respective data fields (site identification, roadway and railway assessment, DNL calculation results, roadway and railway input variables) with the mouse.
- **Note #2:** DNL Calculator assumes roadway data is always entered.

DNL Calculator

Site ID	751 East Tucson Marketplace Boulevard
Record Date	04/30/2025
User's Name	

Road # 1 Name:	**I-10**

Road #1

Vehicle Type	**Cars** ☑	**Medium Trucks** ☑	**Heavy Trucks** ☑
Effective Distance	637	637	637
Distance to Stop Sign			
Average Speed	70	65	65
Average Daily Trips (ADT)	98807	5718	7625
Night Fraction of ADT	15	15	15
Road Gradient (%)			2
Vehicle DNL	63	60	69

Vehicle DNL			
Calculate Road #1 DNL	70	Reset	

Railroad #1 Track Identifier:	**Union Pacific (west)**

Rail # 1

Train Type	**Electric** ☑	**Diesel** ☑
Effective Distance	232	232
Average Train Speed	40	40
Engines per Train	2	2
Railway cars per Train	15	15
Average Train Operations (ATO)	48	48
Night Fraction of ATO	15	15
Railway whistles or horns?	Yes: ☐ No: ☑	Yes: ☐ No: ☑
Bolted Tracks?	Yes: ☑ No: ☐	Yes: ☑ No: ☐
Train DNL	58	65

Calculate Rail #1 DNL	65	Reset

Add Road Source Add Rail Source	
Airport Noise Level	60
Loud Impulse Sounds?	○ **Yes** ◉ **No**
Combined DNL for all Road and Rail sources	**72**
Combined DNL including Airport	**72**
Site DNL with Loud Impulse Sound	

Calculate Reset

Mitigation Options

If your site DNL is in Excess of 65 decibels, your options are:

- **No Action Alternative**: Cancel the project at this location

- **Other Reasonable Alternatives**: Choose an alternate site
- **Mitigation**
  - **Contact your Field or Regional Environmental Officer (/programs/environmental-review/hud-environmental-staff-contacts/)**
  - Increase mitigation in the building walls (only effective if no outdoor, noise sensitive areas)
  - Reconfigure the site plan to increase the distance between the noise source and noise-sensitive uses
  - Incorporate natural or man-made barriers. See ***The Noise Guidebook (/resource/313/hud-noise-guidebook/)***
  - Construct noise barrier. See the **Barrier Performance Module (/programs/environmental-review/bpm-calculator/)**

Tools and Guidance

Day/Night Noise Level Assessment Tool User Guide (/resource/3822/day-night-noise-level-assessment-tool-user-guide/)

Day/Night Noise Level Assessment Tool Flowcharts (/resource/3823/day-night-noise-level-assessment-tool-flowcharts/)

Home | Open Account | Help | 374 users online | Search

Trainorders.com

NOT A MEMBER?
Click here to see what you are missing!

Member Login

Login:

Password:

Remember this info

Login

Discussion
Recent
Western Railroads
Eastern Railroads
Passenger Trains
Steam Railroading
Nostalgia & History
Railroaders' Nostalgia
Canadian Railroads
European Railroads
International
Model Railroading
Railfan Technology
Guidelines

Media Sharing
Video & Audio
Static Photography

Hosting
Member Directory
More Information

Library
Fanfinder
Newsletters
Contest Winners
Virtual Reality
Classified Ads

Site Info
About us
Contact us
Give Gift Membership
Privacy Policy

Western Railroad Discussion > UP Tucson train analysis

Date: 10/05/21 13:17
UP Tucson train analysis
Author: mapboy

It's important to take the measure of UP's line through Tucson, since it's the second busiest UP line after the Overland Route through Nebraska. This sample happened before the recent sad events on Amtrak #2 at the Tucson Station. Keep in mind this is a sample of one week in September, that trains vary from day to day, week to week and season to season.

Here's UP symbol categories past the Tucson railcam for the week Monday, 9/13/21 to Sunday, 9/19/21. Thanks to much anonymous help!

	Westbound	+ Eastbound	= Total	
A	0	9	9	
E	1	0	1	
G	4	2	6	
I	33	38	71	= 10.1/day
L	6	7	13	
M	36	32	68	= 9.7/day
P	4	3	7	
S	1	0	1	
W	1	0	1	
Z	26	24	50	= 7.1/day
Total	112	115	227	= 32.4/day

Daily train count: Mo- 35, Tu- 29, We- 34, Th- 27, Fr- 33, Sa- 34, Su- 35.
No unit trains of baretables, military equipment or ore this week.

For comparison, UP Kearney Sub on the Overland Route at Kearney, NE, was 58.9/day 6/30-7/6/20
https://www.trainorders.com/discussion/read.php?1,5062561,5062561#msg-5062561

UP's Yuma Sub, by the Salton Sea west of Tucson, averaged 27.8/day 3/13-3/20/21 during the quieter period of spring.
https://www.trainorders.com/discussion/read.php?1,5232117,5232117#msg-5232117

WBD

AMTK #1 Sunset Limited	due TuThSu, arr. 18:45, lv. 19:35, see below.
CRIRI	light power to Rillito to take the CalPortland cement coal empties west as CRIWE.
ETUGBF	light power to Gila Bend.
GS4NNW	from Mexico via Nogales to Great Northwest RR,WA.
GSCKDX	Canton, KS to Dixie near Buckeye, west of Phoenix.
GSFKCP	Frankfurt, KS to Calipatria, CA.
GSJOCP	St. Joseph, MO to Calipatria.

IG1LA daily.
ISICAX Su to Cali. for export hay loading- https://goo.gl/maps/feDa3Zzy55aE25zQ9; next week ran as ISICA.
ISILB1, ISILB2, ISILB3, ISILB4 daily from Santa Teresa, NM, UP's equivalent of BNSF's Clovis, for consolidating cars from many intermodal terminals.
LKL70 Su-Fr, 16:00-18:00, see below.
MEPRV from El Paso to Roseville, designed to bypass West Colton Yard, this occasional manifest ran twice, Tuesday edition went west light power to pick up 73 cars at Red Rock since 9/11.
MEPWCX extra, 70 empty covered hoppers for Searles, CA, and autos.
MEWWC daily, from Englewood (Houston), TX.
MFWWC daily, from Fort Worth.
MHNPX daily, from Hutchinson, KS, 3 of 9 MHNPX terminated at TU and their PX cars went onto MTUPX.
MTUPX daily, 09:00-16:00, the only wbd with lots of lumber loads.
MTUWC daily, leaves 01:00-05:00.
PTULV UP passenger special to Las Vegas.
SKCYR windmill empties for Yermo, CA.
WBWMUS empty ballast work train, Bowie, AZ, to Murdock, UT; Georgetown Rail "Slot Machine", sets of 11-unit articulated gons.
ZAILC daily, mostly 10:45-14:30, mostly low 100 cars, no tofc, to NS via KCS at Shreve- port, LA; none of the Zs had international containers.
ZG4CI daily, mostly 16:00-19:30, most days long enough (mid-100s) for one mid-train DPU.
ZMNLA Mo We-Sa, 06:00-08:30, <100 cars.
ZMNLA2 Tu, similar to ZMNLA.
ZMQLC daily, 04:00-07:30, 100-150 cars, most days 15-20 visible UPS and 15-40 trailers (more than most), mostly 2x2 power.

Amtrak #1 Sunday train arrived almost 3 hours late for the usual refueling by truck, on Main 2 in front of the railcam, providing a scheduled 50-minute break for passengers. The MTUPX ahead of it could not take the signal at Stockham Crossovers, so #1 had to back up to the Cherry Ave. Xovers and reverse to Main 1 to go west. Tuesday's train arrived on Wednesday, 7 hrs. 18 min. late. Earlier that day the PTULV left at 05:00, photos here- https://www.trainorders.com/discussion/read.php?1,5326747,5326778#msg-5326778 ATCS showed Thursday's Sunset Ltd. arriving at Siding 1 at Tucson Yard a half hour late, but it was there for 2 1/2 hours. It moved up and spent the usual refueling time at the station, then left 3 hours late.

LKL70 local leaves with two SD70M units and 15 to 40 cars, from Tucson to Casa Grande and back. It also works at Rillito. Thursday's train had a UP gon of scrap and four lumber loads that went west, then the cars returned east the next morning.

EBD

AMLEGR "R" indicates a repositioning (repo) of empty auto racks, to Eagle Pass, TX.
AMLEP daily, Mira Loma-El Paso.
AMLLDR to Laredo, TX.
AMLPAR to Pantano, AZ, for storage on the old main line stub.
AMTK #2 Sunset Limited due MoThSa, arr. 07:28, lv. 08:15, latest of the four was nine minutes late.
GSDXPY empties, Dixie near Buckeye, west of PX, to Plymouth, NE.
GSGQRK Calipatria to Rock River Lumber & Grain, Sterling, IL.
GSMRFK Maricopa, AZ, to Frankfurt, KS.
ICIG4 daily.
ILAG3X extra.
ILAMQB We.
ILAMQX extra.
ILBDI daily, to Dallas DIT.
ILBG3 daily.
ILBG4 daily.
ILBHO daily, to Houston.
ILBNS daily, to NS via KCS at Shreveport, LA.
LKL70 ebd return trip, arr. Su-Fr 23:30-01:30. Twice spent the early a.m. in Stockham Siding before yarding.
MPXTU daily, with MPXTUB the only ebs with lots of empty centerbeams.
MPXTUB daily.
MWCBS "daily" but annulled 4 days, to Big Spring, TX.
MWCEW daily, to Englewood (Houston), TX.
MWCSA daily, to San Antonio.
ZCIG4 daily, 20:00-00:30, but often annulled Mondays. 140-180 cars (118 on a slow day), lots of trailers, up to 80. From 4x0 to 3x2x2 and 4x4x0 power.
ZLAME Th-Su, 01:00-06:30, average 130 cars, on heavy days will have two mid-train DPUs.
ZLAME2 Tu, 17:45, similar to ZLAME.
ZLAMN3 We, 18:10, 106 cars, 4x0.
ZLAMQ Fr-Su, 20:45-23:30, 25-45 trailers, up to 30 visible UPS, 115-140 cars, 4x0.
ZLAMQ2 Tu, 02:30, similar to ZLAMQ.
ZLAMQ4 Th, 21:30, similar to ZLAMQ.
ZLCAI daily, 21:45-23:59, no trailers, 120-180 cars, heavy days will see two mid-train DPUs.
ZLCMQ2 Tu, 16:45, 94 trailers, 139 cars, 5x0.

New wbd trains compared to March, 2021: MEPRV, MEWWC (was MLFWC for awhile from Laughlin-Spofford, TX).
New ebd trains compared to March, 2021: ICIG4, ILBG3 (replaced ILAG1), ILBHO (replaced ILBSP to Spring, TX).

One oddity was 7 trailers on the ILAMQX. Otherwise none of the Is, east or west, had a trailer. An ISILB4 had a lone UP box 149 cars back amongst the intermodal well cars, with another 11 cars behind it. Anyone know what that's about? There were very few refrigerator (reefer) cars compared to the Overland Route and Pacific Northwest. There were lots of reefer containers on

Z trains, with anywhere from 10-40 on the ZCIG4. All other Zs had <10 on any train, none on I trains.

International marine traffic on UP travels mostly in three main partner groups-
1) ONE (NYK, K Line, MOL), Yang Ming, Hapag-Lloyd (UASC);
2) Ocean Alliance= CMA CGM (APL), Evergreen, COSCO (China Shipping), OOCL; CMA CGM with only Evergreen or
COSCO with OOCL was common;
3) Maersk (Hamburg Sud, Horizon, P&O Nedlloyd, Safmarine), Mediterranean= MSC.

ONE was occasionally seen with MSC, also with CMA CGM Evergreen and with COSCO OOCL, so the groupings do get mixed. You will see these groups scrambled together on the same articulated cars on some "I" trains, but usually they are in separate blocks. Hyundai= HMM was seen in combinations with 2) and 3), but mostly with 1). Surprisingly, giant Maersk was one of the least seen on UP. SM Line took over for Hanjin, but is not seen as often as Hanjin was.

Autos wbd went in manifest trains or ISILBs. None were seen on Zs or As. Ebd, autos were seen from Mira Loma on AMLEPs and repos, with very few on manifests. They were on 4 of 6 ZLAMEs and 2 of 6 ZLAMQs, plus a ZLCAI and ILAMQX. Ebd imported autos have a higher priority than wbd domestic production?

There were 45 10,000+' UP trains, averaging 2 1/2 per day wbd and 4/day ebd. BNSF on 8/5/21 (only 1 sample day) on the Transcon in SoCal had ten 10k+ trains, 7 S marine stacks, 2 Q domestic double stacks and 1 ZAUGSBD7. 60% of the wbd UP I trains were 10k+, vs. 1/3 of the ebd Is. The only 10k+ Zs were ZCIG4 (4, yet none of the ICIG4s), ZG4CI (3), ZLCAI (2 including the longest Z, at 13k) and ZLAME (1). An ISILB was the longest wbd at 15.5k. There was an ebd 16.4k ILBHO and five 15k (ILBDIs, ILBHOs and an ILBG3). The MWCSA at 11k was the only 10k+ ebd manifest. There were two wbd 12k MFWWCs. Unlike BNSF, there were no intermodal trains combined with a manifest or ethanol train.

The only trains that turned on/off the Phoenix Sub on the east leg of the Picacho Wye were MHNPX, MTUPX, MPXTU, MPXTUB, and GSCKDX/GSDXPY. The west leg of the Picacho Wye was only used to turn power (PTC problems on the lead unit?) for the AMLEP, GSMRFK and MWCEW. Cherry Ave. Interlocking is often blocked by long ebd trains while changing crews, so that the Stockham Xovers to the west get a lot of use. You will see trains frequently held there waiting to get into the yard as you drive by on adjacent I-10.

During this week, a CGUNE empty coal train came up from Guaymas, Mexico, via Nogales and turned east at Tucson, by-passing the railcam. It was returning to the New Elk Mine for loading. It went to El Paso, north to Tucumcari and Stratford, TX, where it gets onto BNSF trackage rights. Via BNSF rights it goes north to Las Animas, CO, west to La Junta and Pueblo, south to Trinidad and Jansen, where the coal is trucked from the New Elk Mine.

There were also two CCQDG Arizona Electric Power coal trains from Cochise that were interchange to Southwestern RR at Deming, NM, which interchanges it to BNSF at Rincon on the El Paso Sub. Those cars are for the El Segundo Mine (43% of Cochise coal) north of Grants, NM. 57% of the coal is from

North Antelope Rochelle Mine in the Powder River Basin and is handled all the way by UP via El Paso.

The ZCIG4 and ZG4CI pass both the Tucson and La Plata, MO, railcams, so it is easy to measure their speeds in that 1,394 mile distance. You can also compare the train make up and see that the ZCIG4 does not work between railcams. It varied in speed between 34.3 and 45.4 MPH, a 10-hour difference, with the fastest making it in 30 3/4 hours. That's excluding the late train at 31.3 MPH, 14 hours behind the fastest. Wbd, the ZG4CI averaged 23.9 to 31.9 MPH, 43 3/4 hours for the fastest one. The slower average speed in part is because it works at Santa Teresa, dropping 5-20 rear end domestic double stacks. Two of the trains dropped a unit, one added a unit. How does the speed of these Zs compare to a passenger train, you ask? Amtrak #1's schedule from Tucson to Yuma is an average of 59.5 MPH, TU to Ontario is 55.9 MPH. UP's PTULV passenger special averaged 47.1 MPH TU to Yuma and 54.1 MPH TU to Loma Linda, CA, possibly with some inspection stops. PTULV times thanks to TO's Gary TheNavigator.

For shooting trains, the Zs and the LKL70 local are the most dependable. It's easy to check on how Amtrak is doing to predict it's arrival. A look at trains and their time passing the TU railcam is a big help. Between trains during the night, if you're watching the railcam, the cats at the Southern Arizona Transportation Museum will keep you entertained with their antics. SATM-http://tucsonhistoricdepot.org/ sponsors the railcam. Search for "Tucson railcam". A big thanks to Jeff and Christi (RailfanAZ) for providing ATCS and radio voice feeds for Tucson and across the west. Donation time.

Corrections, additions welcome.

mapboy

Edit: How could I forgot to mention RailfanAZ and their ATCS and radio voice feeds? I also corrected some spacing.
Edit: I corrected info on coal trains. More info in a post below.
Edit: added more on coal trains from BradleyMcKay.

Edited 3 time(s). Last edit at 10/06/21 16:07 by mapboy.

[Reply To This Message] [Quote]

Date: 10/05/21 14:04
Re: UP Tucson train analysis
Author: callum_out

Your work is appreciated, insane amount of effort in what you posted.

Out

Edited 1 time(s). Last edit at 10/05/21 19:27 by callum_out.

[Reply To This Message] [Quote]

Date: 10/05/21 14:07
Re: UP Tucson train analysis
Author: SouthWestRailCams

Awesome Data Mapboy! Thanks for putting this all together.

Jeff

SouthWest RailCams
CA, NM, CO, TX, AR, MO, AZ
https://southwestrailcams.com

[Reply To This Message] [Quote]

Date: 10/05/21 14:18
Re: UP Tucson train analysis
Author: jacquesd

Thanks for the data! It sure seems with the monsters roaming the rails there should be less traffic, but the figures do not bear that supposition out.

[Reply To This Message] [Quote]

Date: 10/05/21 14:26
Re: UP Tucson train analysis
Author: goneon66

callum_out Wrote:

> Your work is appreciated, insane amount of erffort
> in what you posted.
>
> Out

well said.....

66

[Reply To This Message] [Quote]

Date: 10/05/21 14:27
Re: UP Tucson train analysis
Author: Lackawanna484

Thanks for all the analysis, huge amount of detail to sift

[Reply To This Message] [Quote]

Date: 10/05/21 14:34
Re: UP Tucson train analysis

Author: Christi

Great Information mapboy! Glad we are able to provide the ATCS and RadioFeed data for RailFans. The Tucson Yard RadioFeed has been very busy since the CAMs are offline due to the sad event that happened yesterday. We upped the connection limits for it in the meantime.

Have a great day and stay safe!

Christi

RailFanAZ - RailFanning BNSF & UP
AZ, CA, NM, TX
RailFanAZ.com

Edited 1 time(s). Last edit at 10/05/21 14:34 by Christi.

[Reply To This Message] [Quote]

Date: 10/05/21 16:52
Re: UP Tucson train analysis
Author: memphisfreight

Fantastic summary, mapboy. You answered several questions regarding some of the symbols I've heard recently.

.

[Reply To This Message] [Quote]

Date: 10/05/21 16:56
Re: UP Tucson train analysis
Author: Bandito

mapboy Wrote:

> International marine traffic on UP travels mostly
> in three main partner groups-
> 1) ONE (NYK, K Line, MOL), Yang Ming, Hapag-Lloyd
> (UASC);
> 2) Ocean Alliance= CMA CGM (APL), Evergreen, COSCO
> (China Shipping), OOCL; CMA CGM with only
> Evergreen or
> COSCO with OOCL was common;
> 3) Maersk (Hamburg Sud, Horizon, P&O Nedlloyd,
> Safmarine), Mediterranean= MSC.
>
> ONE was occasionally seen with MSC, also with CMA
> CGM Evergreen and with COSCO OOCL, so the
> groupings do get mixed.

ONE's (K-Line's) ITS teminal in LGB has been hosting MSC vessels for some time, so the mix of ONE and MSC could have been done at ITS' ondock operation. ONE mixed with Ocean Alliance containers I would think would be more likely to have been loaded off-dock at UP's terminal.

Edited 1 time(s). Last edit at 10/06/21 12:36 by Bandito.

[Reply To This Message] [Quote]

Date: 10/05/21 16:58
Re: UP Tucson train analysis
Author: StStephen

Mapboy,

As always great information; thanks for the time spent. I don't have access to the old predictions done in the early 2000s, but think the projections were for about 70 or 80 trains per day by now. Oh well....

Bruce

[Reply To This Message] [Quote]

Date: 10/05/21 19:07
Re: UP Tucson train analysis
Author: MSE

Was just reading that, in spite of the stock market, the U.S. economy still has not fully recovered from the Great Recession (2007-08). That would account for fewer trains along with the decrease in coal trains.

[Reply To This Message] [Quote]

Date: 10/05/21 19:48
Re: UP Tucson train analysis
Author: memphisfreight

StStephen Wrote:

> Mapboy,
>
> As always great information; thanks for the time
> spent. I don't have access to the old predictions
> done in the early 2000s, but think the projections
> were for about 70 or 80 trains per day by now. Oh
> well....
>
> Bruce

Might be handy if we had ton-miles figures for comparison. Would be fun to

compare the tonnage SP was hauling pre merger 1996 and now.

Edited 1 time(s). Last edit at 10/05/21 19:49 by memphisfreight.

[Reply To This Message] [Quote]

Date: 10/05/21 21:09
Re: UP Tucson train analysis
Author: cchan006

Thanks mapboy, for the very comprehensive data and report!

I see that IKCPX (Kansas City to Phoenix) is no more? When I caught the train several times last year, it looked like a PSR experiment with MHNPX?

For eastbound, MWCLI (West Colton to Livonia, Louisiana) is missing, which I caught once last year.

Don't know when I'll go back to the area, but it's a great area to chase trains.

[Reply To This Message] [Quote]

Date: 10/05/21 21:45
Re: UP Tucson train analysis
Author: ble692

The IKCPX and MWCLI are no more. Not sure when they went away, but the symbols seem to change about as fast as the weather does.

[Reply To This Message] [Quote]

Date: 10/06/21 02:50
Re: UP Tucson train analysis
Author: howeld

Christi Wrote:

> Great Information mapboy! Glad we are able to
> provide the ATCS and RadioFeed data for
> RailFans. The Tucson Yard RadioFeed has been
> very busy since the CAMs are offline due to the
> sad event that happened yesterday. We upped the
> connection limits for it in the meantime.
>
> Have a great day and stay safe!
>
> Christi

ATCS has gone dark on BNSF on the east end of the system. Any idea on how long the excellent coverage you have put together on BNSF will last?

[Reply To This Message] [Quote]

Date: 10/06/21 05:14
Re: UP Tucson train analysis
Author: texchief1

Just think when coal was good and before PSR, Kearney had 135-150 trains a day. Don't need 3 tracks there any more.

RC LUndgren
Elgin, TX

[Reply To This Message] [Quote]

Date: 10/06/21 06:13
Re: UP Tucson train analysis
Author: Lackawanna484

memphisfreight Wrote:

> StStephen Wrote:
> ---
> -----
> > Mapboy,
> >
> > As always great information; thanks for the
> time
> > spent. I don't have access to the old
> predictions
> > done in the early 2000s, but think the
> projections
> > were for about 70 or 80 trains per day by now.
> Oh
> > well....
> >
> > Bruce
>
> Might be handy if we had ton-miles figures for
> comparison. Would be fun to compare the tonnage
> SP was hauling pre merger 1996 and now.

Yes, although the rise in intermodal and decline in coal might skew the results

Posted from Android

[Reply To This Message] [Quote]

Date: 10/06/21 13:55
Re: UP Tucson train analysis
Author: mapboy

BradleyMckay has reminded me that the CGUNE uses an all-UP routing, from Nogales to Tucson to El Paso, north to Tucumcari and Stratford, TX, where it gets onto BNSF trackage rights. Via BNSF it goes north to Las Animas, CO, west to La Junta and Pueblo, south to Trinidad and Jansen, where the coal is trucked from the New Elk Mine.

The Arizona Electric power station at Cochise has been getting coal in 2021 from North Antelope Rochelle Mine in the Powder River Basin (57% thru July, BradleyMcKay advises that UP handles that all the way from PRB) and El Segundo Mine (43%) north of Grants, NM. UP interchanges the El Segundo Mine coal empties at Deming, NM, to Southwestern RR which interchanges it to BNSF at Rincon on the El Paso Sub.

memphisfreight Wrote:

> Might be handy if we had ton-miles figures for
> comparison. Would be fun to compare the tonnage
> SP was hauling pre merger 1996 and now.

Per UP, “Gross ton miles of freight train cars, contents, locomotives and cabooses handled in millions of tons."
UP 2011 tonnage (I don’t have later), Tucson-Picacho (junction to Phoenix) 49.9 Millions of Gross Tons wb + 47.3 MGT eb= 97.2 MGT.
UP 2001 tonnage Tucson- Picacho 35 MGT wb + 32 MGT eb= 67 MGT.
SP 1991 tonnage only shows an average for Tucson-Yuma 27.2 MGT wb + 21.3 MGT eb= 48.5 MGT.
I couldn't find better years for examples.

I think I got this from Trains Magazine, trains per day for 1998-2004-2019:
"LA-El Paso Sunset Route 33-44-39"
“Nebraska triple track 115-137-77”

cchan006 Wrote:

> ...I see that IKCPX (Kansas City to Phoenix) is no
> more? When I caught the train several times last
> year, it looked like a PSR experiment with MHNPX?
>
> For eastbound, MWCLI (West Colton to Livonia,
> Louisiana) is missing, which I caught once last
> year…

The MHNPX started 10/20 and replaced the IKCPX then.
By March of this year, the MWCLI had become the MWCSA.

rantoul Wrote:

> I thought UP hauled solid no-manifest auto trains
> to Phoenix.

I was surprised to see no solid auto trains to Phoenix or Mira Loma via the Sunset Route. UP was running MNPML and MNPMLB to West Colton, where any manifest was dropped, and then autos to ML, sometimes with L.A. domestic

intermodal traffic. Occasionally UP runs an all-autos ANPMLX. The symbols could have changed.

mapboy

Edited 1 time(s). Last edit at 10/06/21 16:02 by mapboy.

[Reply To This Message] [Quote]

Date: 10/06/21 16:06
Re: UP Tucson train analysis
Author: stash

Fascinating data!

[Reply To This Message] [Quote]

Date: 10/06/21 16:20
Re: UP Tucson train analysis
Author: spider1319

Many thanks for a job well done.Bill Webb

[Reply To This Message] [Quote]

[Share Thread on Facebook] [Search] [Start a New Thread] [Back to Thread List] [<Newer] [Older>]

Page created in 0.1552 seconds

ADOT Multimodal Planning

ERR N3

Arizona Department of Transportation
AVERAGE ANNUAL DAILY TRAFFIC REPORT 2022

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100001}	100001	I-8	0.0	California State Line - Yuma	0.4	0.5	E Giss Pkwy	10,576	8,002	18,578	Derivation Code = 3 | MS2 TDMS; Reference = {68_100001} | Previous AADT = 19054	5	52	965	2,751	20%	26,910
{68_100002}	100002	I-8	0.6	E Giss Pkwy	1.8	2.2	US-95	13,656	12,698	26,354	Derivation Code = 1 | MS2 TDMS; Reference = {68_100002} | Previous AADT = 25050	11	54	2,324	2,703	19%	38,174
{68_100003}	100003	I-8	2.2	US-95	2.7	4.0	SR-280	20,858	20,073	40,931	Derivation Code = 3 | MS2 TDMS; Reference = {68_100003} | Previous AADT = 41981	5	53	1,471	4,193	14%	55,462
{68_100004}	100004	I-8	4.0	SR-280	5.8	7.6	Exit 7 Araby Rd	25,406	21,943	47,349	Derivation Code = 3 | MS2 TDMS; Reference = {68_100004} | Previous AADT = 48563	5	57	2,058	6,373	18%	68,585
{68_100005}	100005	I-8	7.6	Exit 7 Araby Rd	8.3	9.7	Exit 9 SB 8 (1) / Avenue 8 1/2 E - East of Yuma	22,677	22,017	44,694	Derivation Code = 3 | MS2 TDMS; Reference = {68_100005} | Previous AADT = 45840	5	53	1,571	4,596	14%	64,739
{68_100006}	100006	I-8	9.7	Exit 9 SB 8 (1) / Avenue 8 1/2 E - East of Yuma	10.8	12.3	S Fortuna Rd SB	19,763	21,456	41,219	Derivation Code = 3 | MS2 TDMS; Reference = {68_100006} | Previous AADT = 42276	5	51	1,517	4,547	15%	55,852
{68_100007}	100007	I-8	12.2	S Fortuna Rd SB	13.0	14.2	S Foothills Blvd	13,870	14,226	28,096	Derivation Code = 1 | MS2 TDMS; Reference = {68_100007} | Previous AADT = 26502	11	51	1,950	3,406	19%	42,098
{68_100008}	100008	I-8	14.2	S Foothills Blvd	16.0	21.0	Exit 21 Dome Valley	11,286	10,524	21,810	Derivation Code = 1 | MS2 TDMS; Reference = {68_100008} | Previous AADT = 19049	11	56	1,892	3,923	27%	32,680
{68_100009}	100009	I-8	21.0	Exit 21 Dome Valley	25.9	30.8	Exit 30 Avenue 29E - Wellton	6,333	7,682	14,015	Derivation Code = 3 | MS2 TDMS; Reference = {68_100009} | Previous AADT = 14374	5	56	699	2,652	24%	20,301
{68_100010}	100010	I-8	30.8	Exit 30 Avenue 29E - Wellton	37.0	38.0	S Avenue 36 E	8,005	6,475	14,480	Derivation Code = 1 | MS2 TDMS; Reference = {68_100010} | Previous AADT = 13847	8	67	687	3,009	26%	22,625
{68_100011}	100011	I-8	38.0	S Avenue 36 E	40.3	42.1	S Avenue 40 E	6,882	5,735	12,617	Derivation Code = 3 | MS2 TDMS; Reference = {68_100011} | Previous AADT = 12940	9	55	593	2,546	25%	18,905
{68_100012}	100012	I-8	42.1	S Avenue 40 E	48.5	54.9	I 8 Exit 54 Access Ramp	6,533	5,869	12,402	Derivation Code = 1 | MS2 TDMS; Reference = {68_100012} | Previous AADT = 11704	7	56	626	2,497	25%	18,583
{68_100013}	100013	I-8	54.9	I 8 Exit 54 Access Ramp	67.0	67.4	S Avenue 64 E	4,816	4,774	9,590	Derivation Code = 3 | MS2 TDMS; Reference = {68_100013} | Previous AADT = 9836	7	66	562	2,293	30%	14,984
{68_100014}	100014	I-8	67.4	S Avenue 64 E	70.0	73.5	Aztec Rd	6,359	5,589	11,948	Derivation Code = 1 | MS2 TDMS; Reference = {68_100014} | Previous AADT = 10758	6	56	544	2,148	23%	17,903
{68_100015}	100015	I-8	73.5	Aztec Rd	74.0	78.5	Spot Rd	5,473	5,268	10,741	Derivation Code = 3 | MS2 TDMS; Reference = {68_100015} | Previous AADT = 11016	7	59	557	2,114	25%	16,094
{68_100016}	100016	I-8	78.5	Spot Rd	81.0	87.0	Sentinel Rd	6,599	7,260	13,859	Derivation Code = 3 | MS2 TDMS; Reference = {68_100016} | Previous AADT = 13339	8	55	590	3,161	27%	23,387
{68_100017}	100017	I-8	87.0	Sentinel Rd	93.6	102.3	Painted Rock Dam Rd	6,708	6,708	13,416	Derivation Code = 3 | MS2 TDMS; Reference = {68_100017} | Previous AADT = 12912	7	60	616	4,199	36%	22,640
{68_100018}	100018	I-8	102.3	Painted Rock Dam Rd	104.0	106.5	Paloma Rd	7,600	7,484	15,084	Derivation Code = 1 | MS2 TDMS; Reference = {68_100018} | Previous AADT = 14463	13	52	616	4,199	32%	25,454
{68_100019}	100019	I-8	106.5	Paloma Rd	108.0	111.4	Citrus Valley Rd	6,978	6,067	13,045	Derivation Code = 1 | MS2 TDMS; Reference = {68_100019} | Previous AADT = 12032	7	59	616	4,199	37%	22,013
{68_100020}	100020	I-8	111.4	Citrus Valley Rd	112.8	114.3	Exit 115 SB 8 (3) - West of Gila Bend	7,703	7,320	15,023	Derivation Code = 3 | MS2 TDMS; Reference = {68_100020} | Previous AADT = 14459	8	63	528	2,949	23%	23,603
{68_100021}	100021	I-8	114.3	Exit 115 SB 8 (3) - West of Gila Bend	115.5	115.6	Exit 116 SR 85	2,132	1,620	3,752	Derivation Code = 1 | MS2 TDMS; Reference = {68_100021} | Previous AADT = 14459	10	64	-	-	-	5,906
{68_100022}	100022	I-8	115.6	Exit 116 SR 85	116.1	119.4	Exit 119 Butterfield Trail - East of Gila Bend	1,565	1,370	2,935	Derivation Code = 3 | MS2 TDMS; Reference = {68_100022} | Previous AADT = 2825	10	64	304	1,632	66%	4,953
{68_100023}	100023	I-8	119.4	Exit 119 Butterfield Trail - East of Gila Bend	120.9	140.8	I-8 Exit 140	3,820	3,921	7,741	Derivation Code = 1 | MS2 TDMS; Reference = {68_100023} | Previous AADT = 7296	12	60	453	3,314	49%	13,063
{68_100024}	100024	I-8	140.8	I-8 Exit 140	143.0	144.6	Vekol Valley Rd	3,731	3,277	7,008	Derivation Code = 3 | MS2 TDMS; Reference = {68_100024} | Previous AADT = 6745	7	50	318	2,653	42%	11,826
{68_100025}	100025	I-8	144.6	Exit 144 Vekol Rd	147.0	151.7	Exit 151 SR 84 / Maricopa Rd	3,744	3,251	6,995	Derivation Code = 3 | MS2 TDMS; Reference = {68_100025} | Previous AADT = 6732	7	56	294	2,483	40%	16,042
{68_100026}	100026	I-8	151.7	SR-84	157.0	161.6	S Stanfield Rd	3,589	3,567	7,156	Derivation Code = 1 | MS2 TDMS; Reference = {68_100026} | Previous AADT = 6648	11	60	310	3,286	50%	14,557
{68_100027}	100027	I-8	161.5	S Stanfield Rd	162.0	167.5	S Montgomery Rd	4,307	4,408	8,715	Derivation Code = 3 | MS2 TDMS; Reference = {68_100027} | Previous AADT = 8324	7	51	249	2,583	32%	19,987
{68_100028}	100028	I-8	167.5	S Montgomery Rd	169.0	169.5	S Bianco Rd	3,201	3,411	6,612	Derivation Code = 3 | MS2 TDMS; Reference = {68_100028} | Previous AADT = 6315	8	51	252	2,431	41%	15,164
{68_100029}	100029	I-8	169.5	S Bianco Rd	170.9	172.5	S Thornton Rd	1,732	5,704	7,436	Derivation Code = 3 | MS2 TDMS; Reference = {68_100029} | Previous AADT = 7102	7	74	230	1,925	29%	15,127
{68_100030}	100030	I-8	172.6	S Thornton Rd	173.6	174.5	S Trekell Rd	4,203	4,197	8,400	Derivation Code = 3 | MS2 TDMS; Reference = {68_100030} | Previous AADT = 8023	8	56	326	2,377	32%	19,264
{68_100031}	100031	I-8	174.4	S Trekell Rd	176.9	177.8	I-8 Exit 178 A-Ramp	6,259	4,895	11,154	Derivation Code = 3 | MS2 TDMS; Reference = {68_100031} | Previous AADT = 10653	7	55	404	2,023	22%	28,041
{68_100063}	100063	I-10	0.0	California State Line - Ehrenberg	0.4	0.7	Exit 1 Ehrenberg - Parker Hwy	14,757	15,866	30,623	Derivation Code = 3 | MS2 TDMS; Reference = {68_100063} | Previous AADT = 31408	6	51	1,211	10,845	39%	48,404
{68_100064}	100064	I-10	0.7	Juneau Ave	2.4	5.9	Tom Wells Rd	13,510	13,688	27,198	Derivation Code = 1 | MS2 TDMS; Reference = {68_100064} | Previous AADT = 29642	10	53	1,211	10,845	44%	42,990
{68_100065}	100065	I-10	5.8	Tom Wells Rd	11.0	12.0	W Dome Rock Rd	12,836	12,020	24,856	Derivation Code = 3 | MS2 TDMS; Reference = {68_100065} | Previous AADT = 25493	7	59	1,211	10,845	49%	39,288
{68_100066}	100066	I-10	12.0	W Dome Rock Rd	17.0	17.5	SR-10B nonCard (1)	12,298	13,466	25,764	Derivation Code = 3 | MS2 TDMS; Reference = {68_100066} | Previous AADT = 26425	7	55	1,071	11,634	49%	40,724
{68_100067}	100067	I-10	17.5	SR-10B nonCard (1)	19.0	19.9	SR-10B nonCard (1)	12,877	11,284	24,161	Derivation Code = 3 | MS2 TDMS; Reference = {68_100067} | Previous AADT = 24781	6	58	935	9,532	43%	41,898
{68_100068}	100068	I-10	19.9	SR-10B nonCard (1)	22.8	26.7	Gold Nugget Rd	12,956	12,402	25,358	Derivation Code = 3 | MS2 TDMS; Reference = {68_100068} | Previous AADT = 26008	8	66	1,448	10,519	47%	43,974
{68_100069}	100069	I-10	26.7	Gold Nugget Rd	30.6	31.2	US-60	13,178	12,763	25,941	Derivation Code = 3 | MS2 TDMS; Reference = {68_100069} | Previous AADT = 26606	6	58	1,296	10,346	45%	41,003
{68_100070}	100070	I-10	31.2	US-60	43.9	45.4	Vicksburg Rd	13,878	13,658	27,536	Derivation Code = 1 | MS2 TDMS; Reference = {68_100070} | Previous AADT = 28160	11	57	1,241	11,703	47%	46,178
{68_100071}	100071	I-10	45.4	Vicksburg Rd	51.8	54.0	Hovatter Rd	12,424	14,930	27,354	Derivation Code = 3 | MS2 TDMS; Reference = {68_100071} | Previous AADT = 28055	12	57	593	4,689	19%	43,237
{68_100072}	100072	I-10	54.0	Hovatter Rd	61.8	69.7	Avenue 75	12,369	11,324	23,693	Derivation Code = 3 | MS2 TDMS; Reference = {68_100072} | Previous AADT = 24300	6	59	947	8,892	42%	37,450
{68_100073}	100073	I-10	69.7	Avenue 75	75.4	81.2	Salome Hwy	11,801	14,197	25,998	Derivation Code = 3 | MS2 TDMS; Reference = {68_100073} | Previous AADT = 25022	8	53	1,179	9,321	40%	43,872
{68_100074}	100074	I-10	81.2	Salome Hwy	87.7	94.2	411th Ave	12,473	14,275	26,748	Derivation Code = 3 | MS2 TDMS; Reference = {68_100074} | Previous AADT = 25744	7	66	1,091	9,272	39%	42,024
{68_100075}	100075	I-10	94.2	411th Ave	94.9	98.3	Wintersburg Rd	15,624	14,280	29,904	Derivation Code = 1 | MS2 TDMS; Reference = {68_100075} | Previous AADT = 29437	10	58	1,049	5,614	22%	50,463
{68_100076}	100076	I-10	98.3	Wintersburg Rd	99.0	103.5	339th Ave	12,656	15,874	28,530	Derivation Code = 3 | MS2 TDMS; Reference = {68_100076} | Previous AADT = 27459	7	52	1,213	9,002	36%	48,144
{68_100077}	100077	I-10	103.5	339th Ave	104.0	109.7	Palo Verde Rd	26,994	23,993	50,987	Derivation Code = 3 | MS2 TDMS; Reference = {68_100077} | Previous AADT = 49073	8	54	1,428	9,356	21%	80,255
{68_100078}	100078	I-10	109.7	Palo Verde Rd	110.2	112.8	I-10 Exit 112 C-Ramp	23,901	22,582	46,483	Derivation Code = 3 | MS2 TDMS; Reference = {68_100078} | Previous AADT = 44738	7	54	2,326	10,935	29%	63,804

Source: ADOT Highway Performance Monitoring System
Printed: 8/25/2023

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100079}	100079	I-10	112.8	I-10 Exit 112 C-Ramp	114.1	114.9	Miller Bky Rd	23,967	17,971	41,938	Derivation Code = 3 | MS2 TDMS; Reference = {68_100079} | Previous AADT = 42022	8	63	2,516	12,532	36%	57,565
{68_100080}	100080	I-10	114.9	Miller Bky Rd	115.7	117.0	Watson Rd	42,433	30,968	73,401	Derivation Code = 3 | MS2 TDMS; Reference = {68_100080} | Previous AADT = 73548	9	50	3,867	11,934	22%	115,536
{68_100081}	100081	I-10	117.0	Watson Rd	118.0	120.2	Verrado Way	46,804	46,434	93,238	Derivation Code = 3 | MS2 TDMS; Reference = {68_100081} | Previous AADT = 93425	8	51	4,198	13,401	19%	146,760
{68_100082}	100082	I-10	120.2	Verrado Way	121.0	121.7	Jackrabbit Trl	57,919	57,863	115,782	Derivation Code = 12 | MS2 TDMS; Reference = {68_100082} | Previous AADT = 117310	6	53	6,227	14,072	18%	182,245
{68_100083}	100083	I-10	121.7	Jackrabbit Trl	124.2	124.7	SR-303	57,642	56,919	114,561	Derivation Code = 3 | MS2 TDMS; Reference = {68_100083} | Previous AADT = 114791	6	55	6,227	14,072	18%	157,249
{68_100084}	100084	I-10	124.7	SR-303	126.0	126.7	Estrella Pkwy	75,486	74,429	149,915	Derivation Code = 3 | MS2 TDMS; Reference = {68_100084} | Previous AADT = 150215	7	67	11,066	17,310	19%	235,971
{68_100085}	100085	I-10	126.7	Estrella Pkwy	127.0	127.7	Bullard Ave	79,794	76,888	156,682	Derivation Code = 3 | MS2 TDMS; Reference = {68_100085} | Previous AADT = 156996	7	56	11,066	17,310	18%	246,623
{68_100086}	100086	I-10	127.7	Bullard Ave	128.1	128.7	Litchfield Rd	113,633	107,905	221,538	Derivation Code = 1 | MS2 TDMS; Reference = {68_100086} | Previous AADT = 222327	7	51	11,066	17,310	13%	348,709
{68_100087}	100087	I-10	128.7	Litchfield Rd	129.2	129.7	Dysart Rd	113,856	109,061	222,917	Derivation Code = 1 | MS2 TDMS; Reference = {68_100087} | Previous AADT = 220848	8	51	12,545	20,122	15%	350,879
{68_100088}	100088	I-10	129.7	Dysart Rd	131.0	131.7	Avondale Blvd	87,809	98,099	185,908	Derivation Code = 12 | MS2 TDMS; Reference = {68_100088} | Previous AADT = 208372	7	57	9,181	14,482	13%	292,626
{68_100089}	100089	I-10	131.7	Avondale Blvd	133.0	133.7	99th Ave	91,103	99,332	190,435	Derivation Code = 3 | MS2 TDMS; Reference = {68_100089} | Previous AADT = 190817	8	64	7,429	11,428	10%	299,751
{68_100090}	100090	I-10	133.7	99th Ave	134.4	134.7	91st Ave	117,107	122,952	240,059	Derivation Code = 3 | MS2 TDMS; Reference = {68_100090} | Previous AADT = 240540	7	58	7,429	11,428	8%	405,100
{68_100091}	100091	I-10	134.7	91st Ave	135.0	135.7	83rd Ave	213,802	18,625	232,427	Derivation Code = 3 | MS2 TDMS; Reference = {68_100091} | Previous AADT = 232893	6	53	7,635	11,750	8%	392,221
{68_100092}	100092	I-10	135.7	83rd Ave	136.1	136.2	79th Ave	175,617	114,309	289,926	Derivation Code = 12 | MS2 TDMS; Reference = {68_100092} | Previous AADT = 225388	7	55	7,635	11,750	7%	456,354
{68_100093}*2	100093	I-10	136.2	79th Ave	136.3	136.7	75th Ave	113,397	143,537	256,934	Derivation Code = 1 | MS2 TDMS; Reference = {68_100093}*2 | Previous AADT = 225388	7	59	7,735	11,903	8%	404,423
{68_100094}	100094	I-10	136.7	75th Ave	137.2	137.7	67th Ave	151,392	150,281	301,673	Derivation Code = 1 | MS2 TDMS; Reference = {68_100094} | Previous AADT = 236848	7	54	8,667	13,335	7%	414,083
{68_100095}	100095	I-10	137.7	67th Ave	138.1	138.7	59th Ave	158,534	113,480	272,014	Derivation Code = 12 | MS2 TDMS; Reference = {68_100095} | Previous AADT = 206140	9	57	9,316	14,334	9%	428,159
{68_100096}	100096	I-10	138.7	59th Ave	139.0	139.7	51st Ave	110,727	120,238	230,965	Derivation Code = 1 | MS2 TDMS; Reference = {68_100096} | Previous AADT = 210140	7	58	6,876	10,577	8%	363,547
{68_100097}	100097	I-10	139.7	51st Ave	140.1	140.7	43rd Ave	145,143	143,445	288,588	Derivation Code = 7 | MS2 TDMS; Reference = {68_100097} | Previous AADT = 231550	7	53	7,808	12,010	7%	454,248
{68_100098}	100098	I-10	140.7	43rd Ave	141.1	141.7	35th Ave	140,552	147,281	287,833	Derivation Code = 1 | MS2 TDMS; Reference = {68_100098} | Previous AADT = 257000	7	53	9,263	6,581	6%	453,059
{68_100099}	100099	I-10	141.7	35th Ave	142.1	142.7	27th Ave	138,634	145,017	283,651	Derivation Code = 1 | MS2 TDMS; Reference = {68_100099} | Previous AADT = 279288	7	57	10,798	5,529	6%	446,477
{68_100100}*2	100100	I-10	142.7	27th Ave	142.8	143.2	I-17	107,886	117,608	225,494	Derivation Code = 3 | MS2 TDMS; Reference = {68_100100}*2 | Previous AADT = 225946	7	51	10,049	5,136	7%	354,935
{68_100101_WB}*2	100101	I-10	143.2	I-17	143.3	143.7	19th Ave	59,339	76,547	135,886	Derivation Code = 3 | MS2 TDMS; Reference = {68_100101_WB}*2 | Previous AADT = 136158	7	53	10,166	15,640	19%	213,889
{68_100102}	100102	I-10	143.7	19th Ave	144.2	144.7	7th Ave	44,629	217,041	261,670	Derivation Code = 12 | MS2 TDMS; Reference = {68_100102} | Previous AADT = 195170	5	67	14,420	4,359	7%	411,878
{68_100103}*2	100103	I-10	144.7	7th Ave	144.9	144.9	3rd Ave	98,229	157,423	255,652	Derivation Code = 3 | MS2 TDMS; Reference = {68_100103}*2 | Previous AADT = 256164	7	51	13,774	4,674	7%	402,405
{68_100104}	100104	I-10	144.9	3rd Ave	145.0	145.4	3rd St nonCard	126,274	131,684	257,958	Derivation Code = 3 | MS2 TDMS; Reference = {68_100104} | Previous AADT = 258475	7	55	13,064	4,707	7%	406,035
{68_100105}*2	100105	I-10	145.4	3rd St nonCard	145.7	145.7	7th St	94,402	157,270	251,672	Derivation Code = 1 | MS2 TDMS; Reference = {68_100105}*2 | Previous AADT = 260032	7	52	12,362	4,793	7%	396,140
{68_100106}	100106	I-10	145.7	7th St	146.2	146.7	16th St	213,415	170,871	384,286	Derivation Code = 12 | MS2 TDMS; Reference = {68_100106} | Previous AADT = 318644	7	54	10,858	6,309	4%	604,880
{68_100107}	100107	I-10	146.7	16th St	147.3	147.4	Roosevelt Phx St	61,707	63,532	125,239	Derivation Code = 3 | MS2 TDMS; Reference = {68_100107} | Previous AADT = 125490	7	54	4,251	6,542	9%	197,131
{68_100108}	100108	I-10	147.4	Roosevelt Phx St	147.9	148.2	Jefferson St	86,062	61,333	147,395	Derivation Code = 1 | MS2 TDMS; Reference = {68_100108} | Previous AADT = 153388	7	54	5,929	9,123	10%	232,005
{68_100109}	100109	I-10	148.2	Jefferson St	148.6	148.9	Buckeye Rd	82,703	91,378	174,081	Derivation Code = 1 | MS2 TDMS; Reference = {68_100109} | Previous AADT = 175917	8	57	10,526	7,724	10%	274,010
{68_100110}	100110	I-10	148.9	Buckeye Rd	149.2	149.9	24th St	77,508	74,124	151,632	Derivation Code = 1 | MS2 TDMS; Reference = {68_100110} | Previous AADT = 161774	8	52	6,123	9,421	10%	238,674
{68_100111}	100111	I-10	149.9	24th St	151.1	151.5	University Dr	139,805	61,869	201,674	Derivation Code = 3 | MS2 TDMS; Reference = {68_100111} | Previous AADT = 202078	7	60	9,897	15,227	12%	317,442
{68_100112}	100112	I-10	151.5	University Dr	152.0	152.4	40th St	116,297	132,000	248,297	Derivation Code = 3 | MS2 TDMS; Reference = {68_100112} | Previous AADT = 248795	7	66	5,264	6,450	5%	390,828
{68_100113}	100113	I-10	152.4	40th St	152.9	153.2	I-10 Exit 153 A-Ramp	126,474	111,110	237,584	Derivation Code = 3 | MS2 TDMS; Reference = {68_100113} | Previous AADT = 238060	4	57	4,426	6,810	5%	373,965
{68_100114}	100114	I-10	153.2	I-10 Exit 153 A-Ramp	153.2	154.0	I-10 Exit 153 G-Ramp	115,851	139,535	255,386	Derivation Code = 3 | MS2 TDMS; Reference = {68_100114} | Previous AADT = 255898	7	56	9,829	11,124	8%	401,986
{68_100115}	100115	I-10	154.0	I-10 Exit 153 G-Ramp	154.3	154.9	US-60	131,436	174,163	305,599	Derivation Code = 3 | MS2 TDMS; Reference = {68_100115} | Previous AADT = 306211	8	53	10,290	15,830	9%	419,472
{68_100116}	100116	I-10	154.9	US-60	155.5	156.0	Baseline Rd	85,400	106,110	191,510	Derivation Code = 3 | MS2 TDMS; Reference = {68_100116} | Previous AADT = 191894	7	53	5,713	8,793	8%	301,443
{68_100117}	100117	I-10	155.9	Baseline Rd	157.1	157.9	Elliot Rd	88,513	97,013	185,526	Derivation Code = 3 | MS2 TDMS; Reference = {68_100117} | Previous AADT = 185898	8	53	7,143	3,570	6%	292,024
{68_100118}	100118	I-10	157.8	Elliot Rd	158.2	158.8	Warner Rd	98,095	115,440	213,535	Derivation Code = 3 | MS2 TDMS; Reference = {68_100118} | Previous AADT = 213963	6	56	11,693	6,191	8%	336,112
{68_100119}	100119	I-10	158.8	Warner Rd	159.2	159.8	Ray Rd	87,854	91,773	179,627	Derivation Code = 3 | MS2 TDMS; Reference = {68_100119} | Previous AADT = 179987	7	59	13,146	6,332	11%	282,739
{68_100120}	100120	I-10	159.8	Ray Rd	160.3	160.8	Chandler Blvd	133,905	43,011	176,916	Derivation Code = 3 | MS2 TDMS; Reference = {68_100120} | Previous AADT = 177271	5	79	6,004	9,239	9%	298,546
{68_100121}	100121	I-10	160.7	Chandler Blvd	161.4	162.6	Wild Horse Pass Blvd	46,012	62,043	108,055	Derivation Code = 1 | MS2 TDMS; Reference = {68_100121} | Previous AADT = 76657	7	53	3,783	7,666	11%	182,343
{68_100122}	100122	I-10	162.5	Wild Horse Pass Blvd	164.0	164.5	SR-347 nonCard	55,785	56,452	112,237	Derivation Code = 1 | MS2 TDMS; Reference = {68_100122} | Previous AADT = 111071	8	54	4,652	10,737	14%	189,400
{68_100123}	100123	I-10	164.5	SR-347 nonCard	165.0	167.5	Riggs Rd	26,946	28,135	55,081	Derivation Code = 3 | MS2 TDMS; Reference = {68_100123} | Previous AADT = 55191	9	53	4,652	10,737	28%	92,949
{68_100124}	100124	I-10	167.5	Riggs Rd	172.0	175.8	SR-587	25,650	39,754	65,404	Derivation Code = 1 | MS2 TDMS; Reference = {68_100124} | Previous AADT = 61788	8	67	1,811	4,802	10%	133,050
{68_100125}	100125	I-10	175.8	SR-587	177.5	185.3	SR-387	33,398	31,487	64,885	Derivation Code = 3 | MS2 TDMS; Reference = {68_100125} | Previous AADT = 62449	9	52	1,982	8,307	16%	131,995
{68_100126}	100126	I-10	185.3	SR-387	188.0	190.7	W McCartney Rd	24,610	25,650	50,260	Derivation Code = 3 | MS2 TDMS; Reference = {68_100126} | Previous AADT = 48004	8	53	1,870	5,662	15%	115,265
{68_100127}	100127	I-10	190.7	W McCartney Rd	193.0	194.9	SR-287	25,016	26,133	51,149	Derivation Code = 3 | MS2 TDMS; Reference = {68_100127} | Previous AADT = 48853	7	51	1,830	5,938	15%	80,631
{68_100128}	100128	I-10	194.9	SR-287	196.5	198.1	SR-84	30,274	29,625	59,899	Derivation Code = 1 | MS2 TDMS; Reference = {68_100128} | Previous AADT = 56871	9	51	2,770	9,457	20%	150,584
{68_100129}	100129	I-10	198.1	SR-84	198.5	199.4	I-8	3,743	51,617	55,360	Derivation Code = 3 | MS2 TDMS; Reference = {68_100129} | Previous AADT = 52875	7	54	2,134	7,642	18%	139,173
{68_100130}	100130	I-10	199.4	I-8	199.7	200.1	N Sunland Gin Rd	25,676	24,582	50,258	Derivation Code = 3 | MS2 TDMS; Reference = {68_100130} | Previous AADT = 48002	7	64	1,707	8,845	21%	115,261

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100131}	100131	I-10	200.1	N Sunland Gin Rd	203.0	203.8	N Toltec Hwy (A)	28,608	28,196	56,804	Derivation Code = 1 | MS2 TDMS; Reference = {68_100131} | Previous AADT = 54373	9	51	2,959	11,473	25%	115,556
{68_100132}	100132	I-10	203.8	N Toltec Hwy (A)	206.3	208.8	S Sunshine Blvd	28,551	25,032	53,583	Derivation Code = 1 | MS2 TDMS; Reference = {68_100132} | Previous AADT = 46164	6	51	1,678	8,941	20%	84,468
{68_100133}	100133	I-10	208.8	S Sunshine Blvd	210.0	210.9	SR-84	27,815	27,898	55,713	Derivation Code = 1 | MS2 TDMS; Reference = {68_100133} | Previous AADT = 53768	9	53	1,454	6,097	14%	87,825
{68_100134}	100134	I-10	210.9	SR-87	211.0	212.2	Exit 212 Picacho Hwy	23,406	33,485	56,891	Derivation Code = 3 | MS2 TDMS; Reference = {68_100134} | Previous AADT = 54337	7	57	1,798	10,235	21%	130,473
{68_100135}	100135	I-10	212.2	Exit 212 Picacho Hwy	214.0	219.8	E Picacho Peak Rd	29,047	28,578	57,625	Derivation Code = 1 | MS2 TDMS; Reference = {68_100135} | Previous AADT = 54971	9	53	2,566	11,858	25%	117,226
{68_100136}	100136	I-10	219.8	E Picacho Peak Rd	222.8	226.5	E I-10 Exit 226 Bridge	31,794	26,384	58,178	Derivation Code = 12 | MS2 TDMS; Reference = {68_100136} | Previous AADT = 47244	6	51	1,830	5,934	13%	118,351
{68_100137}	100137	I-10	226.5	E I-10 Exit 226 Bridge	229.3	232.0	E Pinal Airpark Rd	22,709	29,204	51,913	Derivation Code = 3 | MS2 TDMS; Reference = {68_100137} | Previous AADT = 49583	6	51	1,763	6,176	15%	119,056
{68_100138}	100138	I-10	232.0	E Pinal Airpark Rd	234.0	236.4	N Sandario Rd	27,795	26,006	53,801	Derivation Code = 3 | MS2 TDMS; Reference = {68_100138} | Previous AADT = 51386	7	54	1,562	6,841	16%	80,163
{68_100139}	100139	I-10	236.4	N Sandario Rd	237.3	240.4	W Tangerine Rd	34,002	33,035	67,037	Derivation Code = 1 | MS2 TDMS; Reference = {68_100139} | Previous AADT = 64719	9	56	1,314	11,683	19%	92,667
{68_100140}	100140	I-10	240.5	W Tangerine Rd	241.8	243.0	W Avra Valley Rd	39,695	31,745	71,440	Derivation Code = 3 | MS2 TDMS; Reference = {68_100140} | Previous AADT = 68233	7	51	2,161	8,505	15%	108,899
{68_100141}	100141	I-10	243.0	W Avra Valley Rd	243.3	244.9	W Twin Peaks Rd	24,841	23,897	48,738	Derivation Code = 3 | MS2 TDMS; Reference = {68_100141} | Previous AADT = 82202	9	52	2,412	7,858	21%	74,293
{68_102321}	102321	I-10	244.9	W Twin Peaks Rd	246.1	246.7	N Cortaro Rd	43,726	56,965	100,691	Derivation Code = 3 | MS2 TDMS; Reference = {68_102321} | Previous AADT = 96171	7	66	3,725	7,954	12%	139,188
{68_100142}	100142	I-10	246.7	N Cortaro Rd	248.0	248.7	W Ina Rd	57,301	47,274	104,575	Derivation Code = 3 | MS2 TDMS; Reference = {68_100142} | Previous AADT = 99881	7	51	3,298	10,429	13%	159,408
{68_100143}	100143	I-10	248.7	W Ina Rd	249.5	250.1	W Orange Grove Rd	61,307	58,521	119,828	Derivation Code = 3 | MS2 TDMS; Reference = {68_100143} | Previous AADT = 114449	7	70	3,714	12,462	13%	182,658
{68_100144}	100144	I-10	250.1	W Orange Grove Rd	250.6	251.2	W Sunset Rd	69,082	63,491	132,573	Derivation Code = 3 | MS2 TDMS; Reference = {68_100144} | Previous AADT = 126622	7	61	4,507	13,125	13%	202,086
{68_100145}	100145	I-10	251.2	W Sunset Rd	251.9	252.4	W El Camino Del Cerro	69,578	67,518	137,096	Derivation Code = 3 | MS2 TDMS; Reference = {68_100145} | Previous AADT = 130942	8	63	5,347	12,063	13%	189,511
{68_100146}	100146	I-10	252.4	W El Camino Del Cerro	253.2	254.3	W Prince Rd	65,727	51,584	117,311	Derivation Code = 1 | MS2 TDMS; Reference = {68_100146} | Previous AADT = 116081	8	65	5,516	12,434	15%	162,162
{68_100147}	100147	I-10	254.3	W Prince Rd	255.0	255.3	SR-77	83,525	98,367	181,892	Derivation Code = 3 | MS2 TDMS; Reference = {68_100147} | Previous AADT = 173727	8	54	8,912	9,821	10%	277,265
{68_100148}	100148	I-10	255.3	SR-77	256.0	256.2	W Grant Rd	90,869	101,776	192,645	Derivation Code = 3 | MS2 TDMS; Reference = {68_100148} | Previous AADT = 183997	8	58	9,933	9,933	10%	293,656
{68_100149}	100149	I-10	256.2	W Grant Rd	256.7	257.3	W Speedway Blvd	98,649	94,190	192,839	Derivation Code = 3 | MS2 TDMS; Reference = {68_100149} | Previous AADT = 184182	9	52	10,605	8,291	10%	293,952
{68_100150}	100150	I-10	257.3	W Speedway Blvd	257.5	257.8	W Saint Marys Rd	99,206	95,862	195,068	Derivation Code = 3 | MS2 TDMS; Reference = {68_100150} | Previous AADT = 186311	6	65	10,727	7,802	9%	297,350
{68_100151}	100151	I-10	257.8	W Saint Marys Rd	258.0	258.4	W Congress St	99,769	95,619	195,388	Derivation Code = 3 | MS2 TDMS; Reference = {68_100151} | Previous AADT = 186617	8	54	10,941	7,723	10%	297,837
{68_100152}	100152	I-10	258.4	W Congress St	259.0	259.3	W 22nd St	108,398	100,871	209,269	Derivation Code = 3 | MS2 TDMS; Reference = {68_100152} | Previous AADT = 199875	8	54	10,330	7,800	9%	318,997
{68_100153}	100153	I-10	259.3	W 22nd St	260.0	260.4	I-19 Exit 101 A-Ramp	91,572	92,815	184,387	Derivation Code = 3 | MS2 TDMS; Reference = {68_100153} | Previous AADT = 176110	8	51	7,519	7,153	8%	281,068
{68_100154}	100154	I-10	260.4	I-19 Exit 101 A-Ramp	260.5	260.8	I-10 Exit 261 A-Ramp	70,560	58,681	129,241	Derivation Code = 3 | MS2 TDMS; Reference = {68_100154} | Previous AADT = 123439	7	51	4,733	6,701	9%	197,007
{68_100155}	100155	I-10	260.8	I-10 Exit 261 A-Ramp	261.0	261.3	I-10 Exit 261 A1-Ramp	59,521	56,547	116,068	Derivation Code = 3 | MS2 TDMS; Reference = {68_100155} | Previous AADT = 110858	8	59	4,873	6,498	10%	176,927
{68_100156}	100156	I-10	261.3	I-10 Exit 261 A1-Ramp	261.4	261.6	I-10 Exit 261 G-Ramp	59,457	56,611	116,068	Derivation Code = 3 | MS2 TDMS; Reference = {68_100156} | Previous AADT = 110858	8	59	5,473	6,035	10%	176,927
{68_100157}	100157	I-10	261.6	I-10 Exit 261 G-Ramp	261.8	261.9	I-10 Exit 262 G-Ramp	54,389	54,100	108,489	Derivation Code = 3 | MS2 TDMS; Reference = {68_100157} | Previous AADT = 103619	8	58	5,423	6,834	11%	165,374
{68_100158}	100158	I-10	261.9	I-10 Exit 262 G-Ramp	262.0	262.3	I-10 Exit 263 A-Ramp	55,585	56,565	112,150	Derivation Code = 3 | MS2 TDMS; Reference = {68_100158} | Previous AADT = 107116	7	59	5,718	7,625	12%	170,955
{68_100159}	100159	I-10	262.3	I-10 Exit 263 A-Ramp	262.6	262.8	I-10 Exit 263 G-Ramp	52,223	50,378	102,601	Derivation Code = 3 | MS2 TDMS; Reference = {68_100159} | Previous AADT = 97995	8	51	5,132	9,159	14%	156,399
{68_100160}	100160	I-10	262.8	I-10 Exit 263 G-Ramp	263.2	264.3	E Irvington Rd	33,951	39,551	73,502	Derivation Code = 1 | MS2 TDMS; Reference = {68_100160} | Previous AADT = 74761	9	53	4,228	10,383	20%	112,042
{68_100161}	100161	I-10	264.3	E Irvington Rd	264.5	264.5	I-10 Exit 264 B-Ramp	44,035	37,473	81,508	Derivation Code = 3 | MS2 TDMS; Reference = {68_100161} | Previous AADT = 77849	8	53	2,526	9,372	15%	115,503
{68_100162}	100162	I-10	264.6	I-10 Exit 264 B-Ramp	264.8	265.1	S Alvernon Way	36,608	32,189	68,797	Derivation Code = 3 | MS2 TDMS; Reference = {68_100162} | Previous AADT = 65709	9	63	3,394	10,655	20%	95,100
{68_100163}	100163	I-10	265.1	S Alvernon Way	266.4	267.1	E Valencia Rd	36,109	44,194	80,303	Derivation Code = 3 | MS2 TDMS; Reference = {68_100163} | Previous AADT = 76698	8	53	9,143	23,828	41%	122,409
{68_100164}	100164	I-10	267.1	E Valencia Rd	267.6	268.1	S Craycroft Rd	35,999	41,652	77,651	Derivation Code = 3 | MS2 TDMS; Reference = {68_100164} | Previous AADT = 74165	7	54	2,368	9,092	15%	118,366
{68_100165}	100165	I-10	268.1	S Craycroft Rd	268.7	269.4	S Wilmot Rd	36,289	34,923	71,212	Derivation Code = 3 | MS2 TDMS; Reference = {68_100165} | Previous AADT = 68015	7	55	2,363	6,808	13%	108,551
{68_100166}	100166	I-10	269.4	S Wilmot Rd	269.9	270.6	S Kolb Rd	29,667	29,434	59,101	Derivation Code = 1 | MS2 TDMS; Reference = {68_100166} | Previous AADT = 56895	9	51	2,363	6,808	16%	90,090
{68_100167}	100167	I-10	270.6	S Kolb Rd	272.0	273.1	S Rita Rd	30,447	30,771	61,218	Derivation Code = 1 | MS2 TDMS; Reference = {68_100167} | Previous AADT = 59047	9	53	2,513	9,646	20%	86,751
{68_100168}	100168	I-10	273.1	S Rita Rd	274.0	275.5	S Houghton Rd	26,005	20,137	46,142	Derivation Code = 3 | MS2 TDMS; Reference = {68_100168} | Previous AADT = 44071	8	57	2,301	6,753	20%	70,336
{68_100169}	100169	I-10	275.5	S Houghton Rd	276.1	279.4	S Wentworth Rd	23,320	21,114	44,434	Derivation Code = 1 | MS2 TDMS; Reference = {68_100169} | Previous AADT = 44583	9	54	1,940	8,678	24%	61,422
{68_100170}	100170	I-10	279.4	S Wentworth Rd	281.0	281.7	SR-83	20,061	20,169	40,230	Derivation Code = 3 | MS2 TDMS; Reference = {68_100170} | Previous AADT = 38424	7	52	1,533	8,027	24%	57,009
{68_100171}	100171	I-10	281.7	SR-83	285.5	291.0	E Marsh Station Rd	15,649	14,654	30,303	Derivation Code = 3 | MS2 TDMS; Reference = {68_100171} | Previous AADT = 28943	7	52	1,432	8,544	33%	45,151
{68_100172}	100172	I-10	291.0	E Marsh Station Rd	291.7	292.5	S Bell Rd	17,412	16,930	34,342	Derivation Code = 1 | MS2 TDMS; Reference = {68_100172} | Previous AADT = 33147	9	50	1,937	8,159	29%	48,665
{68_100173}	100173	I-10	292.5	S Bell Rd	296.0	297.2	S J Six Ranch Rd	18,553	16,433	34,986	Derivation Code = 3 | MS2 TDMS; Reference = {68_100173} | Previous AADT = 33415	8	64	1,763	5,933	22%	49,578
{68_100174}	100174	I-10	297.2	S J Six Ranch Rd	298.2	299.3	W Skyline Rd (A)	17,455	17,224	34,679	Derivation Code = 3 | MS2 TDMS; Reference = {68_100174} | Previous AADT = 33122	7	52	1,733	5,755	22%	60,878
{68_100175}	100175	I-10	299.4	W Skyline Rd (A)	300.1	302.4	SR-90	17,202	11,447	28,649	Derivation Code = 3 | MS2 TDMS; Reference = {68_100175} | Previous AADT = 27363	8	54	1,397	5,314	23%	50,292
{68_100176}	100176	I-10	302.4	SR-90	303.3	303.9	I-10 Exit 303 J-Ramp	16,432	15,415	31,847	Derivation Code = 3 | MS2 TDMS; Reference = {68_100176} | Previous AADT = 30417	7	53	1,335	6,003	23%	62,601
{68_100177}	100177	I-10	303.9	I-10 Exit 303 J-Ramp	304.5	304.9	N Ocotillo St	11,843	8,142	19,985	Derivation Code = 3 | MS2 TDMS; Reference = {68_100177} | Previous AADT = 19088	7	55	866	6,018	34%	39,284
{68_100178}	100178	I-10	304.8	N Ocotillo St	305.3	307.0	SR-10B nonCard	8,375	7,680	16,055	Derivation Code = 3 | MS2 TDMS; Reference = {68_100178} | Previous AADT = 15334	7	50	990	5,982	43%	31,559
{68_100179}	100179	I-10	306.7	SR-10B nonCard	312.0	312.8	N Sibyl Rd	11,095	10,026	21,121	Derivation Code = 3 | MS2 TDMS; Reference = {68_100179} | Previous AADT = 20173	7	50	945	6,076	33%	37,077
{68_100180}	100180	I-10	312.8	N Sibyl Rd	313.4	319.0	E Dragoon Rd	11,079	10,633	21,712	Derivation Code = 1 | MS2 TDMS; Reference = {68_100180} | Previous AADT = 21828	9	54	765	7,441	38%	38,115
{68_100181}	100181	I-10	319.0	E Dragoon Rd	322.0	322.6	N Johnson Rd	8,637	11,073	19,710	Derivation Code = 3 | MS2 TDMS; Reference = {68_100181} | Previous AADT = 18825	9	65	886	6,976	40%	34,600

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100182}	100182	I-10	322.6	N Johnson Rd	330.0	331.6	US-191 nonCard	10,741	9,467	20,208	Derivation Code = 3 | MS2 TDMS; Reference = {68_100182} | Previous AADT = 19301	7	52	859	6,614	37%	35,474
{68_100183}	100183	I-10	331.6	US-191 nonCard	336.0	336.9	SR-10B nonCard	10,721	9,519	20,240	Derivation Code = 1 | MS2 TDMS; Reference = {68_100183} | Previous AADT = 21270	9	56	1,113	8,320	47%	35,531
{68_100184}	100184	I-10	336.9	SR-10B nonCard	338.7	340.5	SR-186	10,059	8,807	18,866	Derivation Code = 1 | MS2 TDMS; Reference = {68_100184} | Previous AADT = 18257	7	55	726	6,441	38%	33,119
{68_100185}	100185	I-10	340.5	SR-186	342.5	344.5	SR-10B nonCard	8,856	9,923	18,779	Derivation Code = 3 | MS2 TDMS; Reference = {68_100185} | Previous AADT = 17936	7	51	536	6,141	36%	30,962
{68_100186}	100186	I-10	344.5	SR-10B nonCard	345.6	352.4	US-191	8,965	11,083	20,048	Derivation Code = 3 | MS2 TDMS; Reference = {68_100186} | Previous AADT = 19148	7	52	514	6,229	34%	35,194
{68_100187}	100187	I-10	352.4	Exit 352 US 191 North	353.0	356.0	Exit 355 US 191 (1) - Luzena	8,914	7,706	16,620	Derivation Code = 3 | MS2 TDMS; Reference = {68_100187} | Previous AADT = 15874	7	56	462	6,646	43%	29,176
{68_100188}	100188	I-10	356.0	Exit 355 US 191 (1) - Luzena	359.5	362.9	Exit 362 SB 10 (5) - West end of Bowie	10,045	8,485	18,530	Derivation Code = 1 | MS2 TDMS; Reference = {68_100188} | Previous AADT = 16802	8	53	199	4,785	27%	32,529
{68_100189}	100189	I-10	362.9	Exit 362 SB 10 (5) - West end of Bowie	365.8	366.8	Exit 366 SB 10 (5) - East end of Bowie	8,657	7,310	15,967	Derivation Code = 3 | MS2 TDMS; Reference = {68_100189} | Previous AADT = 15250	7	54	568	5,652	39%	28,029
{68_100190}	100190	I-10	366.8	Exit 366 SB 10 (5) - East end of Bowie	372.0	379.0	Exit 378 SB 10 (5) - West end of San Simon	8,746	7,949	16,695	Derivation Code = 3 | MS2 TDMS; Reference = {68_100190} | Previous AADT = 15946	7	52	621	6,676	44%	29,307
{68_100191}	100191	I-10	378.9	Exit 378 SB 10 (5) - West end of San Simon	381.4	382.3	Exit 382 SB 10 (5)	5,416	5,761	11,177	Derivation Code = 3 | MS2 TDMS; Reference = {68_100191} | Previous AADT = 10675	9	54	493	5,184	51%	19,621
{68_100192}	100192	I-10	382.3	Exit 382 SB 10 (5)	385.8	390.7	N Cavot Rd	6,818	8,919	15,737	Applied Growth Factor = 0.047 to Previous Year | Previous AADT = 15031	7	54	706	6,042	43%	27,626
{68_100193}	100193	I-10	390.7	N Cavot Rd	391.1	391.1	Interstate 10 EB	9,329	8,089	17,418	Derivation Code = 12 | MS2 TDMS; Reference = {68_100193} | Previous AADT = 15480	8	53	789	7,062	45%	30,577
{68_100325}	100325	I-15	0.0	Nevada State Line - Mesquite	1.0	8.6	N Highway 91	14,666	15,496	30,162	Derivation Code = 1 | MS2 TDMS; Reference = {68_100325} | Previous AADT = 31738	9	52	1,457	5,866	24%	46,658
{68_102332}	102332	I-15	8.6	N Highway 91	9.0	10.1	Exit 9 Desert Springs	17,105	14,906	32,011	Derivation Code = 3 | MS2 TDMS; Reference = {68_102332} | Previous AADT = 32832	7	56	1,331	5,868	22%	49,518
{68_100326}	100326	I-15	10.1	Exit 9 Desert Springs	11.0	18.3	Exit 18 Cedar Pocket	16,394	14,734	31,128	Derivation Code = 3 | MS2 TDMS; Reference = {68_100326} | Previous AADT = 31926	7	50	862	6,139	22%	51,814
{68_100327}	100327	I-15	18.3	Exit 18 Cedar Pocket	27.0	27.5	Exit 27 Black Rock	16,277	15,110	31,387	Derivation Code = 3 | MS2 TDMS; Reference = {68_100327} | Previous AADT = 32192	8	54	896	5,989	22%	48,553
{68_100328}	100328	I-15	27.4	Exit 27 Black Rock	27.8	29.4	Utah State Line	13,129	15,645	28,774	Derivation Code = 3 | MS2 TDMS; Reference = {68_100328} | Previous AADT = 29512	10	61	894	5,982	24%	44,511
{68_100333}	100333	I-17	193.5	I-10	194.1	194.4	16th St	51,067	57,197	108,264	Derivation Code = 1 | MS2 TDMS; Reference = {68_100333} | Previous AADT = 91551	8	50	4,308	6,629	10%	170,411
{68_100334}	100334	I-17	194.6	16th St	195.2	195.6	7th St	66,278	66,260	132,538	Derivation Code = 1 | MS2 TDMS; Reference = {68_100334} | Previous AADT = 117057	8	51	5,287	8,134	10%	208,619
{68_100335}	100335	I-17	195.9	7th St	196.2	196.9	7th Ave	61,974	50,592	112,566	Derivation Code = 1 | MS2 TDMS; Reference = {68_100335} | Previous AADT = 100493	8	57	5,122	7,882	12%	177,183
{68_100336}	100336	I-17	196.9	7th Ave	197.1	198.0	19th Ave	71,371	55,849	127,220	Derivation Code = 12 | MS2 TDMS; Reference = {68_100336} | Previous AADT = 95313	9	59	5,071	7,804	10%	200,249
{68_100337}	100337	I-17	198.0	19th Ave	198.4	199.2	Grant St	63,338	69,299	132,637	Derivation Code = 3 | MS2 TDMS; Reference = {68_100337} | Previous AADT = 126081	5	54	4,539	6,986	9%	208,775
{68_100338}*2	100338	I-17	199.2	Grant St	199.3	199.7	Adams St	47,485	67,783	115,268	Derivation Code = 1 | MS2 TDMS; Reference = {68_100338}*2 | Previous AADT = 112314	8	59	4,740	7,304	10%	181,436
{68_100339}	100339	I-17	199.7	Adams St	199.9	200.6	I-10 nonCard	61,656	44,908	106,564	Derivation Code = 7 | MS2 TDMS; Reference = {68_100339} | Previous AADT = 96444	7	66	4,343	6,684	10%	167,735
{68_100340}*2	100340	I-17	200.6	I-10	200.8	200.9	McDowell Rd	30,284	45,264	75,548	Derivation Code = 1 | MS2 TDMS; Reference = {68_100340}*2 | Previous AADT = 71860	8	65	4,009	2,498	9%	118,915
{68_100341}	100341	I-17	200.9	McDowell Rd	201.5	201.9	Thomas Rd	62,292	103,386	165,678	Derivation Code = 12 | MS2 TDMS; Reference = {68_100341} | Previous AADT = 204493	7	61	6,111	4,847	7%	260,783
{68_100342}	100342	I-17	201.9	Thomas Rd	202.3	202.9	Indian School Rd	104,731	114,747	219,478	Derivation Code = 1 | MS2 TDMS; Reference = {68_100342} | Previous AADT = 216465	7	51	6,351	7,655	6%	345,466
{68_100343}	100343	I-17	202.9	Indian School Rd	203.3	203.9	Camelback Rd	106,632	113,953	220,585	Derivation Code = 1 | MS2 TDMS; Reference = {68_100343} | Previous AADT = 220005	7	51	4,992	6,015	5%	347,208
{68_100344}	100344	I-17	203.9	Camelback Rd	204.3	204.9	Bethany Home Rd	104,919	113,163	218,082	Derivation Code = 1 | MS2 TDMS; Reference = {68_100344} | Previous AADT = 210319	7	51	6,573	7,922	7%	343,269
{68_100345}	100345	I-17	204.9	Bethany Home Rd	205.4	205.9	Glendale Ave	104,134	108,177	212,311	Derivation Code = 1 | MS2 TDMS; Reference = {68_100345} | Previous AADT = 213867	7	51	5,607	8,628	7%	334,185
{68_100346}	100346	I-17	205.9	Glendale Ave	206.3	206.9	Northern Ave	105,203	108,322	213,525	Derivation Code = 1 | MS2 TDMS; Reference = {68_100346} | Previous AADT = 205186	7	50	4,715	5,685	5%	336,096
{68_100347}	100347	I-17	206.9	Northern Ave	207.5	208.0	Dunlap Ave	100,691	105,305	205,996	Derivation Code = 12 | MS2 TDMS; Reference = {68_100347} | Previous AADT = 201730	8	52	5,970	9,182	7%	324,245
{68_100348}	100348	I-17	208.0	Dunlap Ave	208.4	209.0	Peoria Ave	99,759	105,804	205,563	Derivation Code = 1 | MS2 TDMS; Reference = {68_100348} | Previous AADT = 183216	7	50	6,235	9,596	8%	323,563
{68_100349}	100349	I-17	209.0	Peoria Ave	209.3	210.0	Cactus Rd	99,348	84,866	184,214	Derivation Code = 1 | MS2 TDMS; Reference = {68_100349} | Previous AADT = 217740	8	58	6,183	6,304	7%	289,959
{68_100350}	100350	I-17	210.0	Cactus Rd	210.5	211.0	Thunderbird Rd	123,671	54,531	178,202	Derivation Code = 12 | MS2 TDMS; Reference = {68_100350} | Previous AADT = 215932	5	55	6,587	6,690	7%	280,496
{68_100351}	100351	I-17	210.9	Thunderbird Rd	211.0	211.9	Greenway Rd	150,110	68,042	218,152	Derivation Code = 3 | MS2 TDMS; Reference = {68_100351} | Previous AADT = 207369	4	69	6,980	6,762	6%	343,379
{68_100352}	100352	I-17	211.9	Greenway Rd	212.6	213.0	Bell Rd	92,378	76,694	169,072	Derivation Code = 12 | MS2 TDMS; Reference = {68_100352} | Previous AADT = 178274	5	51	6,803	6,803	8%	232,072
{68_100353}	100353	I-17	213.0	Bell Rd	213.6	214.0	Union Hills Dr	78,061	74,146	152,207	Derivation Code = 1 | MS2 TDMS; Reference = {68_100353} | Previous AADT = 143312	8	52	6,770	7,410	9%	239,579
{68_100354}	100354	I-17	214.0	Union Hills Dr	214.2	214.5	Yorkshire Dr	91,379	83,226	174,605	Derivation Code = 3 | MS2 TDMS; Reference = {68_100354} | Previous AADT = 165974	7	51	6,284	7,158	8%	274,834
{68_100355}	100355	I-17	214.5	Yorkshire Dr	214.8	214.9	SR-101	44,419	85,021	129,440	Applied Growth Factor = 0.052 to Previous Year | Previous AADT = 123042	7	74	5,731	7,089	10%	203,743
{68_100356}	100356	I-17	214.9	SR-101	215.2	215.5	Rose Garden Ln	56,395	34,639	91,034	Derivation Code = 12 | MS2 TDMS; Reference = {68_100356} | Previous AADT = 88073	8	61	3,334	4,447	9%	143,291
{68_100357}	100357	I-17	215.5	Rose Garden Ln	215.7	216.0	Deer Valley Rd	54,606	83,242	137,848	Derivation Code = 3 | MS2 TDMS; Reference = {68_100357} | Previous AADT = 131034	7	60	5,512	7,445	9%	216,978
{68_100358}	100358	I-17	216.0	Deer Valley Rd	217.0	217.1	Pinnacle Peak Rd	60,219	57,120	117,339	Derivation Code = 1 | MS2 TDMS; Reference = {68_100358} | Previous AADT = 156060	9	56	6,402	9,194	13%	184,696
{68_100359}	100359	I-17	217.1	Pinnacle Peak Rd	217.5	218.0	Happy Valley Rd	58,963	65,841	124,804	Derivation Code = 12 | MS2 TDMS; Reference = {68_100359} | Previous AADT = 130937	7	57	7,069	5,451	10%	196,446
{68_100392}	100392	I-17	218.0	Happy Valley Rd	218.5	218.9	Jomax Rd	64,074	65,880	129,954	Derivation Code = 1 | MS2 TDMS; Reference = {68_100392} | Previous AADT = 122506	9	51	7,069	5,451	10%	204,552
{68_100393}	100393	I-17	218.9	Jomax Rd	220.0	220.9	Black Canyon Hwy (A)	59,024	61,588	120,612	Derivation Code = 12 | MS2 TDMS; Reference = {68_100393} | Previous AADT = 113538	8	55	4,342	3,367	6%	189,847
{68_100394}	100394	I-17	220.9	Black Canyon Hwy (A)	221.1	222.0	SR-303	58,956	60,114	119,070	Derivation Code = 1 | MS2 TDMS; Reference = {68_100394} | Previous AADT = 112899	9	50	4,342	3,367	6%	187,420
{68_100395}	100395	I-17	222.0	SR-303	222.5	223.0	Dove Valley Rd	44,078	57,122	101,200	Derivation Code = 1 | MS2 TDMS; Reference = {68_100395} | Previous AADT = 98108	10	59	3,851	3,993	8%	159,292
{68_100396}	100396	I-17	223.0	Dove Valley Rd	223.5	224.0	SR-74	52,917	54,923	107,840	Derivation Code = 1 | MS2 TDMS; Reference = {68_100396} | Previous AADT = 104429	9	51	6,399	8,031	13%	169,744
{68_100397}	100397	I-17	224.0	SR-74	225.0	225.5	Pioneer Rd	26,721	39,645	66,366	Derivation Code = 3 | MS2 TDMS; Reference = {68_100397} | Previous AADT = 63086	8	57	6,399	8,031	22%	104,462
{68_100398}	100398	I-17	225.5	Pioneer Rd	226.5	227.0	Daisy Mountain Dr	40,493	41,943	82,436	Derivation Code = 3 | MS2 TDMS; Reference = {68_100398} | Previous AADT = 78361	8	53	4,312	4,505	11%	139,111

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100399}	100399	I-17	227.0	Daisy Mountain Dr	228.0	229.1	Anthem Way	33,159	33,065	66,224	Derivation Code = 1 | MS2 TDMS; Reference = {68_100399} | Previous AADT = 67404	9	51	2,870	5,209	12%	111,753
{68_100400}	100400	I-17	229.1	Anthem Way	230.0	232.0	New River Rd	25,046	25,066	50,112	Derivation Code = 1 | MS2 TDMS; Reference = {68_100400} | Previous AADT = 51052	10	57	2,296	4,128	13%	78,878
{68_100365}	100365	I-17	232.0	New River Rd	232.5	236.0	Table Mesa Rd	23,283	23,945	47,228	Derivation Code = 1 | MS2 TDMS; Reference = {68_100365} | Previous AADT = 48251	10	62	2,202	4,745	15%	79,697
{68_100366}	100366	I-17	236.0	Table Mesa Rd	239.0	242.1	S Old Black Canyon Hwy (A)	22,596	23,076	45,672	Derivation Code = 3 | MS2 TDMS; Reference = {68_100366} | Previous AADT = 43958	7	53	1,974	4,483	14%	71,756
{68_100367}	100367	I-17	242.1	S Old Black Canyon Hwy (A)	243.2	244.4	S Old Black Canyon Hwy	20,965	21,429	42,394	Derivation Code = 3 | MS2 TDMS; Reference = {68_100367} | Previous AADT = 43660	6	57	1,723	3,776	13%	68,409
{68_100368}	100368	I-17	244.5	S Old Black Canyon Hwy	246.0	248.3	Bumble Bee Rd	19,262	17,557	36,819	Derivation Code = 3 | MS2 TDMS; Reference = {68_100368} | Previous AADT = 37919	7	56	1,508	3,165	13%	59,413
{68_100369}	100369	I-17	248.4	Bumble Bee Rd	251.0	252.5	Sunset Path	20,675	18,887	39,562	Derivation Code = 3 | MS2 TDMS; Reference = {68_100369} | Previous AADT = 40744	7	60	1,622	3,520	13%	63,839
{68_100370}	100370	I-17	252.6	Sunset Path	254.6	256.0	Badger Springs Rd	19,166	20,066	39,232	Derivation Code = 3 | MS2 TDMS; Reference = {68_100370} | Previous AADT = 40404	8	53	1,471	3,395	12%	63,307
{68_100371}	100371	I-17	256.0	Badger Springs Rd	257.9	259.4	E Bloody Basin Rd W	18,800	18,904	37,704	Derivation Code = 3 | MS2 TDMS; Reference = {68_100371} | Previous AADT = 38830	7	56	2,375	4,297	18%	60,841
{68_100372}	100372	I-17	259.4	E Bloody Basin Rd W	262.0	262.1	SR-69	14,818	18,817	33,635	Derivation Code = 3 | MS2 TDMS; Reference = {68_100372} | Previous AADT = 34640	8	54	1,842	3,722	17%	54,275
{68_102331}	102331	I-17	262.1	SR-69	262.7	263.2	I-17 Exit 263 G-Ramp	12,650	11,112	23,762	Derivation Code = 3 | MS2 TDMS; Reference = {68_102331} | Previous AADT = 24472	9	66	1,139	3,136	18%	38,344
{68_100373}	100373	I-17	263.3	I-17 Exit 263 G-Ramp	267.9	268.8	S Orme Rd	14,563	14,711	29,274	Derivation Code = 1 | MS2 TDMS; Reference = {68_100373} | Previous AADT = 30041	12	59	825	2,052	10%	46,271
{68_100374}	100374	I-17	268.8	S Orme Rd	269.4	278.4	SR-169	13,654	13,902	27,556	Derivation Code = 3 | MS2 TDMS; Reference = {68_100374} | Previous AADT = 28379	7	56	1,495	3,551	18%	44,466
{68_100375}	100375	I-17	278.4	SR-169	279.2	285.5	General Crook Trl	17,630	17,413	35,043	Derivation Code = 1 | MS2 TDMS; Reference = {68_100375} | Previous AADT = 35806	11	57	1,971	3,848	17%	56,547
{68_100376}	100376	I-17	285.5	General Crook Trl	286.2	287.3	SR-260	14,682	19,022	33,704	Derivation Code = 3 | MS2 TDMS; Reference = {68_100376} | Previous AADT = 34711	7	58	1,853	3,437	16%	57,894
{68_100377}	100377	I-17	287.3	SR-260	289.1	290.0	W Middle Verde Rd	16,397	17,445	33,842	Derivation Code = 3 | MS2 TDMS; Reference = {68_100377} | Previous AADT = 34853	7	51	1,725	2,817	13%	46,702
{68_100378}	100378	I-17	290.0	W Middle Verde Rd	290.7	293.3	E Cornville Rd	16,653	17,135	33,788	Derivation Code = 3 | MS2 TDMS; Reference = {68_100378} | Previous AADT = 34797	7	56	1,338	1,766	9%	54,522
{68_100379}	100379	I-17	293.3	E Cornville Rd	294.6	299.0	SR-179	11,941	14,865	26,806	Derivation Code = 3 | MS2 TDMS; Reference = {68_100379} | Previous AADT = 27607	11	61	372	1,410	7%	43,256
{68_100380}	100380	I-17	299.0	SR-179	303.2	306.3	Unidrd Sedona	11,383	11,233	22,616	Derivation Code = 1 | MS2 TDMS; Reference = {68_100380} | Previous AADT = 23521	12	52	743	1,862	12%	35,747
{68_100381}	100381	I-17	306.3	Unidrd Sedona	306.6	315.6	Rock Park Rd	11,033	12,408	23,441	Derivation Code = 3 | MS2 TDMS; Reference = {68_100381} | Previous AADT = 24141	8	51	481	2,409	12%	37,826
{68_100382}	100382	I-17	315.6	Rock Park Rd	316.1	317.9	Fox Ranch Rd	11,754	11,735	23,489	Derivation Code = 3 | MS2 TDMS; Reference = {68_100382} | Previous AADT = 24191	7	58	924	2,966	17%	35,893
{68_100383}	100383	I-17	317.9	Fox Ranch Rd	319.4	320.5	Schnebly Hill Rd	11,228	11,175	22,403	Derivation Code = 3 | MS2 TDMS; Reference = {68_100383} | Previous AADT = 23072	8	59	956	2,775	17%	34,233
{68_100384}	100384	I-17	320.5	Schnebly Hill Rd	321.0	322.7	S Munds Ranch Rd	11,279	13,030	24,309	Derivation Code = 3 | MS2 TDMS; Reference = {68_100384} | Previous AADT = 25035	7	60	1,012	3,112	17%	39,476
{68_100385}	100385	I-17	322.7	S Munds Ranch Rd	323.1	326.2	Willard Springs Rd	10,766	13,776	24,542	Derivation Code = 3 | MS2 TDMS; Reference = {68_100385} | Previous AADT = 25275	7	60	932	2,797	15%	37,502
{68_100386}	100386	I-17	326.2	Willard Springs Rd	327.5	328.8	FS 772 Rd	11,551	13,291	24,842	Derivation Code = 3 | MS2 TDMS; Reference = {68_100386} | Previous AADT = 25584	7	50	1,135	3,001	17%	37,960
{68_100387}	100387	I-17	328.8	FS 772 Rd	329.6	331.1	Kelly Canyon Rd	11,507	13,286	24,793	Derivation Code = 3 | MS2 TDMS; Reference = {68_100387} | Previous AADT = 25533	7	58	569	3,575	17%	37,886
{68_100388}	100388	I-17	331.1	Kelly Canyon Rd	332.2	333.9	Kachina Village Unde	11,811	10,157	21,968	Derivation Code = 3 | MS2 TDMS; Reference = {68_100388} | Previous AADT = 22624	8	52	646	4,059	21%	33,569
{68_100389}	100389	I-17	333.9	Kachina Village Unde	335.6	337.4	SR-89A	14,828	16,726	31,554	Derivation Code = 3 | MS2 TDMS; Reference = {68_100389} | Previous AADT = 32496	7	59	1,816	3,214	16%	46,842
{68_100390}	100390	I-17	337.3	SR-89A	338.6	339.7	S Lake Mary Rd	17,736	17,329	35,065	Derivation Code = 1 | MS2 TDMS; Reference = {68_100390} | Previous AADT = 36116	10	52	1,907	3,449	15%	60,297
{68_100391}	100391	I-17	339.7	S Lake Mary Rd	339.7	339.9	I-40	19,287	21,044	40,331	Derivation Code = 3 | MS2 TDMS; Reference = {68_100391} | Previous AADT = 41536	7	54	1,411	3,023	11%	69,353
{68_100401}	100401	I-17	339.9	I-40	340.1	340.2	I-17 nonCard	19,037	13,560	32,597	Derivation Code = 3 | MS2 TDMS; Reference = {68_100401} | Previous AADT = 33571	8	54	1,597	2,574	13%	56,053
{68_100451}	100451	I-19	0.0	N Grand Ave	0.6	1.2	N Western Ave	6,060	5,486	11,546	Derivation Code = 3 | MS2 TDMS; Reference = {68_100451} | Previous AADT = 11028	7	52	838	86	8%	13,469
{68_100452}	100452	I-19	1.2	N Western Ave	2.0	2.9	SR-189	7,479	5,679	13,158	Derivation Code = 3 | MS2 TDMS; Reference = {68_100452} | Previous AADT = 12567	8	51	746	542	10%	19,699
{68_100453}	100453	I-19	3.0	SR-189	4.0	5.3	I-19 Exit 8 C-Ramp	12,525	12,274	24,799	Derivation Code = 3 | MS2 TDMS; Reference = {68_100453} | Previous AADT = 23686	8	59	1,391	2,602	16%	37,127
{68_100454}	100454	I-19	5.3	I-19 Exit 8 C-Ramp	6.5	7.7	SR-289	19,885	19,421	39,306	Derivation Code = 3 | MS2 TDMS; Reference = {68_100454} | Previous AADT = 37542	7	57	982	2,533	9%	66,609
{68_100455}	100455	I-19	7.7	SR-289	8.3	10.9	Rio Rico Dr	14,937	15,968	30,905	Derivation Code = 1 | MS2 TDMS; Reference = {68_100455} | Previous AADT = 27816	9	55	2,584	2,429	16%	45,320
{68_100456}	100456	I-19	10.9	Rio Rico Dr	12.4	13.9	Peck Canyon Dr	10,790	9,656	20,446	Derivation Code = 3 | MS2 TDMS; Reference = {68_100456} | Previous AADT = 19528	8	50	729	2,080	14%	34,648
{68_100457}	100457	I-19	13.9	Peck Canyon Dr	14.8	15.6	Palo Parado Rd	11,312	10,672	21,984	Derivation Code = 3 | MS2 TDMS; Reference = {68_100457} | Previous AADT = 20997	7	54	741	2,074	13%	37,254
{68_100458}	100458	I-19	15.6	Palo Parado Rd	17.0	18.2	Tumacacori Overpass	10,652	9,905	20,557	Derivation Code = 3 | MS2 TDMS; Reference = {68_100458} | Previous AADT = 19634	7	55	663	1,949	13%	34,836
{68_100459}	100459	I-19	18.1	Tumacacori Overpass	21.0	21.6	Exit 34 Tubac Rd	10,271	9,196	19,467	Derivation Code = 3 | MS2 TDMS; Reference = {68_100459} | Previous AADT = 18593	7	54	589	2,280	15%	32,989
{68_100460}	100460	I-19	21.6	Exit 34 Tubac Rd	22.3	24.8	Exit 40 Chavez Siding Rd	10,813	10,032	20,845	Derivation Code = 3 | MS2 TDMS; Reference = {68_100460} | Previous AADT = 19909	8	52	564	2,190	13%	30,642
{68_100461}	100461	I-19	24.8	Chavez Siding Access	25.7	26.5	Agua Linda Rd	11,111	11,116	22,227	Derivation Code = 3 | MS2 TDMS; Reference = {68_100461} | Previous AADT = 21229	8	53	687	2,665	15%	37,666
{68_100462}	100462	I-19	26.5	Agua Linda Rd	29.4	30.0	County Line Rd	9,455	12,839	22,294	Derivation Code = 3 | MS2 TDMS; Reference = {68_100462} | Previous AADT = 21293	12	52	972	2,468	15%	37,780
{68_100463}	100463	I-19	30.0	County Line Rd	33.9	34.9	W Canoa Ranch Dr	11,468	10,975	22,443	Derivation Code = 3 | MS2 TDMS; Reference = {68_100463} | Previous AADT = 21436	10	53	925	2,228	14%	33,440
{68_100464}	100464	I-19	34.9	W Canoa Ranch Dr	39.1	39.5	E Continental Rd	13,465	13,101	26,566	Derivation Code = 3 | MS2 TDMS; Reference = {68_100464} | Previous AADT = 25373	7	52	1,273	3,050	16%	36,723
{68_100465}	100465	I-19	39.5	E Continental Rd	39.9	40.8	W Esperanza Blvd	18,108	17,853	35,961	Derivation Code = 3 | MS2 TDMS; Reference = {68_100465} | Previous AADT = 34347	8	50	1,460	3,550	14%	49,710
{68_100466}	100466	I-19	40.8	W Esperanza Blvd	41.9	43.2	SR-19B nonCard (2)	18,601	19,092	37,693	Derivation Code = 3 | MS2 TDMS; Reference = {68_100466} | Previous AADT = 36001	8	51	1,576	3,381	13%	53,414
{68_100467}	100467	I-19	43.2	SR-19B nonCard (2)	44.9	46.8	W Sahuarita Rd	22,130	21,315	43,445	Derivation Code = 3 | MS2 TDMS; Reference = {68_100467} | Previous AADT = 41495	8	55	2,671	4,676	17%	66,225
{68_100468}	100468	I-19	46.7	W Sahuarita Rd	48.2	49.7	W Pima Mine Rd	20,494	20,371	40,865	Derivation Code = 1 | MS2 TDMS; Reference = {68_100468} | Previous AADT = 43216	9	52	897	2,006	7%	56,489
{68_100469}	100469	I-19	49.6	W Pima Mine Rd	52.0	54.4	Exit 87 Papago Rd	24,398	23,917	48,315	Derivation Code = 3 | MS2 TDMS; Reference = {68_100469} | Previous AADT = 46146	7	53	897	2,006	6%	71,989
{68_100470}	100470	I-19	54.4	Exit 87 Papago Rd	55.9	56.9	Exit 92 San Xavier Rd	24,519	24,297	48,816	Derivation Code = 3 | MS2 TDMS; Reference = {68_100470} | Previous AADT = 46625	7	54	3,790	5,660	19%	69,176
{68_100471}	100471	I-19	56.9	W San Xavier Loop Rd	58.0	58.8	I-19 Exit 95 A-Ramp	28,682	26,990	55,672	Derivation Code = 3 | MS2 TDMS; Reference = {68_100471} | Previous AADT = 53173	8	59	4,148	6,480	19%	84,863

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100472}	100472	I-19	58.8	I-19 Exit 95 A-Ramp	60.0	60.9	W Irvington Rd	42,594	37,812	80,406	Derivation Code = 3 | MS2 TDMS; Reference = {68_100472} | Previous AADT = 76797	8	55	3,554	7,155	13%	111,147
{68_100473}	100473	I-19	60.9	W Irvington Rd	61.4	61.9	SR-86	53,115	46,096	99,211	Derivation Code = 3 | MS2 TDMS; Reference = {68_100473} | Previous AADT = 94757	8	57	2,891	6,944	10%	151,231
{68_100474}	100474	I-19	61.8	SR-86	62.4	62.9	I-19 Exit 101 A1-Ramp	51,610	50,941	102,551	Derivation Code = 3 | MS2 TDMS; Reference = {68_100474} | Previous AADT = 97947	9	53	3,244	7,793	11%	156,322
{68_100499}	100499	I-40	0.0	Kingman 8652 DB	0.2	0.5	S Historic Rte 66	8,970	10,674	19,644	Derivation Code = 3 | MS2 TDMS; Reference = {68_100499} | Previous AADT = 20148	6	51	997	7,230	42%	30,388
{68_100500}	100500	I-40	0.6	S Historic Rte 66	1.4	3.0	E Needle Mountain Rd	9,760	9,034	18,794	Derivation Code = 1 | MS2 TDMS; Reference = {68_100500} | Previous AADT = 19256	8	57	1,087	7,023	43%	29,073
{68_100501}	100501	I-40	3.0	E Needle Mountain Rd	9.0	9.8	SR-95	9,230	7,966	17,196	Derivation Code = 12 | MS2 TDMS; Reference = {68_100501} | Previous AADT = 16088	5	54	936	7,510	49%	26,601
{68_100502}	100502	I-40	9.8	SR-95	11.4	13.2	N Franconia Rd	9,360	8,739	18,099	Derivation Code = 3 | MS2 TDMS; Reference = {68_100502} | Previous AADT = 18563	5	54	832	6,395	40%	27,998
{68_100503}	100503	I-40	13.2	N Franconia Rd	18.0	20.1	W Santa Fe Ranch Rd	7,831	7,302	15,133	Derivation Code = 3 | MS2 TDMS; Reference = {68_100503} | Previous AADT = 15521	7	52	800	7,603	56%	23,409
{68_100504}	100504	I-40	20.1	W Santa Fe Ranch Rd	22.4	25.2	W Industry Dr	7,949	7,333	15,282	Derivation Code = 1 | MS2 TDMS; Reference = {68_100504} | Previous AADT = 15450	8	62	800	7,603	55%	25,438
{68_100505}	100505	I-40	25.2	W Industry Dr	26.0	26.2	W Proving Grounds Rd	8,140	6,558	14,698	Derivation Code = 3 | MS2 TDMS; Reference = {68_100505} | Previous AADT = 15075	6	56	622	5,870	44%	22,737
{68_100506}	100506	I-40	26.2	W Proving Grounds Rd	27.4	28.7	W Dean Dr	8,548	7,891	16,439	Derivation Code = 3 | MS2 TDMS; Reference = {68_100506} | Previous AADT = 16860	6	60	637	5,871	40%	25,430
{68_100507}	100507	I-40	28.7	W Dean Dr	32.9	37.0	W Griffith Rd	7,999	7,437	15,436	Derivation Code = 1 | MS2 TDMS; Reference = {68_100507} | Previous AADT = 15746	8	61	619	5,939	42%	23,878
{68_100508}	100508	I-40	37.0	W Griffith Rd	43.8	44.3	W Shinarump Dr	6,984	7,765	14,749	Derivation Code = 3 | MS2 TDMS; Reference = {68_100508} | Previous AADT = 15127	7	55	498	5,470	40%	22,815
{68_100509}	100509	I-40	44.3	W Shinarump Dr	47.1	48.9	US-93	8,883	8,447	17,330	Derivation Code = 1 | MS2 TDMS; Reference = {68_100509} | Previous AADT = 17565	8	55	975	7,623	50%	26,808
{68_100510}	100510	I-40	48.9	US-93	50.5	51.7	N Stockton Hill Rd	20,466	20,792	41,258	Derivation Code = 3 | MS2 TDMS; Reference = {68_100510} | Previous AADT = 42316	7	52	1,769	9,858	28%	63,823
{68_100511}	100511	I-40	51.8	N Stockton Hill Rd	52.3	53.2	SR-66	15,692	16,252	31,944	Derivation Code = 3 | MS2 TDMS; Reference = {68_100511} | Previous AADT = 32763	11	51	1,107	6,177	23%	48,395
{68_100512}	100512	I-40	53.5	SR-66	56.6	59.6	S Dw Ranch Rd	14,089	10,220	24,309	Derivation Code = 3 | MS2 TDMS; Reference = {68_100512} | Previous AADT = 24932	8	51	907	6,369	30%	39,581
{68_100513}	100513	I-40	59.7	S Dw Ranch Rd	63.0	66.5	S Blake Ranch Rd	14,446	12,751	27,197	Derivation Code = 3 | MS2 TDMS; Reference = {68_100513} | Previous AADT = 27894	8	52	878	4,900	21%	42,071
{68_100514}	100514	I-40	66.5	Exit 66 Blake Ranch Rd	69.0	72.0	Exit 71 US 93 - Round Valley	11,361	10,039	21,400	Derivation Code = 3 | MS2 TDMS; Reference = {68_100514} | Previous AADT = 21949	7	61	1,030	5,746	32%	33,104
{68_100515}	100515	I-40	72.0	US-93 nonCard	77.8	79.4	S Silver Springs Rd	8,834	8,437	17,271	Derivation Code = 1 | MS2 TDMS; Reference = {68_100515} | Previous AADT = 17518	9	54	668	8,269	52%	28,748
{68_100516}	100516	I-40	79.5	S Silver Springs Rd	86.9	87.6	N Willows Ranch Rd	8,689	6,932	15,621	Derivation Code = 3 | MS2 TDMS; Reference = {68_100516} | Previous AADT = 16022	7	53	622	5,894	42%	24,164
{68_100517}	100517	I-40	87.6	N Willows Ranch Rd	88.0	91.7	E Fort Rock Ranch Rd	8,724	6,913	15,637	Derivation Code = 3 | MS2 TDMS; Reference = {68_100517} | Previous AADT = 16038	7	56	622	3,470	26%	24,189
{68_100518}	100518	I-40	91.7	E Fort Rock Ranch Rd	94.8	96.0	Fort Rock Rd	7,438	8,293	15,731	Derivation Code = 3 | MS2 TDMS; Reference = {68_100518} | Previous AADT = 15922	7	55	510	3,200	24%	25,384
{68_100519}	100519	I-40	96.0	Fort Rock Rd	103.1	103.6	W Fort Rock Rd	8,124	7,492	15,616	Derivation Code = 3 | MS2 TDMS; Reference = {68_100519} | Previous AADT = 15806	7	50	513	3,226	24%	25,199
{68_100520}	100520	I-40	103.6	W Fort Rock Rd	104.7	109.7	Unidrd Seligman(162)	6,479	10,300	16,779	Derivation Code = 3 | MS2 TDMS; Reference = {68_100520} | Previous AADT = 16938	8	67	647	6,367	42%	27,076
{68_100521}	100521	I-40	109.7	Exit 109 Anvil Rock Rd	110.4	121.1	Exit 121 SB 40 (1) - West end of Seligman	9,586	8,266	17,852	Derivation Code = 3 | MS2 TDMS; Reference = {68_100521} | Previous AADT = 18069	7	53	552	5,962	36%	28,217
{68_100522}	100522	I-40	121.1	Exit 121 SB 40 (1) - West end of Seligman	122.8	123.3	Exit 123 SB 40 (1) - East end of Seligman	9,007	7,474	16,481	Derivation Code = 3 | MS2 TDMS; Reference = {68_100522} | Previous AADT = 16681	9	55	549	3,450	24%	26,595
{68_100523}	100523	I-40	123.3	SR-40B nonCard (1)	138.6	139.9	W Old Highway 66	8,982	9,324	18,306	Derivation Code = 1 | MS2 TDMS; Reference = {68_100523} | Previous AADT = 18558	9	54	519	4,006	25%	29,540
{68_100524}	100524	I-40	139.9	W Old Highway 66	143.0	144.9	Exit 145 SB 40 (2) - West end of Ash Fork	9,514	7,553	17,067	Derivation Code = 3 | MS2 TDMS; Reference = {68_100524} | Previous AADT = 17274	7	60	671	6,611	43%	27,540
{68_100525}	100525	I-40	144.9	SR-40B nonCard (2)	145.6	146.3	SR-89	8,889	7,410	16,299	Derivation Code = 3 | MS2 TDMS; Reference = {68_100525} | Previous AADT = 16497	7	56	650	6,022	41%	26,301
{68_100526}	100526	I-40	146.3	SR-89	147.7	148.3	County Line Rd (A)	8,595	8,769	17,364	Derivation Code = 1 | MS2 TDMS; Reference = {68_100526} | Previous AADT = 18495	9	55	872	5,613	37%	28,020
{68_100527}	100527	I-40	148.3	County Line Rd (A)	148.7	149.1	Monte Carlo Rd	8,825	8,089	16,914	Derivation Code = 3 | MS2 TDMS; Reference = {68_100527} | Previous AADT = 17119	7	57	693	6,344	42%	25,846
{68_100528}	100528	I-40	149.2	Monte Carlo Rd	151.0	151.8	Corva Rd (A)	9,269	8,429	17,698	Derivation Code = 3 | MS2 TDMS; Reference = {68_100528} | Previous AADT = 17913	7	54	835	6,929	44%	27,044
{68_100529}	100529	I-40	151.8	Corva Rd (A)	155.3	157.8	McLellan Reservoir U	9,704	9,599	19,303	Derivation Code = 3 | MS2 TDMS; Reference = {68_100529} | Previous AADT = 19537	9	51	675	6,640	38%	29,496
{68_100530}	100530	I-40	157.8	Exit 157 Devil Dog Rd	161.4	162.0	Exit 161 West Williams	10,701	10,167	20,868	Derivation Code = 3 | MS2 TDMS; Reference = {68_100530} | Previous AADT = 21121	7	55	695	6,979	37%	35,884
{68_100531}	100531	I-40	162.0	SR-40B nonCard (3)	162.7	163.5	N Grand Canyon Blvd	8,840	9,150	17,990	Derivation Code = 3 | MS2 TDMS; Reference = {68_100531} | Previous AADT = 18209	8	54	700	6,635	41%	30,935
{68_100532}	100532	I-40	163.5	N Grand Canyon Blvd	164.5	166.0	SR-64	10,694	10,865	21,559	Derivation Code = 3 | MS2 TDMS; Reference = {68_100532} | Previous AADT = 21821	7	55	847	6,536	34%	37,073
{68_100533}	100533	I-40	165.9	SR-64	166.7	167.6	Circle Pines Rd (A)	12,042	10,538	22,580	Derivation Code = 3 | MS2 TDMS; Reference = {68_100533} | Previous AADT = 22854	7	50	875	6,770	34%	38,828
{68_100534}	100534	I-40	167.5	Circle Pines Rd (A)	169.1	171.7	Cool Pines Rd	12,247	9,417	21,664	Derivation Code = 3 | MS2 TDMS; Reference = {68_100534} | Previous AADT = 21927	7	56	792	6,961	36%	35,181
{68_100535}	100535	I-40	171.7	Cool Pines Rd	172.4	178.3	N Parks Rd	11,088	9,399	20,487	Derivation Code = 3 | MS2 TDMS; Reference = {68_100535} | Previous AADT = 20736	7	53	768	6,755	37%	31,306
{68_100536}	100536	I-40	178.3	N Parks Rd	178.8	185.1	Transwestern Rd	11,861	9,877	21,738	Derivation Code = 3 | MS2 TDMS; Reference = {68_100536} | Previous AADT = 22002	7	53	1,129	7,351	39%	33,217
{68_100537}	100537	I-40	185.1	Transwestern Rd	186.0	190.6	A1 Mountain Overpass	14,310	11,427	25,737	Derivation Code = 1 | MS2 TDMS; Reference = {68_100537} | Previous AADT = 25992	9	51	1,111	8,438	37%	39,328
{68_100538}	100538	I-40	190.5	Exit 190 A-1 Mountain Rd	191.0	191.7	Exit 191	12,435	12,620	25,055	Derivation Code = 3 | MS2 TDMS; Reference = {68_100538} | Previous AADT = 25359	8	52	1,306	7,132	34%	38,286
{68_100539}	100539	I-40	191.7	SR-40B nonCard	192.0	192.6	S Flagstaff Ranch Rd	13,118	10,175	23,293	Derivation Code = 3 | MS2 TDMS; Reference = {68_100539} | Previous AADT = 23576	6	61	1,317	7,154	36%	35,593
{68_100540}	100540	I-40	192.6	S Flagstaff Ranch Rd	194.1	195.4	I-17	12,329	12,075	24,404	Derivation Code = 1 | MS2 TDMS; Reference = {68_100540} | Previous AADT = 25654	8	53	729	5,533	26%	41,965
{68_100541}	100541	I-40	195.4	I-17	196.3	198.3	E Butler Ave	20,860	30,515	51,375	Derivation Code = 3 | MS2 TDMS; Reference = {68_100541} | Previous AADT = 51999	9	51	1,801	9,193	21%	76,266
{68_100542}	100542	I-40	198.3	E Butler Ave	199.8	201.1	N Country Club Dr	23,177	24,122	47,299	Derivation Code = 3 | MS2 TDMS; Reference = {68_100542} | Previous AADT = 47873	9	54	1,715	10,739	26%	81,335
{68_100543}	100543	I-40	201.1	SR-40B nonCard	201.8	204.9	FS 622 Rd	17,502	13,575	31,077	Derivation Code = 3 | MS2 TDMS; Reference = {68_100543} | Previous AADT = 31454	6	51	1,119	13,212	46%	53,440
{68_100544}	100544	I-40	204.9	FS 622 Rd	206.0	207.2	N Cosnino Rd	12,835	12,815	25,650	Derivation Code = 1 | MS2 TDMS; Reference = {68_100544} | Previous AADT = 24932	8	54	838	7,714	33%	39,195
{68_100545}	100545	I-40	207.2	N Cosnino Rd	209.0	211.2	Winona Overpass	12,951	11,228	24,179	Derivation Code = 3 | MS2 TDMS; Reference = {68_100545} | Previous AADT = 24473	7	51	977	11,422	51%	36,947
{68_100546}	100546	I-40	211.2	Winona Overpass	215.0	219.6	Twin Arrows Overpass	12,722	12,008	24,730	Derivation Code = 3 | MS2 TDMS; Reference = {68_100546} | Previous AADT = 25030	8	53	938	11,336	50%	37,789

Reference	Loc ID	Road	BMP	FromRoad	TCS MP	EMP	ToRoad	Pos Dir AADT	Neg Dir AADT	AADT 2022	AADT Source Dataset	K Factor %	D Factor %	AADT Single Trucks	AADT Combo Trucks	T Factor %	2042 Future AADT
{68_100547}	100547	I-40	219.6	Twin Arrows Overpass	222.3	225.1	Buffalo Range Rd	11,649	10,047	21,696	Derivation Code = 3 | MS2 TDMS; Reference = {68_100547} | Previous AADT = 21960	7	51	878	9,201	46%	33,153
{68_100548}	100548	I-40	225.1	Buffalo Range Rd	228.1	230.5	Canyon Diablo Overpa	11,736	10,693	22,429	Derivation Code = 3 | MS2 TDMS; Reference = {68_100548} | Previous AADT = 22701	8	51	838	10,292	50%	36,423
{68_100549}	100549	I-40	230.5	Canyon Diablo Overpa	232.0	233.9	I 40 Meteor Crater O	11,609	10,320	21,929	Derivation Code = 3 | MS2 TDMS; Reference = {68_100549} | Previous AADT = 22195	7	53	809	9,209	46%	33,509
{68_100550}	100550	I-40	233.9	I 40 Meteor Crater O	236.7	239.7	Meteor City Rd	9,535	9,876	19,411	Derivation Code = 3 | MS2 TDMS; Reference = {68_100550} | Previous AADT = 19647	8	50	719	9,188	51%	29,661
{68_100551}	100551	I-40	239.7	Meteor City Rd	242.5	245.4	SR-99	10,887	10,556	21,443	Derivation Code = 3 | MS2 TDMS; Reference = {68_100551} | Previous AADT = 21703	7	50	750	9,821	49%	32,767
{68_100552}	100552	I-40	245.4	SR-99	248.7	252.1	Hipkoe Dr	12,613	11,430	24,043	Derivation Code = 3 | MS2 TDMS; Reference = {68_100552} | Previous AADT = 24335	6	52	769	9,628	43%	36,740
{68_100553}	100553	I-40	252.1	SR-40B nonCard	252.8	253.6	North Park Dr	11,514	10,624	22,138	Derivation Code = 3 | MS2 TDMS; Reference = {68_100553} | Previous AADT = 22407	7	55	731	9,565	47%	40,767
{68_100554}	100554	I-40	253.6	North Park Dr	254.7	255.8	Exit 255 SB 40 (6) / Oak Rd	12,416	10,903	23,319	Derivation Code = 3 | MS2 TDMS; Reference = {68_100554} | Previous AADT = 23602	7	52	760	9,751	45%	40,808
{68_100555}	100555	I-40	255.8	SR-40B nonCard	256.6	257.7	SR-87	12,462	11,180	23,642	Derivation Code = 3 | MS2 TDMS; Reference = {68_100555} | Previous AADT = 23929	7	52	769	9,858	45%	37,142
{68_100556}	100556	I-40	257.7	SR-87	260.0	264.8	Hibbard Siding Rd	10,635	10,511	21,146	Derivation Code = 1 | MS2 TDMS; Reference = {68_100556} | Previous AADT = 21480	8	55	908	7,833	41%	33,220
{68_100557}	100557	I-40	264.8	Exit 264 Hibbard Rd	268.0	270.0	Exit 269 Jackrabbit Rd	11,042	12,638	23,680	Derivation Code = 3 | MS2 TDMS; Reference = {68_100557} | Previous AADT = 23968	6	58	908	7,833	37%	37,201
{68_100558}	100558	I-40	270.0	Exit 269 Jackrabbit Rd	271.6	274.7	Exit 274 SB 40 (7) - West end of Joseph City	11,647	10,141	21,788	Derivation Code = 3 | MS2 TDMS; Reference = {68_100558} | Previous AADT = 22053	7	52	1,097	8,708	45%	34,229
{68_100559}	100559	I-40	274.7	Exit 274 SB 40 (7) - West end of Joseph City	276.0	277.1	Exit 277 SB 40 (7) - East end of Joseph City	11,608	9,701	21,309	Derivation Code = 3 | MS2 TDMS; Reference = {68_100559} | Previous AADT = 21568	7	55	1,130	8,904	47%	33,476
{68_100560}	100560	I-40	277.1	SR-40B nonCard (7)	277.2	280.7	Hunt Rd	12,770	11,009	23,779	Derivation Code = 3 | MS2 TDMS; Reference = {68_100560} | Previous AADT = 24068	6	51	1,197	8,945	43%	37,357
{68_100561}	100561	I-40	280.7	Exit 280 Hunt Rd	283.2	283.7	Exit 283 Perkins Valley	10,968	9,976	20,944	Derivation Code = 3 | MS2 TDMS; Reference = {68_100561} | Previous AADT = 21198	8	53	894	8,800	46%	36,467
{68_100562}	100562	I-40	283.7	Exit 283 Perkins Valley	284.7	285.2	Exit 285 Hopi Dr - West end of Holbrook	11,849	10,959	22,808	Derivation Code = 3 | MS2 TDMS; Reference = {68_100562} | Previous AADT = 23085	6	54	775	8,323	40%	42,001
{68_100563}	100563	I-40	285.2	Exit 285 Hopi Dr - West end of Holbrook	286.0	286.9	Exit 286 SB 40 (8) / Navajo Rd	9,504	9,263	18,767	Derivation Code = 3 | MS2 TDMS; Reference = {68_100563} | Previous AADT = 18995	7	54	767	7,066	42%	34,559
{68_100564}	100564	I-40	286.9	Exit 286 SB 40 (8) / Navajo Rd	288.2	289.5	Exit 289 SR 77 - East end of Holbrook	11,383	9,748	21,131	Derivation Code = 3 | MS2 TDMS; Reference = {68_100564} | Previous AADT = 21388	6	54	844	8,154	43%	38,913
{68_100565}	100565	I-40	289.5	SR-40B nonCard (8)	290.2	292.8	SR-77	10,232	11,129	21,361	Derivation Code = 3 | MS2 TDMS; Reference = {68_100565} | Previous AADT = 21620	11	50	916	7,717	40%	33,558
{68_100566}	100566	I-40	292.8	SR-77	293.5	294.5	Sun Valley Rd	11,515	10,075	21,590	Derivation Code = 3 | MS2 TDMS; Reference = {68_100566} | Previous AADT = 21852	6	51	949	8,031	42%	33,918
{68_100567}	100567	I-40	294.5	Sun Valley Rd	299.0	300.3	I-40 Exit 300 G-Ramp	10,452	8,079	18,531	Derivation Code = 3 | MS2 TDMS; Reference = {68_100567} | Previous AADT = 18756	8	52	1,014	8,395	51%	29,112
{68_100568}	100568	I-40	300.3	I-40 Exit 300 G-Ramp	303.0	303.6	Adamana Rd	11,027	8,960	19,987	Derivation Code = 3 | MS2 TDMS; Reference = {68_100568} | Previous AADT = 20230	7	55	938	8,589	48%	31,400
{68_100569}	100569	I-40	303.6	Adamana Rd	307.5	311.6	Petrified Forest Rd	9,987	9,420	19,407	Derivation Code = 3 | MS2 TDMS; Reference = {68_100569} | Previous AADT = 19643	7	54	634	8,072	45%	33,043
{68_100570}	100570	I-40	311.6	Petrified Forest Rd	318.0	320.0	I-40 Exit 320 Xing	10,096	10,663	20,759	Derivation Code = 3 | MS2 TDMS; Reference = {68_100570} | Previous AADT = 21011	7	52	787	8,178	43%	35,345
{68_100571}	100571	I-40	320.0	I-40 Exit 320 Xing	320.7	325.9	I-40 Exit 325 Xing	10,867	10,817	21,684	Derivation Code = 1 | MS2 TDMS; Reference = {68_100571} | Previous AADT = 21920	10	58	748	8,214	41%	36,920
{68_100572}	100572	I-40	325.9	I-40 Exit 325 Xing	329.7	330.0	McCarrol Rd	10,634	9,785	20,419	Derivation Code = 3 | MS2 TDMS; Reference = {68_100572} | Previous AADT = 20667	6	52	857	7,616	41%	34,766
{68_100573}	100573	I-40	330.0	McCarrol Rd	330.4	333.4	US-191 nonCard	10,917	9,734	20,651	Derivation Code = 3 | MS2 TDMS; Reference = {68_100573} | Previous AADT = 20902	8	51	681	7,134	38%	37,055
{68_100574}	100574	I-40	333.4	US-191 nonCard	337.0	339.5	US-191	10,598	8,872	19,470	Derivation Code = 3 | MS2 TDMS; Reference = {68_100574} | Previous AADT = 19706	8	60	720	7,721	43%	33,150
{68_100575}	100575	I-40	339.5	US-191	340.0	341.7	I-40 Exit 341 A-Ramp	12,346	11,816	24,162	Applied Growth Factor = -0.012 to Previous Year | Previous AADT = 24456	10	50	344	3,989	18%	41,139
{68_100576}	100576	I-40	341.7	Exit 341 Ortega Rd	343.0	343.8	Exit 343 Querino Rd	14,034	10,933	24,967	Derivation Code = 3 | MS2 TDMS; Reference = {68_100576} | Previous AADT = 25270	6	56	833	8,974	39%	42,510
{68_100577}	100577	I-40	343.8	Exit 343 Querino Rd	346.0	346.6	US-191	12,713	13,279	25,992	Derivation Code = 3 | MS2 TDMS; Reference = {68_100577} | Previous AADT = 26308	6	52	1,117	9,590	41%	44,255
{68_100578}	100578	I-40	346.6	Exit 346 Pine Springs Rd	347.9	348.2	Exit 348 Houck	12,285	13,267	25,552	Derivation Code = 3 | MS2 TDMS; Reference = {68_100578} | Previous AADT = 25862	6	53	1,071	9,288	41%	43,506
{68_100579}	100579	I-40	348.2	Exit 348 Houck	348.7	351.4	Exit 351 Allentown Rd	12,114	12,793	24,907	Derivation Code = 3 | MS2 TDMS; Reference = {68_100579} | Previous AADT = 25210	6	52	850	8,550	38%	42,407
{68_100580}	100580	I-40	351.4	Exit 351 Allentown Rd	352.0	354.7	Exit 354 Hawthorne Rd	11,554	10,403	21,957	Derivation Code = 3 | MS2 TDMS; Reference = {68_100580} | Previous AADT = 22224	8	51	820	8,405	42%	37,385
{68_100581}	100581	I-40	354.6	Exit 354 Hawthorne Rd	357.2	357.5	Exit 357 Window Rock	11,607	7,849	19,456	Derivation Code = 3 | MS2 TDMS; Reference = {68_100581} | Previous AADT = 19692	8	50	744	8,035	45%	33,126
{68_100582}	100582	I-40	357.4	Exit 357 Window Rock	357.9	359.0	Exit 359 Grants	11,836	10,415	22,251	Derivation Code = 3 | MS2 TDMS; Reference = {68_100582} | Previous AADT = 22521	7	52	734	8,854	43%	37,885
{68_100583}	100583	I-40	358.9	Exit 359 Grants	359.2	359.3	New Mexico State Line	11,213	13,143	24,356	Derivation Code = 3 | MS2 TDMS; Reference = {68_100583} | Previous AADT = 24652	6	61	900	9,905	44%	41,469

Ruler
Line
Path
Polygon
Circle
3D path
3D polygon
Measure the distance between two points on the ground
Map Length: 636.86 Feet
Ground Length: 636.86
Heading: 179.22 degrees
Mouse Navigation
Save
Clear
Image © 2025 Vexcel Imaging US, Inc.
Google Earth
1985
Imagery Date: 11/16/2022 32°11'20.72" N 110°57'47.38" W elev 0 ft eye alt 2165 ft

ERR N5
Ruler
Line
Path
Polygon
Circle
3D path
3D polygon
Measure the distance between two points on the ground
Map Length: 232.46 Feet
Ground Length: 232.46
Heading: 268.01 degrees
Mouse Navigation
Save
Clear
Image © 2025 Vexcel Imaging US, Inc.
Google Earth
1985
Imagery Date: 11/16/2022 32°11'24.12" N 110°57'45.72" W elev 0 ft eye alt 2165 ft

ERR N6

Barrier Performance Module (BPM) Calculator

This module provides to the user a measure on the barrier's effectiveness on noise reduction. A list of the input/output variables and their definitions, as well as illustrations of different scenarios are provided.

Calculator

View Day/Night Noise Level Calculator (/programs/environmental-review/dnl-calculator/)

View Descriptions of the Input/Output variables.

Note: Tool tips, containing field specific information, have been added in this tool and may be accessed by hovering over the Input and Output variables with the mouse.

WARNING: If there is direct line-of-sight between the Source and the Observer, the module will report erroneous attenuation. "Direct line-of-sight" means if the 5' tall Observer can see the noise Source (cars, trucks, trains, etc.) over the Barrier (wall, hill/excavation, building, etc.), the current version of Barrier Performance Module will not accurately calculate the attenuation provided. In this instance, there is unlikely to be any appreciable attenuation.

Note: Barrier height must block the line of sight

Input Data

H	30	**R**[1]	650
S	15	**D**[1]	60
O	5	**α**	127

Calculate Output

Output Data

h	24	**R**	650
D	60	**FS**	5.6932

Reduction From Barrier (dB):

-5.6932

Refresh

Note: If you have separate Road and Rail DNL values, please enter the values below to calculate the new combined Road/Rail DNL :

Road DNL:

70

Rail DNL:

65

Calculate

Combined Road/Rail DNL with Barrier Reduction:

65.5068

Input/Output Variables

Input Variables

The following variables and definitions from the barrier being assessed are the input required for the web-based barrier performance module:

- H = Barrier Height
- S = Noise Source Height
- O = Observer Height (known as the receiver)
- R^1 = Distance from Noise Source to Barrier
- D^1 = Distance from the Observer to the Barrier
- α = Line of sight angle between the Observer and the Noise Source, subtended by the barrier at observer's location

Output Variables

Definitions of the output variables from the mitigation module of the Day/Night Noise Level Assessment Tools as part of the Assessment Tools for Environmental Compliance:

- h = The shortest distance from the barrier top to the line of sight from the Noise source to

the Observer.

- R = Slant distance along the line of sight from the Barrier to the Noise Source
- D = Slant distance along the line of sight from the Barrier to the Observer

The “actual barrier performance for barriers of finite length” is noted on the worksheets(in the Guidebook) as **FS**.

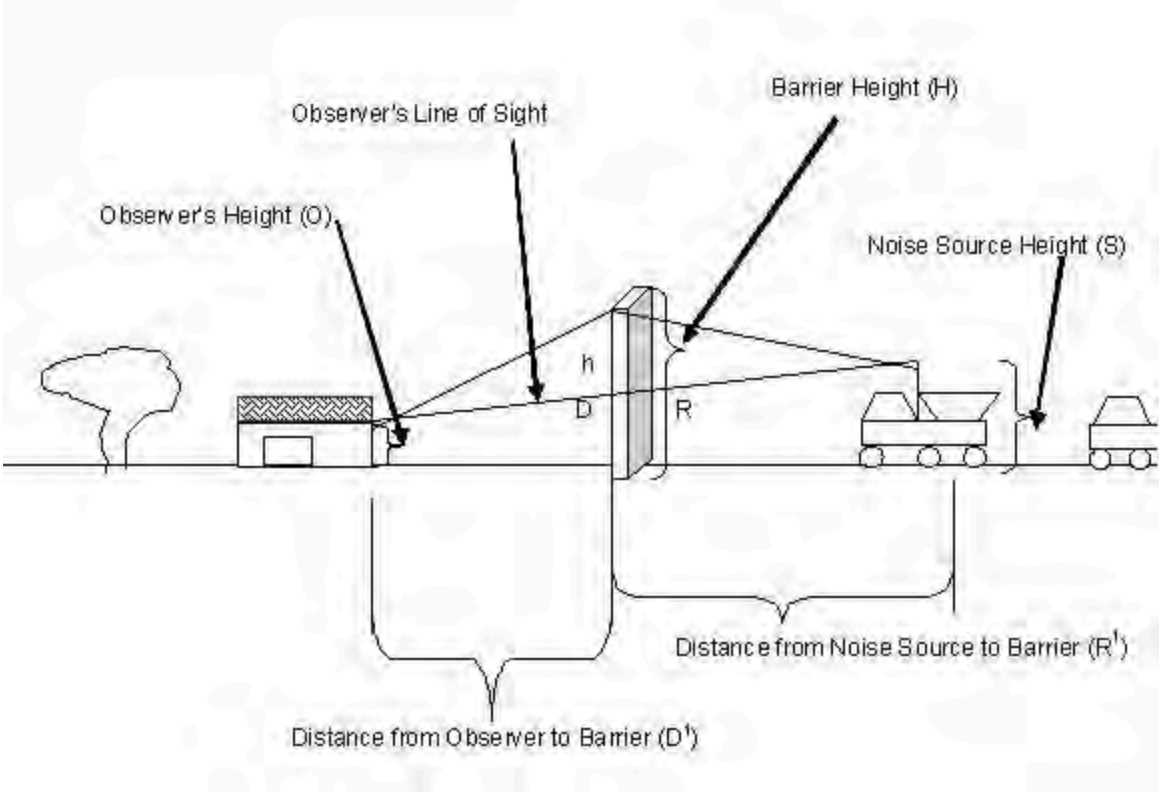

Barrier Implementation Scenarios

Locate the cursor on the following thumbnails to enlarge the respective scenario as implementation examples of the barrier performance module.

Scenario #1:

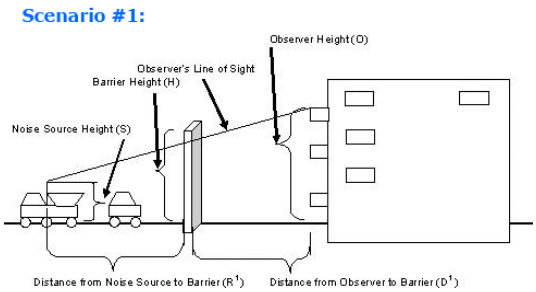

Noise receiver at a higher elevation than the noise source and a man-made noise barrier in between the receiver and the source.

Noise receiver at a higher elevation than the noise source and a man-made noise barrier in between the receiver and the source.

(https://www.hudexchange.info/resources/documents/Barrier-Performance-Module-Barrier-Implementation-Scenario-1.gif)

view larger version of image (/resource/3841/barrier-performance-module-bpm-barrier-implementation-scenarios/)

Scenario #2:

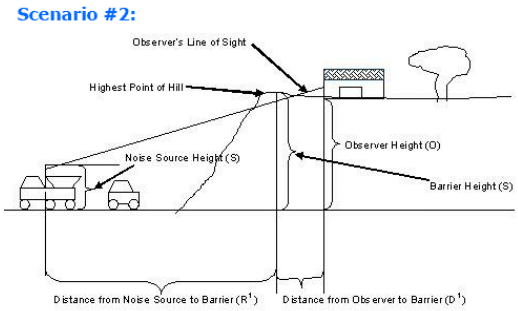

Noise receiver at a higher elevation than the noise source and a natural barrier (hill) between the receiver and the source.

Noise receiver at a higher elevation than the noise source and a natural barrier (hill) between the receiver and the source.

(https://www.hudexchange.info/resources/documents/Barrier-Performance-Module-Barrier-Implementation-Scenario-2.gif)

view larger version of image (/resource/3841/barrier-performance-module-bpm-barrier-implementation-scenarios/)

Scenario #3:

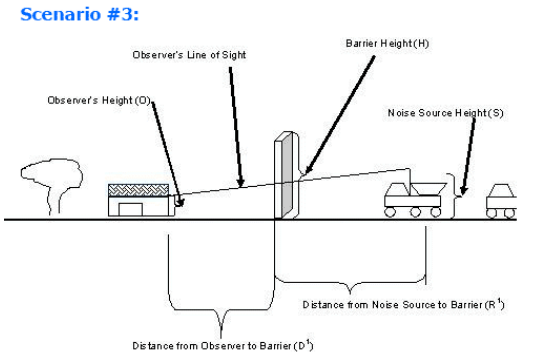

Noise receiver at almost the same elevation of the noise source and a man-made noise barrier between the receiver and the source.

(https://files.hudexchange.info/resources/documents/Barrier-Performance-Module-Barrier-Implementation-Scenario-3.gif)

view larger version of image (/resource/3841/barrier-performance-module-bpm-barrier-implementation-scenarios/)

Scenario #4:

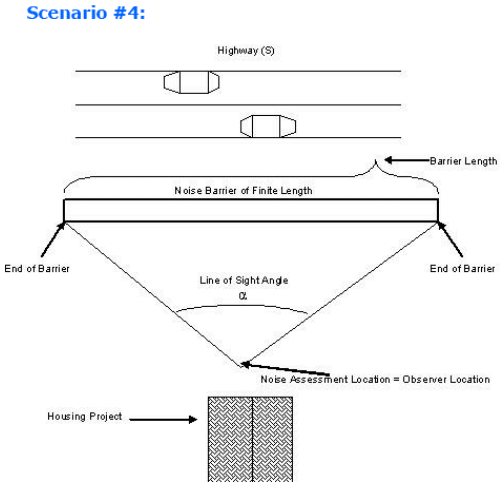

A noise barrier of finite length between a noise source and a receiver. This top view illustrates the angle α, subtended by the barrier at the observer's location.

(https://files.hudexchange.info/resources/documents/Barrier-Performance-Module-Barrier-Implementation-Scenario-4.gif)

view larger version of image (/resource/3841/barrier-performance-module-bpm-barrier-implementation-scenarios/)

Contents

Calculator

Input/Output Variables

Barrier Implementation Scenarios

ERR O

USEPA Sole Source Aquifer Map

6/20/2025, 9:32:11 AM

Sole_Source_Aquifers

1:1,155,581

0 5 10 20 mi

0 12.5 25 50 km

CONANP, Esri, TomTom, Garmin, SafeGraph, FAO, METI/NASA, USGS, Bureau of Land Management, EPA, NPS, USFWS

U.S. Environmental Protection Agency

U.S. Fish and Wildlife Service
National Wetlands Inventory

Wetlands Map

ERR P

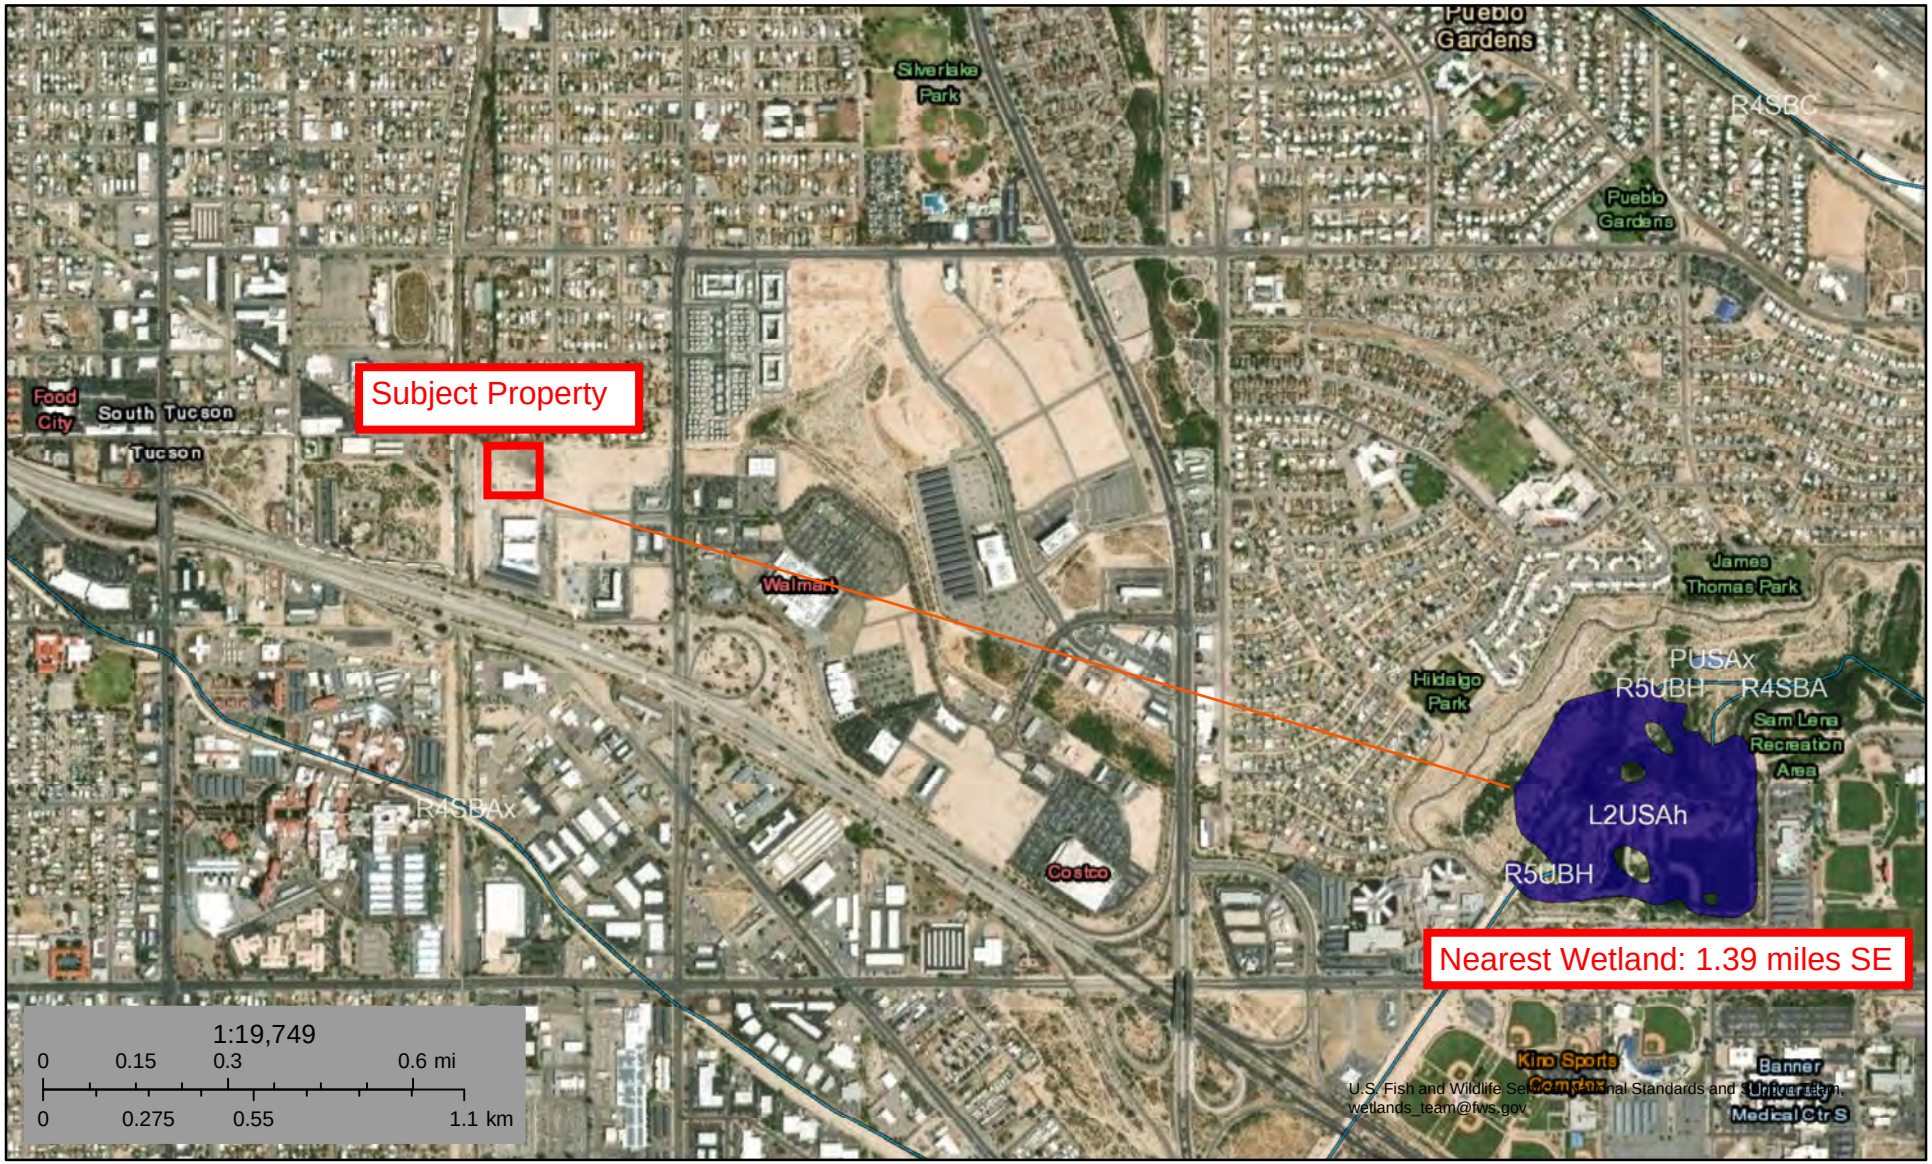

January 16, 2025

Wetlands

- Estuarine and Marine Deepwater
- Estuarine and Marine Wetland
- Freshwater Emergent Wetland
- Freshwater Forested/Shrub Wetland
- Freshwater Pond
- Lake
- Other
- Riverine

This map is for general reference only. The US Fish and Wildlife Service is not responsible for the accuracy or currentness of the base data shown on this map. All wetlands related data should be used in accordance with the layer metadata found on the Wetlands Mapper web site.

ERR Q1
Park Tiles Imagery
3300 S Park Ave, Tucson, Arizon
Marana
Oro Valley
CORONADO NATIONAL FOREST
SAGUARO NATIONAL PARK
Tucson Mountain District
SAGUARO NP
12 Miles
Tucson
Rincon Mountain District
SAGUARO NP
Phoenix
SAGUARO NP
TUMACACORI NHP
3 mi
National Park Service | © Mapbox © OpenStreetMap contributors | Geocoding by Esri

Appendix B, Figure 9

ERR Q2

Oro Valley

Picture Rocks

Casas Adobes

Saguaro National Park

Catalina Foothills

Tucson

Tanque Verde

Tucson Mountain Park

South Tucson

Tucson Estates

3300 S Park Ave

Mica Mount

Drexel Heights

Drexel-Alvernon

Three Points

Cienega Creek

Vail

Image © 2024 Airbus

Google Earth

Ruler

Line | Path | Polygon | Circle | 3D path | 3D polygon

Measure the distance between two points on the ground

Map Length: 17.69 Miles

Ground Length: 17.69

Heading: 120.15 degrees

Mouse Navigation | Save | Clear

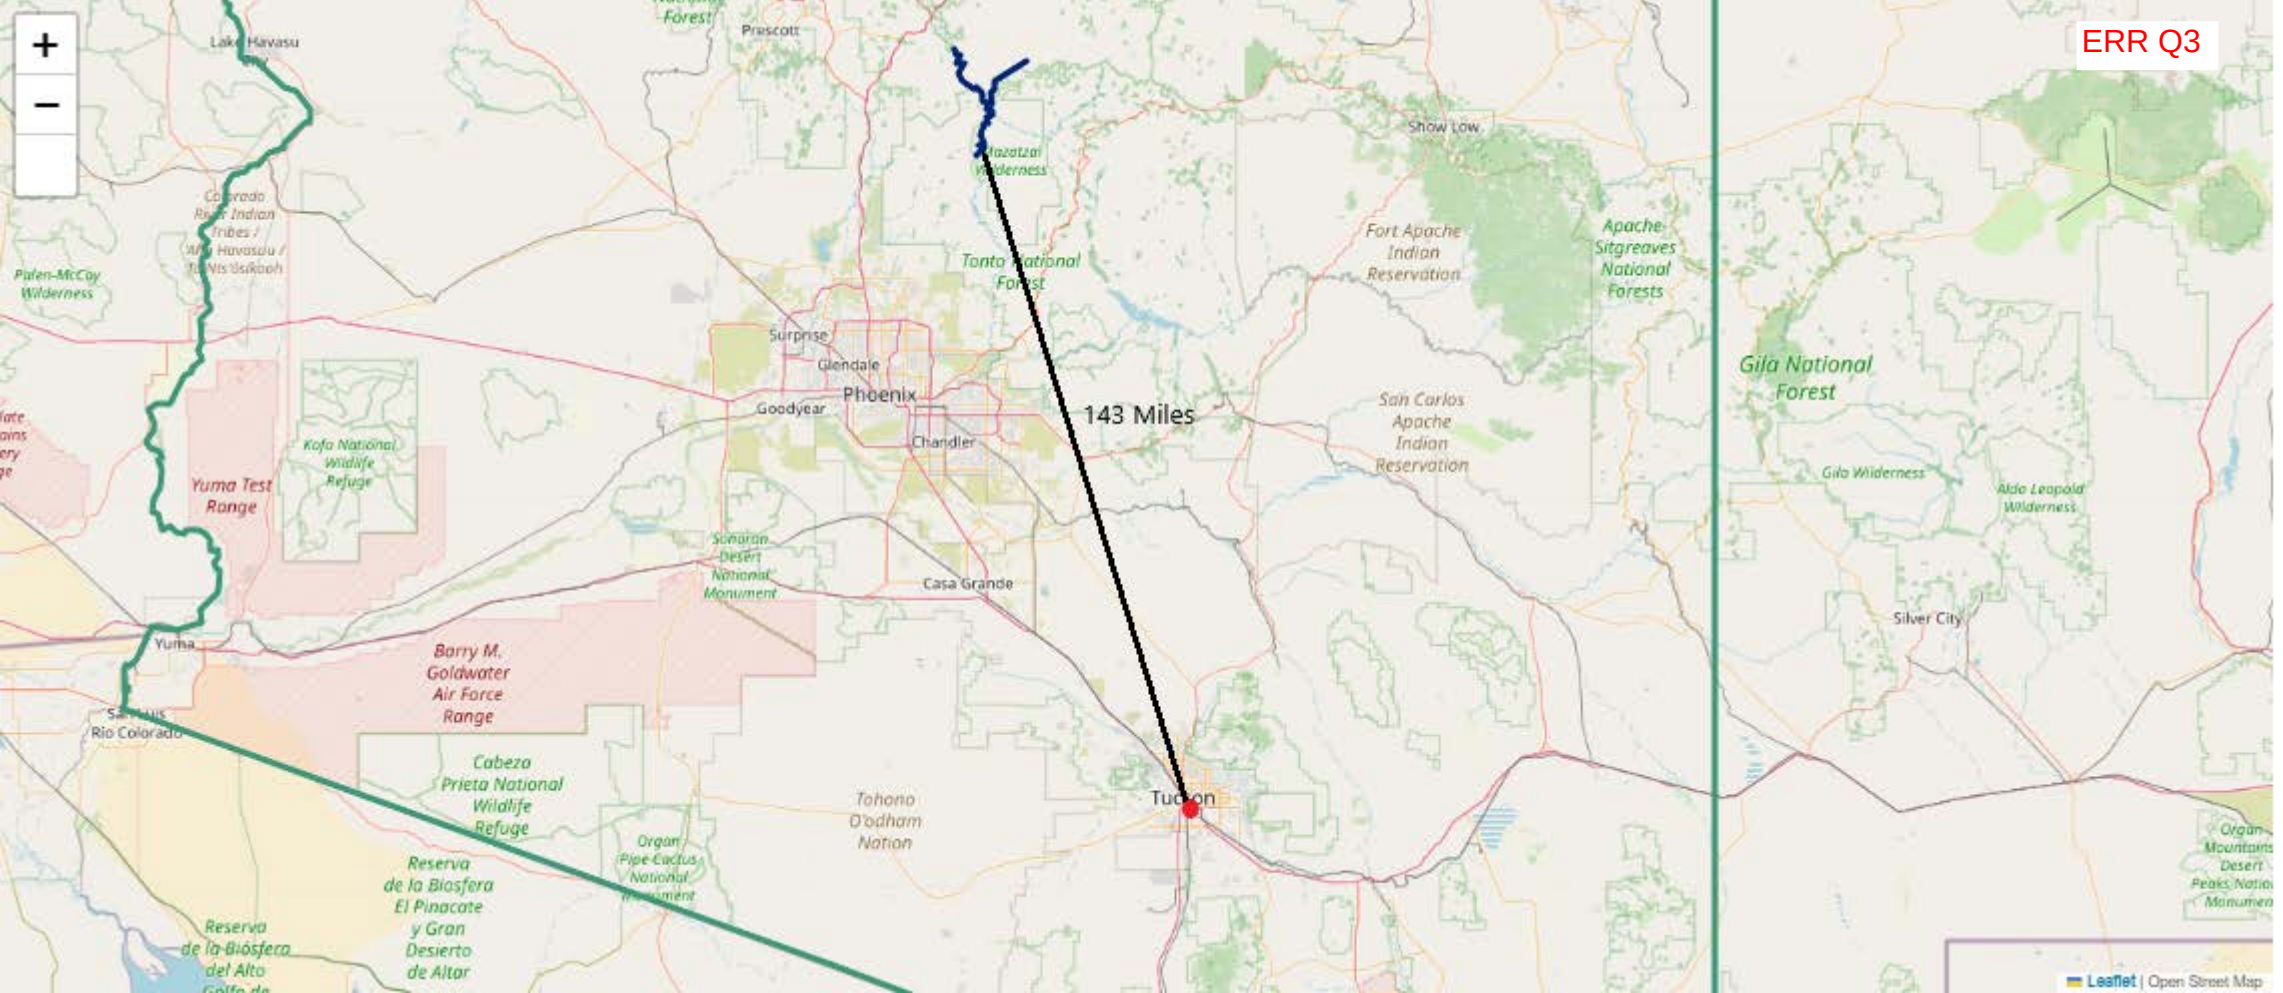
ERR Q3
143 Miles
Lake Havasu
Prescott
Show Low
Phoenix
Surprise
Glendale
Goodyear
Chandler
Casa Grande
Tucson
Yuma
Silver City
Yuma Test Range
Barry M. Goldwater Air Force Range
Cabeza Prieta National Wildlife Refuge
Reserva de la Biosfera El Pinacate y Gran Desierto de Altar
Reserva de la Biósfera del Alto
Tohono O'odham Nation
Fort Apache Indian Reservation
San Carlos Apache Indian Reservation
Apache-Sitgreaves National Forests
Gila National Forest
Tonto National Forest
Kofa National Wildlife Refuge
Sonoran Desert National Monument
Organ Pipe Cactus National Monument
Gila Wilderness
Aldo Leopold Wilderness
Pilot Mountains Desert Peaks National Monument
Leaflet | Open Street Map

ERR R

Place

Tucson city, Arizona

Tucson city, Arizona is a city, town, place equivalent, or township located in Arizona. Tucson city, Arizona has a land area of 238.0 square miles.

// United States / Arizona / Tucson city, Arizona

Display Sources

Populations and People
Total Population
542,629
P1 | 2020 Decennial Census

Education
Bachelor's Degree or Higher
31.3%
S1501 | 2023 American Community Survey 1-Year Estimates

Housing
Total Housing Units
242,798
H1 | 2020 Decennial Census

Families and Living Arrangements
Total Households
233,257
DP02 | 2023 American Community Survey 1-Year Estimates

Income and Poverty
Median Household Income
$55,708
S1901 | 2023 American Community Survey 1-Year Estimates

Employment
Employment Rate
59.2%
DP03 | 2023 American Community Survey 1-Year Estimates

Health
Without Health Care Coverage
10.5%
S2701 | 2023 American Community Survey 1-Year Estimates

Race and Ethnicity
Hispanic or Latino (of any race)
228,878
P9 | 2020 Decennial Census

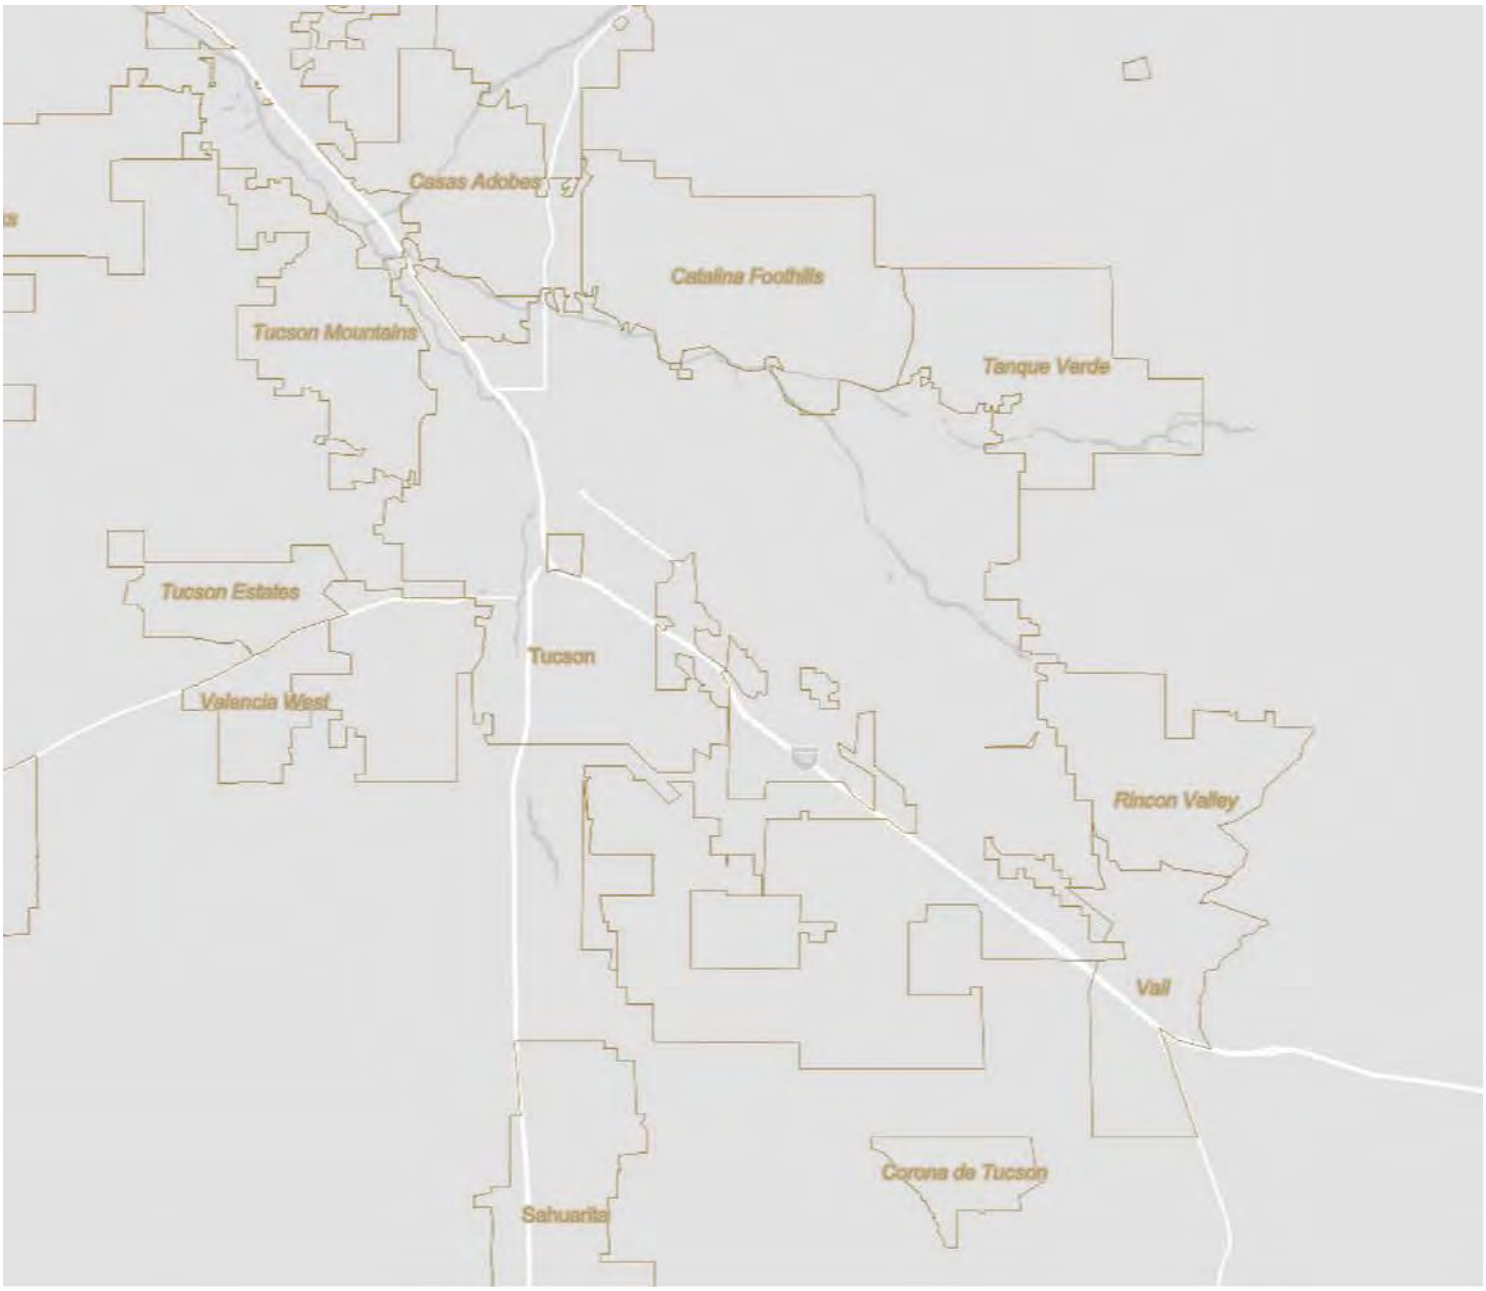

Source: undefined |

Populations and People

Age and Sex

35.6 ± 0.8
Median Age in Tucson city, Arizona

39.3 ± 0.2
Median Age in Arizona

S0101 | *2023 American Community Survey 1-Year Estimates*

Population Pyramid: Population by Age and Sex
in Tucson city, Arizona

Share / Embed

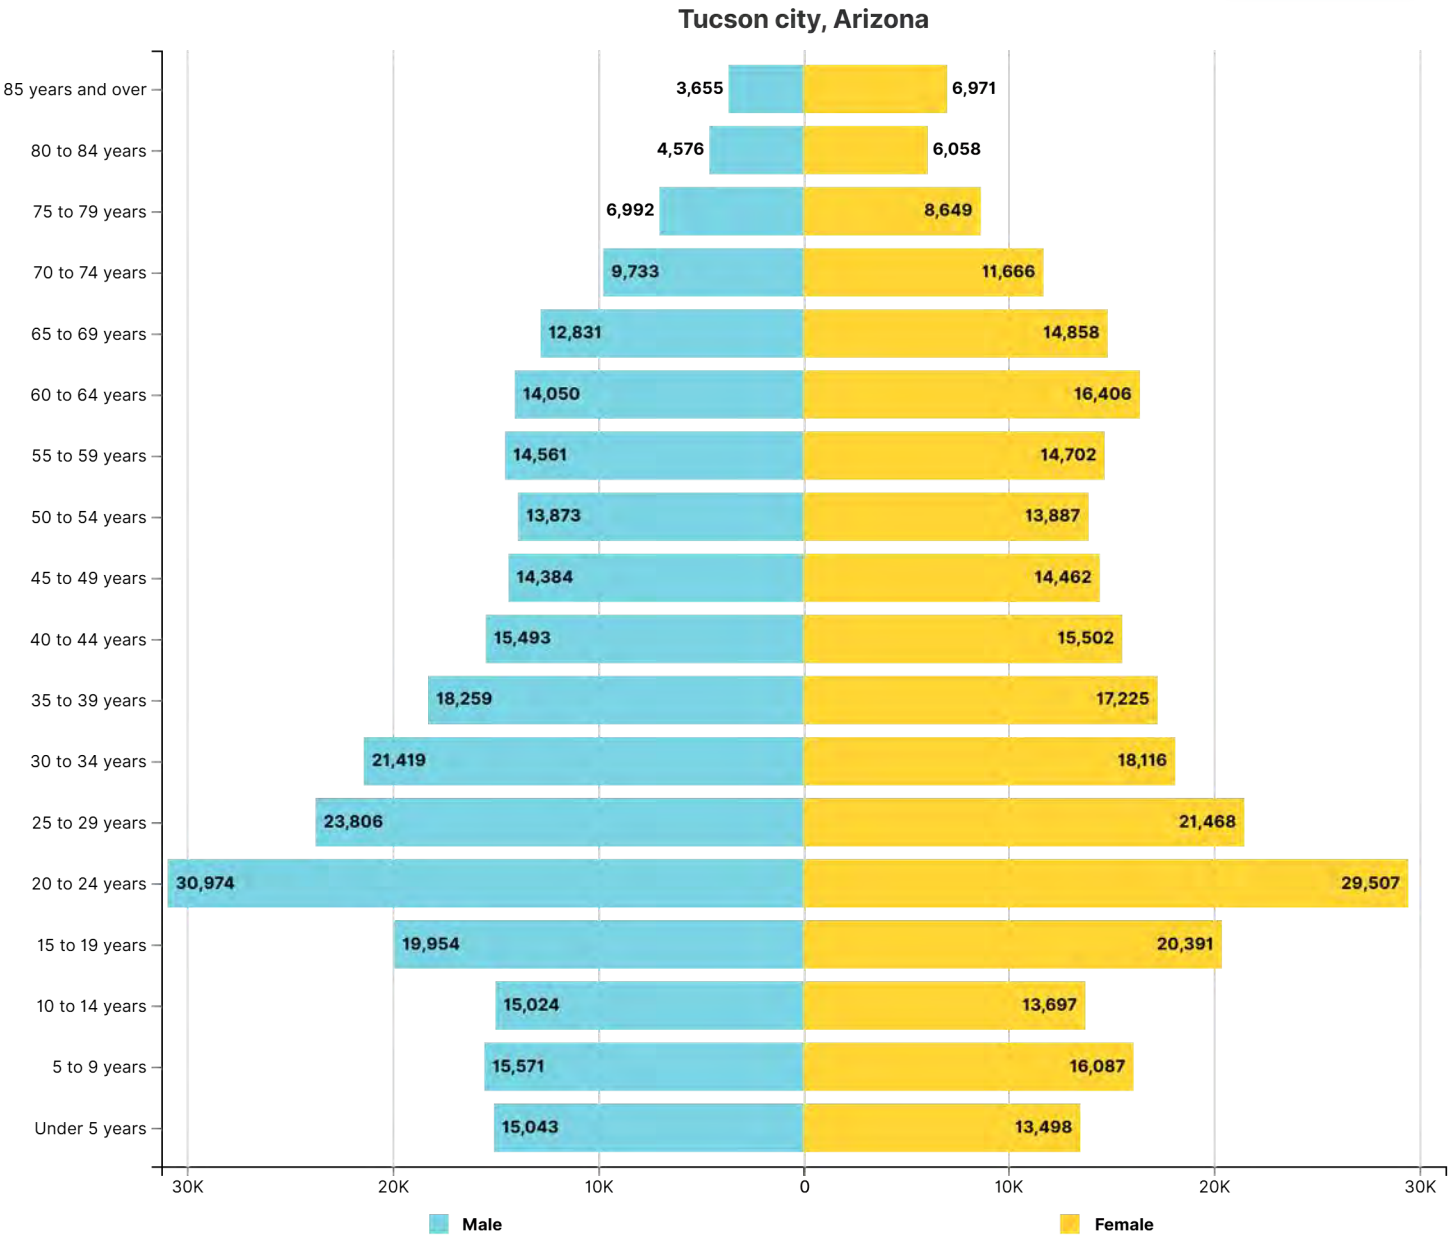

Display Margin of Error
S0101 | *2023 ACS 5-Year Estimates Subject Tables*

Language Spoken at Home

31.3% ± 1.9%
Language Other Than English Spoken at Home in Tucson city, Arizona

25.9% ± 0.4%
Language Other Than English Spoken at Home in Arizona

S1601 | *2023 American Community Survey 1-Year Estimates*

Types of Language Spoken at Home
in Tucson city, Arizona

Share / Embed

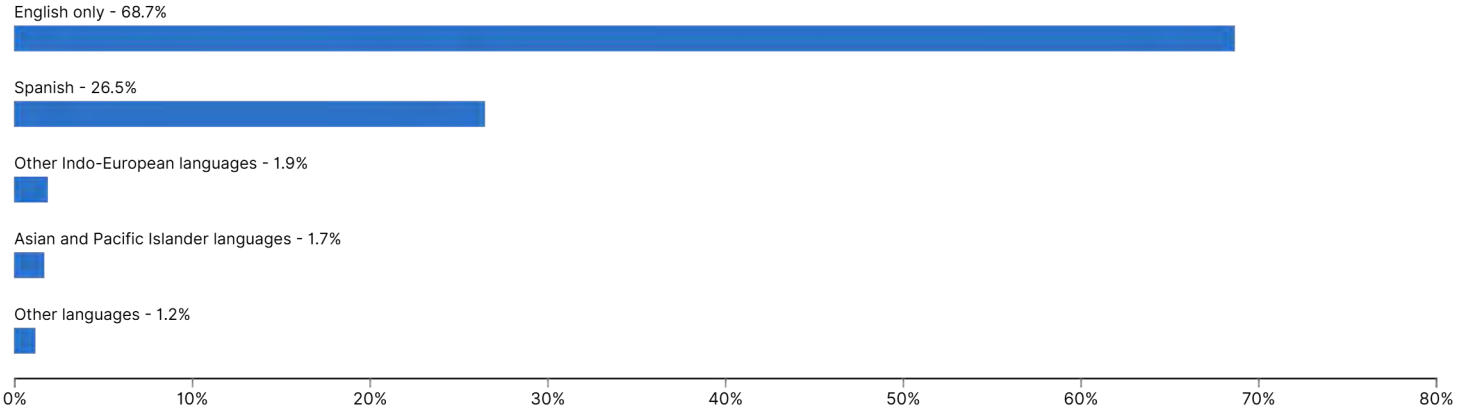

Display Margin of Error

S1601 | *2023 American Community Survey 1-Year Estimates*

Native and Foreign-Born

13.9% ± 1.3%
Foreign-Born population in Tucson city, Arizona

13.2% ± 0.3%
Foreign-Born population in Arizona

DP02 | *2023 American Community Survey 1-Year Estimates*

Foreign-Born Population
in Tucson city, Arizona

Share / Embed

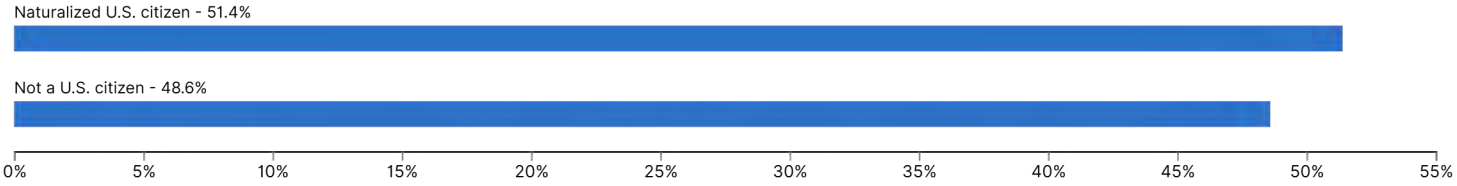

Display Margin of Error

DP02 | *2023 American Community Survey 1-Year Estimates*

Older Population

16.5% ± 0.9%
65 Years and Older in Tucson city, Arizona

19.3% ± 0.1%
65 Years and Older in Arizona

DP05 | *2023 American Community Survey 1-Year Estimates*

Older Population by Age
in Tucson city, Arizona

Share / Embed

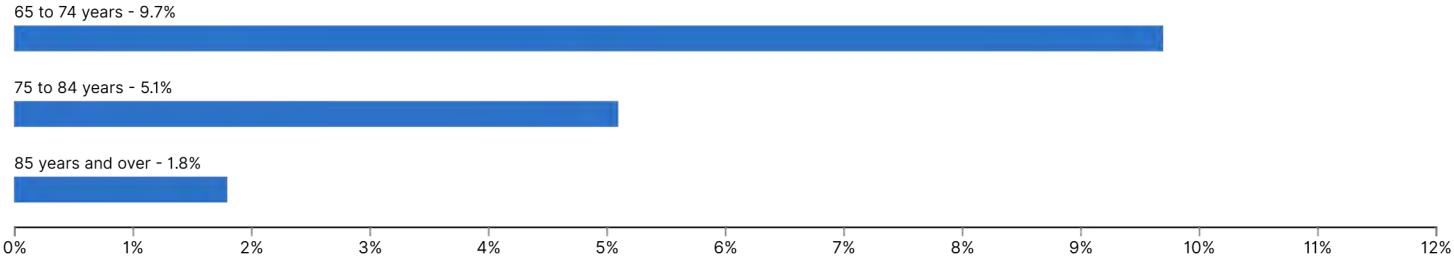

Display Margin of Error

DP05 | *2023 American Community Survey 1-Year Estimates*

Residential Mobility

3.8% ± 0.5%
Moved From a Different State in the Last Year in Tucson city, Arizona

3.5% ± 0.2%
Moved From a Different State in the Last Year in Arizona

S0701 | *2023 American Community Survey 1-Year Estimates*

Residential Mobility in the Last Year
in Tucson city, Arizona

Share / Embed

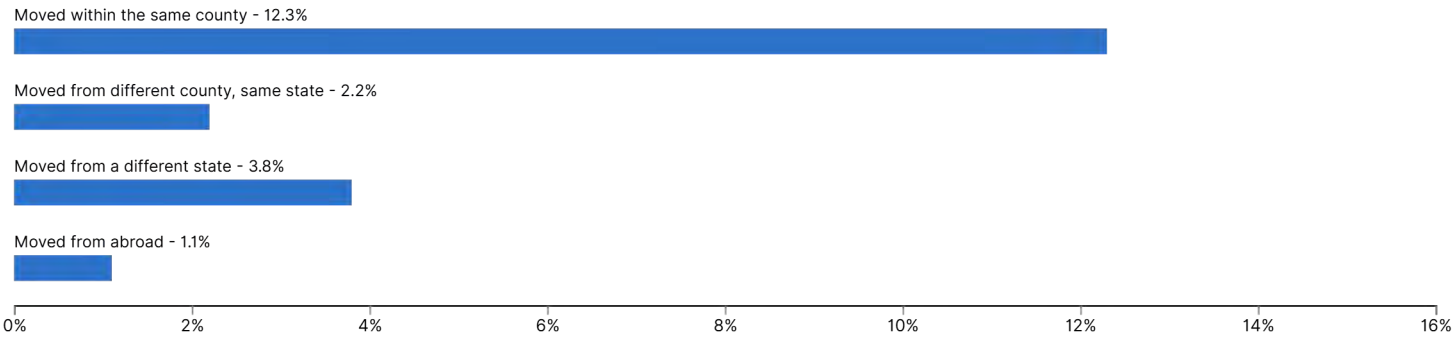

Display Margin of Error

S0701 | *2023 American Community Survey 1-Year Estimates*

Veterans

7.3% ± 0.7%
Veterans in Tucson city, Arizona

7.5% ± 0.2%
Veterans in Arizona

S2101 | *2023 American Community Survey 1-Year Estimates*

Veterans by Sex
in Tucson city, Arizona

Share / Embed

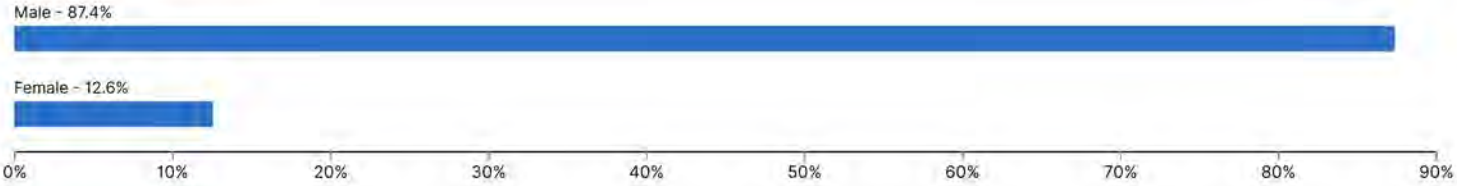

Display Margin of Error

S2101 | 2023 American Community Survey 1-Year Estimates

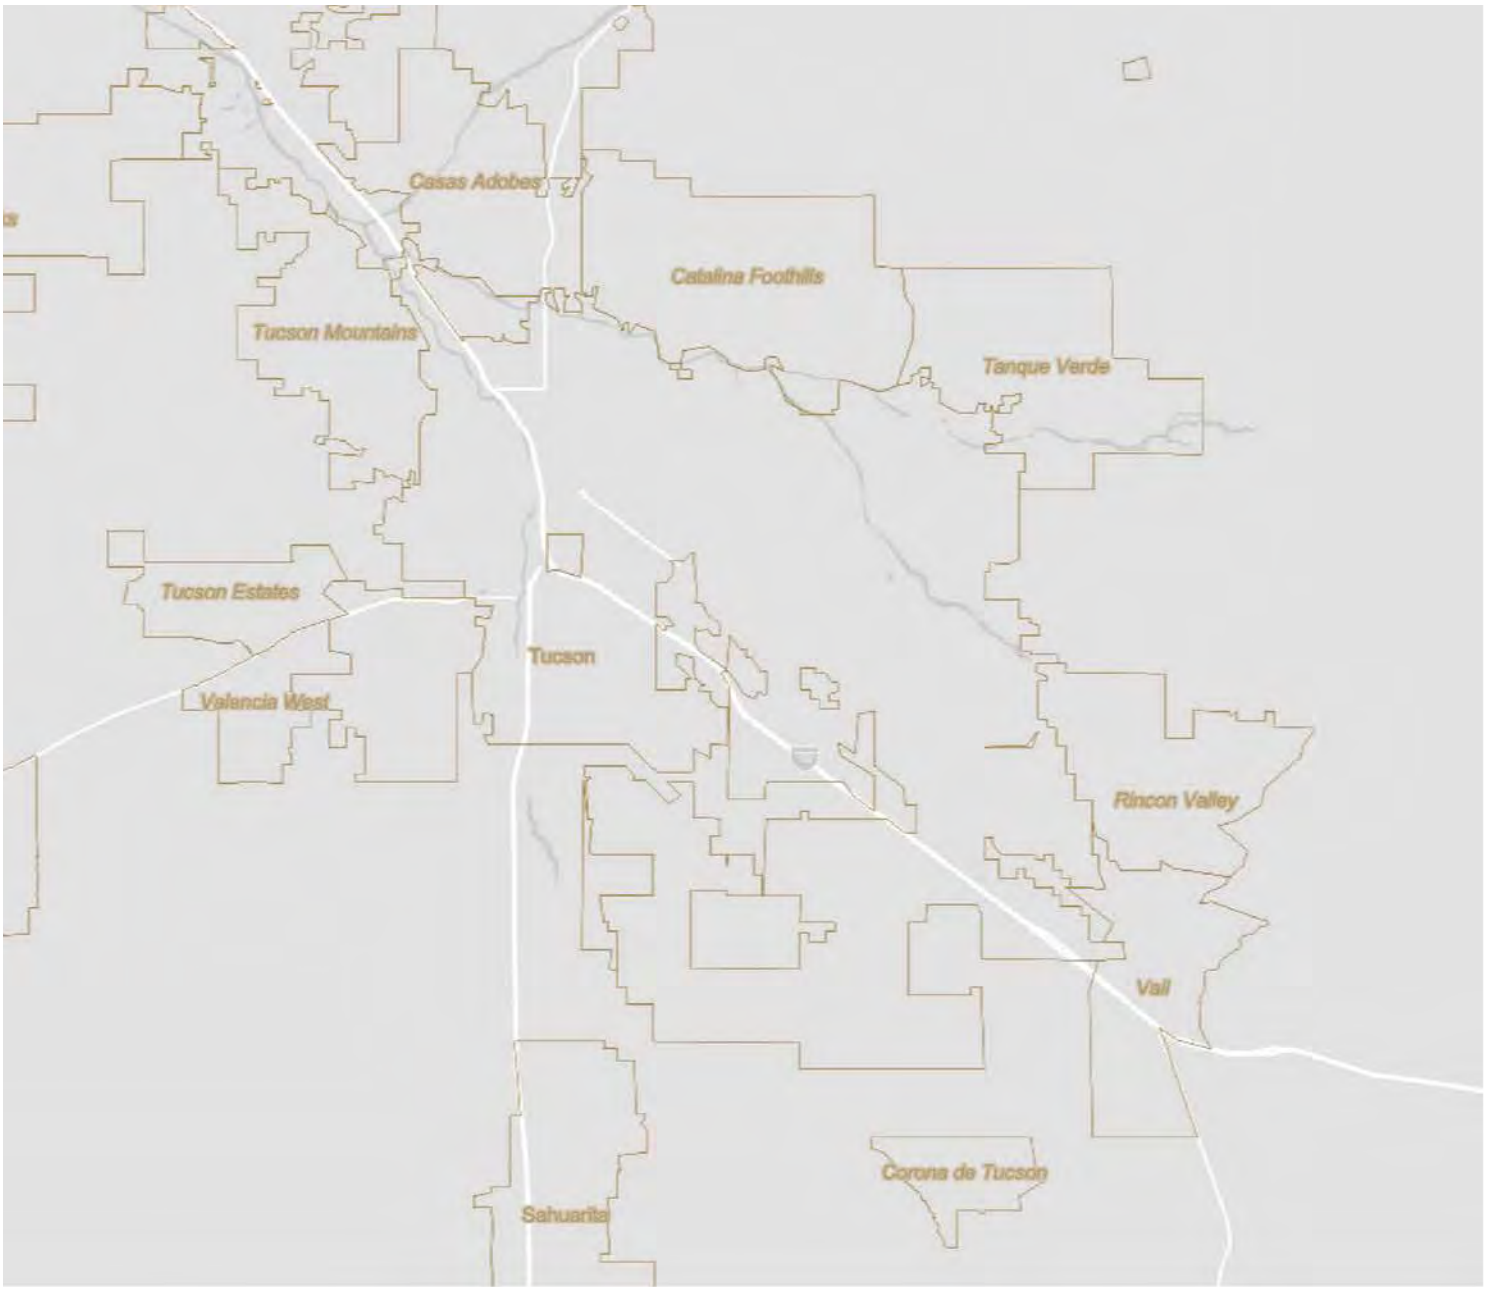

Source: undefined |

Income and Poverty

Income and Earnings

$55,708 ± $2,811
Median Household Income in Tucson city, Arizona

$77,315 ± $931
Median Household Income in Arizona

S1901 | *2023 American Community Survey 1-Year Estimates*

Median Income by Types of Families
in Tucson city, Arizona

Share / Embed

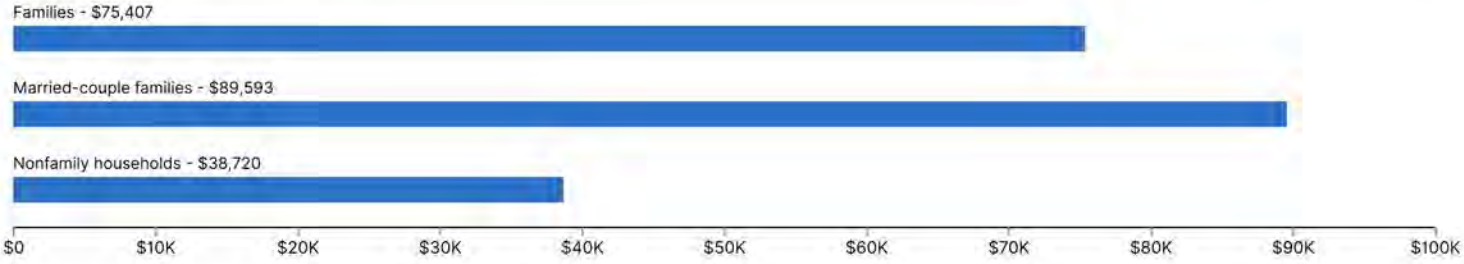

Display Margin of Error

S1901 | 2023 American Community Survey 1-Year Estimates

Poverty

18.6% ± 1.8%
Poverty, All people in Tucson city, Arizona

12.4% ± 0.4%
Poverty, All people in Arizona

S1701 | 2023 American Community Survey 1-Year Estimates

Poverty by Age
in Tucson city, Arizona

Share / Embed

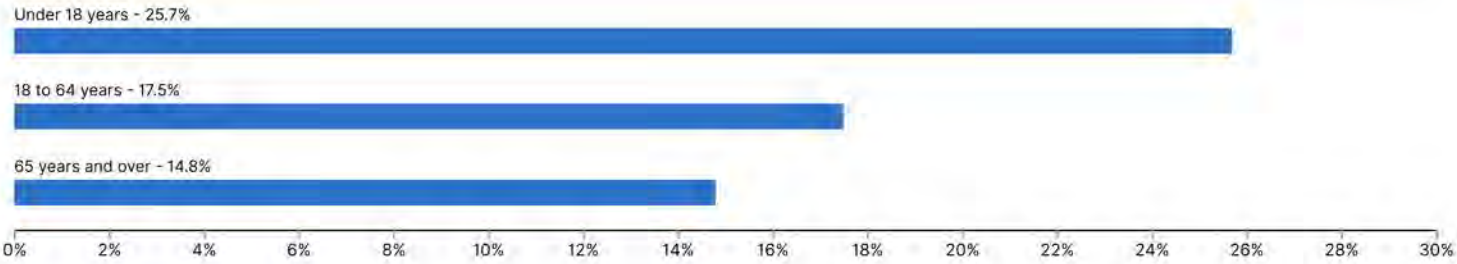

Display Margin of Error

S1701 | 2023 American Community Survey 1-Year Estimates

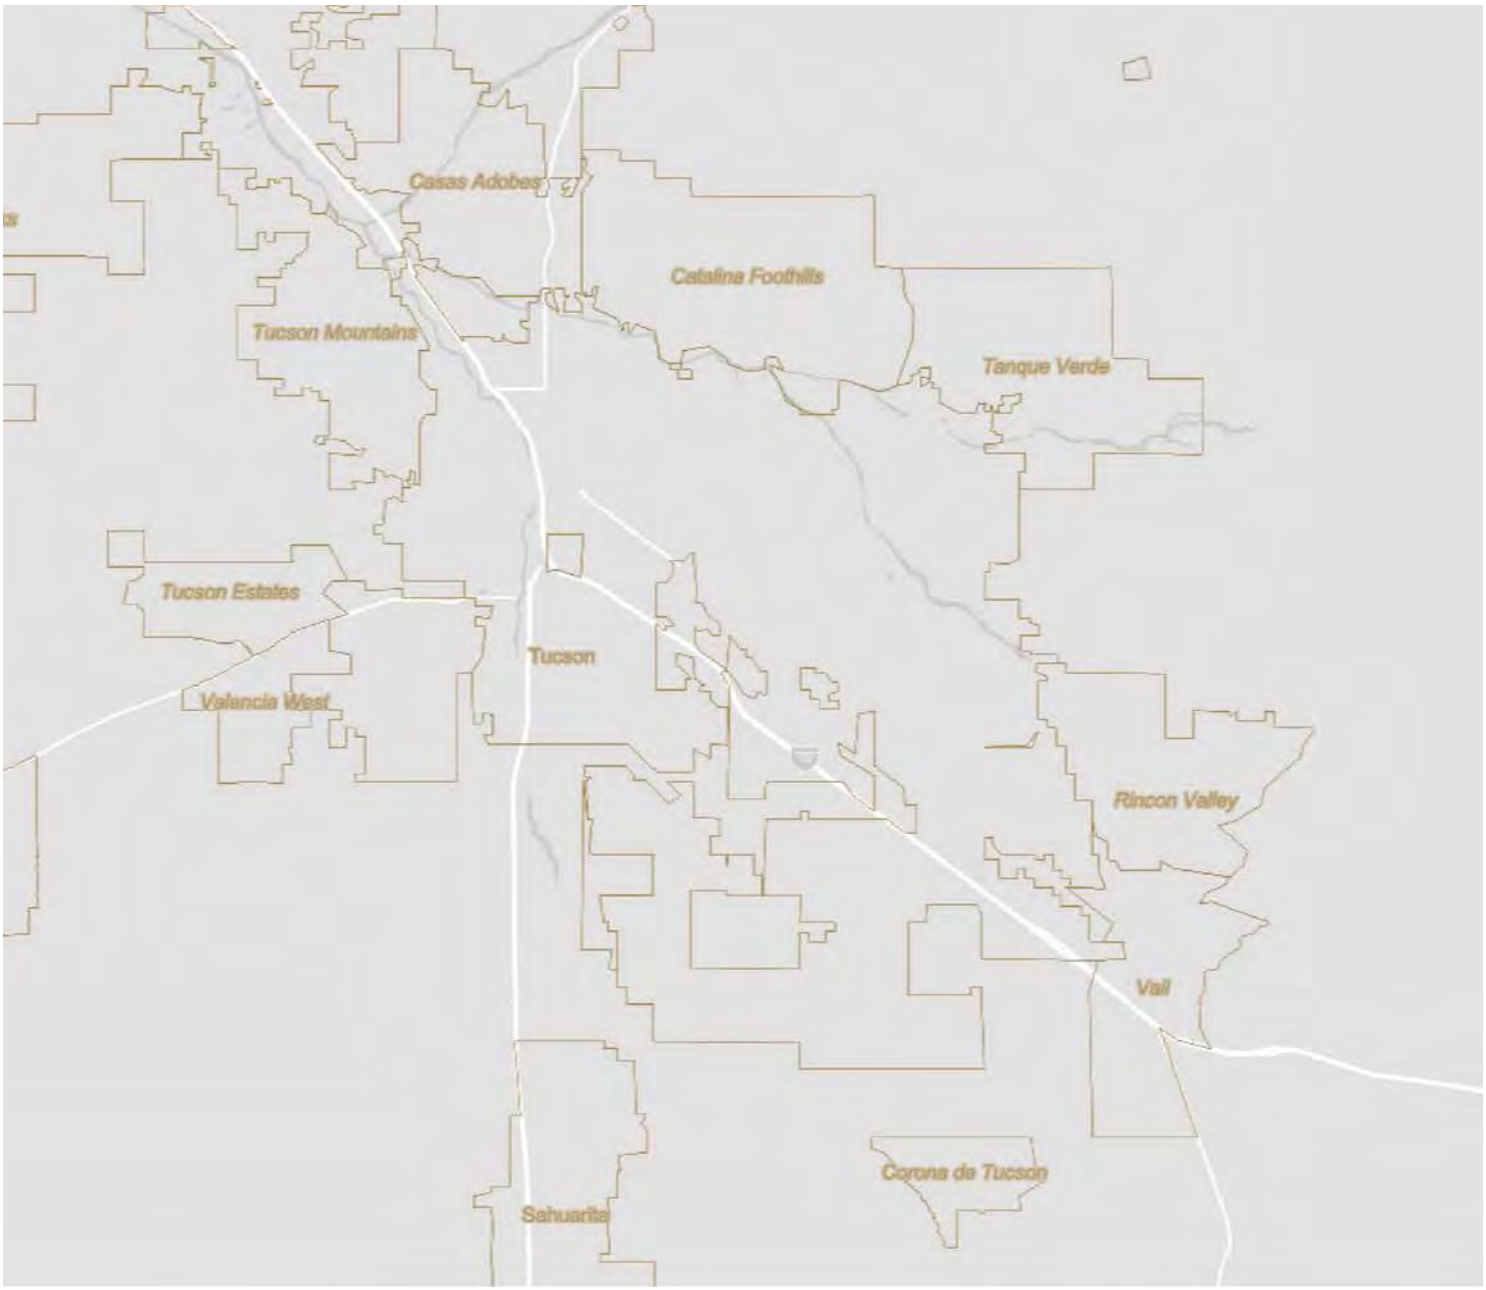

Source: undefined |

Education

Educational Attainment

31.3% ± 1.6%
Bachelor's Degree or Higher in Tucson city, Arizona

33.5% ± 0.4%
Bachelor's Degree or Higher in Arizona

S1501 | *2023 American Community Survey 1-Year Estimates*

Education Attainment (Population 25 Years and Older)
in Tucson city, Arizona

Share / Embed

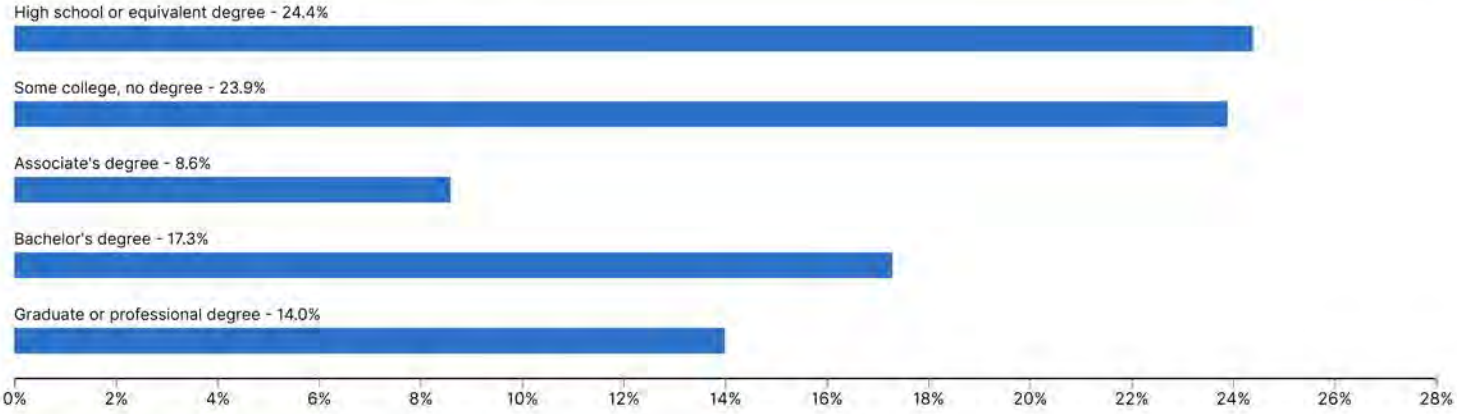

Display Margin of Error

S1501 | 2023 American Community Survey 1-Year Estimates

School Enrollment

53.9% ± 2.6%
School Enrolled Population Enrolled in Kindergarten to 12th Grade in Tucson city, Arizona

68.8% ± 0.6%
School Enrolled Population Enrolled in Kindergarten to 12th Grade in Arizona

S1401 | 2023 American Community Survey 1-Year Estimates

School Enrollment (Population 3 Years and Over Enrolled in School)
in Tucson city, Arizona

Share / Embed

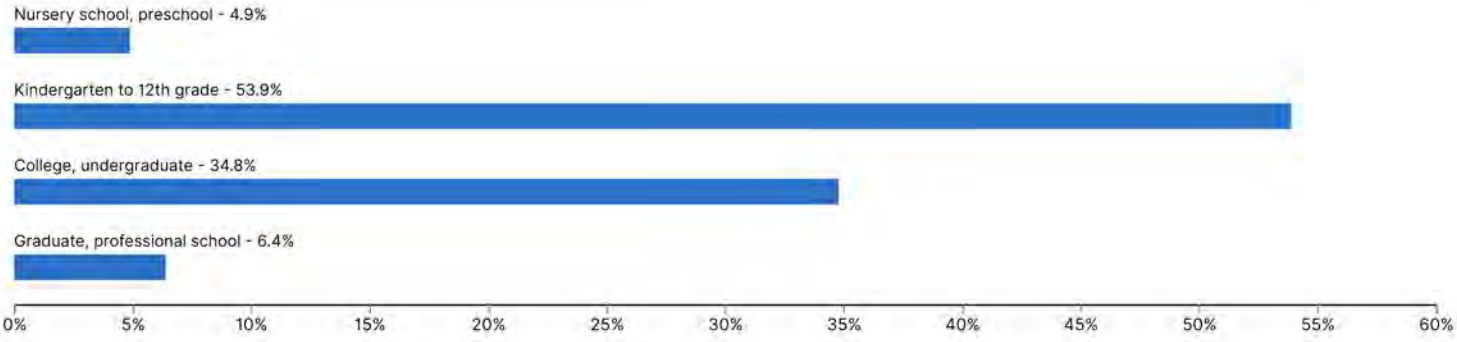

Display Margin of Error

S1401 | 2023 American Community Survey 1-Year Estimates

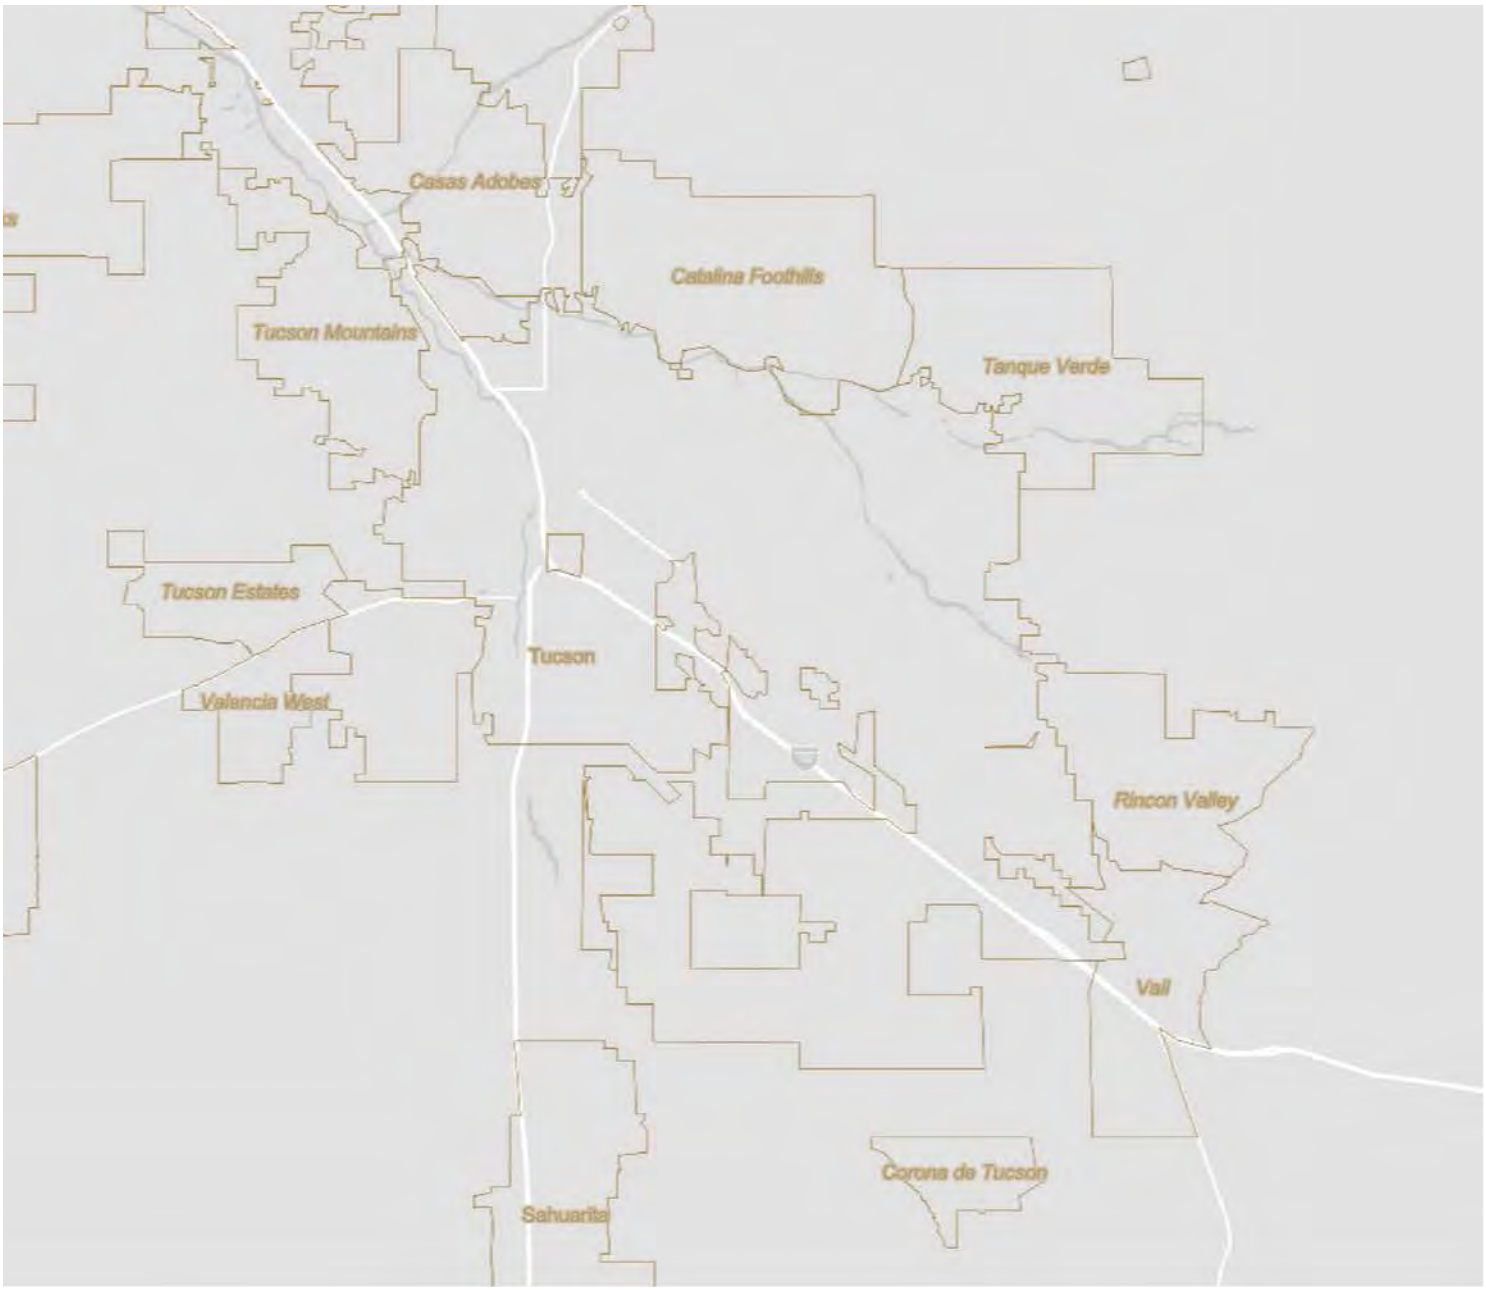

Source: undefined |

Employment

Class of Worker

17.4% ± 1.5%
Local, state, and federal government workers in Tucson city, Arizona

14.0% ± 0.4%
Local, state, and federal government workers in Arizona

S2406 | *2023 American Community Survey 1-Year Estimates*

Class of Worker
in Tucson city, Arizona

Share / Embed

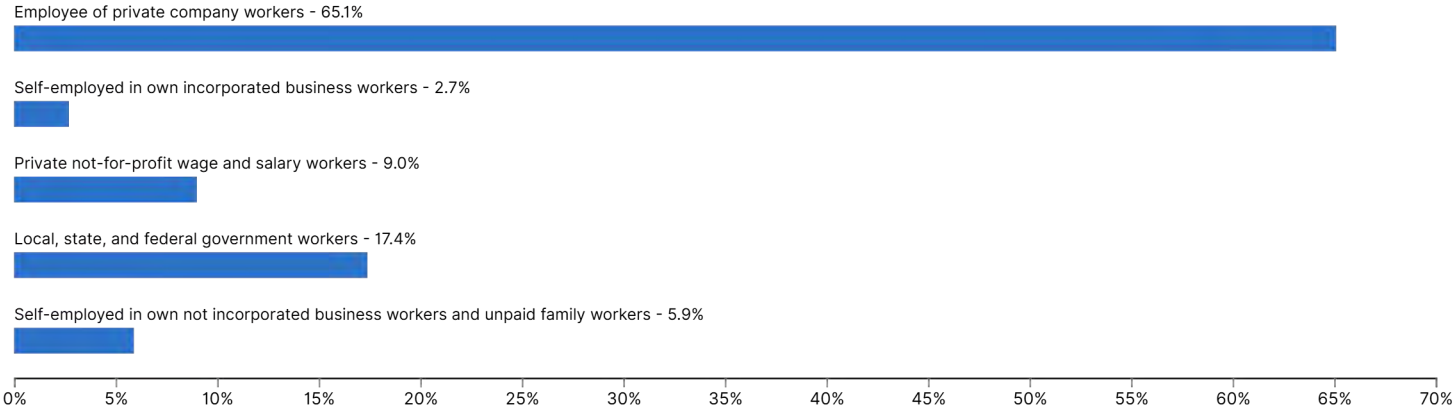

Display Margin of Error

S2406 | *2023 American Community Survey 1-Year Estimates*

Commuting

22.1 ± 0.7
Average travel time to work (in minutes) in Tucson city, Arizona

25.7 ± 0.3
Average travel time to work (in minutes) in Arizona

S0801 | *2023 American Community Survey 1-Year Estimates*

Means of Transportation to Work (Workers 16 Years and Over)
in Tucson city, Arizona

Share / Embed

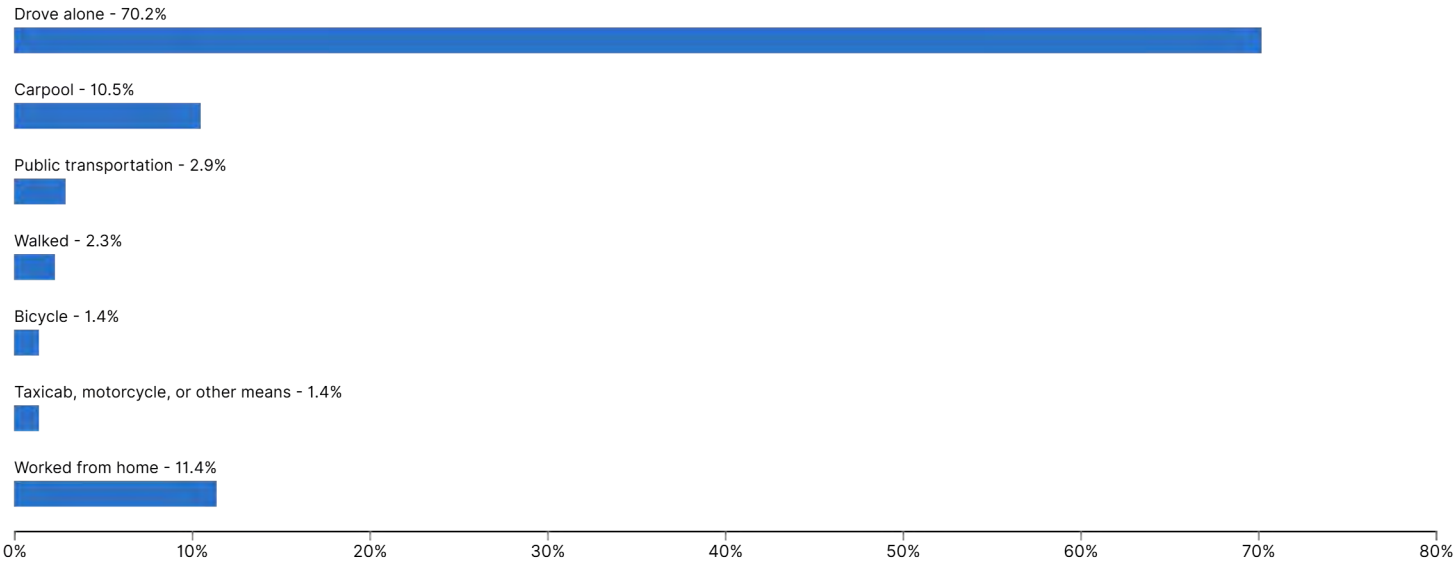

Display Margin of Error

S0801 | *2023 American Community Survey 1-Year Estimates*

Employment and Labor Force Status

59.2% ± 1.5%
Employment Rate in Tucson city, Arizona

57.8% ± 0.4%
Employment Rate in Arizona

DP03 | *2023 American Community Survey 1-Year Estimates*

Industry

Industry for the Civilian Employed Population 16 Years and Over
in Tucson city, Arizona

Share / Embed

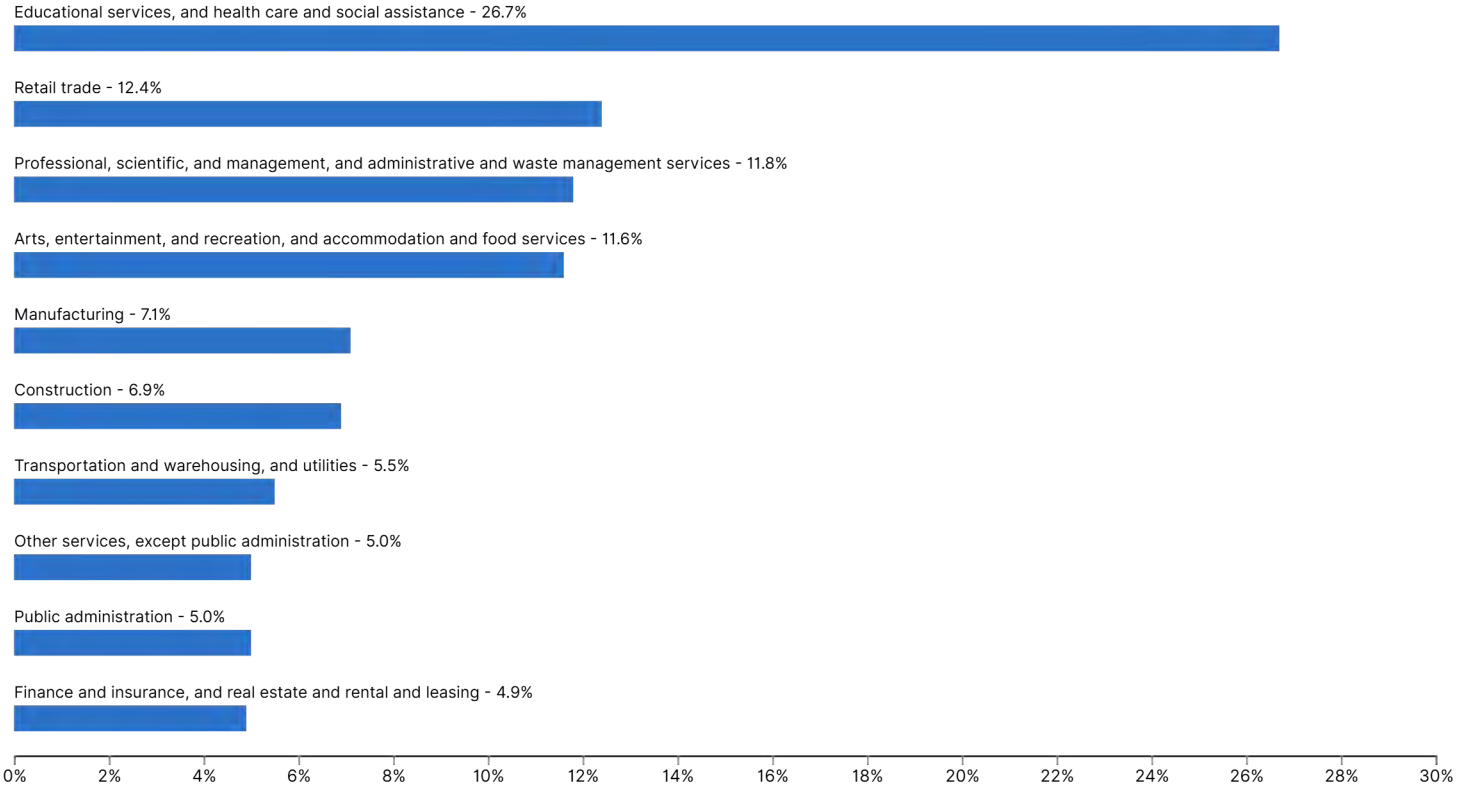

Display Margin of Error

DP03 | *2023 American Community Survey 1-Year Estimates*

Occupation

Occupation for the Civilian Employed Population 16 Years and Over
in Tucson city, Arizona

Share / Embed

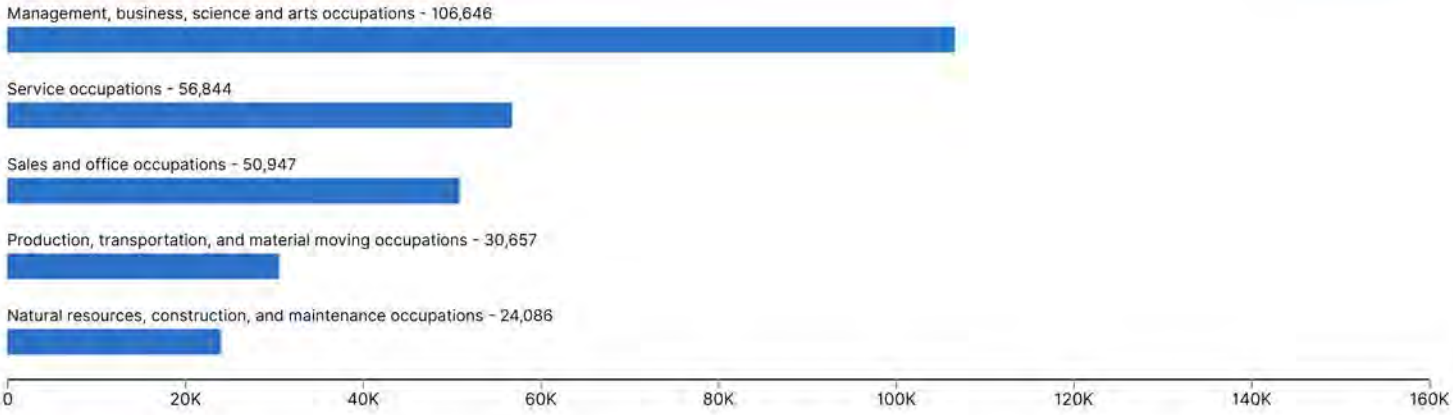

Display Margin of Error

S2401 | 2023 American Community Survey 1-Year Estimates

Work Experience

37.2 ± 0.5
Mean Usual Hours Worked for Workers in Tucson city, Arizona

38.5 ± 0.1
Mean Usual Hours Worked for Workers in Arizona

S2303 | 2023 American Community Survey 1-Year Estimates

Mean Usual Hours Worked for Workers by Sex
in Tucson city, Arizona

Share / Embed

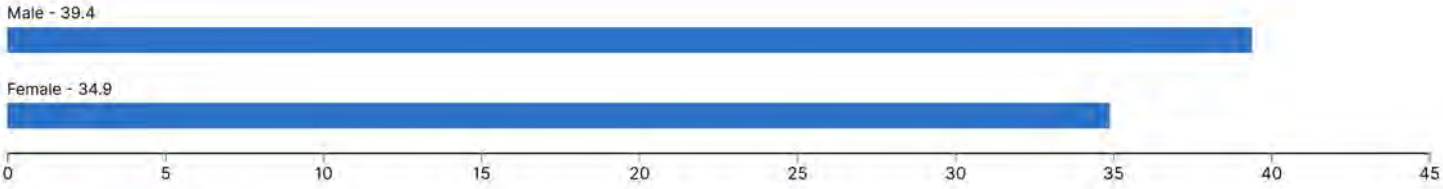

Display Margin of Error

S2303 | 2023 American Community Survey 1-Year Estimates

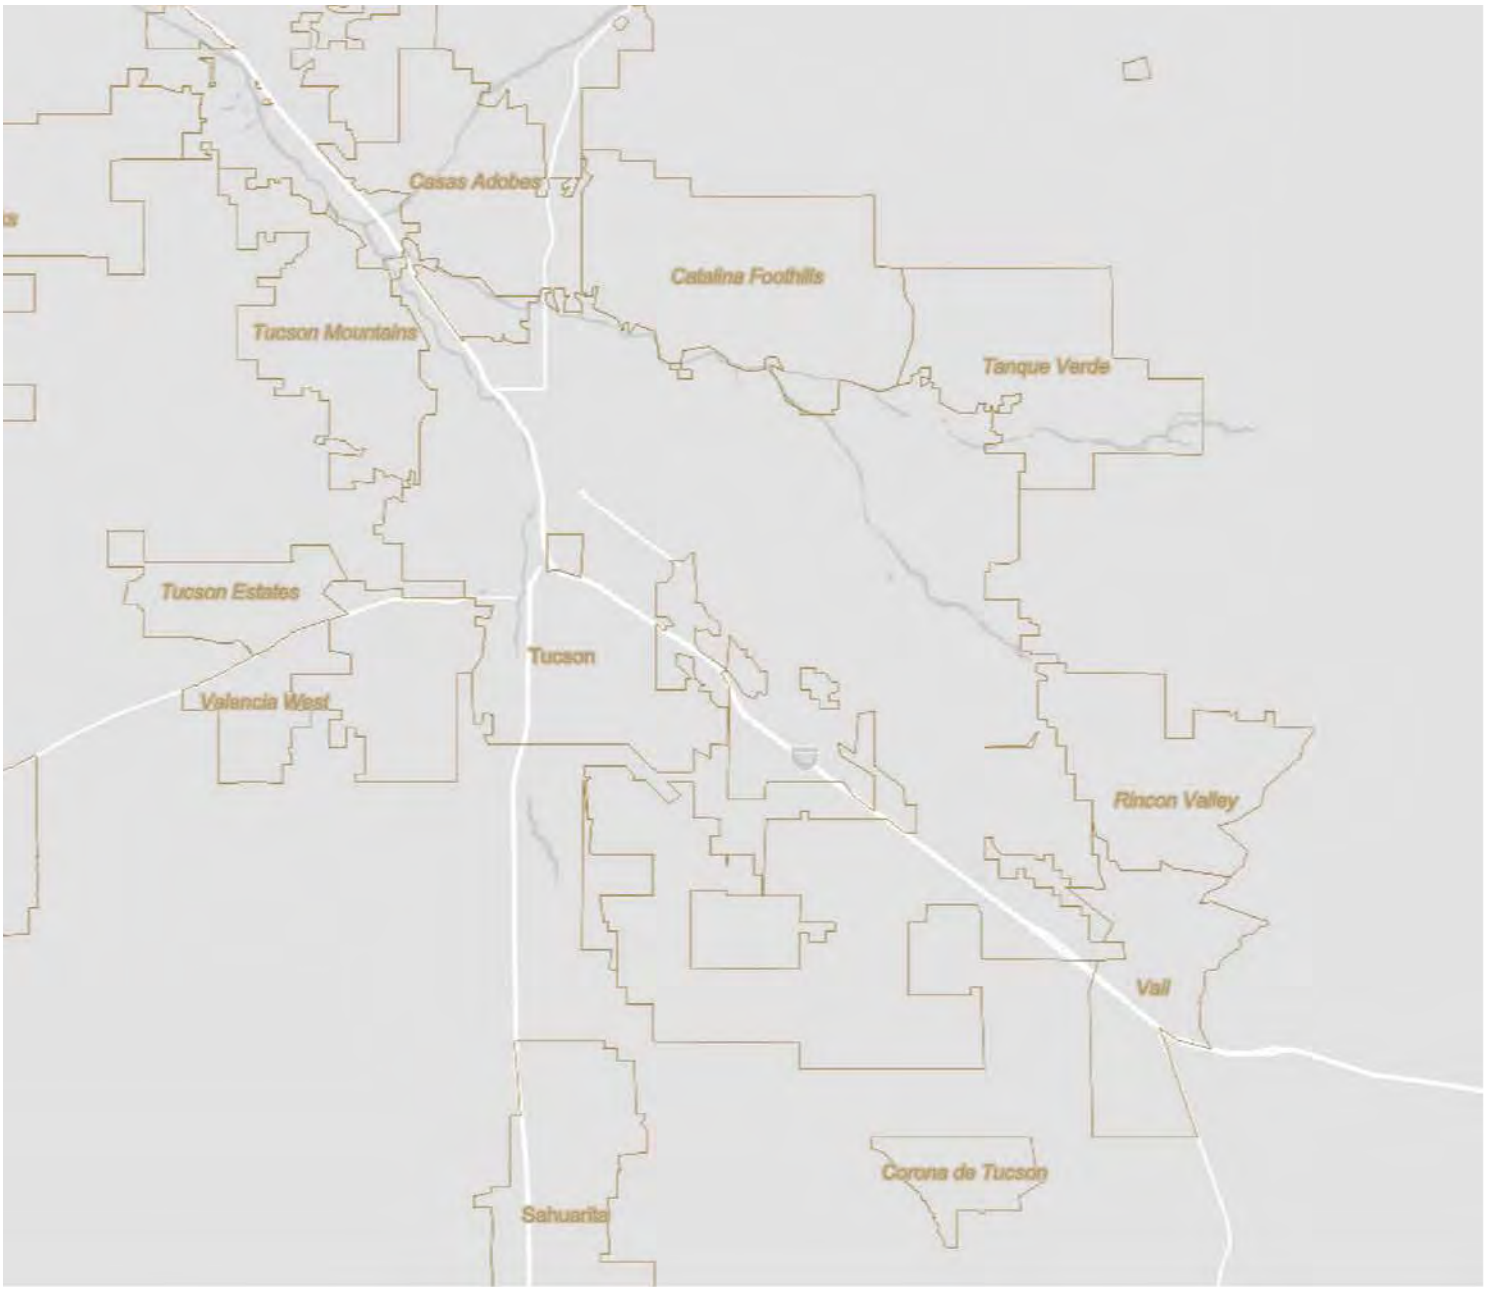

Source: undefined |

Employment

Class of Worker

17.4% ± 1.5%
Local, state, and federal government workers in Tucson city, Arizona

14.0% ± 0.4%
Local, state, and federal government workers in Arizona

S2406 | *2023 American Community Survey 1-Year Estimates*

Class of Worker
in Tucson city, Arizona

Share / Embed

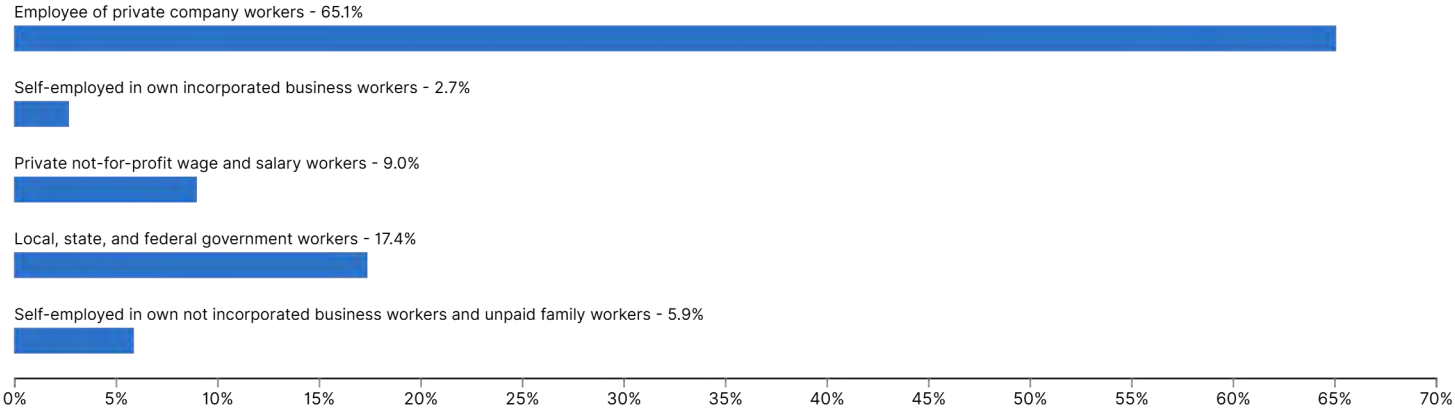

Display Margin of Error

S2406 | *2023 American Community Survey 1-Year Estimates*

Commuting

22.1 ± 0.7
Average travel time to work (in minutes) in Tucson city, Arizona

25.7 ± 0.3
Average travel time to work (in minutes) in Arizona

S0801 | *2023 American Community Survey 1-Year Estimates*

Means of Transportation to Work (Workers 16 Years and Over)
in Tucson city, Arizona

Share / Embed

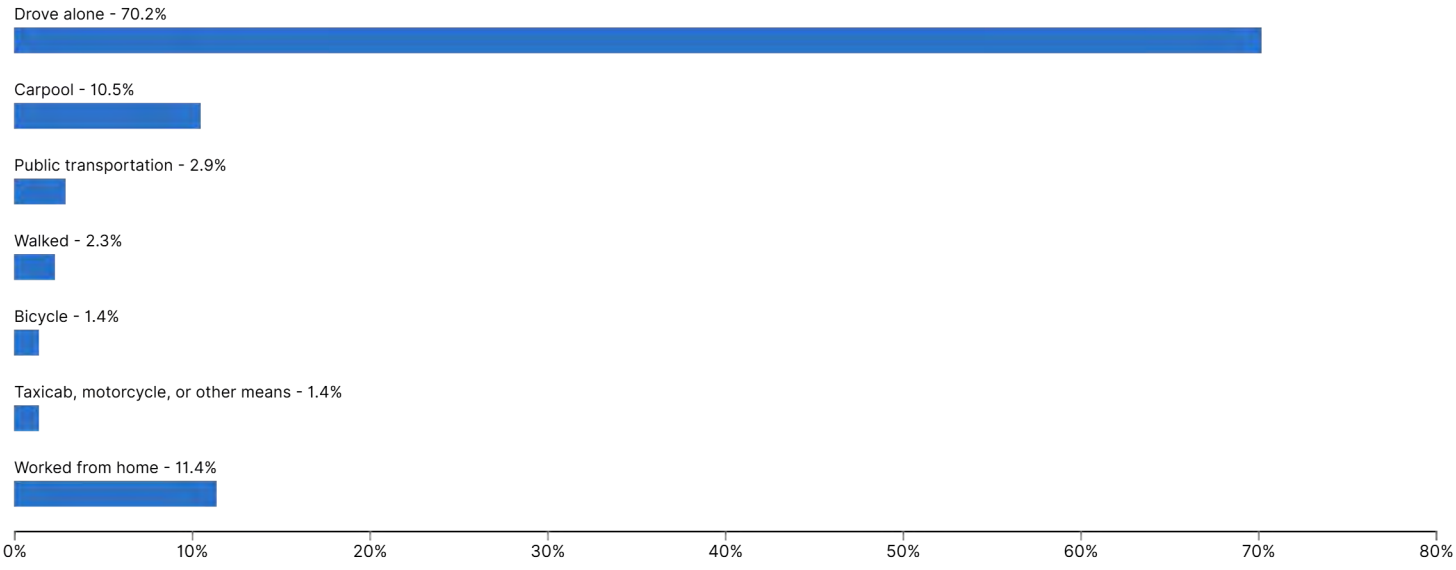

Display Margin of Error

S0801 | *2023 American Community Survey 1-Year Estimates*

Employment and Labor Force Status

59.2% ± 1.5%
Employment Rate in Tucson city, Arizona

57.8% ± 0.4%
Employment Rate in Arizona

DP03 | *2023 American Community Survey 1-Year Estimates*

Industry

Industry for the Civilian Employed Population 16 Years and Over
in Tucson city, Arizona

Share / Embed

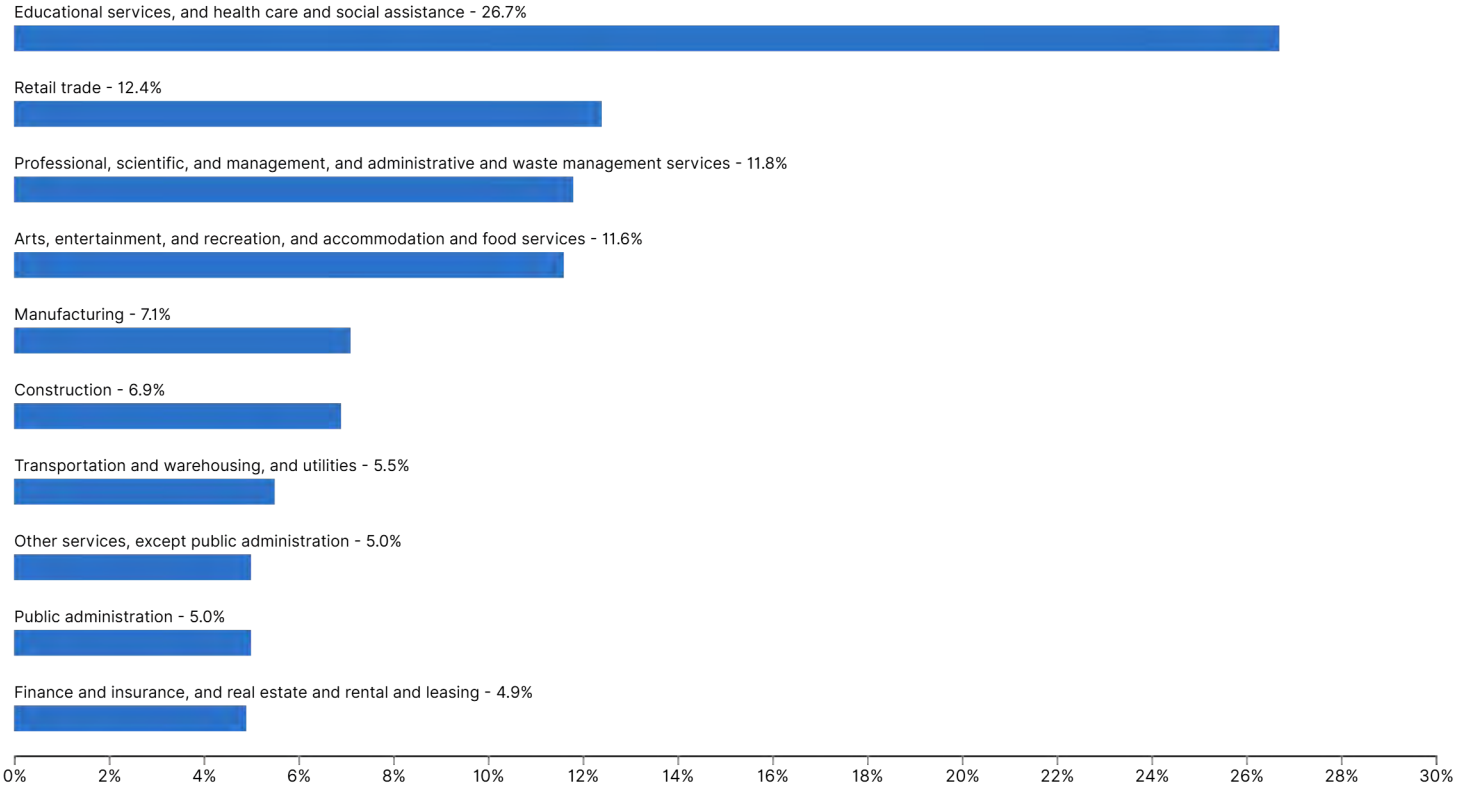

Display Margin of Error

DP03 | *2023 American Community Survey 1-Year Estimates*

Occupation

Occupation for the Civilian Employed Population 16 Years and Over
in Tucson city, Arizona

Share / Embed

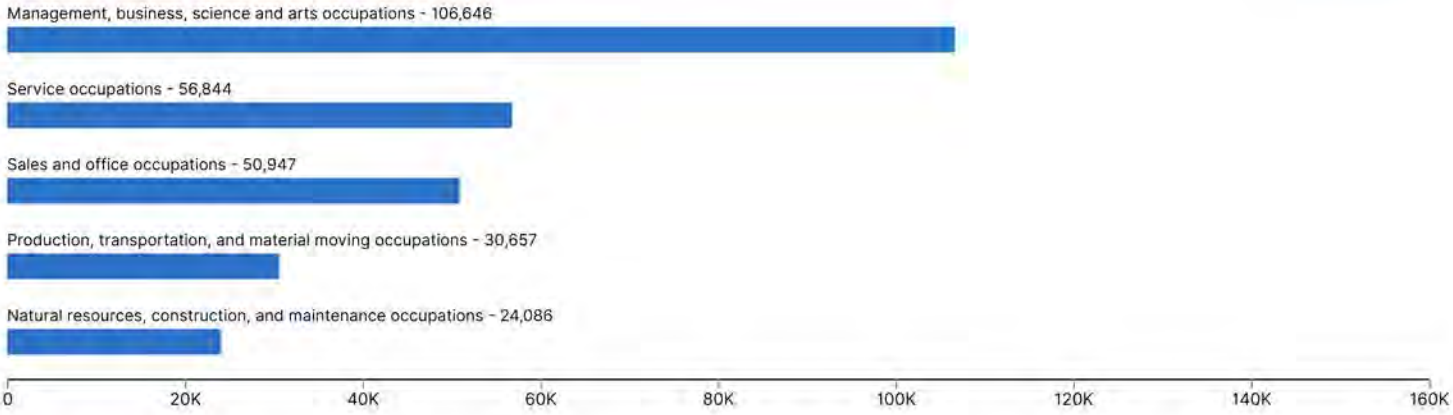

Display Margin of Error

S2401 | 2023 American Community Survey 1-Year Estimates

Work Experience

37.2 ± 0.5
Mean Usual Hours Worked for Workers in Tucson city, Arizona

38.5 ± 0.1
Mean Usual Hours Worked for Workers in Arizona

S2303 | 2023 American Community Survey 1-Year Estimates

Mean Usual Hours Worked for Workers by Sex
in Tucson city, Arizona

Share / Embed

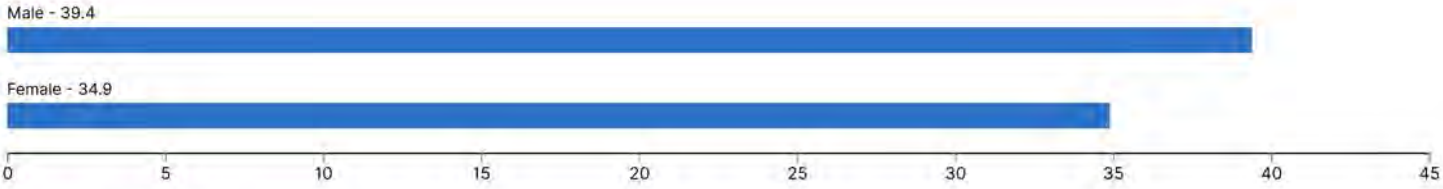

Display Margin of Error

S2303 | 2023 American Community Survey 1-Year Estimates

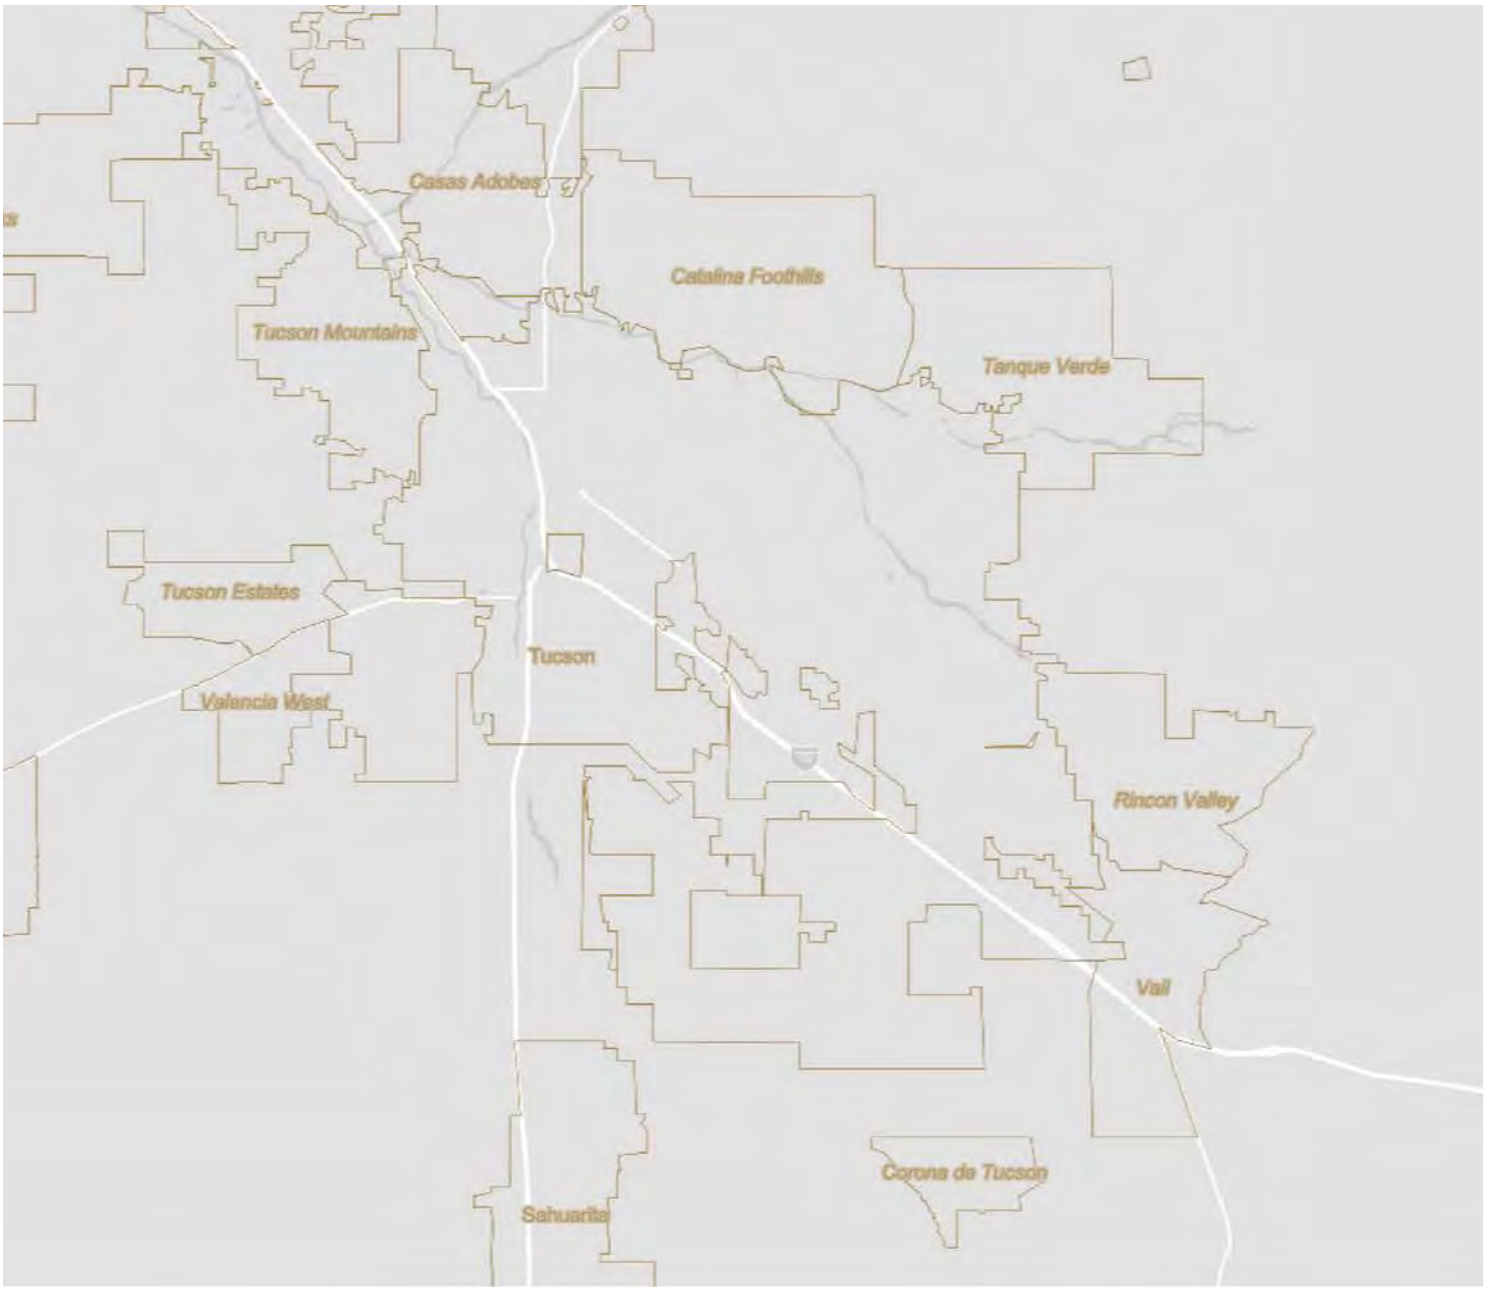

Source: undefined |

Housing

Financial Characteristics

$1,183 ± $29
Median Gross Rent in Tucson city, Arizona

$1,608 ± $16
Median Gross Rent in Arizona

DP04 | *2023 American Community Survey 1-Year Estimates*

Occupied Units Paying Rent
in Tucson city, Arizona

Share / Embed

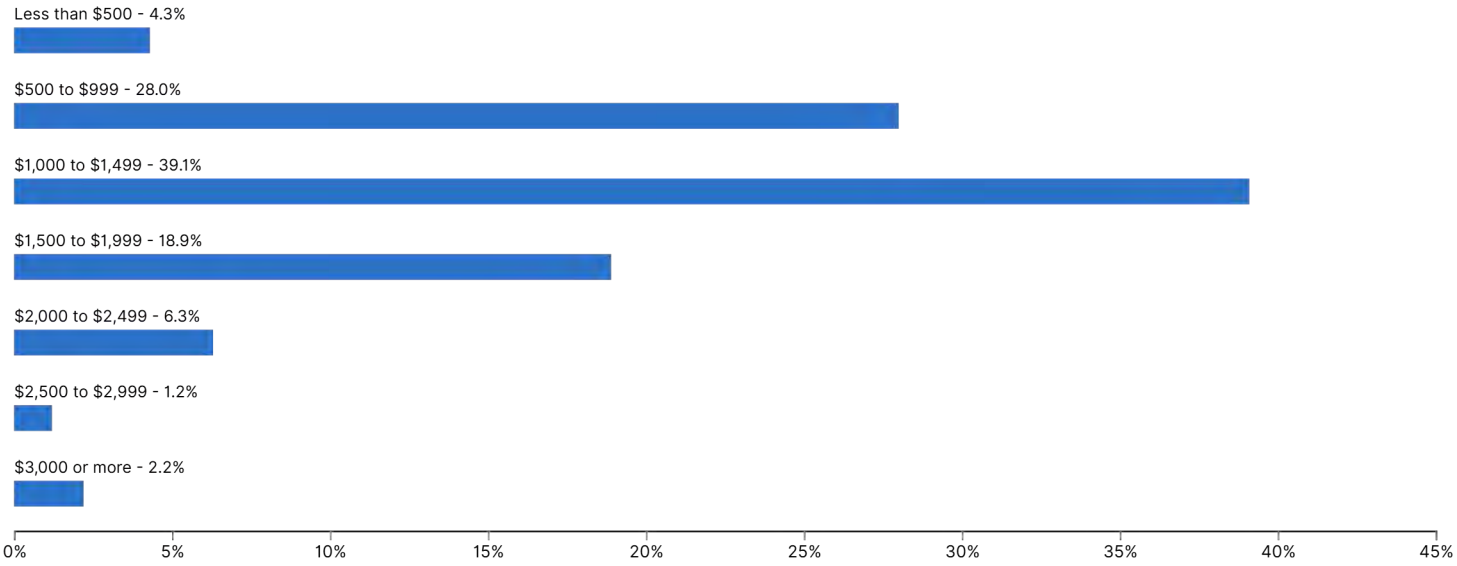

Display Margin of Error

DP04 | *2023 American Community Survey 1-Year Estimates*

Homeownership Rate

52.9% ± 1.8%
Homeownership Rate in Tucson city, Arizona

67.7% ± 0.5%
Homeownership Rate in Arizona

DP04 | *2023 American Community Survey 1-Year Estimates*

Housing Value
in Tucson city, Arizona

Share / Embed

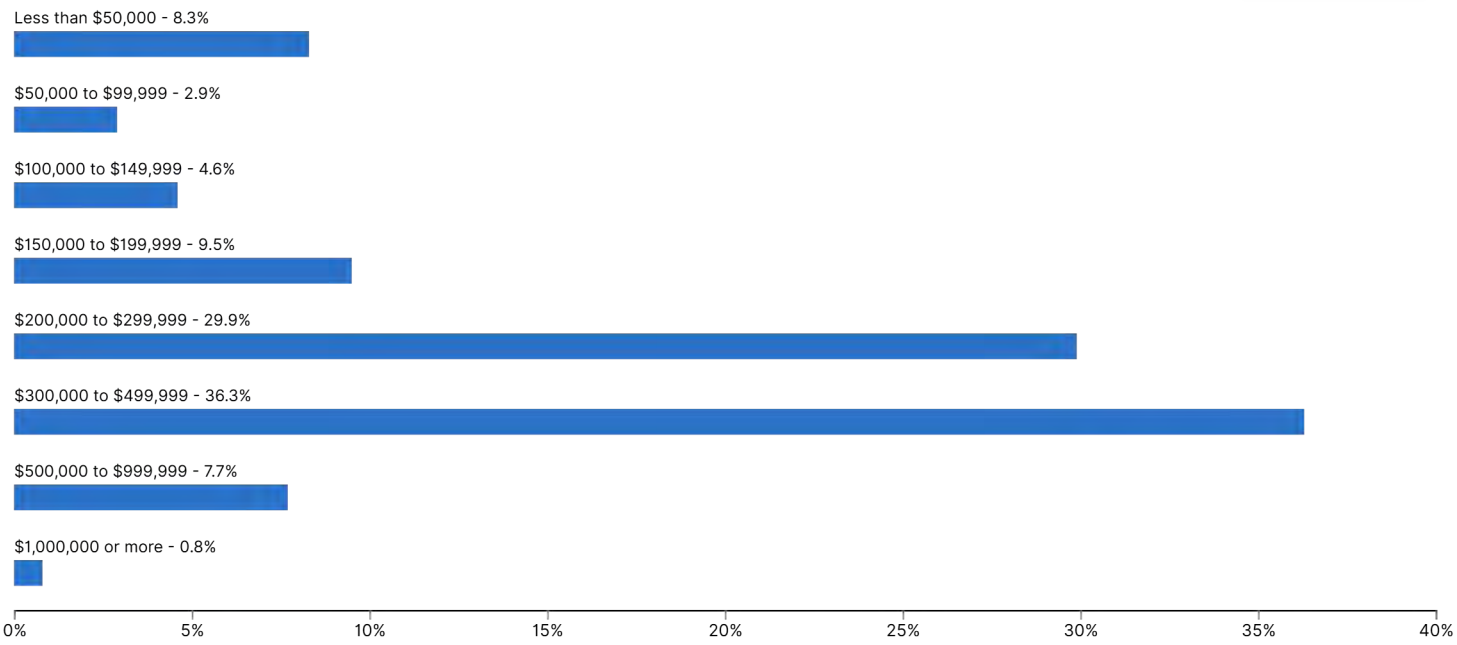

Display Margin of Error

DP04 | *2023 American Community Survey 1-Year Estimates*

Housing Units

242,798
Total Housing Units in Tucson city, Arizona

3,082,000
Total Housing Units in Arizona

H1 | *2020 Decennial Census*

Housing Occupancy
in Tucson city, Arizona

Share / Embed

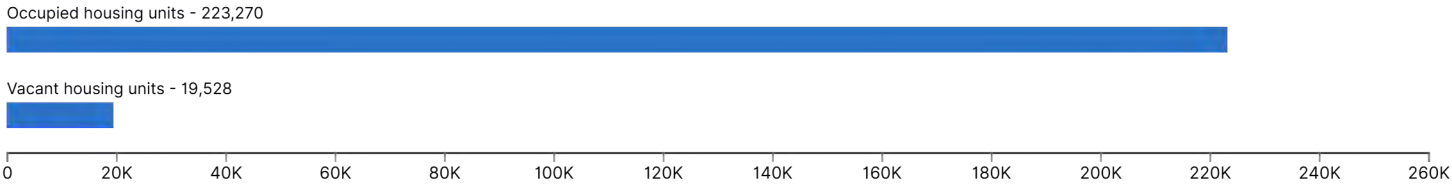

H1 | *2020 Decennial Census*

Occupancy Characteristics

223,270
Occupied Housing Units in Tucson city, Arizona

H1 | *2020 Decennial Census*

Owner Occupied Housing Units by Types of Households
in Tucson city, Arizona

Share / Embed

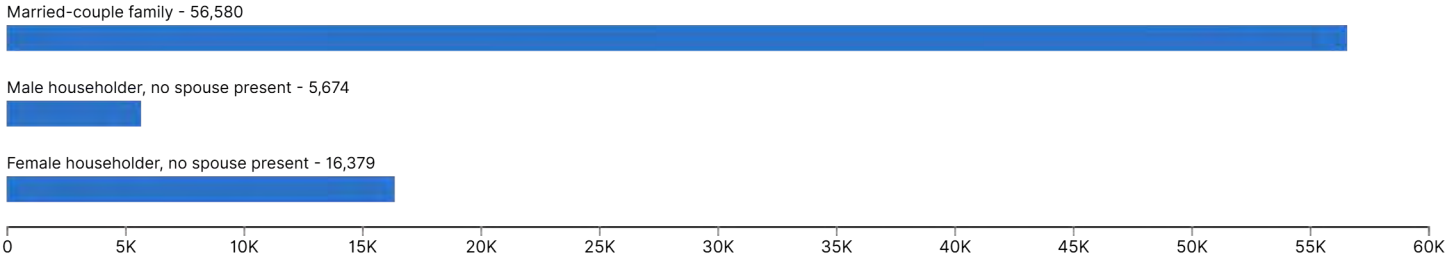

Display Margin of Error

S2501 | *2023 American Community Survey 1-Year Estimates*

Owner/Renter (Householder) Characteristics

35.8% ± 2.0%
Moved 2021 or Later Into Occupied Housing Unit in Tucson city, Arizona

29.9% ± 0.5%
Moved 2021 or Later Into Occupied Housing Unit in Arizona

S2502 | *2023 American Community Survey 1-Year Estimates*

Moved 2021 or Later Into Occupied Housing Unit by Type of Units
in Tucson city, Arizona

Share / Embed

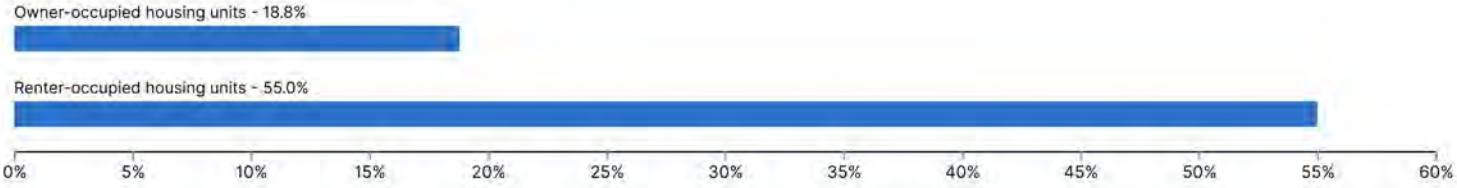

Display Margin of Error

S2502 | 2023 American Community Survey 1-Year Estimates

Physical Characteristics

16.3% ± 1.5%
Occupied Housing Units with Four or More Bedrooms in Tucson city, Arizona

25.5% ± 0.4%
Occupied Housing Units with Four or More Bedrooms in Arizona

S2504 | 2023 American Community Survey 1-Year Estimates

Bedrooms in Occupied Housing Units
in Tucson city, Arizona

Share / Embed

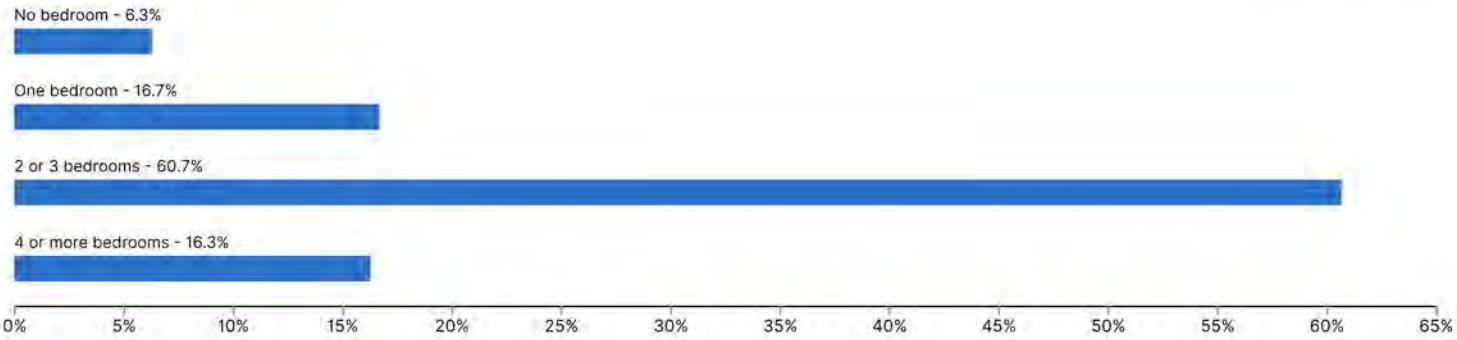

Display Margin of Error

S2504 | 2023 American Community Survey 1-Year Estimates

Vacancy

19,528
Vacant Housing Units in Tucson city, Arizona

H1 | 2020 Decennial Census

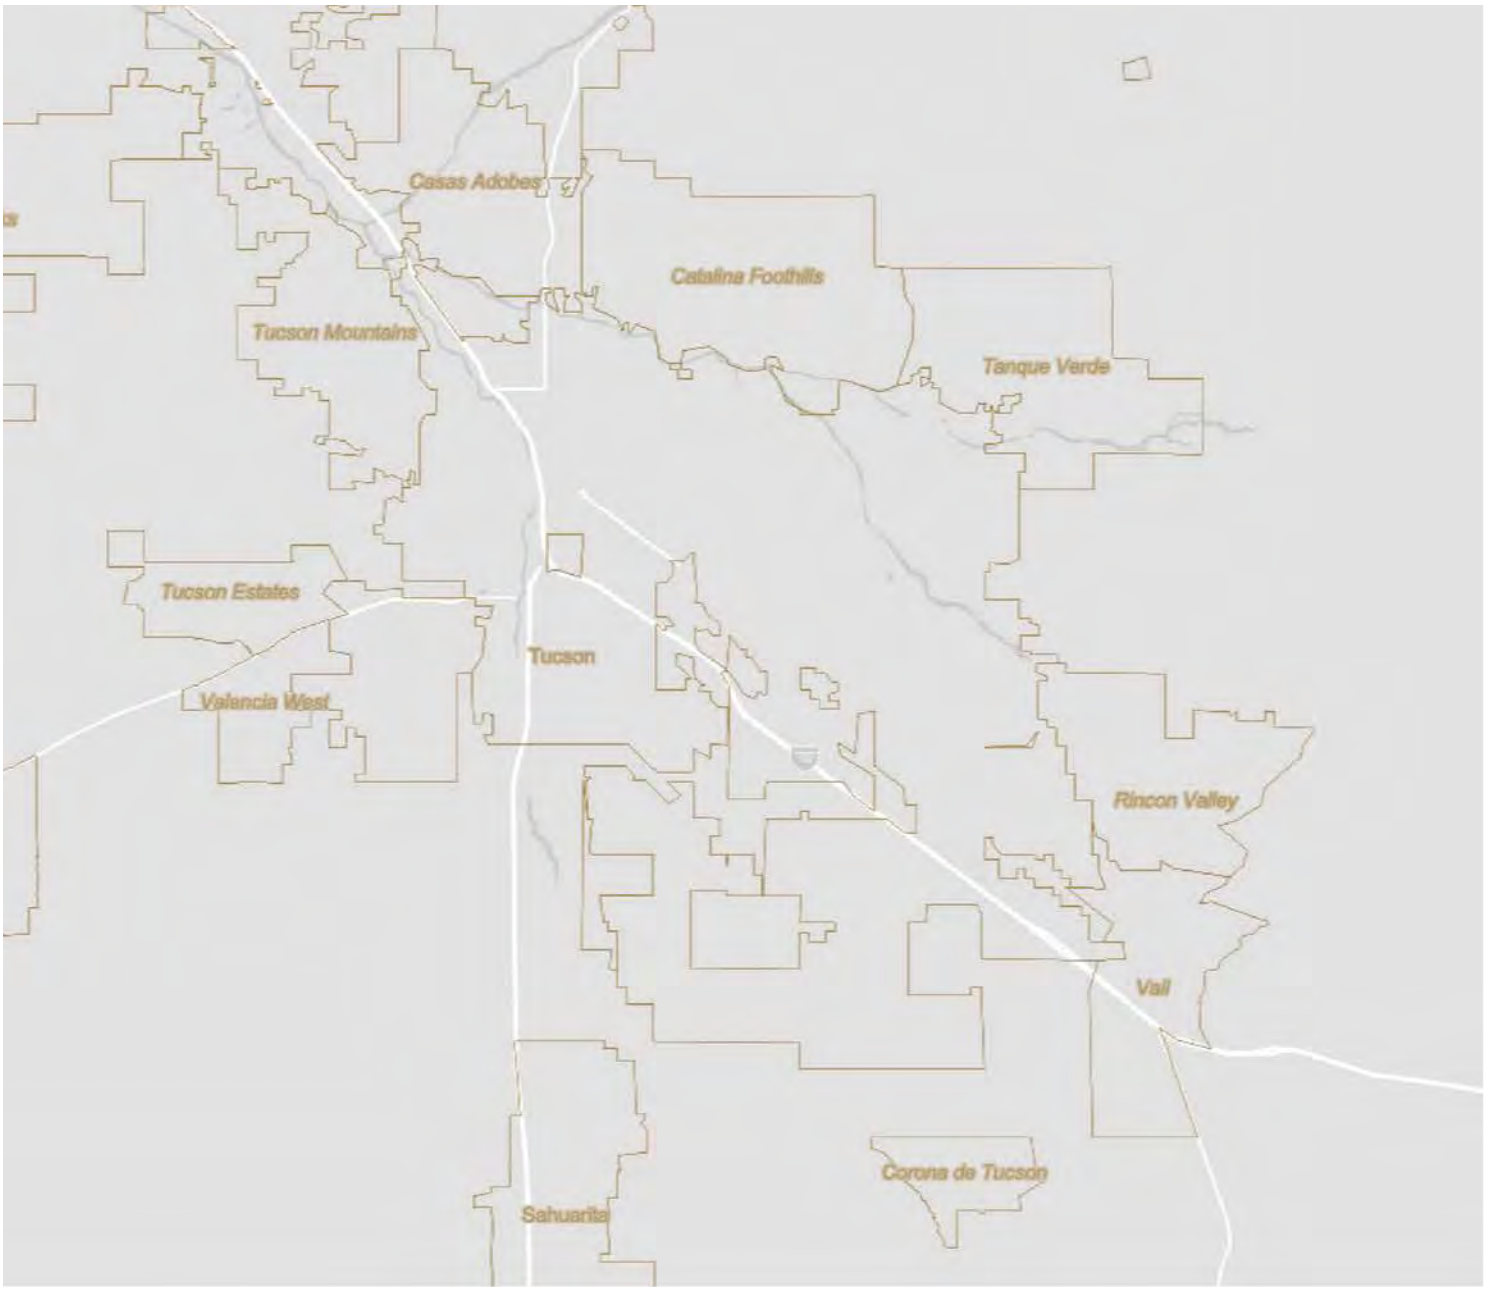

Source: undefined |

Health

Disability

15.3% ± 1.0%
Disabled Population in Tucson city, Arizona

14.0% ± 0.3%
Disabled Population in Arizona

S1810 | *2023 American Community Survey 1-Year Estimates*

Types of Disabilities
in Tucson city, Arizona

Share / Embed

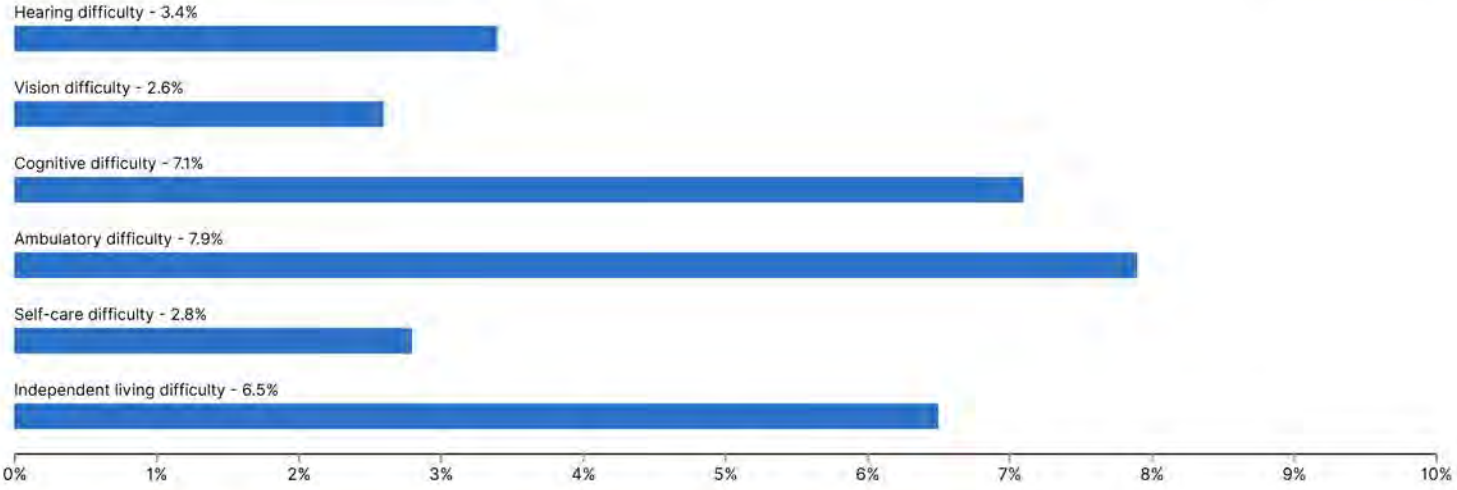

Display Margin of Error

S1810 | 2023 American Community Survey 1-Year Estimates

Fertility

142,064 ± 3,457
Women 15 to 50 years old in Tucson city, Arizona

1,695,321 ± 4,547
Women 15 to 50 years old in Arizona

S1301 | 2023 American Community Survey 1-Year Estimates

Women with Births in the Past 12 Months
in Tucson city, Arizona

Share / Embed

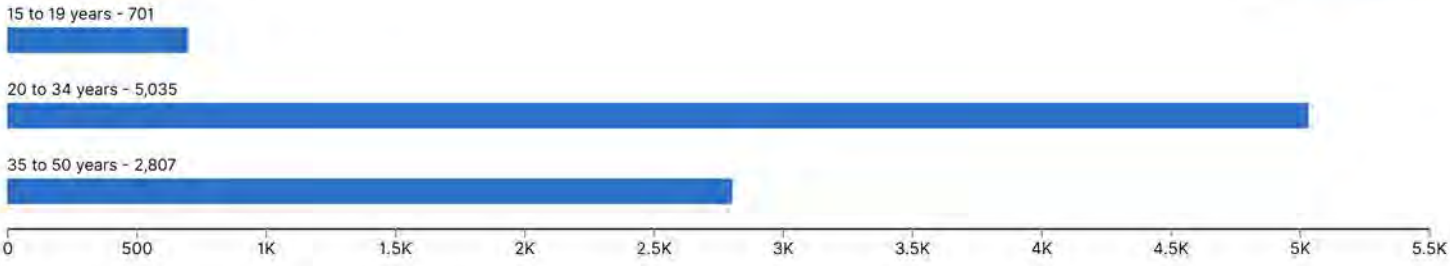

Display Margin of Error

S1301 | 2023 American Community Survey 1-Year Estimates

Health Insurance

10.5% ± 1.4%
Without Health Care Coverage in Tucson city, Arizona

9.9% ± 0.3%
Without Health Care Coverage in Arizona

S2701 | 2023 American Community Survey 1-Year Estimates

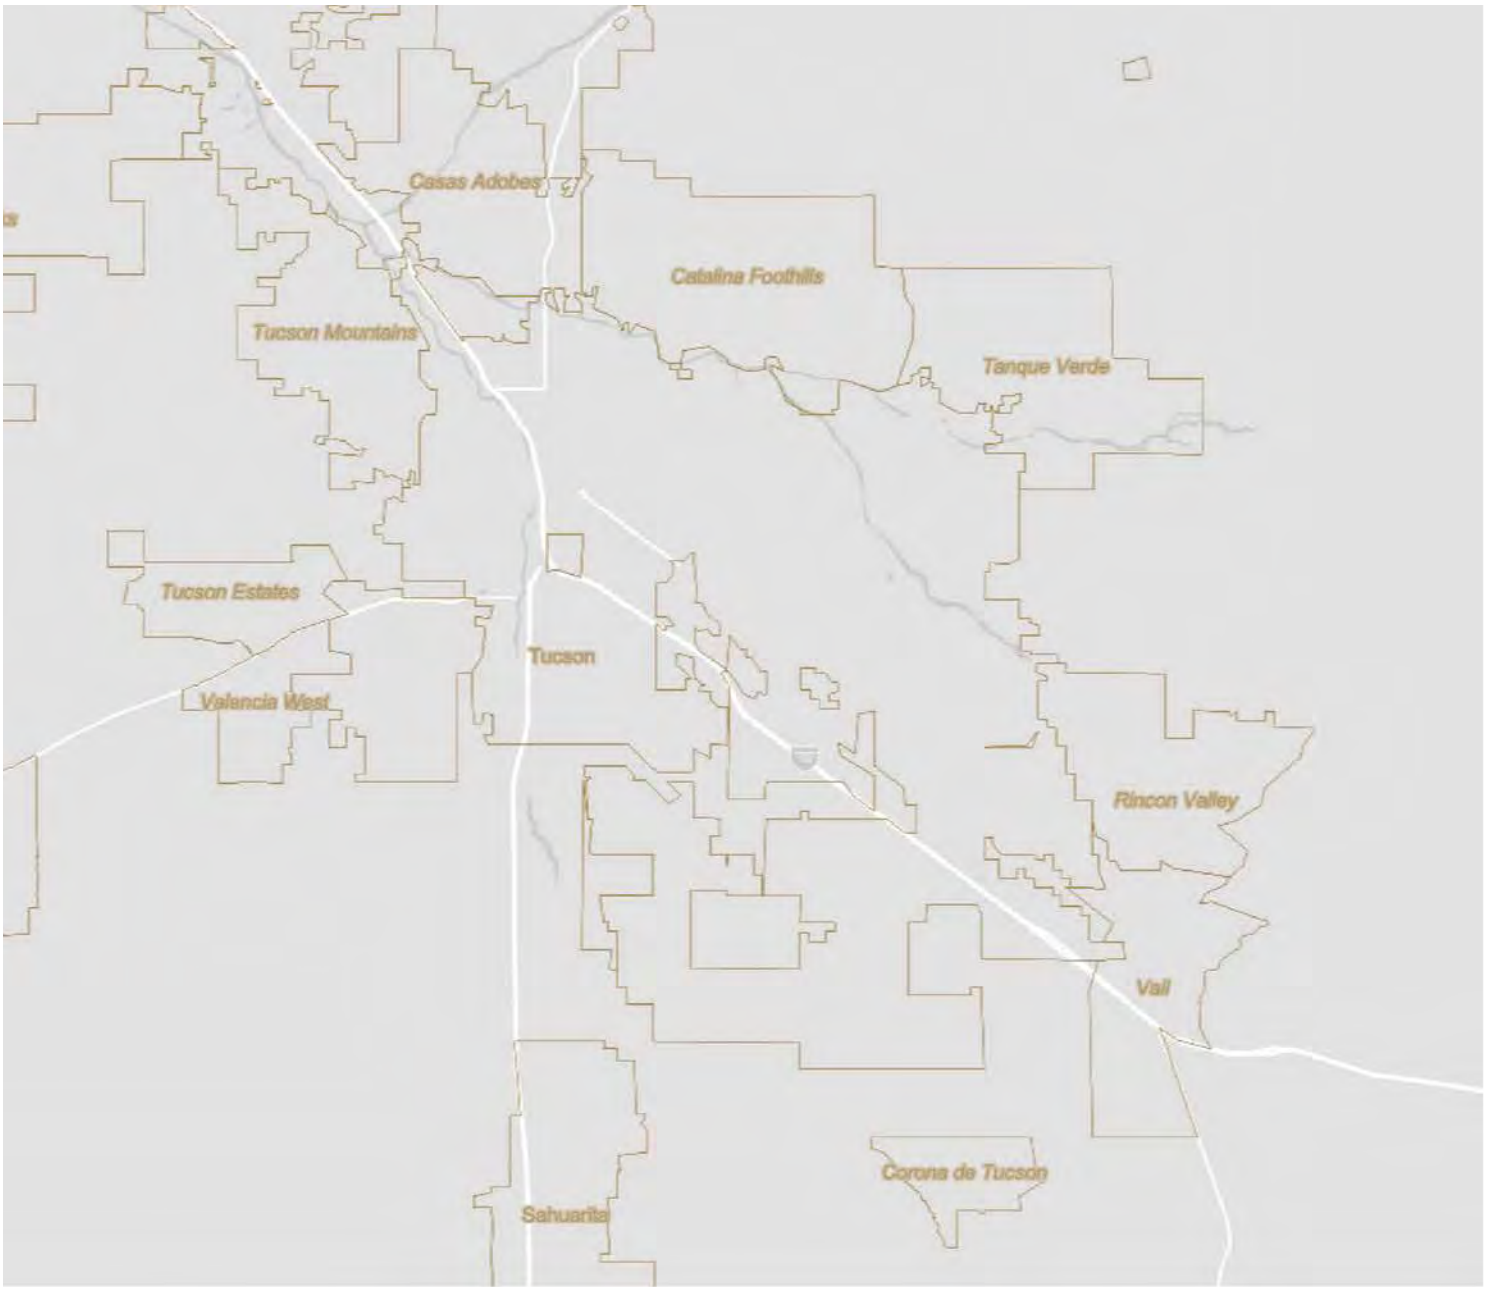

Source: undefined |

Families and Living Arrangements

Children

19.1% ± 0.9%
Under 18 years old in Tucson city, Arizona

21.3% ± 0.1%
Under 18 years old in Arizona

S0101 | *2023 American Community Survey 1-Year Estimates*

Children Under 18 by Age Range
in Tucson city, Arizona

Share / Embed

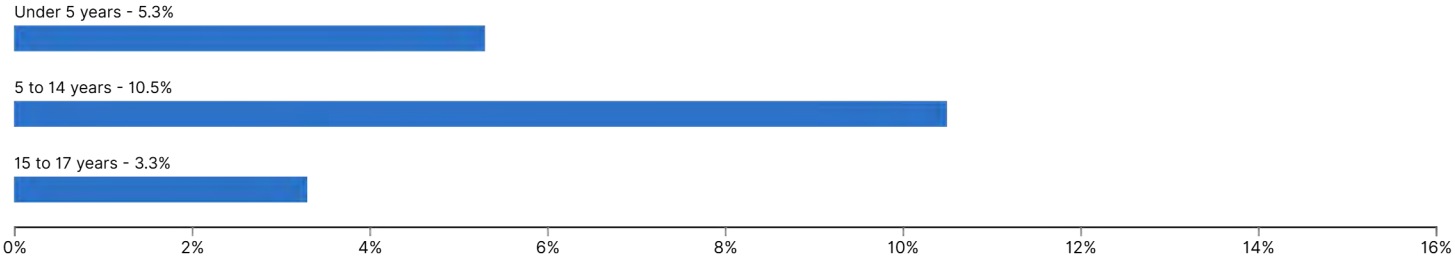

Display Margin of Error

S0101 | *2023 American Community Survey 1-Year Estimates*

Families and Household Characteristics

3.04 ± 0.09
Average Family Size in Tucson city, Arizona

3.09 ± 0.02
Average Family Size in Arizona

DP02 | *2023 American Community Survey 1-Year Estimates*

Total Households by Type of Households
in Tucson city, Arizona

Share / Embed

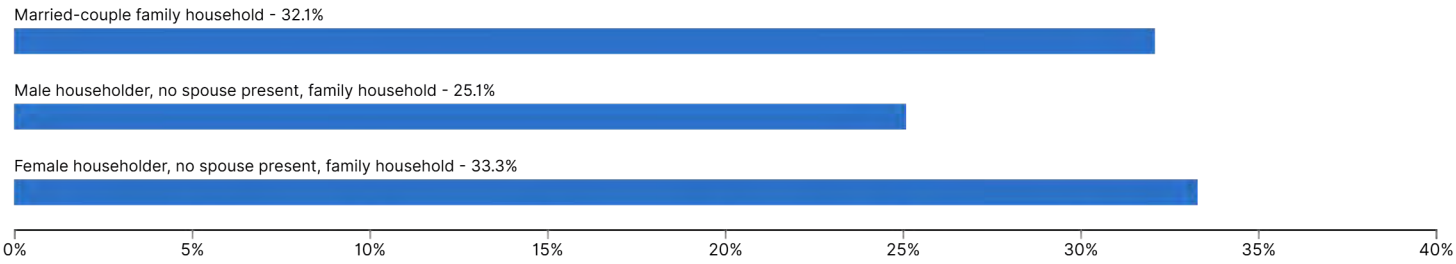

Display Margin of Error

DP02 | *2023 American Community Survey 1-Year Estimates*

Marital Status and Marital History

43.2% ± 1.4%
Never Married in Tucson city, Arizona

34.3% ± 0.4%
Never Married in Arizona

S1201 | *2023 American Community Survey 1-Year Estimates*

Marital Status by Sex
in Tucson city, Arizona

Share / Embed

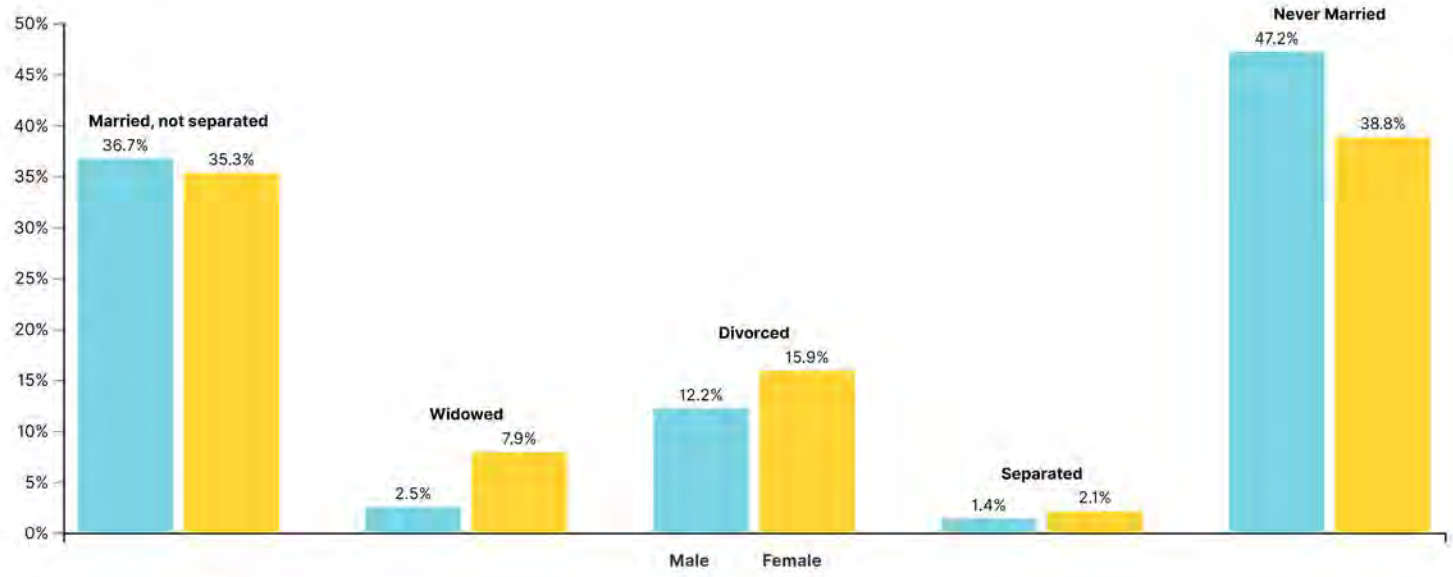

Display Margin of Error

S1201 | 2023 ACS 5-Year Estimates Subject Tables

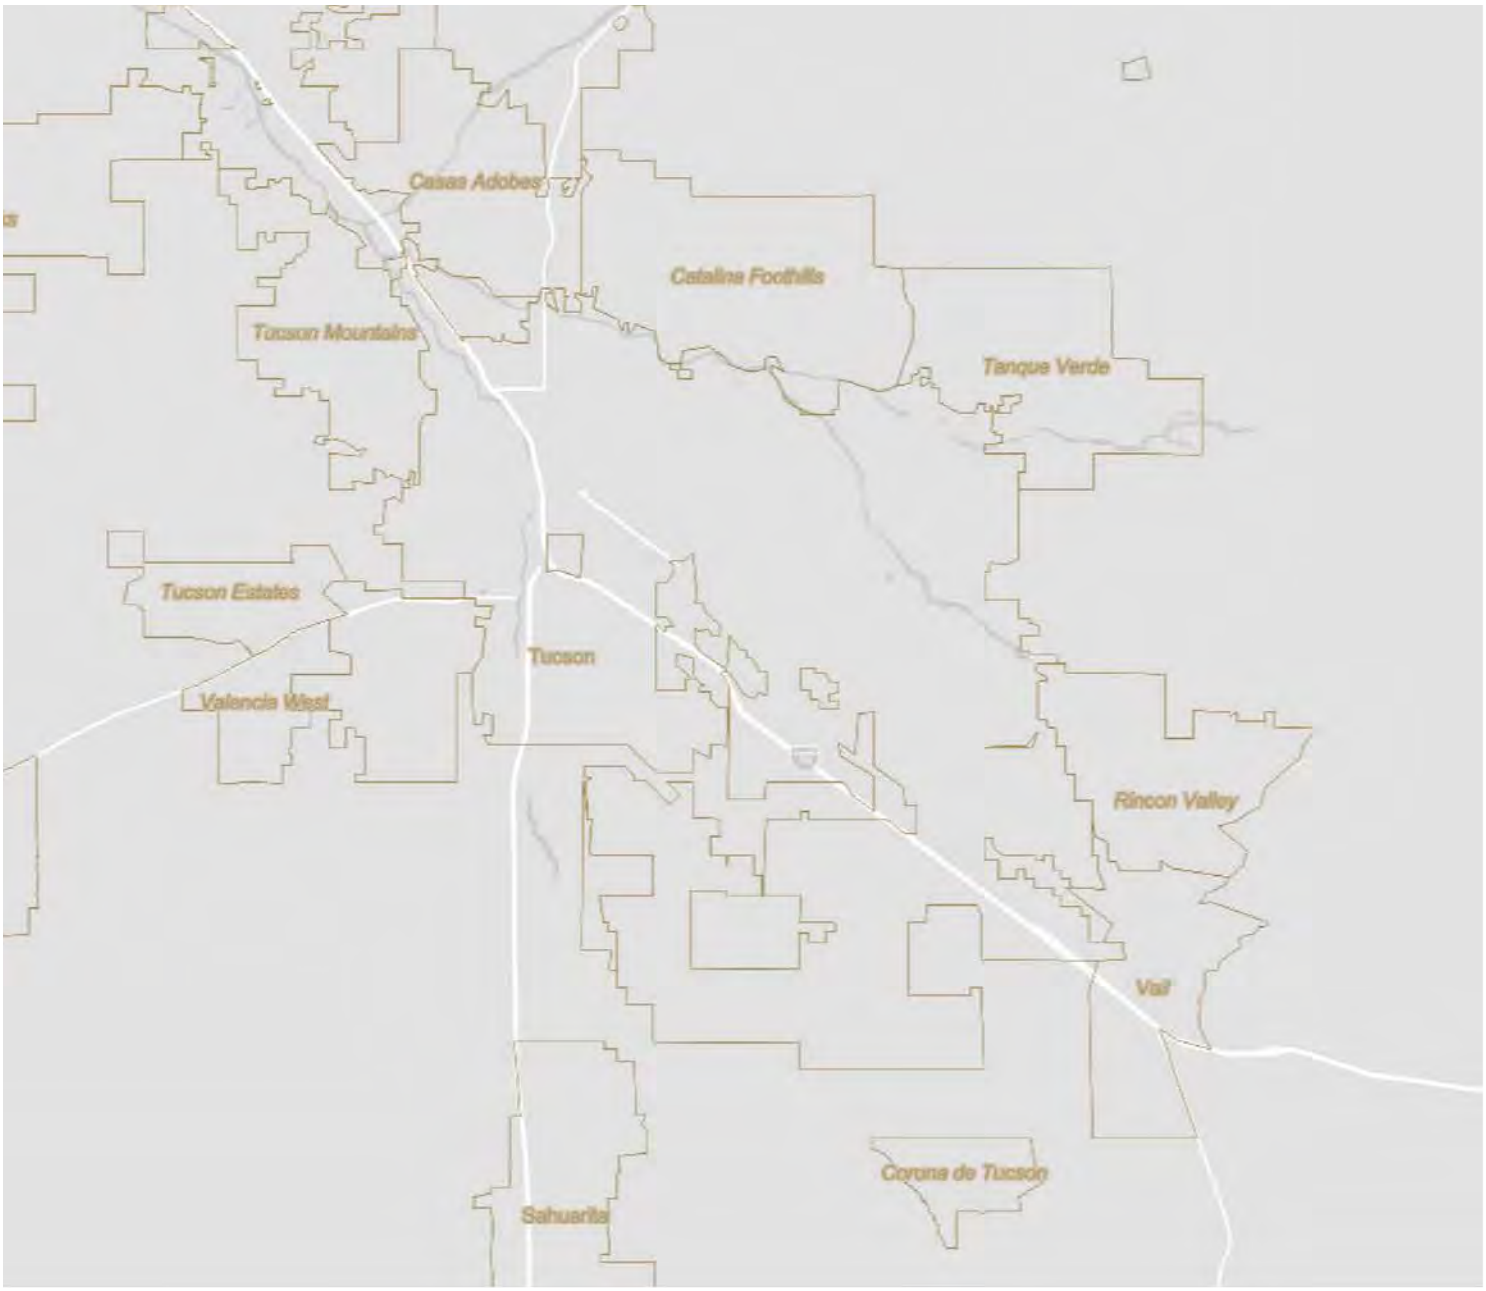

Source: undefined |

Race and Ethnicity

American Indian and Alaska Native

15,842
American Indian and Alaska Native alone in Tucson city, Arizona

319,512
American Indian and Alaska Native alone in Arizona

P8 | *2020 Decennial Census*

Asian

17,236
Asian alone in Tucson city, Arizona

257,430
Asian alone in Arizona

P8 | 2020 Decennial Census

Black or African American

30,342
Black or African American alone in Tucson city, Arizona

339,150
Black or African American alone in Arizona

P8 | 2020 Decennial Census

Hispanic or Latino

228,878
Hispanic or Latino (of any race) in Tucson city, Arizona

2,192,253
Hispanic or Latino (of any race) in Arizona

P9 | 2020 Decennial Census

Native Hawaiian and Other Pacific Islander

1,522
Native Hawaiian and Other Pacific Islander alone in Tucson city, Arizona

16,397
Native Hawaiian and Other Pacific Islander alone in Arizona

P8 | 2020 Decennial Census

Not Hispanic or Latino

236,837
White alone, not Hispanic or Latino in Tucson city, Arizona

3,816,547
White alone, not Hispanic or Latino in Arizona

P9 | 2020 Decennial Census

Some Other Race

82,249
Some Other Race alone in Tucson city, Arizona

899,870
Some Other Race alone in Arizona

P8 | 2020 Decennial Census

Two or More Races

99,452
Two or More Races in Tucson city, Arizona

996,806
Two or More Races in Arizona

P8 | 2020 Decennial Census

White

295,986
White alone in Tucson city, Arizona

4,322,337
White alone in Arizona

P8 | 2020 Decennial Census

Accessibility | Information Quality | FOIA | Data Protection and Privacy Policy | U.S. Department of Commerce | Release Notes

ERR S

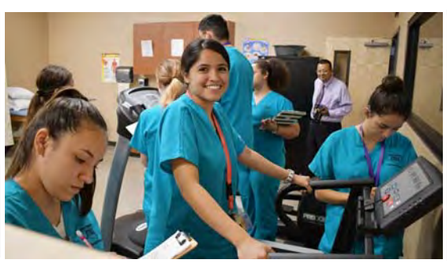

MEL AND ENID ZUCKERMAN CENTER FOR HEALTH AND MEDICAL CAREERS

Tucson, Arizona

An Investment Opportunity to Transform Students, Innovate Educational Delivery & Lift a Community

20231026

PROJECT OVERVIEW

Tucson, AZ is challenged with a poverty rate of nearly 21% compared to a U.S. rate of 13.2%, an average income of less than 85% of the national average, high school educational spending and ranking of 48th and 49th respectively, and a high school dropout rate of nearly 32%. Despite these challenges, Tucson has tremendous assets that can be leveraged to positively impact all of these negative metrics: a great public research university, the University of Arizona, a great community college, Pima Community College, and a Career and Technical Education (CTE) district, called Pima Joint Technical Education District (JTED), which is one of the top-performing CTE districts in the country. These three organizations have come together to provide a highly integrated and innovative opportunity for Tucson high school students, the Pima JTED Health & Medical Careers High School. This standalone high school will give students a valuable springboard in pursuing health and medical related career, and is expected to be transformative for individual students, for educational delivery, and for the community in improving our challenging metrics.

LOCATION: OVERVIEW & METRICS:

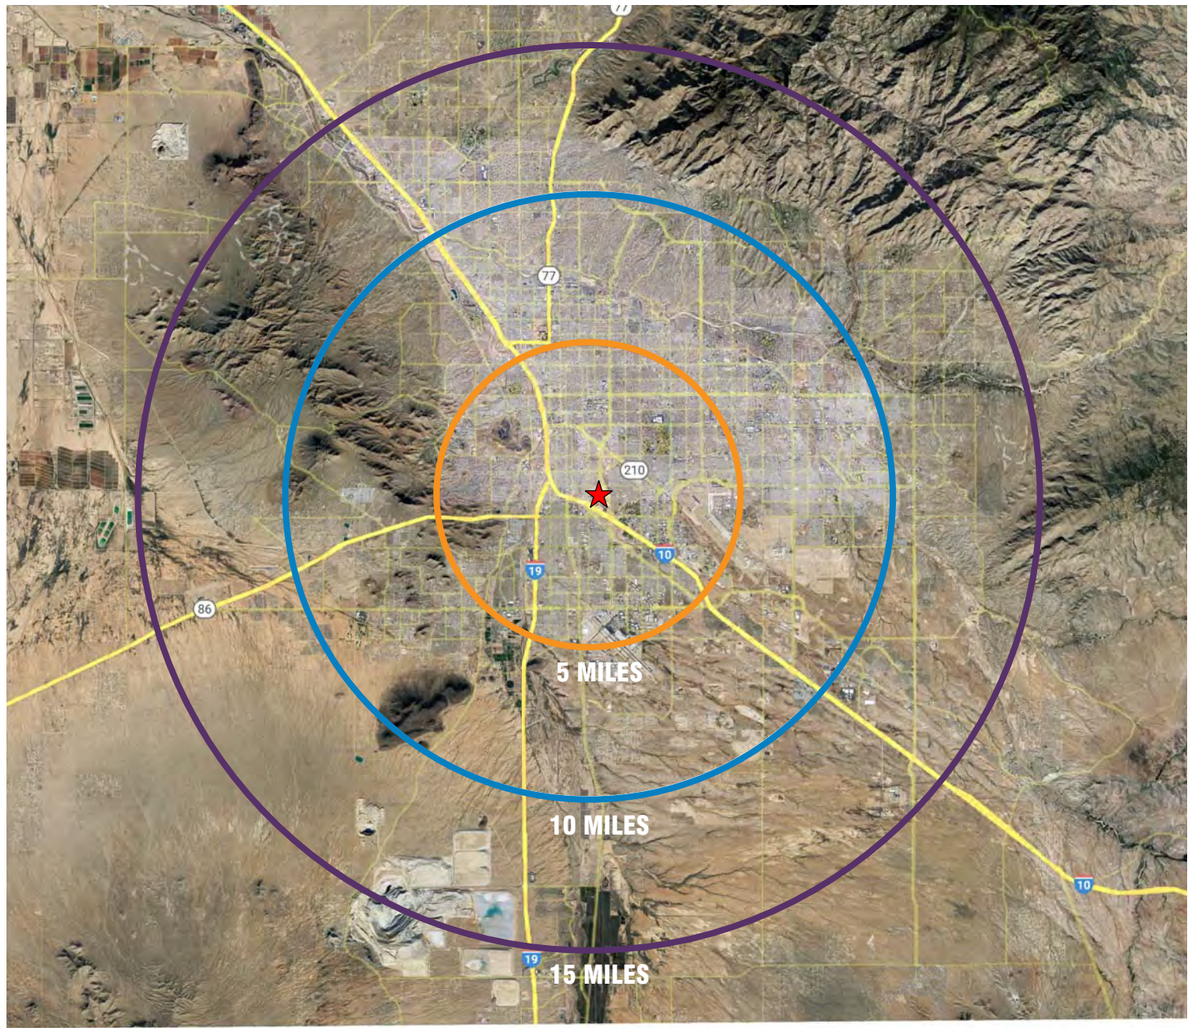

	US	Tucson	% / US
Avg HH Income	$105,029	$88,679	84.43%
Median HH Income	$72,414	$61,675	85.17%
Poverty Rate:	13.20%	20.79%	

PIMA JTED HEALTH & MEDICAL					
5 Miles	% US	10 Miles	% US	15 Miles	% US
$61,185	58.26%	$73,535	70.01%	$84,022	80.00%
$42,627	58.87%	$50,548	69.80%	$57,613	79.56%

TUCSON EDUCATIONAL STATISTICS:

- **High School Dropout Rate:** Local: 32% State: 23% National: 28%
- **AZ Rankings:** High School Spending/Student: 48th High School Ranking/Student: 49th
- **Higher Education Institutions Enrollment:** Pima Community College: 30,396 University of Arizona: 49,471

Vision: A standalone Health and Medical Careers High School is being proposed that will ultimately serve 1,000 students each year (grades 9-12).

Location: Tucson, Arizona, at the Interchange of Interstate 10 and Park Avenue, which is accessible to 66% of Tucson's school-aged children within a 20-minute drive.

Underserved Community: The location also sits in an underserved area where residents within a 5-mile radius have a household income 41% less than the national average and 31% less than the Tucson average. The school-aged population is 78% Hispanic.

Transformative: This high school is consistent with, and the first step in, a strategic plan to use focused technical education through Pima JTED as a transformative change agent for our individual students, our high school educational delivery platform and our community.

Identify/Innovate/Integrate: This program is consistent with the JTED belief in Educational Transformation: **Identify** significant demand, Be **Innovative** in the delivery of the knowledge to meet that demand, and **Integrate** available resources to bring the best expertise to the table.

Master Plan: The high school will be located on a master planned technical educational campus that at full build-out could reach 300,000 square feet, serving over 5,000 students.

Free: The high school, as part of the State of Arizona school system, will be available to all area students at no cost.

CAREER & TECHNICAL EDUCATION (CTE):

Career & Technical Education (CTE) is a broad term for education that combines academic and technical skills with the knowledge and training needed to succeed in today's labor market. CTE prepares students for the world of work by introducing them to workplace competencies in a real-world, applied context. Compared to vocational school of decades past, modern CTE spans nearly every industry. In addition to traditional pathways like automotive repair and construction, today's CTE programs cover health sciences, engineering, entrepreneurship, computer science, sustainable agriculture, theater arts production, media, culinary arts, and many other fields.

CAREER & TECHNICAL EDUCATION (CTE) PROVIDES STUDENTS:

Career Pathway Understanding: Provides broad understanding of industries and organizes potential career paths into identifiable steps for those industries.

Direct Technical Training: Delivers a career-driven training program that creates immediate work opportunities and meaningful steps to educational requirements for a chosen career.

Professional Skills Training: Delivers the knowledge and skills to have the confidence and ability to thrive in a professional environment (as well as other real-world environments).

FUNDAMENTALLY BETTER-PREPARED STUDENTS:

Post Secondary Path Students: Provides real-world, focused knowledge that creates maturity and context to be better prepared for post-secondary education.

Work Path Students: Provides a clear, direct and immediate path to quality work and careers.

At-Risk Students: Brings meaning to education, opportunity for achievement, career paths that may not have been visible, and a tangible reason to stay in school.

CAREER & TECHNICAL EDUCATION (CTE) DATA POINTS:

94%

94% of students concentrating in CTE graduated high school -- 9 percentage points higher than the overall U.S. graduation rate.

$2.8M

Individuals with associates degrees in CTE fields can earn up to $2.8 million in lifetime earnings - the same as bachelor's degree holders.

77%

77% of employers from in-demand industries hired an employee because of knowledge and skills gained from their CTE experience.

6.5M

The U.S. faces a shortage of 6.5 million skilled workers over the next decade in key industries.

Source: acteonline.org

PIMA JOINT TECHNICAL EDUCATION DISTRICT (JTED):

Pima JTED is a public **Career and Technical Education District** which works with business and industry and 14 member public school districts to provide premier CTE programs to approximately 25,000 freshman through senior-level high school students each year. JTED's award-winning programs are proven to increase student success, significantly contribute to the local economy, and afford students the chance to jumpstart their careers and do what they love in high school!

- **Business, Arts & Design**
  - Business Start-up/Entrepreneurship
  - Project SEARCH
- **Computers & Media**
  - 3D Animation/Virtual Reality & Game Design
  - Computer Science/Information Technologies
  - Cybersecurity & Artificial Intelligence
  - Graphic Design
- **Health Science**
  - Community Health Care Worker
  - Comprehensive Health Care Technician
  - Emergency Medical Technician
  - Health Care Foundations
  - Licensed Nursing Assistant (LNA)
  - Medical Assistant
  - Medical Records Technician
  - Pharmacy Technician
  - Physical Therapy Technician
- **Public Service**
  - Fire Service
  - Law & Public Safety
- **Hospitality, Education & Human Services**
  - Cosmetology
  - Culinary & Nutritional Arts/Restaurant Management/Pastry
  - Early Childhood Education
- **Industrial Technologies**
  - Air Transportation/FAA Drone Operator
  - Automotive Technology
  - Aviation Technology
  - CNC & Machine Inspection/Precision Manufacturing
  - Computer Aided Design (CAD)/Architectural Drafting
  - Construction Technologies
  - Energy Technology
  - Heating, Ventilation & A/C
  - Heavy Equipment Operations
  - Welding Technologies
- **Science & Engineering**
  - Engineering/Aerospace & Mining Technology
  - Veterinary Science

JTED Success Metrics

25,000
Students

98%
High School Graduation Rate

80%
Placement Rate

JTED'S APPROACH TO A RAPIDLY EVOLVING WORLD: 3 I'S - IDENTIFY, INNOVATE, INTEGRATE

The world has evolved at blinding speed. Technology has led this evolution and has disrupted nearly every industry. This technology revolution has created tremendous demand for well trained technical talent.

School systems have not evolved to match the technical, vocational and life skills needed to be competitive in today's world.

JTED consistently out-performs the stellar metrics of national CTE programs. This track record of success has been the result of strong leadership, community buy-in, and a proactive approach in providing educational content to its students.

JTED's proactive process to deliver current, relevant technical education that meets the needs of today's world focuses on three fundamental drivers: The 3 I's - Identify | Innovate | Integrate.

Identify the key skills and industries where education can best impact student success.

- Strategic areas of evolution and transformation around relevant career topics
- Available career paths
- Current and projected job availability
- Expected compensation at entry and throughout career path

Innovate curricula and delivery systems to be relevant for today and in the future.

- Link traditional education with industry-focused education to provide direct applicability and relevance
- Identify unique sources of expertise and delivery methods
- Use technology and remote learning opportunities to provide best-in-class learning

Integrate learning opportunities, resources, and expertise to maximize student learning.

- Integrate subject matters for a better real-world understanding of relevant knowledge and skill
- Integrate resources to maximize learning opportunities for students
- Expertise – Leverage available expertise in colleges, universities, industry

"I started my JTED journey in 2015 as a Healthcare Foundations student which sparked my love for healthcare. I went to join the Physical Therapy Technician course as my senior pathway graduating in 2017. I continued my education in college and graduated with a Bachelors of Science in Public Health. I am now currently a Master's student at John Hopkins University in the Population, Family, and Reproductive Health program. JTED has always pushed me to get out of my comfort zone and strive for more. Thank you for everything JTED!" **Alena Pappas, 2017**

JTED : A CATALYST FOR TRANSFORMING STUDENTS, EDUCATIONAL DELIVERY & COMMUNITY

TRANSFORMING INDIVIDUAL STUDENTS: Powerful, real-world skill sets that elevates students across all socioeconomics and racial backgrounds.

DROPOUT RATES: High dropout rates are crippling, generally leading to substantially lower income, shorter life expectancy and higher crime rates. Tucson suffers from abnormally high dropout rates:

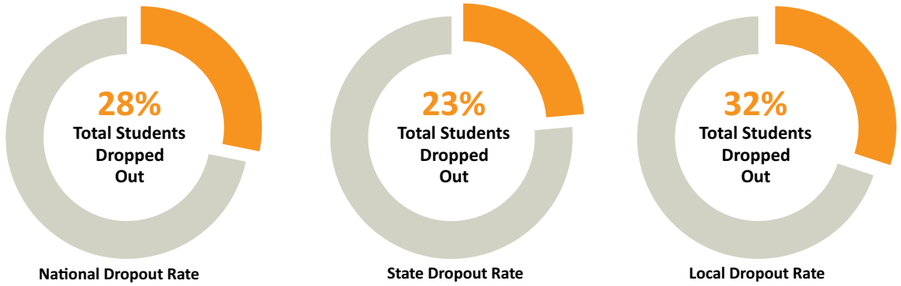

Preventing Dropout: Top 3 Strategies:

JTED's Graduation Rate of 98% is an incredible indicator of the power of its program.

Earning Potential: Dramatic Increase in Student Earning Potential – at Graduation & Over Lifetime

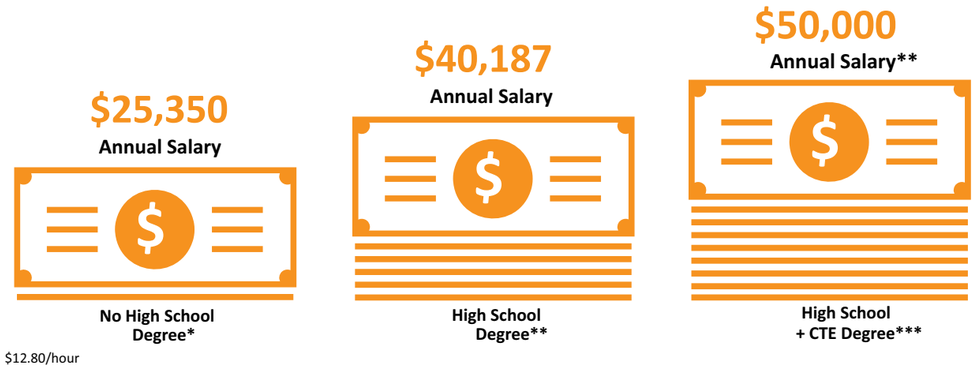

*Minimum wage = $12.80/hour
**High School salary is based on research by Northeastern University
***Based on Registered Medical Assistant salary

Sources: NCES.ED.GOV, AZED.GOV, Career & Technical Assistance Center of NY, https://www.northeastern.edu/bachelors-completion/news/average-salary-by-education-level/

TRANSFORMING EDUCATIONAL DELIVERY: This model is unique and innovative across a number of levels, providing the opportunity to transform educational delivery:

Educational and Vocational Focus: 1) Integrates highly relevant vocational education with traditional high school subjects 2) brings like-minded students together to create a more robust learning environment 3) creates context and meaning for student learning.

Integration and Pooling of Resources: Brings 3 distinct, traditionally standalone institutions together to leverage talent and resources, in a resource-starved community, resulting in a world-class education for students of all backgrounds.

Cost and Efficiencies: The capital cost to serve 1,000 students is a fraction of that of most educational models. The focus is on the curriculum and a quality learning environment, not institutional design or costly ancillary needs that can jeopardize project financial solvency.

Immediacy: Immediately relevant education with immediate work opportunities provides immediate solutions for those that have immediate, pressing needs. This is a key factor in serving and retaining the at-risk students that cannot survive in the traditional educational environment.

Investment Model: The public/private investment model, using a combination of philanthropy, JTED reserves, State of Arizona reimbursement funding and private balance sheet debt financing, creates a prudent, innovative model that could be replicated by other important educational institutions. Note that this model, as part of the state public education program, does not require any investment from the students.

TRANSFORMING OUR COMMUNITY: Make Talent Production Tucson's #1 Product

Corporate Pursuit of Talent: Companies make decisions around talent, often making strategic decisions based on where they can attract critical talent. Communities win or lose based on their ability to attract companies and the relevant talent needed by those companies.

Value Analytics: Recognize value increase of students as they progress through education; provide data to students for a more productive and decisive approach to their education and future career opportunities.

High school talent production is a multi-pronged opportunity:

- **Trajectory** - Sets a higher starting point, more consistent opportunities and steeper earnings trajectory.
- **Waste** – High school dropouts represent severe underutilization of precious "inventory" to the community.
- **Retention** – High school level job-training significantly increases the retention of those Tucson students.
- **Drop Out Reduction** - Significant increases in value and productivity while reducing negative community impacts of high school dropouts directly impacts community talent delivery.

Scale: Using the Pima JTED Health & Medical Careers High School as a model, JTED and the Tucson community can create additional dedicated technical high schools focused on critical skills and industries with an ultimate goal of doubling the total numbered of students served every 5 years.

Technical Hub: Tucson can become a premiere, industry-focused, technical talent hub for the U.S.

PIMA JTED HEALTH & MEDICAL CAREERS HIGH SCHOOL

CATALYST:

The catalyst for the Pima JTED Health & Medical Careers High School has been Dr. Robert Robbins, University of Arizona President, a former cardiac surgeon and former President of the Texas Medical Center. Dr. Robbins saw the opportunity to leverage the tremendous success of JTED with the University of Arizona College of Medicine to provide an integrated approach in teaching health and medicine through a standalone high school. The University of Arizona and Dr. Robbins have been driving forces to make this vision a reality.

HIGHLIGHTS:

Stand Alone High School: Pima JTED Health & Medical Careers High School will be a 4-year, standalone high school, located on the Pima JTED campus in Tucson, Arizona, at the intersection of Interstate 10 and Park Avenue.

Integrated Curriculum: Students will complete a traditional high school education fully integrated within a medical-focused curriculum.

Open Enrollment/Underserved Population: The opportunity to attend Pima JTED Health & Medical Careers High School will be determined through an open enrollment system (enrollment will not be competitive using test scores or previous academic success). It will be entirely free of charge to all students. Special emphasis will be placed on serving the underserved and assisting the at-risk population that may drop out of high school.

Career Counseling: Career counseling will be an integral part of the program, opening the eyes of students to the many facets of medicine that are available to them. Attention will be given to immediate career opportunities and educational requirements for health and medical careers.

PLANNED CURRICULUM:

- Comprehensive Health Care Technician
- Community Healthcare Worker
- Dental Assisting
- Emergency Medical Technician
- Emergency Medical Services
- Health Care Foundations
- Health Information Technology
- Home Health Aide
- Licensed Nursing Assistant
- Mental/Social Health
- Personal Assistant/Caregiver
- Pharmacy Technician
- Physical Therapy Technician
- Registered Medical Assistant
- Sports Medicine
- Veterinary Sciences

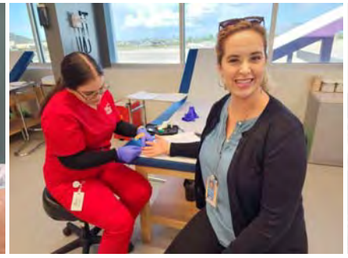

IDENTIFIABLE DEMAND:

Healthcare will be one of the fastest-growing industries with a tremendous number of babyboomers retiring from the healthcare field, and a large segment of those baby boomers will be requiring additional medical care. Data points highlighting the expected healthcare shortage include:

- Current national shortage for lower-wage healthcare is 3.2 million workers. By 2025, the US will face a shortage of nearly 6.7 million total health care workers.
- By 2025, Arizona will face a shortage of nearly 93,000 lower-wage healthcare workers.
- In 2021, Tucson hospitals saw unfilled jobs for 900 support roles and 600 RNs.
- By 2030, an estimated 132,885 additional credentialed vet techs will be needed.

INNOVATIVE AND INTEGRATIVE:

High school will be **innovative** and **integrative** as one of the first fully functioning health and medical high schools in the country with a focus on serving the underserved, using expertise and leadership from both the University of Arizona and Pima Community College. Certain classes will be taught within the Pima Community College system, with the students earning full college credits. Outside industry leaders, including the local hospitals, have also committed to support JTED through capital, expertise and in-facility internships and real world, hands-on experience.

Health and medical subjects and applications will be integrated into traditional high school subjects to provide a highly applicable and robust learning environment.

BUILDING & FINANCIAL SUMMARY:

Site & Building		**Budget**	
Land Area:	3.16 Acres	Land	$1.90 Million
Building Area:	50,000 Sq Ft	Hard Costs:	$18.60 Million
		Soft Costs:	$1.50 Million
		Total:	$22.00 Million

ROI Projections: (Based on 200 Graduates/yr)

	LOW	HIGH
Marginal increase in Student Compensation Value ($5-10/Hr)	$5.00	$10.00
Annualized Working Hours (2,000 Hours)	2,000	2,000
Marginal increase in Annual Compensation Value/Student	$10,000	$20,000
Graduating Students	200	200
Marginal Increase in Student Compensation Value	$2,000,000	$4,000,000
Investment	$22,000,000	$22,000,000
Marginal ROI	9%	18%

Fundraising to Date: $17M (leaving $5M to completion)

CONCEPTUAL RENDERING

PIMA JTED HEALTH & MEDICAL CAREERS HIGH SCHOOL

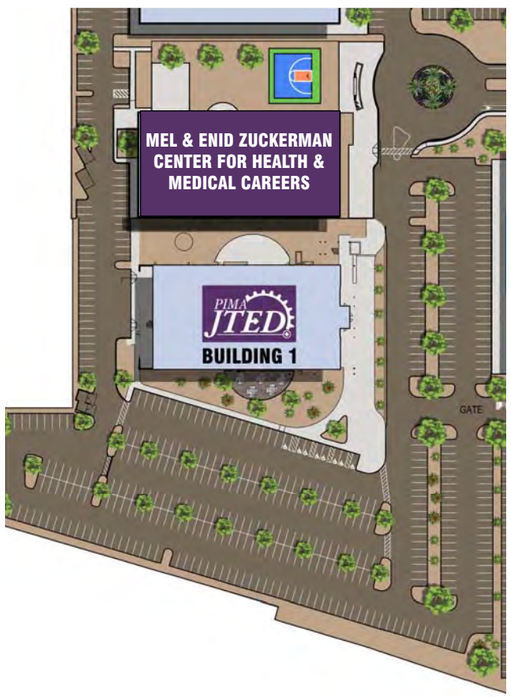

FLOOR PLAN - FIRST FLOOR

JTED INNOVATIVE LEARNING CENTER AT THE BRIDGES - PHASE II

WSM ARCHITECTS
A DIVISION OF SHIVE-HATTERY

FLOOR PLAN - SECOND FLOOR

JTED INNOVATIVE LEARNING CENTER AT THE BRIDGES - PHASE II

WSM ARCHITECTS
A DIVISION OF SHIVE-HATTERY

Support: Established Community Partners

14 Community School Districts, including Tucson Unified School District, will partner with JTED in operating the Health & Medical Careers High School.

2855 W. Master Pieces Dr.
Tucson, AZ, 85741

520 352-JTED (5833)
Fax: 520 352-5842

NOTICE OF FINDING OF NO SIGNFICANT IMPACT AND NOTICE OF INTENT TO REQUEST RELEASE OF FUNDS

September 25, 2025
JTED Bridges II, LLC
20 East Congress Street, Suite 300
Tucson, Arizona 85701

These notices shall satisfy two separate but related procedural requirements for activities to be undertaken by Pima County Joint Technological Education District ("JTED").

REQUEST FOR RELEASE OF FUNDS

On or about September 26, 2025, JTED will submit a request to the Department of Housing and Urban Development (HUD) for the release of the following funds to undertake a project known as the Pima County Urban Workforce Development via Career and Technical Education at 751 East Marketplace Boulevard in Tucson, Arizona.

- The Urban Workforce Development via Career and Technical Education Project will increase access to Career and Technical Education (CTE) programs in inner-city Tucson and throughout Southern Arizona by purchasing 4.5 acres of land adjacent to an existing campus currently operating at capacity. The property will be become the future site of Building 3 of Bridges at JTED. Economic Development Initiative Community Project Funding, Grant No. B-24-CP-AZ-0060 ($2,700,000).

FINDING OF NO SIGNIFICANT IMPACT

The JTED has determined the project will have no significant impact on the human environment. Therefore, an Environmental Impact Statement under the National Environmental Policy Act of 1969 (NEPA) is not required. Additional project information is contained in the Environmental Review Record (ERR) on file at JTED Bridges II, LLC at 20 East Congress Street, Suite 300 in Tucson, Arizona and may be examined or copied weekdays 8 AM to 5 PM.

PUBLIC COMMENTS

Any individual, group, or agency may submit written comments on the ERR to JTED addressed to Ms. Tina Norton. All comments received by October 10, 2025 will be considered by JTED prior to authorizing submission of a request for release of funds. Comments should specify which Notice they are addressing.

ENVIRONMENTAL CERTIFICATION

The JTED certifies to HUD that Kathy Prather in her capacity as Pima County JTED Superintendent consents to accept the jurisdiction of the Federal Courts if an action is brought to enforce responsibilities in relation to the environmental review process and that these responsibilities have been satisfied. HUD's approval of the certification satisfies its responsibilities under NEPA and related laws and authorities and allows JTED to use Program funds.

OBJECTIONS TO RELEASE OF FUNDS

HUD will accept objections to its release of fund and JTED's certification for a period of fifteen days following the anticipated submission date or its actual receipt of the request (whichever is later) only if they are on one of the following bases: (a) the certification was not executed by the Certifying Officer of JTED; (b) JTED has omitted a step or failed to make a decision or finding required by HUD regulations at 24 CFR part 58; (c) the grant recipient or other participants in the development process have committed funds, incurred costs or undertaken activities not authorized by 24 CFR Part 58 before approval of a release of funds by HUD; or (d) another Federal agency acting pursuant to 40 CFR Part 1504 has submitted a written finding that the project is unsatisfactory from the standpoint of environmental quality. Objections must be prepared and submitted in accordance with the required procedures (24 CFR Part 58, Sec. 58.76) and shall be addressed to HUD at: Ra'Chel'Ni Mar'na, Senior CPD Representative, Office of Community Planning and Urban Development, 2800 N. Central, Suite 700, Phoenix, Arizona 85004, tel: 602-379-7173, email: Rachelni.R.Marna@hud.gov. Potential objectors should contact HUD/State to verify the actual last day of the objection period.

Outlook

Re: Meeting Minutes and Info-Memo regarding FONSI & EA

From Tina Norton <tnorton@pimajted.org>
Date Fri 11/21/2025 4:20 PM
To Kage Anderson <kanderson@rma-western.com>
Cc Matt Dickey <mdickey@bourncompanies.com>; Dajahnique Burley <dburley@rma-western.com>

You don't often get email from tnorton@pimajted.org. Learn why this is important

We did not receive any comments

> On Nov 19, 2025, at 11:21 AM, Kage Anderson <kanderson@rma-western.com> wrote:
>
> Hey Tina!
>
> I just wanted to follow up and see if you had received the previous email about the comment period. Did you receive any comments on JTED and the EA findings?
>
> Thanks,

Kage Anderson
Senior Environmental Scientist

<Outlook-azjlexlx.png>

3480 South Dodge Boulevard,
Tucson, Arizona 85713
O: 520-748-2262
M: 520-444-8639

certerra.com

We are thrilled that Western Technologies has undergone a rebrand and is now named Certerra. Over the coming months, we will be transitioning to our new email domain: @certerra.com. During this transition, we will provide further details to ensure the uninterrupted receipt and transmission of email messages. Please feel free to reach out if you have any questions.